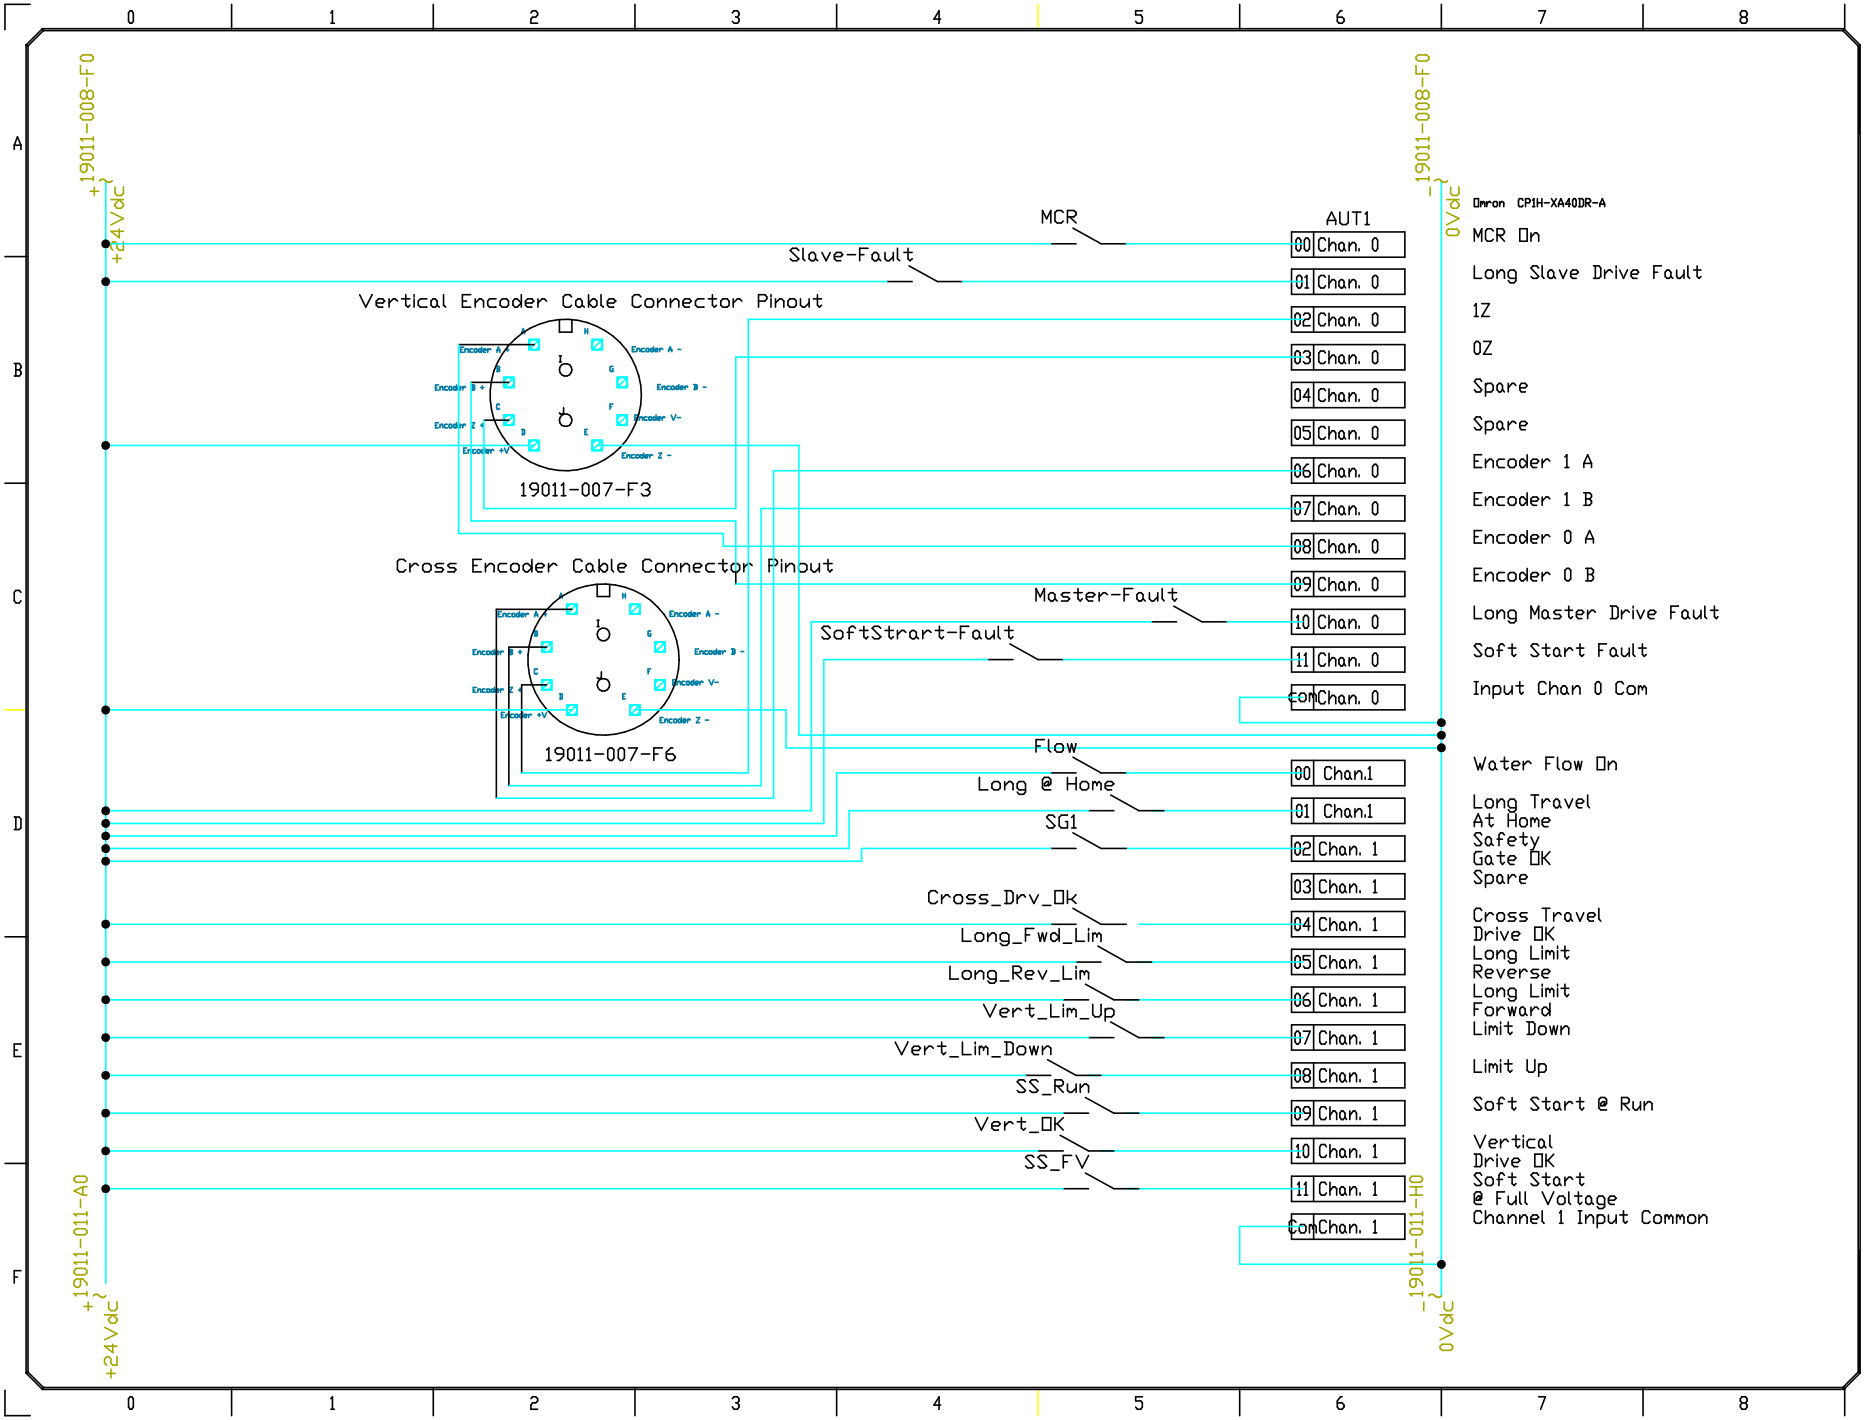
19011-008-F0
+24Vdc
19011-008-F0
-0Vdc
Omron CP1H-XA40DR-A
AUT1
MCR
Slave-Fault
Vertical Encoder Cable Connector Pinout
19011-007-F3
Cross Encoder Cable Connector Pinout
19011-007-F6
Master-Fault
SoftStrart-Fault
Flow
Long @ Home
SG1
Cross_Drv_Ok
Long_Fwd_Lim
Long_Rev_Lim
Vert_Lim_Up
Vert_Lim_Down
SS_Run
Vert_OK
SS_FV
00 Chan. 0
01 Chan. 0
02 Chan. 0
03 Chan. 0
04 Chan. 0
05 Chan. 0
06 Chan. 0
07 Chan. 0
08 Chan. 0
09 Chan. 0
10 Chan. 0
11 Chan. 0
Com Chan. 0
00 Chan.1
01 Chan.1
02 Chan. 1
03 Chan. 1
04 Chan. 1
05 Chan. 1
06 Chan. 1
07 Chan. 1
08 Chan. 1
09 Chan. 1
10 Chan. 1
11 Chan. 1
Com Chan. 1
MCR On
Long Slave Drive Fault
1Z
0Z
Spare
Spare
Encoder 1 A
Encoder 1 B
Encoder 0 A
Encoder 0 B
Long Master Drive Fault
Soft Start Fault
Input Chan 0 Com
Water Flow On
Long Travel
At Home
Safety
Gate OK
Spare
Cross Travel
Drive OK
Long Limit
Reverse
Long Limit
Forward
Limit Down
Limit Up
Soft Start @ Run
Vertical
Drive OK
Soft Start
@ Full Voltage
Channel 1 Input Common
19011-011-A0
+24Vdc
19011-011-H0
-0Vdc
ICM Services
PLC Input Wiring
Digital Input
24 VDC
ENGINEER S. Snow
CHECKED BY S. Snow
JOB NO 19011
DRAWN BY S. Snow
SCALE No Scale
DATE 20210108
DWG NO 009
SHEET NO 10 OF 12