WIRING LIST: every lead, strap and wire of deck A as the model routes it (net; length along its path)

wire	net	kind	mm	from - to
A_R1_to_0	0	tinned Cu lead	4	R1's lead to junction 0
A_R1_to_0p	0	tinned Cu lead	5	R1's lead to junction 0'
A_D1_to_0p	0	tinned Cu lead	5	D1's lead to junction 0'
A_D1_to_2	2	tinned Cu lead	5	D1's lead to junction 2
A_R3_to_2	2	tinned Cu lead	5	R3's lead to junction 2
A_R3_to_2p	2	tinned Cu lead	5	R3's lead to junction 2'
A_D3_to_2p	2	tinned Cu lead	5	D3's lead to junction 2'
A_D3_to_r1	r1	tinned Cu lead	4	D3's lead to junction r1
A_D5_to_l1	l1	tinned Cu lead	4	D5's lead to junction l1
A_D5_to_r2	r2	tinned Cu lead	5	D5's lead to junction r2
A_D8_to_r2	r2	tinned Cu lead	5	D8's lead to junction r2
A_D8_to_1	1	tinned Cu lead	5	D8's lead to junction 1
A_D11_to_1	1	tinned Cu lead	5	D11's lead to junction 1
A_D11_to_xa	xa	tinned Cu lead	5	D11's lead to junction xa
A_D12_to_xa	xa	tinned Cu lead	5	D12's lead to junction xa
A_D12_to_ea	ea	tinned Cu lead	4	D12's lead to junction ea
A_lead_C3_0	2	PTFE HV wire	86	lead: C3's terminal 0 to junction 2, over the parts
A_lead_C3_1	l1	PTFE HV wire	165	lead: C3's terminal 1 to junction l1, over the parts
A_lead_C6_0	r1	PTFE HV wire	72	lead: C6's terminal 0 to junction r1, over the parts
A_lead_C6_1	r2	PTFE HV wire	151	lead: C6's terminal 1 to junction r2, over the parts
A_lead_C8_0	r2	PTFE HV wire	57	lead: C8's terminal 0 to junction r2, over the parts
A_lead_C8_1	xa	PTFE HV wire	183	lead: C8's terminal 1 to junction xa, over the parts
A_lead_Z1_0	1	PTFE HV wire	96	lead: Z1's terminal 0 to junction 1, over the parts
A_lead_Csa_0	ea	PTFE HV wire	161	lead: Csa's terminal 0 to junction ea, over the parts
A_strap_R1	0	Cu strap	98	REF strap: R1's terminal 0 to the can
A_strap_Z1	0	Cu strap	58	REF strap: Z1's terminal 1 to the can
A_strap_Csa	0	Cu strap	80	REF strap: Csa's terminal 1 to the can
A_riser_deck	1	PTFE HV wire	6	node 1's riser, in the potting
A_riser	1	PTFE HV wire	163	node 1's riser: up from the deck, in to r 35, up the column's bore to its comb's first post, under Ca_05
A_tap_deck	2	PTFE HV wire	6	node 2's tap, in the potting
A_tap	2	PTFE HV wire	57	node 2's tap: up from the deck to the column's node-2 plate
A_ring_lead	ea	PTFE HV wire	68	ring A's lead: from its equatorial bead through the PEEK and the coupler, along the coupler, out through the can's PTFE bushing
A_ring_lead_deck	ea	PTFE HV wire	75	ring A's lead on the deck, to Csa's top
A_cross_l1	l1	PTFE HV wire	6	the cross net l1, in deck A's potting
cross_l1	l1	PTFE HV wire	72	the cross net l1: PTFE HV wire straight across between the decks
A_cross_r1	r1	PTFE HV wire	6	the cross net r1, in deck A's potting
cross_r1	r1	PTFE HV wire	72	the cross net r1: PTFE HV wire straight across between the decks


NOTES

1 Tinned Cu leads (1.2 mm) inside the potting; PTFE HV wire (UL3239 class, ≥ 20 kV DC, P-009) for the leads over the parts, the riser, the tap and the cross nets; ≥ 30 kV DC for the ring's lead (docs/rings-design.md §3).
2 Two leads on one junction land 2.5 mm either side of its centre, along the lane.
3 Deck B's list is the mirror: nets 1 → 4, 2 → 3, l1 ↔ r1, l2 ↔ r2, xa → xb, ea → eb.

REVISIONS

Rev	Date	Description
A	2026-10-11	First issue, draft for quotation

status	PROPOSED
qty per machine	2
used in	DCK-500
source	sim/tube_geometry.py LayoutMachine.decks (sim/multiplier_layout.py LEADS_A, STRAPS_A)

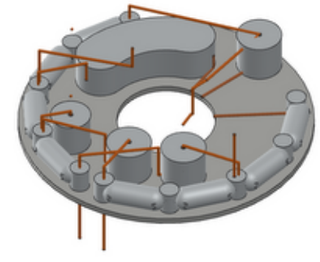

deck A from its parts' side: PTFE HV wire orange, straps copper, leads dark

DCCREG turbine · deck A (deck B the mirror)

Deck A wiring list

Drawing no. **DCCREG-DCK-501**

Material:

Mass: — | Qty per machine: 2 | Rev A Sheet 23 of 103 A3

Scale: — | Tolerances: ISO 2768-mK | Date: 2026-10-11

Drawn: generated by docs/make_drawing_set.py | Checked: — Approved: — | **PROPOSED · DRAFT**