

SB2 ELEVATION

Scale 1:15 | viewed from the E side, end A (S) left

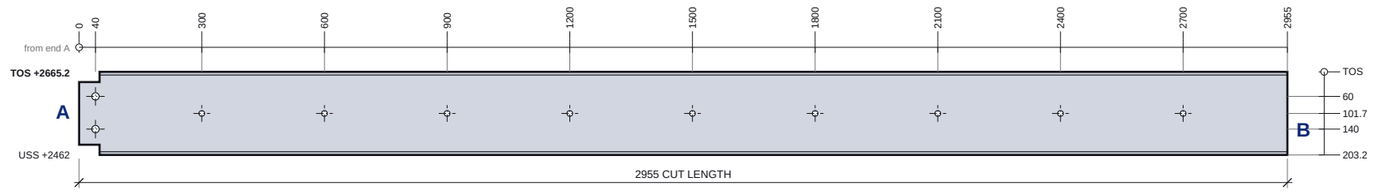

SB2 TOP FLANGE - PLAN

1:15

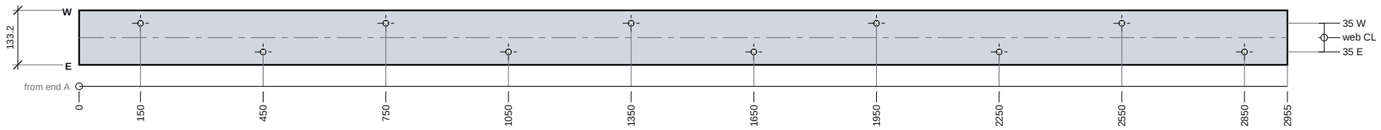


SB2 BOTTOM FLANGE - VIEWED FROM BELOW

1:15



END A 1:5

Detail A: fin plate FP4 welded to SB3

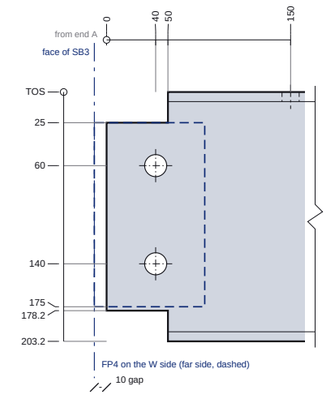


cope 50 long x 25 deep top + bottom

2 no. M16 8.8 bolts in Ø18 holes (bolts loose, site fixed)


1 no. flange hole(s) in this zone - see the flange plan / schedule

END B 1:5

Square cut; bears 150 on the GF-EX16 4-ply stud pack end grain: studs run up to the steel (+2462), top rail + head binder cut over the pack; 2 no. M12x100 coach screws down into the pack (TLS detail)

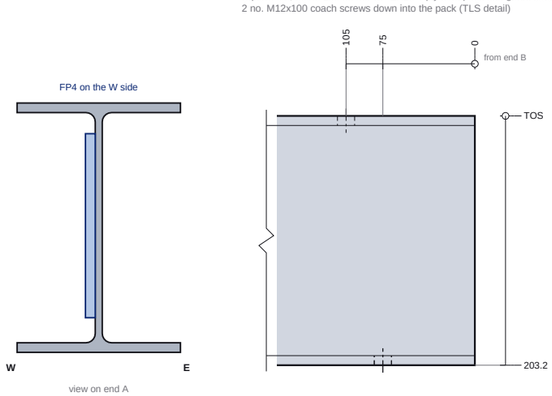

3 no. flange hole(s) in this zone - see the flange plan / schedule

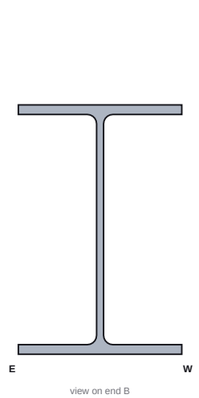

HOLE SCHEDULE

No.	FACE	X FROM A	POSITION	HOLE	PURPOSE
H1	web	40	60 below TOS	Ø18	M16 8.8 bolt - A (FP4 on SB3)
H2	web	40	140 below TOS	Ø18	M16 8.8 bolt - A (FP4 on SB3)
H3	web	300	101.7 below TOS	Ø14	M12 - east packer + binder [TLS detail - engineer to confirm]
H4	web	600	101.7 below TOS	Ø14	M12 - east packer + binder [TLS detail - engineer to confirm]
H5	web	900	101.7 below TOS	Ø14	M12 - east packer + binder [TLS detail - engineer to confirm]
H6	web	1200	101.7 below TOS	Ø14	M12 - east packer + binder [TLS detail - engineer to confirm]
H7	web	1500	101.7 below TOS	Ø14	M12 - east packer + binder [TLS detail - engineer to confirm]
H8	web	1800	101.7 below TOS	Ø14	M12 - east packer + binder [TLS detail - engineer to confirm]
H9	web	2100	101.7 below TOS	Ø14	M12 - east packer + binder [TLS detail - engineer to confirm]
H10	web	2400	101.7 below TOS	Ø14	M12 - east packer + binder [TLS detail - engineer to confirm]
H11	web	2700	101.7 below TOS	Ø14	M12 - east packer + binder [TLS detail - engineer to confirm]
H12	tf	150	35 W of web CL	Ø14	M12x50 coach screw up into the 50x145 top plate (39 embed) [TLS detail - engineer to confirm]

HOLE SCHEDULE (CONT.)

No.	FACE	X FROM A	POSITION	HOLE	PURPOSE
H13	tf	450	35 E of web CL	Ø14	M12x50 coach screw up into the 50x145 top plate (39 embed) [TLS detail - engineer to confirm]
H14	tf	750	35 W of web CL	Ø14	M12x50 coach screw up into the 50x145 top plate (39 embed) [TLS detail - engineer to confirm]
H15	tf	1050	35 E of web CL	Ø14	M12x50 coach screw up into the 50x145 top plate (39 embed) [TLS detail - engineer to confirm]
H16	tf	1350	35 W of web CL	Ø14	M12x50 coach screw up into the 50x145 top plate (39 embed) [TLS detail - engineer to confirm]
H17	tf	1650	35 E of web CL	Ø14	M12x50 coach screw up into the 50x145 top plate (39 embed) [TLS detail - engineer to confirm]
H18	tf	1950	35 W of web CL	Ø14	M12x50 coach screw up into the 50x145 top plate (39 embed) [TLS detail - engineer to confirm]
H19	tf	2250	35 E of web CL	Ø14	M12x50 coach screw up into the 50x145 top plate (39 embed) [TLS detail - engineer to confirm]
H20	tf	2550	35 W of web CL	Ø14	M12x50 coach screw up into the 50x145 top plate (39 embed) [TLS detail - engineer to confirm]
H21	tf	2850	35 E of web CL	Ø14	M12x50 coach screw up into the 50x145 top plate (39 embed) [TLS detail - engineer to confirm]
H22	bf	2880	35 W of web CL	Ø14	M12x100 coach screw down into the GF-EX16 stud pack [TLS detail - engineer to confirm]
H23	bf	2880	35 E of web CL	Ø14	M12x100 coach screw down into the GF-EX16 stud pack [TLS detail - engineer to confirm]

CUT LIST

MARK	ITEM	GRADE	LENGTH	QTY	KG
SB2	UB203x133x25	S355JR	2955	1	74.2
TOTAL					**74.2 kg**

CONNECTIONS

Detail A: SB2 end A on SB3 - 150x90x8 S275 fin plate welded to SB3 (8mm double fillet weld (both sides)); 2 no. M16 8.8 bolts, Ø18 holes; bolt line 50 from the support face, 40 to the plate end; pitch 35/80/35; plate top 25 below TOS; beam end gap 10; cope 50 long x 25 deep top and bottom

NOTES

1. **FOR APPROVAL - NOT FOR FABRICATION until the engineer has approved the TLS details and returned the steel drawings.**
2. ALL STEELWORK SUBJECT TO SITE MEASURE BEFORE FABRICATION.
3. BS EN 1090-2 EXC2, CE marked. UB S355JR (EN 10025-2).
4. Holes: normal clearance (EN 1090-2 Table 11): M12 = 14, M16 = 18. Drilled or punched full size, deburred.
5. Running dimensions from end A / base underside (o = datum). Levels above FFL (model 0).
6. Coating: Blast Sa 2.5 + single-coat shop primer, 80 µm DFT, BS EN ISO 12944-5 C2 (S-0011 3.05) - fabricator to confirm product; 30 min fire protection by others (9.02).
7. Copes: re-entrant corners radiused 10 min (BS EN 1090-2 6.7, 5 min), cut edges ground smooth.
8. Holes / plates marked TLS detail are not on the engineer's drawings: TLS detail - engineer to confirm before fabrication.
9. Install order: bearing coach screws, then the top-plate coach screws, THEN the east packer + binder (the packer leaves ~20 mm inside the section - no screw can be driven after it).

REVISIONS

REV	DATE	DESCRIPTION
C03	11.10.26	Steel fabrication drawings - first issue

TLS TIMBER FRAME

Design & Manufacture

Scan: 3D model + drawings

CLIENT	PROJECT
MP Adams	MP Adams Plot 4, Eckington

DRAWING TITLE

SB2 UB203X133X25 FABRICATION

Under FF-EX1 and the kitchen joist ends, SB3 -> GF-EX16 4-ply pack

SCALE	SIZE	DATE	DRAWN
1:15 / details as noted	A3	11.10.26	TS

STATUS	DRAWING No.	REV
FOR APPROVAL	P4-ST-SB2	C03

Do not scale. All dimensions in mm. Check all dimensions on site.