M-02 2 m BOOM LAYOUT

TAPE MEASURE SATELLITE YAGI | TM-YAGI-01

DRAWING REV A

FOR REVIEW - SOURCE O3/O5/O6 REV L

VIEW A | PVC-2M ELEMENT-PLANE ELEVATION

FRONT DATUM CONTROLS | 1:2

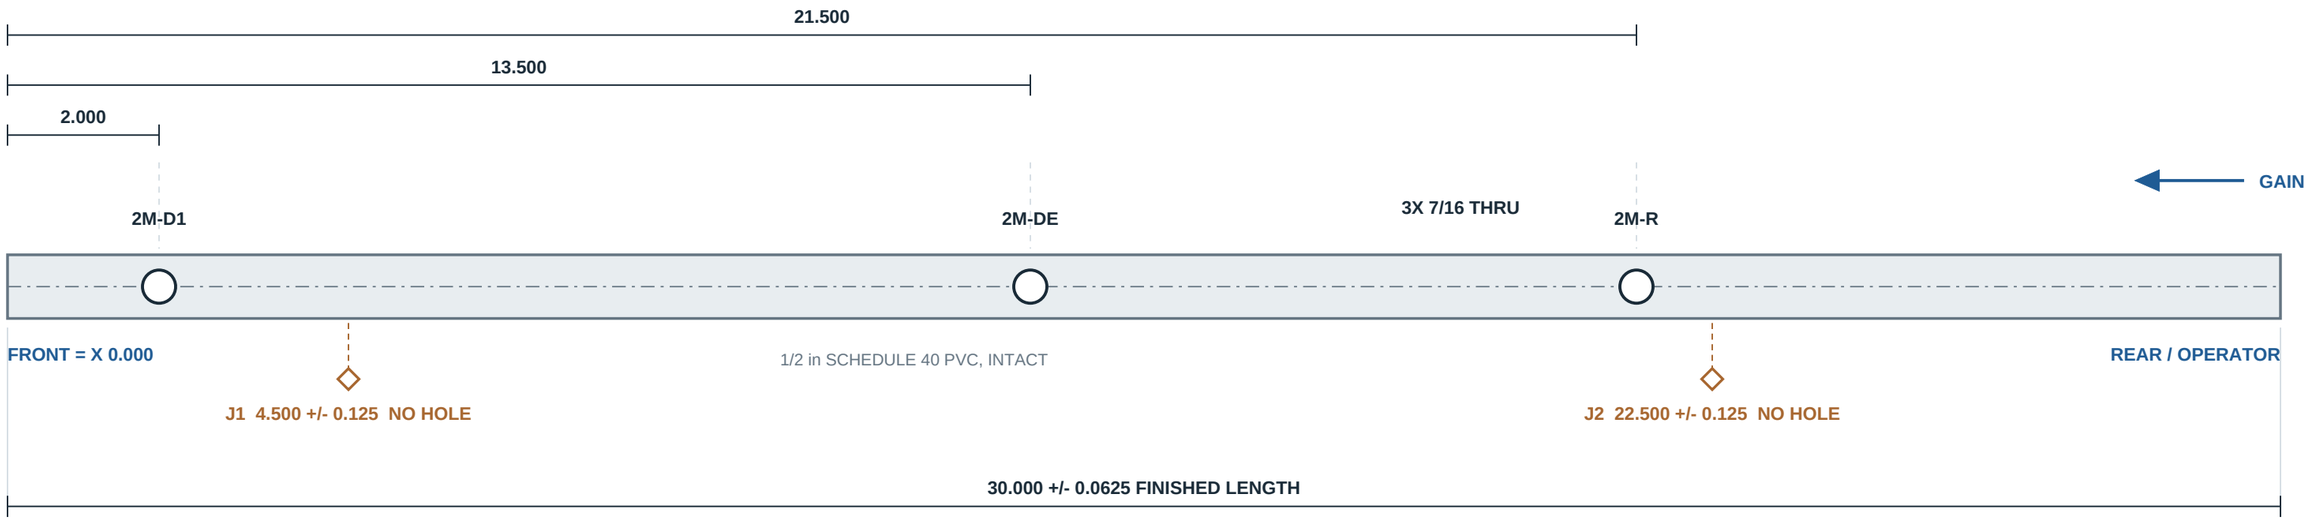

ALL X VALUES MEASURED INDEPENDENTLY FROM THE FINISHED FRONT END; DO NOT CHAIN LAYOUT.

2 m BOOM STATION SCHEDULE

INCHES

ID	X FRONT	TOL.	X REAR NOM.	ACTION
2M-D1	2.000	+/- 0.0625	28.000	7/16 THRU
J1	4.500	+/- 0.125	25.500	NO HOLE
2M-DE	13.500	+/- 0.0625	16.500	7/16 THRU
2M-R	21.500	+/- 0.0625	8.500	7/16 THRU
J2	22.500	+/- 0.125	7.500	NO HOLE

REAR VALUES ARE NOMINAL FOR L = 30.000; ACTUAL L GOVERNS THE CROSS-CHECK.

J1 / J2: CENTER PAD AND TIE AT MARK; DO NOT DRILL EITHER BOOM.

VIEW B | FRONT END

1:1 NOMINAL

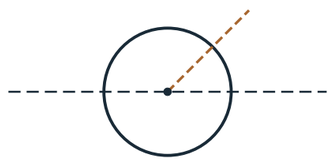

ELEMENT-PLANE / DRILL AXIS

45 deg ASSEMBLY-ORIENTATION LINE

NOMINAL OD 0.840; MEASURE ACTUAL.

TRANSFER LINES AT EACH RF STATION.

DRILLING / INSPECTION

O5 / O6

1. PASS MATERIAL COUPON: 2 m TAPE + SUPPORT.

2. MARK FRONT, REAR, BAND ID, GAIN ARROW.

3. MARK STRAIGHT ELEMENT-PLANE LINE.

4. CHECK EACH X FRONT AND X REAR USING L.

5. REQUIRE |X FRONT + X REAR - L| <= 0.03125.

6. FIX IN V-BLOCK; DRILL 3 RF HOLES ONLY.

7. AXES SQUARE, PARALLEL, COPLANAR.

8. DEBURR / INSPECT FOR CRACKS, WHITENING.

9. RECHECK RF HOLE CENTERS FROM BOTH ENDS.

10. FEED-NODE HOLES ARE IN TAPE, NOT PVC.

GENERAL NOTES

1. DIMENSIONS / TOLERANCES CONTROL. VIEW A 1:2 AT 100% PRINT.
2. THREE 7/16 THROUGH-HOLES ONLY. COUPON APPROVAL PRECEDES FINAL DRILLING.
3. ELEMENT CUTS, MOUNTING, FEED HARDWARE, AND RETENTION DETAILS: M-04 TO M-08.

SOURCE BASELINE

O3/O5/O6 REV L

COMMIT 186c773

SCALE AT 100% PRINT

VIEW A 1:2

VIEW B 1:1 NOMINAL

ISSUE / DATE

REV A - FOR REVIEW

2026-10-12

SHEET M-02