E-03 COAX AND FERRITE ROUTING

TAPE MEASURE SATELLITE YAGI | TM-YAGI-01

DRAWING REV A

FOR REVIEW - SOURCE O3-O6 REV L

VIEW A | TWO REARWARD CABLE PATHS

ORDER / TOPOLOGY ONLY; NOT TO SCALE

ONE 6 FT, 50 OHM RG-58 FACTORY BNC MALE-TO-MALE CABLE PER BAND. KEEP FEEDS SEPARATE; NO PASSIVE BNC TEE.

2 m INDEPENDENT FEED

FRONT / FEED -> REAR / OPERATOR

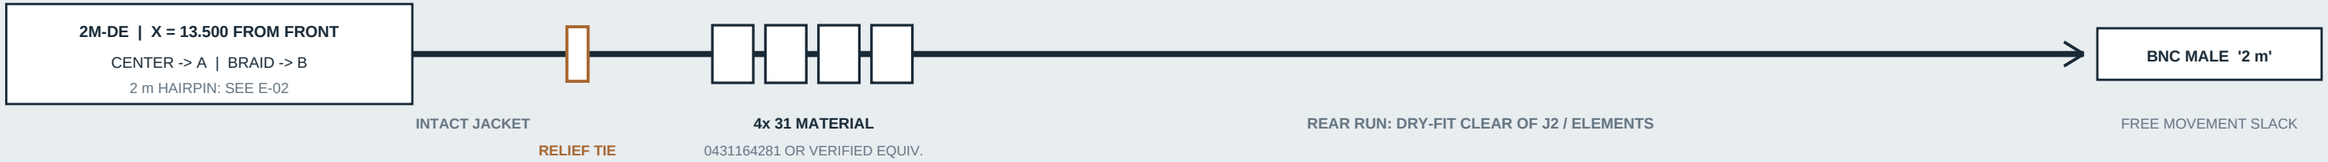

70 cm INDEPENDENT FEED

FRONT / FEED -> REAR / OPERATOR

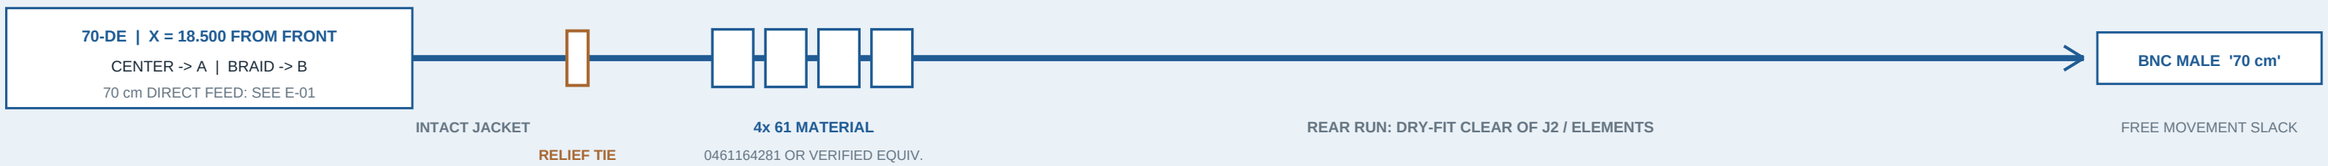

CABLE PATHS, BEND LOCATIONS, FERRITE POSITIONS, AND SLACK ARE SET BY ACTUAL DRY FIT AND RECORDED AS BUILT.

O7 FEED-ENTRY GATE

BEFORE EITHER ANTENNA-END BNC IS REMOVED

1. CONFIRM BOTH 50 OHM RG-58; FACTORY BNC CONTINUITY / SHORT TESTS PASS.
2. RECORD ACTUAL JACKET OD, MAKER / MODEL, AND PUBLISHED MIN BEND RADIUS IF AVAILABLE; CHECK BOTH CABLES FOR DAMAGE.
3. VERIFY FOUR INITIAL FERRITES PER FEED: 31 ON 2 m, 61 ON 70 cm OR APPROVED EQUIVALENTS WITH MANUFACTURER DATA.
4. CHECK EACH SNAP-ON FIT / LATCH ON THE REAL CABLE; NO CRUSH.
5. DRY-FIT BOTH INTACT CABLES, FERRITES, AND LOCAL STRAIN RELIEF.

FAIL? RECORD IN O4 SEC. 11 AND STOP BEFORE CUTTING EITHER CABLE.

INSTALLATION / CLEARANCE RULES

O3 SEC. 14 / O5 SEC. 12

1. JACKET CLOSE TO NODES; LOCAL STRAIN RELIEF BEFORE FERRITES.
2. DO NOT LOAD ELECTRICAL NODES; FERRITES NEAR FEED, BEFORE REAR RUN.
3. OBEY CABLE MAKER'S MINIMUM BEND RADIUS; NO TIGHT BOOM COILS.
4. CLEAR ELEMENT TIPS, HAIRPIN, J1/J2, AND THE OTHER FEEDPOINT.
5. **CROSS-BOOM PART CLEARANCE >= 0.125 IN; MEASURE ON ASSEMBLY.**
6. SMALL ~4 IN TIES: LOCAL ONLY, NEVER AROUND BOTH BOOMS.
7. KEEP FREE REAR CABLE FOR NORMAL HANDHELD MOVEMENT.

O8 COAX-MOVEMENT TEST SETS FINAL FERRITE COUNT / POSITION.

AS-BUILT ROUTE / O8 RECORD

ENTER ACTUAL VALUES; INITIAL FERRITE COUNT = FOUR PER FEED

FEED	CABLE OD / MAKER / BEND LIMIT	FERRITE GRADE / FIT / POSITION	TIES / ROUTE / MIN CROSS-BOOM GAP	O8 MOVEMENT / FINAL QTY
2 m				
70 cm				

GENERAL NOTES

1. ROUTE GRAPHICS ARE SCHEMATIC; NO CABLE CUT LENGTH, TIE STATION, OR BEND RADIUS IS ASSIGNED.
2. REMOVE ONLY THE ANTENNA-SIDE BNC AFTER THE O7 GATE; RETAIN AND LABEL EACH OPERATOR-END BNC.
3. FINAL RF ACCEPTANCE NEEDS O8 MEASUREMENTS; LOW SWR ALONE DOES NOT PROVE COMMON-MODE CONTROL.

SOURCE BASELINE
O3/O4/O5/O6 REV L
COMMIT 186c773

SCALE AT 100% PRINT
SCHEMATIC / NTS
17 x 11 IN SHEET

ISSUE / DATE
REV A - FOR REVIEW
2026-10-12

SHEET E-03