M-03 70 cm BOOM LAYOUT

TAPE MEASURE SATELLITE YAGI | TM-YAGI-01

DRAWING REV A

FOR REVIEW - SOURCE O3/O5/O6 REV L

VIEW A | PVC-70 ELEMENT-PLANE ELEVATION

FRONT DATUM CONTROLS | 1:2

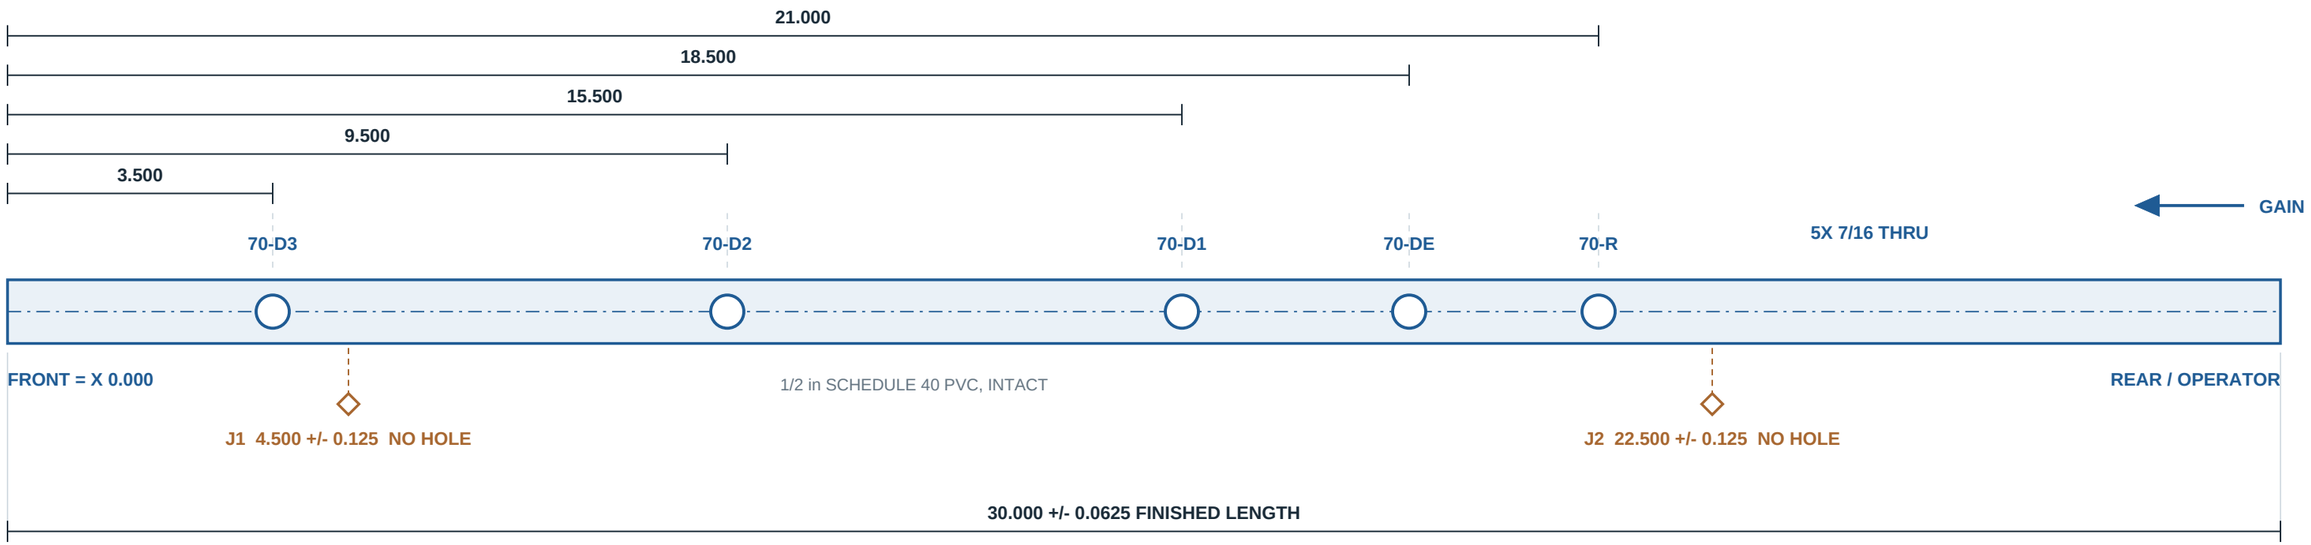

ALL X VALUES MEASURED INDEPENDENTLY FROM THE FINISHED FRONT END; DO NOT CHAIN LAYOUT.

70 cm BOOM STATION SCHEDULE

INCHES

ID	X FRONT	TOL.	X REAR NOM.	ACTION
70-D3	3.500	+/- 0.03125	26.500	7/16 THRU
J1	4.500	+/- 0.125	25.500	NO HOLE
70-D2	9.500	+/- 0.03125	20.500	7/16 THRU
70-D1	15.500	+/- 0.03125	14.500	7/16 THRU
70-DE	18.500	+/- 0.03125	11.500	7/16 THRU
70-R	21.000	+/- 0.03125	9.000	7/16 THRU
J2	22.500	+/- 0.125	7.500	NO HOLE

REAR VALUES ARE NOMINAL FOR L = 30.000; ACTUAL L GOVERNS THE CROSS-CHECK.

J1 / J2: CENTER PAD AND TIE AT MARK; DO NOT DRILL EITHER BOOM.

VIEW B | FRONT END

1:1 NOMINAL

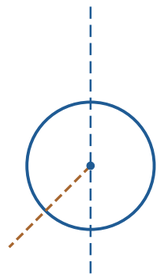

ELEMENT-PLANE / DRILL AXIS

45 deg ASSEMBLY-ORIENTATION LINE

NOMINAL OD 0.840; MEASURE ACTUAL.

TRANSFER LINES AT EACH RF STATION.

DRILLING / INSPECTION

O5 / O6

1. PASS MATERIAL COUPON: 70 cm TAPE ONLY.

2. MARK FRONT, REAR, BAND ID, GAIN ARROW.

3. MARK STRAIGHT ELEMENT-PLANE LINE.

4. MARK 45 deg ASSEMBLY-ORIENTATION LINE.

5. CHECK EACH X FRONT AND X REAR USING L.

6. REQUIRE |X FRONT + X REAR - L| <= 0.03125.

7. 2M-R TO 70-R X DELTA: 0.500 +/- 0.03125.

8. FIX IN V-BLOCK; DRILL 5 RF HOLES ONLY.

9. AXES SQUARE, PARALLEL, COPLANAR.

10. DEBURR / INSPECT; RECHECK X BOTH ENDS.

11. NO J1/J2 OR PVC FEED-NODE HOLES.

GENERAL NOTES

1. DIMENSIONS / TOLERANCES CONTROL. VIEW A 1:2 AT 100% PRINT.
2. FIVE 7/16 THROUGH-HOLES ONLY. COUPON APPROVAL PRECEDES FINAL DRILLING.
3. ALIGN FRONTS WITH PVC-2M; VERIFY CLOSE REFLECTORS PER M-09.

SOURCE BASELINE

O3/O5/O6 REV L

COMMIT 186c773

SCALE AT 100% PRINT

VIEW A 1:2

VIEW B 1:1 NOMINAL

ISSUE / DATE

REV A - FOR REVIEW

2026-10-12

SHEET M-03