

LOOPING WIRING DIAGRAM

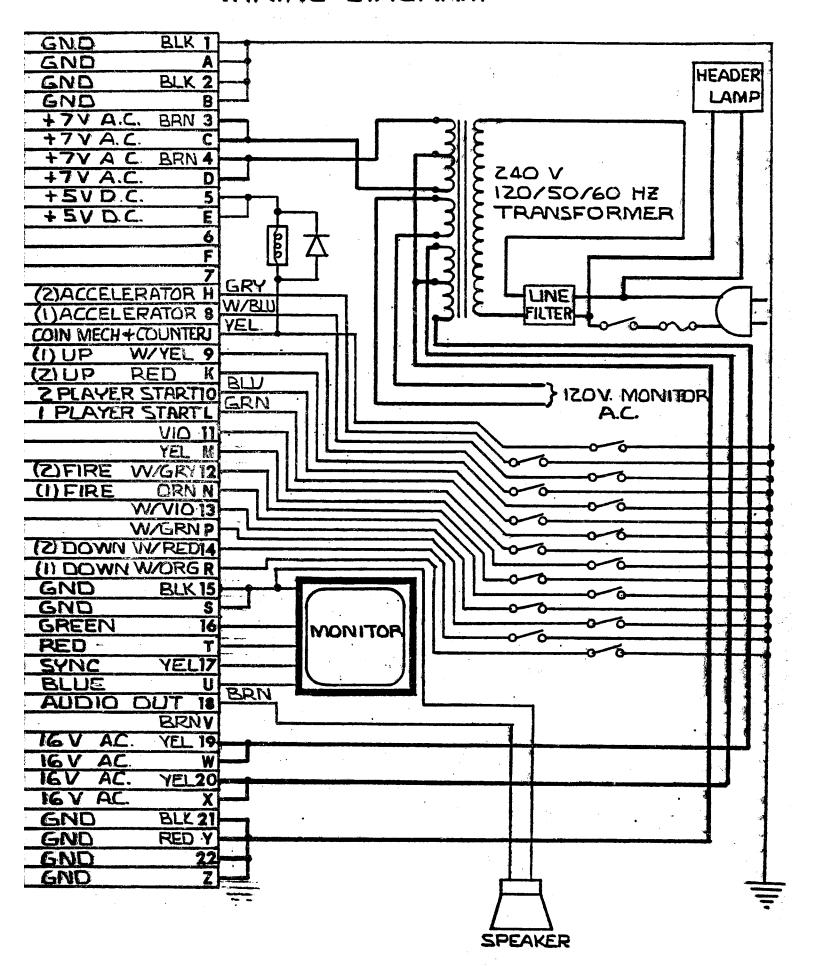

LOOPING POWER SUPPLY ADJUSTMENTS

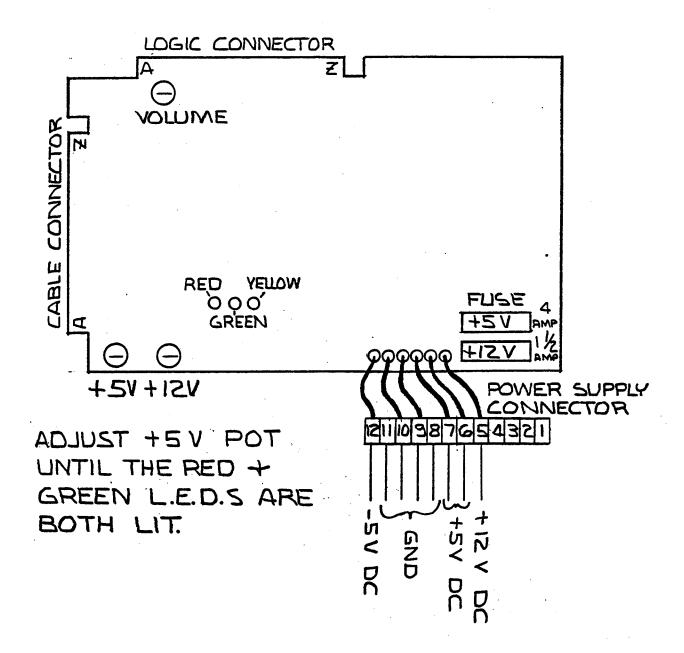

LOGIC BOARD CONNECTIONS

Components Side	Solder Side
1 Red	1 Green
2 Sync.	2 Blue
3 Pot 1	3 Pot 2
4 GND Pot - Video GND	4 Audio 1
5 1 Player Fast	5 Two Player
6 Coin (programmable)	6 Coin 1/1
7 One Player	7 1 Player Fire
8 1 Player Up	8 1 Player Down
9	9
10 2 Player Fast	10
11	11 2 Player Fire
12 2 Player Down	12 2 Player Up
13	13
14	14.
15	15
16	16
17 GND	17 GND
18	18 GND
19	19
20 GND	20 Audio 2
21	21
22	22

SWITCH SETTINGS

			•	
Coin	1	* .	 Coin	2

1	2	3	4	5	6	7	8	Functions
							OFF	1 Credit/Coin
							ON	2 Coins/Credit
1.				OFF	OFF	OFF		7 Credits/Coin
				OFF	OFF	ON		6 Credits/Coin
				OFF	ON	OFF		5 Credits/Coin
		saled		OFF	ON	ON	•	4 Credits/Coin
				ON	OFF	OFF		3 Credits/Coin
				ON	OFF	ON	•	2 Credits/Coin
				ON :	ON	ÓFF		1 Credit/Coin
				ON	ON	ON		10 Credits/Coin
:		OFF					·	5 Jets/PLayer
	•	ON						3 Jets/Player

