Processor Status & FLAGS Register

Course Code: COE 3205

Course Title: Computer Organization & Architecture

Dept. of Computer Science Faculty of Science and Technology

Lecturer No:	05	Week No:	05	Semester:	Fall 24-25
Lecturer:	Noboranjan Dey; noboranjan@aiub.edu				

Lecture Outline



- 1. Overview
- 2. Learning Objective
- 3. The FLAGS Register
- 4. The Status Flags
- 5. Overflow
- 6. How Instructions Affect the Flags
- 7. DEBUG Program

Overview



- Computer's decision-making ability makes it unique than other devices.
- The CPU circuits perform decision making based on the processor's current state.
- The 8086 processor's state is represented with nine individual bits or flags.
- > The 8086 takes decision based on the flags value.
- The flags are placed in the FLAGS register.
- Status flags: Reflects the result of computation.
- Control flags: used to enable or disable certain operations of processor


Learning Objective



- How flags are effected by the machine instructions.
- DOS program DEBUG
- Display registers, flags and memory locations using DEBUG.

The FLAGS Register



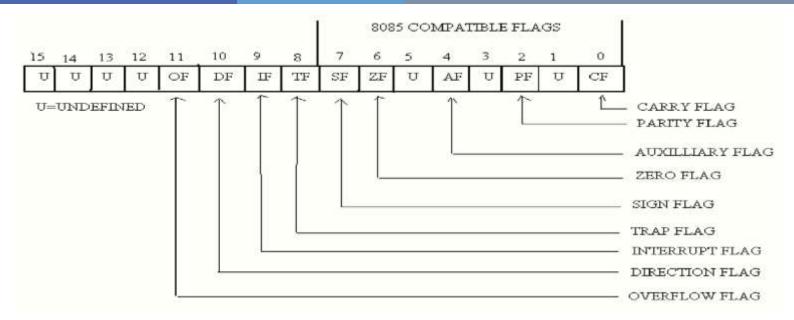

Status Flags: bit **0, 2, 4, 6, 7** and **11**

Control Flags: bit 8, 9 and 10

*** bit 1,3,5,12,13,14,15 has no significance

The Status Flags (1/2)



Flags	Descriptions
Carry Flag	 CF=1 If there is a carry out from the most significant bit (MSB) on addition. CF=1 If there is a borrow into the most significant bit MSB on subtraction. Otherwise, CF=0
Parity Flag	 Even Parity: PF=1, if low byte of a result has even number of one bits [e.g., 1111000011] Odd Parity: PF=0, if low byte of a result has an odd number of one bits [e.g., 1111000111] e.g FFFF is odd parity and FFFE is even parity
Auxiliary carry Flag	 AF=1, if there is a carry out from bit 3 on addition or AF=1, if there is a borrow from bit 3 on subtraction.

The Status Flags (2/2)



Zero Flag	 ZF=1 for a zero result. e.g. for AX-AX= Zero, thus, ZF=1 ZF=0 for a non-zero result
Sign Flag	 SF=1 if MSB of a result is 1. that is the result is negative SF=0 if the MSB is zero
Overflow Flag	OF=1 if signed overflow occurred otherwise it is 0 (Zero)



- The range of numbers can be represented is limited!
 - Range of signed numbers can be represented in 16-bit word is -32768 to 32767
 - For 8 bit byte it is -128 to 127
 - For unsigned number, the range for word is 0 to 65535.
 - For byte it is 0 to 255
- If an Operations falls **outside these range**, overflow occurs and truncated result that is saved and will be incorrect.

Possible Overflows



- If we perform an arithmetic operation such as addition, there are four possible consequences:
 - No overflow
 - Signed overflow only
 - Unsigned overflows only
 - Both signed and unsigned overflows



Example: Unsigned but not Signed Overflow

- For an unsigned interpretation, the correct answer is 10000h or 65536.but this is out of range and 1 is carried out of msb and finally AX= 0000h[WRONG!] thus UNSIGNED overflow occurred.
- However, for a signed number the answer is correct
 FFFFh+0001h or -1+1=0. So no signed overflow occurred.



Example: Signed but not Unsigned Overflow

ADD AX,BX 111111111111110 [FFFEh = -2]

- For singed and unsigned interpretation, 7FFFh= 32767 thus 7FFFh+7FFFh= 32767+32767 = 65534 [out of range for signed numbers!]. So signed overflow occurred.
- However, an unsigned interpretation the answer is correct FFFEh or 65534

PRAESIDIAN THE PRAESI

Processor Overflow Indication

- OF = 1 for a signed overflow
- CF = 1 for unsigned overflow

Unsigned Overflow:

> On addition: the unsigned overflow occurs when there is a carry out of the MSB.

Meaning the correct answer is bigger than largest unsigned number i.e. FFFFh or FFh

On Subtraction: If there is a borrow into the MSB Meaning the correct answer is Smaller than 0.

PARESIDIUM LANGE SIDIUM LANGE S

Signed Overflow:

- On addition: On addition with the numbers with the same sign, signed overflow occurs while SUM has different sign. However, overflow is impossible in addition of numbers with different sign.
- On subtraction: Subtraction of numbers with different signs is like adding numbers of the same sign. Signed overflow occurs if the result has different sign than expected.
- ➤ If there is a carry into msb but no carry out or if there is a carry out but no carry in then the signed overflow occurs and OF is set to 1.

PRAESIDIUM CHINA C

Overflow Summary on Addition:

- Note that the overflow bit was set whenever we had a carry from bit 6 to bit 7, but no carry from bit 7 to C.
- It was also set when we had a carry from bit 7 to C, but no carry from bit 6 to bit 7.
- Upshot: The overflow bit is the EXCLUSIVE-OR of a carry from bit 6 to bit 7 and a carry from bit 7 to C.

Carry And Overflow Exemple - 1 · b+ 6 to 7 No carry Dec Hex 53 35 +25 +19 78 4E 001110101 · by 7 to e 11 0001 1001 · . Czo. 020 0 100 1110 Lit 6 to 7 carry yes 6xample-2 Sinovy HEX 35 11 7 to carry No cons Dec 0101 0011 53 1011 +53 6101 +91 ·. e=0, 0=1 Tad 199 0000 1001 Sit 6 to 7 cosy yes Example -3 Binory Pet & to come control ato Dec Hex 0011 0101 53 -45 + 103 108 1101 i. e= 1, 0= 0 0011 1 0000 1000 Sit & to ? No corry Binny Example-9 -98 -198 -193 -193 -193 1001 1001 ·; C=1, 8= 14 0111 0061

How Instructions Affect the Flags



INSTRUCTION	AFFECT FLAGS	
MOV/ XCHG	NONE	
ADD/SUB	ALL	
INC/DEC	ALL EXCEPT CARRY FLAG	
NEG	ALL(CF =1 UNLESS RESULT 0 OF = 1 IF WORD OPERAND IS 8000H OR BYTE OPERAND IS 80H)	

How Instructions Affect the Flags



Examples

- 1. ADD AX,BX, WHERE AX CONTAINS FFFFH AND BX CONTAINS FFFFH.

The result stored in AX is FFFEh = 1111 1111 1111 1110

- SF = 1 because msb is 1
- PF = 0 because there are 7 of 1 bits in the low byte of the result
- ZF = 0 because the result is non zero
- CF = 1 because there is a carry out of the msb on addition
- OF = 0 because the sign of the stored result is the same as that of the numbers being added(as a binary addition, there is a carry into the msb and also a carry out)

How Instructions Affect the Flags



Examples

2. ADD AL, BL, WHERE AL CONTAINS 80H AND BL CONTAINS 80H.

The result stored in AL is 00h.

- SF = 0 because the msb is 0
- PF = 1 because all the bits in the result are 0
- ZF = 1 because the result is 0
- CF = 1 because there is a carry out of the msb on the addition
- OF = 1 because the numbers being added are both negative, but the result is O(as a binary addition, there is no carry out into the msb but there is a carry out.)

How Instructions Affect the Flags



Examples

3. NEG AX, WHERE AX CONTAINS 8000H.

```
8000h = 1000 0000 0000 0000
one's complement = 0111 1111 1111 1111
two's complement =
```

1000 0000 0000 0000 = 8000h

The result is stored in AX is 8000h

- SF = 1
- PF = 1
- ZF = 0
- CF = 1 because for NEG CF is always 1 unless the result is 0
- OF = ? because the result is 8000h; when a number is negated, we would expect a sign change, but because 8000h is its own two's complement, there is no sign change.

HW



Task: Solve the Following and Show the Effects on Flag Registers

- > SUB AX,BX, WHERE AX CONTAINS 8000H AND BX CONTAINS 0001H.
- > INC AL, WHERE AL CONTAINS FFH.
- \triangleright MOV AX, -5.

DEBUGING Program



- Debug is used to step through a program, display and change the registers and memory.
- ➤ It is possible to enter assembly code directly. DEBUG then converts it to machine code and stores it in memory.

DEBUGING Program



Program 1: Checking Flags

.MODEL SMALL

.STACK 100H

.DATA

.CODE

MAIN PROC

MOV AX,4000H ;AX=4000h

ADD AX,AX ;AX=8000h

SUB AX,0FFFFH ;AX=8001h

NEG AX ;AX=7FFFh

INC AX ;AX=8000h

MOV AH,4CH

INT 21H

MAIN ENDP

END MAIN

DEBUGING Program



DEBUG Flag Symbols

Status Fla	g Set (1) Symbol	Clear (0) Symbol	
CF	CY (carry)	NC (no carry)	
Pf	PE (even parity)	PO (odd parity)	
AF	AC (auxiliary carry)	NA (No Auxiliary carry)	
ZF	ZR (zero)	NZ (nonzero)	
SF	NG (negative)	PL (plus)	
OF	OV (overflow)	NV (no overflow)	
Control Flag			
DF	DN (down)	UP (up)	
IF	El (enable interrupts)	DI (Disable interrupt)	

Books



 Assembly Language Programing and Organization of the IBM PC

> Ytha Yu Charles Marut

References



- Flag Register Details
 - https://www.youtube.com/watch?v=-LXc6lvtsfl
 - https://www.youtube.com/watch?v=vkpGK5bZbSY&list=RDC MUCCU6xxwO9uJuFieylWL2lSA&start_radio=1&t=27
- Carry and Overflow Details
 - https://www.youtube.com/watch?v=9cXe T99nL4