

MAIN TANK ANALYSIS




Equipment Name	GT2C Bleeding	Site	SITE2
Serial No.	383204886	Power Rating	4500 kVA
Manufacture	EAKARAT	Voltage Rating	11 /6.9 kV
Fluid Type	Mineral Oil	Service Type	Auxiliary Transformer

Dissolve Gas Analysis

Test Result

	Sampling Date Lab test date	Current Sampling 07-Oct-2025	Previous Sampling 29-Oct-2024 2024-10-24	Previous Sampling 22-Sep-2022
O2/N2 Ratio: 0.24				
General Dissolve Gas				
Nitrogen [N ₂]		16991	7076	11022
Oxygen [O ₂]		4086	1292	2130
Carbon Dioxide [CO ₂]		A 1381	A 1022	A 492
Dissolve Combutable Gas				
Hydrogen [H ₂]		A 3	A 3	A 0
Methane [CH ₄]		A 2	A 1	A 1
Ethane [C ₂ H ₆]		A 1	A 1	A 1
Ethylene [C ₂ H ₄]		A 0	A 0	A 1
Acetylene [C ₂ H ₂]		A 0	A 0	A 0
Carbon Monoxide [CO]		A 36	A 31	A 32
Total Dissolve Combutable Gas [TDCG]		42	36	35
Other Gas				
Propylene [C ₃ H ₆]		3	13	1
Propane [C ₃ H ₈]		1	5	1

Key Gas Analysis [IEEE C57.104-2019]

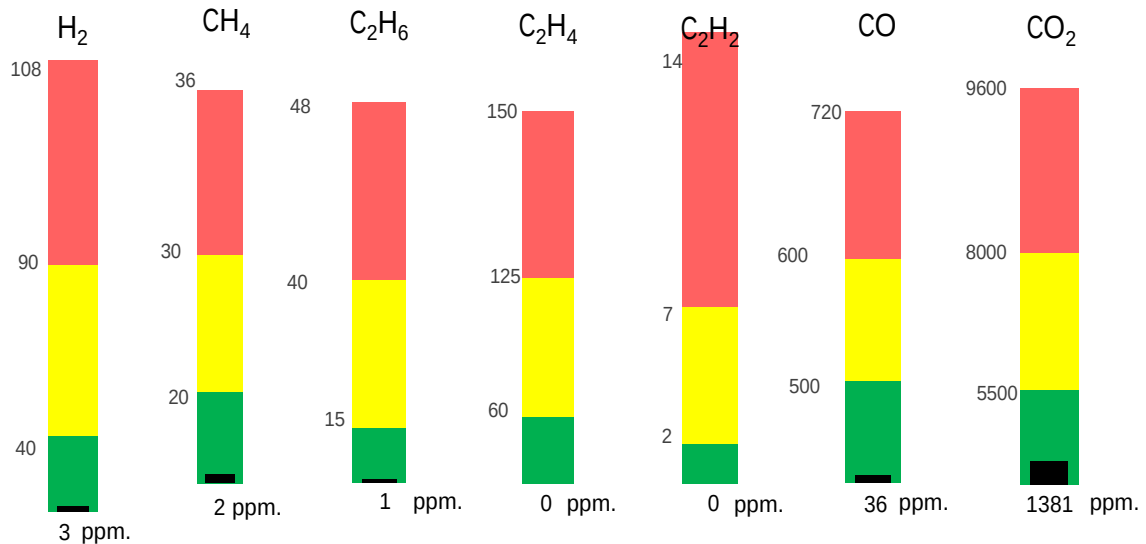

Response	Tested By	Review By	Approved By
Company	Hitachi Energy	-	
Name	Mr. Aekapong Klamchang	-	Mr.Pimchart P.
Signature			
Date	7-Oct-2025	-	7-Oct-2025


MAIN TANK ANALYSIS



Equipment Name	GT2C Bleeding	Site	SITE2
Serial No.	383204886	Power Rating	4500 kVA
Manufacture	EAKARAT	Voltage Rating	11 /6.9 kV
Fluid Type	Mineral Oil	Service Type	Auxiliary Transformer

Dissolve Gas Analysis

Key Gas Trending

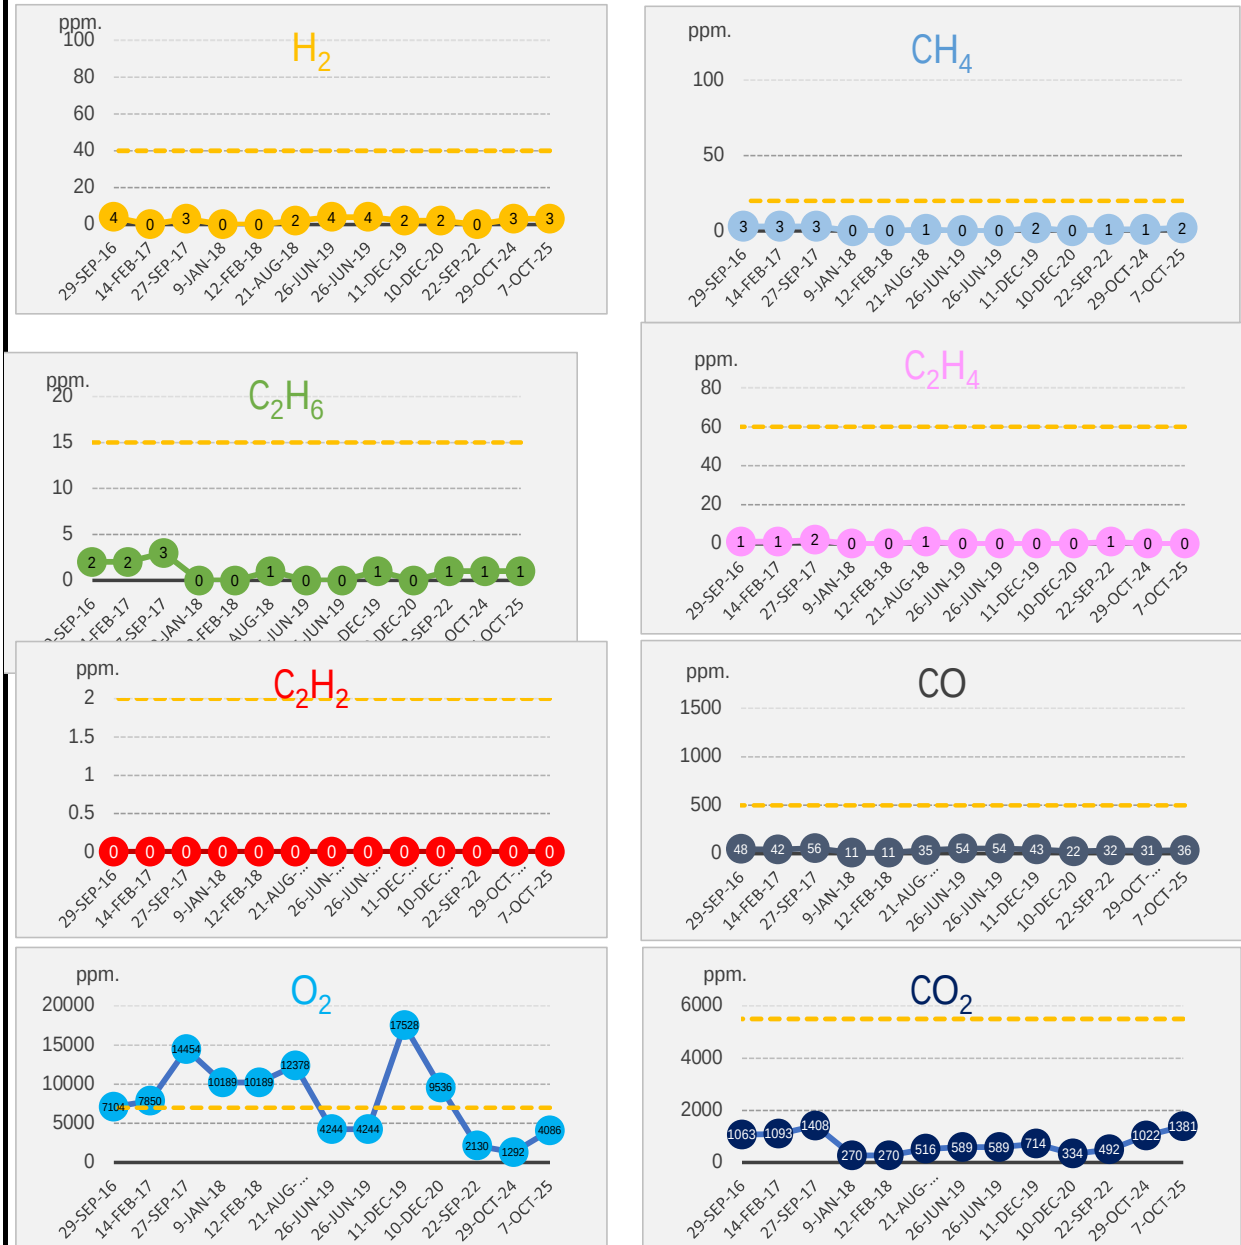

Response	Tested By	Review By	Approved By
Company	Hitachi Energy	-	0
Name	Mr. Aekapong Klamchang	-	Mr.Pimchart P.
Signature			
Date	7-Oct-2025	-	7-Oct-2025





MAIN TANK ANALYSIS



Equipment Name	GT2C Bleeding	Site	SITE2
Serial No.	383204886	Power Rating	4500 kVA
Manufacture	EAKARAT	Voltage Rating	11 /6.9 kV
Fluid Type	Mineral Oil	Service Type	Auxiliary Transformer

Dissolve Gas Analysis

Gas Pattern Method

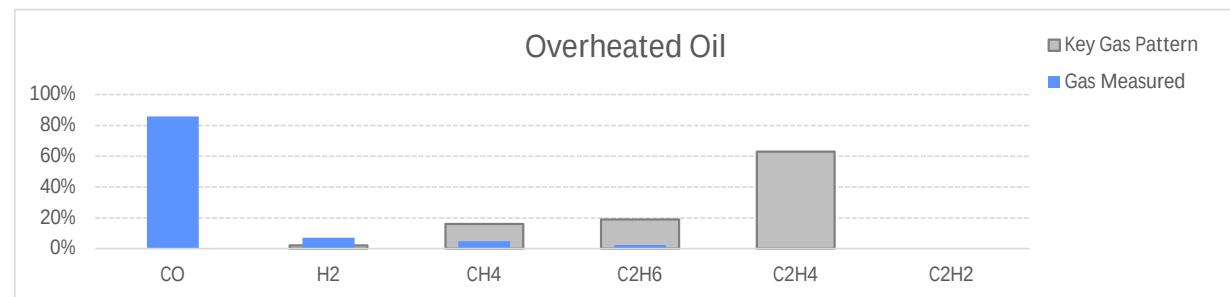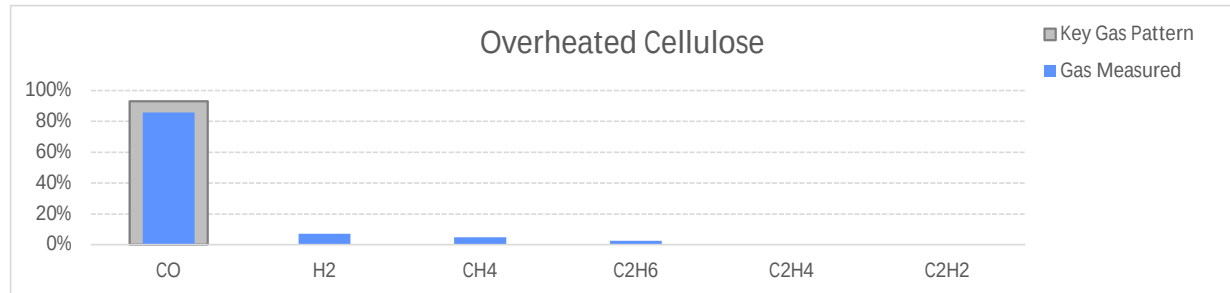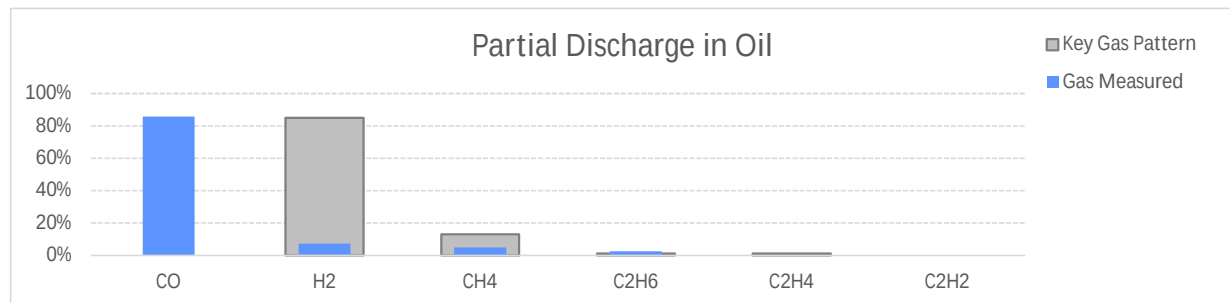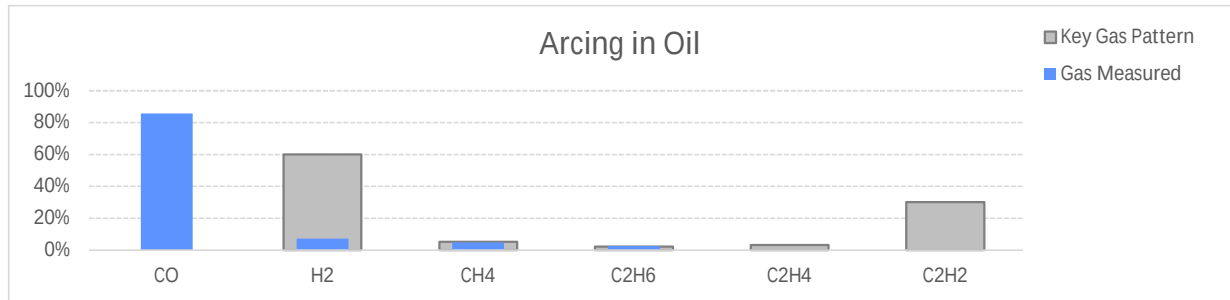

Response	Tested By	Review By	Approved By
Company	Hitachi Energy	-	0
Name	Mr. Aekapong Klamchang	-	Mr.Pimchart P.
Signature			
Date	7-Oct-2025	-	7-Oct-2025


MAIN TANK ANALYSIS




Equipment Name	GT2C Bleeding	Site	SITE2
Serial No.	383204886	Power Rating	4500 kVA
Manufacture	EAKARAT	Voltage Rating	11 /6.9 kV
Fluid Type	Mineral Oil	Service Type	Auxiliary Transformer

Dissolve Gas Analysis

Duval Triangle 1

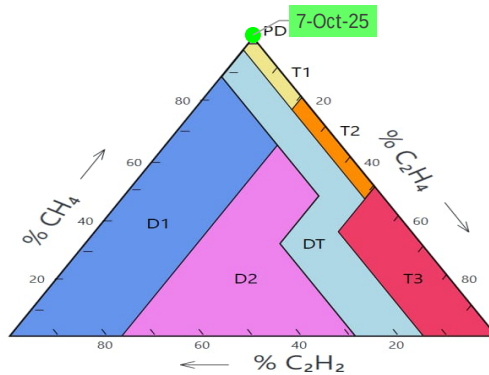

Duval Triangle 4

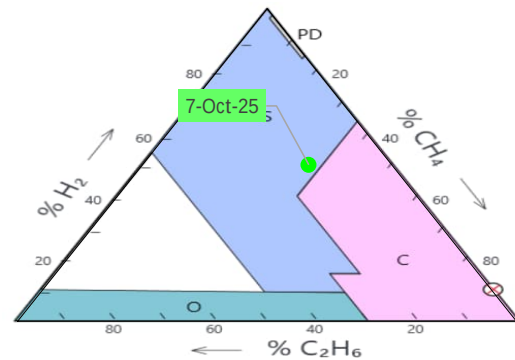

N/A The gas volume is too low for a reliable assessment

PD Partial discharge

D1 Discharge of low energy

D2 Discharge of high energy

T1 Thermal fault ($T < 300^{\circ}\text{C}$)

T2 Thermal fault ($300^{\circ}\text{C} < T < 700^{\circ}\text{C}$)

T3 Thermal fault ($T > 700^{\circ}\text{C}$)


C Carbonization

S Stray gases


O Overheating

PD Partial discharges

Pentagon 1

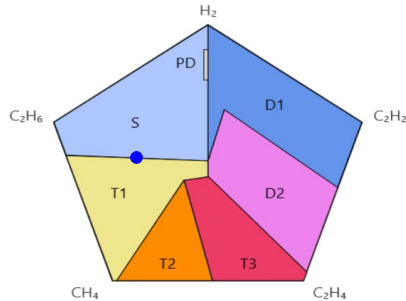

Pentagon 2

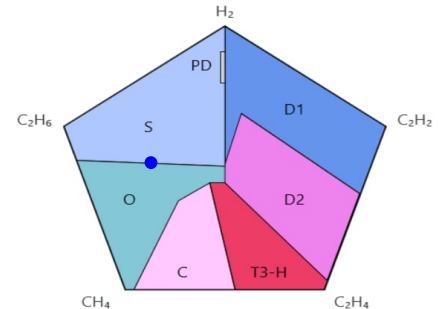

N/A The gas volume is too low for a reliable assessment

D1 Discharge of low energy

D2 Discharge of high energy

T1 Thermal fault ($T < 300^{\circ}\text{C}$)

T2 Thermal fault ($300^{\circ}\text{C} < T < 700^{\circ}\text{C}$)

T3 Thermal fault ($T > 700^{\circ}\text{C}$)

S Stray gases

C Carbonization

S Stray gases

O Overheating

D1 Discharge of low energy

D2 Discharge of high energy

T3-H Thermal faults T3 in oil only

Response	Tested By	Review By	Approved By
Company	Hitachi Energy	-	0
Name	Mr. Aekapong Klamchang	-	Mr.Pimchart P.
Signature			
Date	7-Oct-2025	-	7-Oct-2025