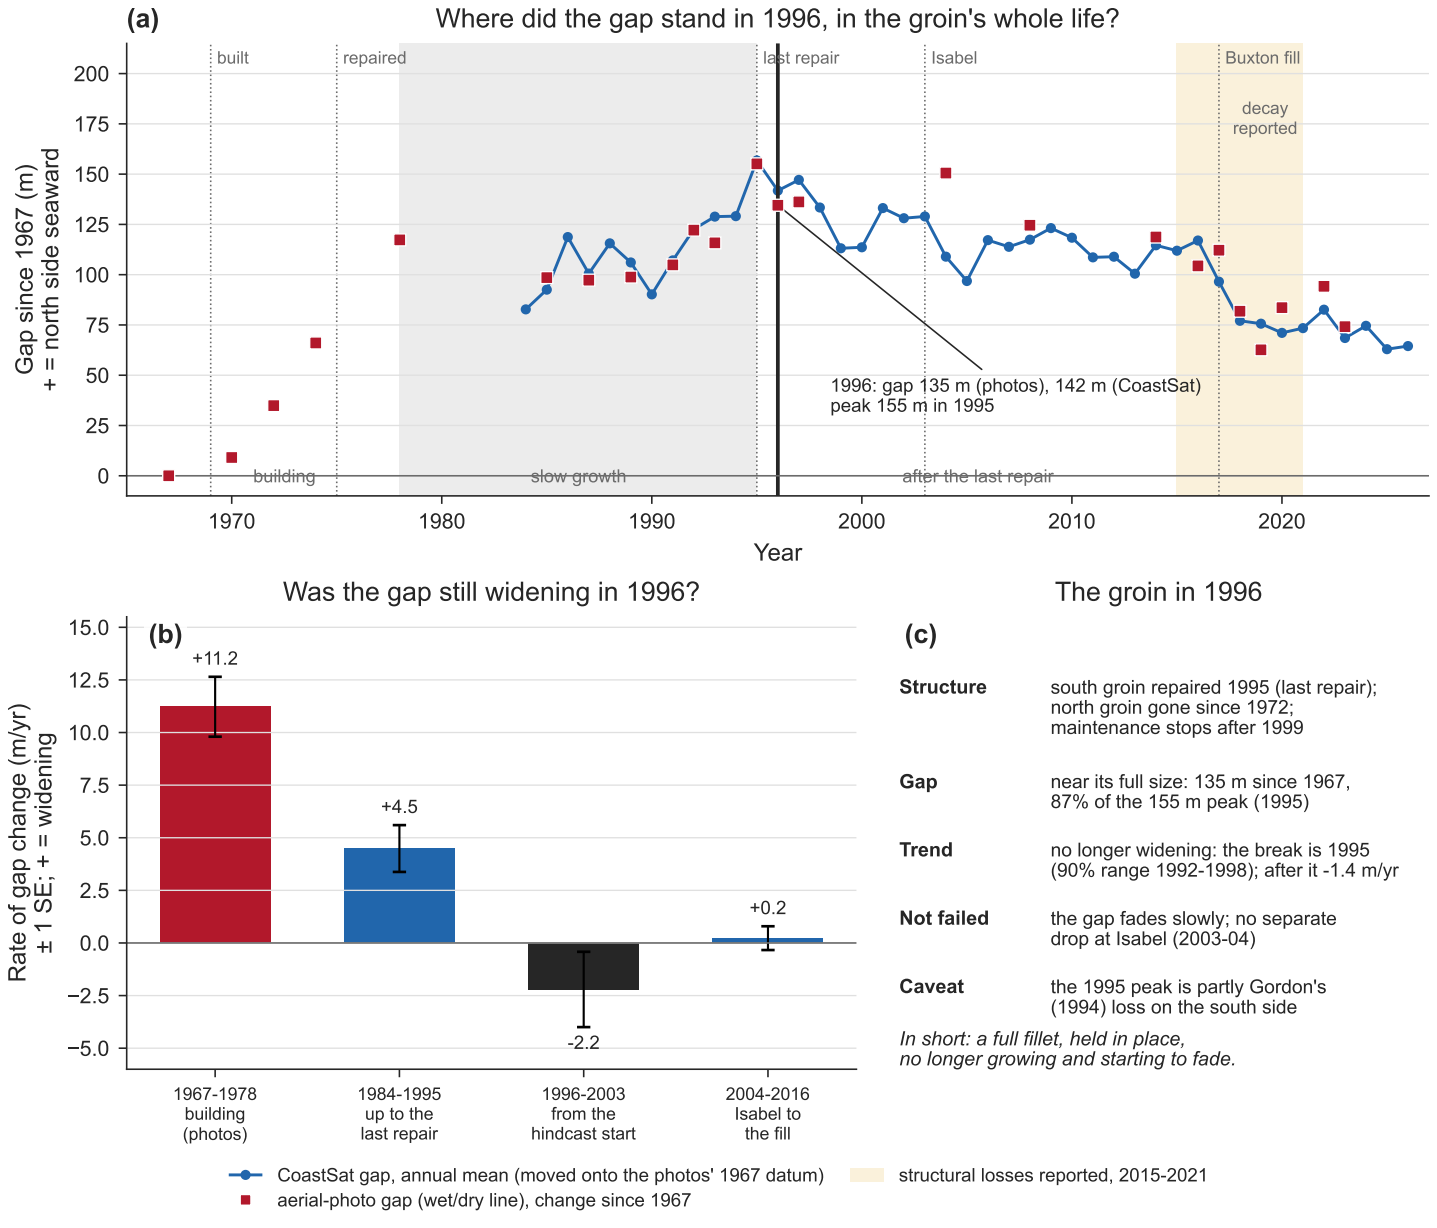
(a)
Where did the gap stand in 1996, in the groin's whole life?
built
repaired
last repair
Isabel
Buxton fill
decay reported
Gap since 1967 (m)
+ = north side seaward
200
175
150
125
100
75
50
25
0
1996: gap 135 m (photos), 142 m (CoastSat)
peak 155 m in 1995
building
slow growth
after the last repair
1970
1980
1990
2000
2010
2020
Year
Was the gap still widening in 1996?
(b)
Rate of gap change (m/yr)
± 1 SE; + = widening
15.0
12.5
10.0
7.5
5.0
2.5
0.0
−2.5
−5.0
+11.2
+4.5
-2.2
+0.2
1967-1978
building
(photos)
1984-1995
up to the
last repair
1996-2003
from the
hindcast start
2004-2016
Isabel to
the fill
CoastSat gap, annual mean (moved onto the photos' 1967 datum)
aerial-photo gap (wet/dry line), change since 1967
structural losses reported, 2015-2021
The groin in 1996
(c)
Structure
south groin repaired 1995 (last repair); north groin gone since 1972; maintenance stops after 1999
Gap
near its full size: 135 m since 1967, 87% of the 155 m peak (1995)
Trend
no longer widening: the break is 1995 (90% range 1992-1998); after it -1.4 m/yr
Not failed
the gap fades slowly; no separate drop at Isabel (2003-04)
Caveat
the 1995 peak is partly Gordon's (1994) loss on the south side
In short: a full fillet, held in place, no longer growing and starting to fade.