1. Description


1.1. Project

Project Name	UART-Debug-Test
Board Name	NUCLEO-F072RB
Generated with:	STM32CubeMX 4.22.0
Date	09/21/2017

1.2. MCU

MCU Series	STM32F0
MCU Line	STM32F0x2
MCU name	STM32F072RBTx
MCU Package	LQFP64
MCU Pin number	64

2. Pinout Configuration

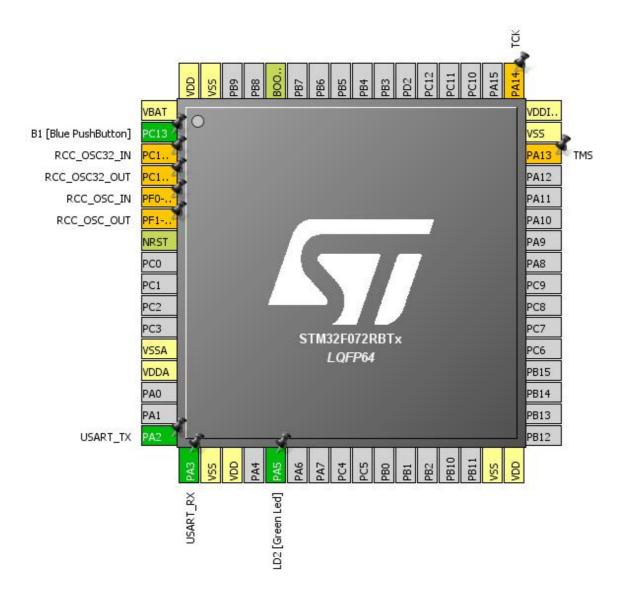


3. Pins Configuration

Pin Number LQFP64	Pin Name (function after reset)	Pin Type	Alternate Function(s)	Label
1	VBAT	Power		
2	PC13	I/O	GPIO_EXTI13	B1 [Blue PushButton]
3	PC14-OSC32_IN *	I/O	RCC_OSC32_IN	
4	PC15-OSC32_OUT *	I/O	RCC_OSC32_OUT	
5	PF0-OSC_IN *	I/O	RCC_OSC_IN	
6	PF1-OSC_OUT *	I/O	RCC_OSC_OUT	
7	NRST	Reset		
12	VSSA	Power		
13	VDDA	Power		
16	PA2	I/O	USART2_TX	USART_TX
17	PA3	I/O	USART2_RX	USART_RX
18	VSS	Power		
19	VDD	Power		
21	PA5 **	I/O	GPIO_Output	LD2 [Green Led]
31	VSS	Power		
32	VDD	Power		
46	PA13 *	I/O	SYS_SWDIO	TMS
47	VSS	Power		
48	VDDIO2	Power		
49	PA14 *	I/O	SYS_SWCLK	тск
60	воото	Boot		
63	VSS	Power		
64	VDD	Power		

^{**} The pin is affected with an I/O function

^{*} The pin is affected with a peripheral function but no peripheral mode is activated

4. Clock Tree Configuration

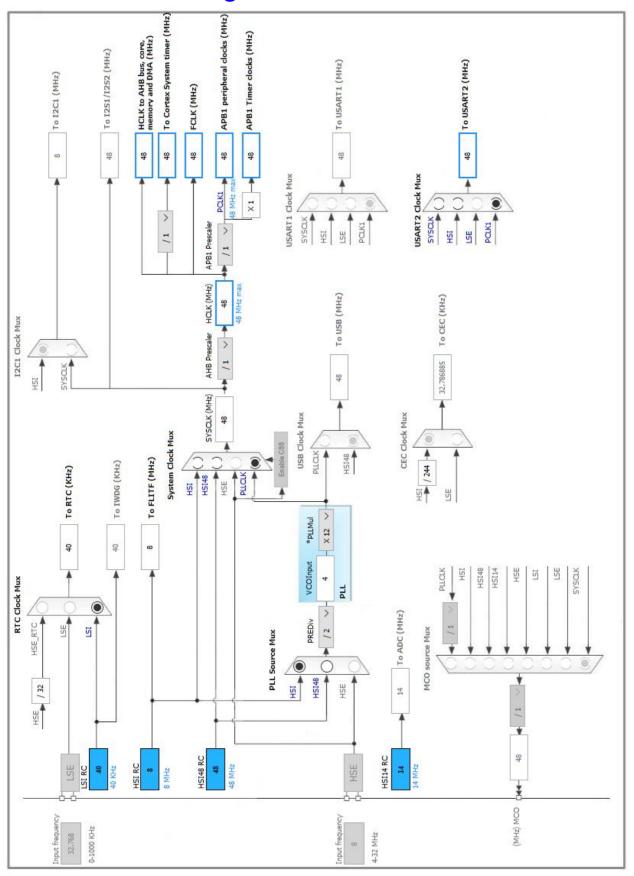

5. IPs and Middleware Configuration

5.1. RTC

mode: Activate Clock Source mode: Activate Calendar

5.1.1. Parameter Settings:

General:

Hour Format Hourformat 24

Asynchronous Predivider value 127
Synchronous Predivider value 255

Calendar Time:

Data Format BCD data format

 Hours
 0

 Minutes
 0

 Seconds
 0

Day Light Saving: value of hour adjustment Daylightsaving None Store Operation Storeoperation Reset

Calendar Date:

Week DayMondayMonthJanuaryDate1Year0

5.2. SYS

Timebase Source: SysTick

5.3. USART2

Mode: Asynchronous

5.3.1. Parameter Settings:

Basic Parameters:

Baud Rate 38400

Word Length 7 Bits (including Parity)

Parity None Stop Bits 1

Advanced Parameters:

Data Direction Receive and Transmit

Over Sampling 16 Samples
Single Sample Disable

Advanced Features:

Disable Auto Baudrate TX Pin Active Level Inversion Disable RX Pin Active Level Inversion Disable Disable **Data Inversion** TX and RX Pins Swapping Disable Enable Overrun Enable DMA on RX Error MSB First Disable

5.4. FREERTOS

mode: Enabled

5.4.1. Config parameters:

Versions:

FreeRTOS version 9.0.0
CMSIS-RTOS version 1.02

Kernel settings:

USE_PREEMPTION Enabled

CPU_CLOCK_HZ SystemCoreClock

TICK_RATE_HZ 1000 7 MAX_PRIORITIES 128 MINIMAL_STACK_SIZE MAX_TASK_NAME_LEN 16 USE_16_BIT_TICKS Disabled Enabled IDLE_SHOULD_YIELD USE_MUTEXES Enabled USE_RECURSIVE_MUTEXES Disabled USE_COUNTING_SEMAPHORES Disabled QUEUE_REGISTRY_SIZE

USE_APPLICATION_TASK_TAG Disabled ENABLE_BACKWARD_COMPATIBILITY Enabled USE_PORT_OPTIMISED_TASK_SELECTION Disabled

USE_TICKLESS_IDLE Disabled
USE_TASK_NOTIFICATIONS Enabled

Memory management settings:

Memory AllocationDynamicTOTAL_HEAP_SIZE3072Memory Management schemeheap_4

Hook function related definitions:

USE_IDLE_HOOK Disabled
USE_TICK_HOOK Disabled
USE_MALLOC_FAILED_HOOK Disabled
USE_DAEMON_TASK_STARTUP_HOOK Disabled
CHECK_FOR_STACK_OVERFLOW Disabled

Run time and task stats gathering related definitions:

GENERATE_RUN_TIME_STATS Disabled
USE_TRACE_FACILITY Disabled
USE_STATS_FORMATTING_FUNCTIONS Disabled

Co-routine related definitions:

USE_CO_ROUTINES Disabled MAX_CO_ROUTINE_PRIORITIES 2

Software timer definitions:

USE_TIMERS Disabled

Interrupt nesting behaviour configuration:

LIBRARY_LOWEST_INTERRUPT_PRIORITY 3
LIBRARY_MAX_SYSCALL_INTERRUPT_PRIORITY 3

5.4.2. Include parameters:

Include definitions:

Enabled vTaskPrioritySet uxTaskPriorityGet Enabled vTaskDelete Enabled Disabled vTaskCleanUpResources vTaskSuspend Enabled Disabled vTaskDelayUntil vTaskDelay Enabled xTaskGetSchedulerState Enabled Enabled xTaskResumeFromISR xQueueGetMutexHolder Disabled xSemaphoreGetMutexHolder Disabled pcTaskGetTaskName Disabled Disabled uxTaskGetStackHighWaterMark

xTaskGetCurrentTaskHandle	Disabled
eTaskGetState	Disabled
xEventGroupSetBitFromISR	Disabled
xTimerPendFunctionCall	Disabled
xTaskAbortDelay	Disabled
xTaskGetHandle	Disabled

* User modified value

6. System Configuration

6.1. GPIO configuration

IP	Pin	Signal	GPIO mode	GPIO pull/up pull down	Max Speed	User Label
USART2	PA2	USART2_TX	Alternate Function Push Pull	*	Low	USART_TX
	PA3	USART2_RX	Alternate Function Push Pull	*	Low	USART_RX
Single Mapped	PC14- OSC32_IN	RCC_OSC32_IN	n/a	n/a	n/a	
Signals	PC15- OSC32_OU T	RCC_OSC32_O UT	n/a	n/a	n/a	
	PF0-OSC_IN	RCC_OSC_IN	n/a	n/a	n/a	
	PF1- OSC_OUT	RCC_OSC_OUT	n/a	n/a	n/a	
	PA13	SYS_SWDIO	n/a	n/a	n/a	TMS
	PA14	SYS_SWCLK	n/a	n/a	n/a	TCK
GPIO	PC13	GPIO_EXTI13	External Interrupt	No pull-up and no pull-down	n/a	B1 [Blue PushButton]
			Mode with Falling edge trigger detection			
	PA5	GPIO_Output	Output Push Pull	No pull-up and no pull-down	Low	LD2 [Green Led]

6.2. DMA configuration

nothing configured in DMA service

6.3. NVIC configuration

Interrupt Table	Enable	Preenmption Priority	SubPriority
Non maskable interrupt	true 0 0		
Hard fault interrupt	true	0	0
System service call via SWI instruction	true	0	0
Pendable request for system service	true 3 0		
System tick timer	true 3 0		0
PVD and VDDIO2 supply comparator interrupts through EXTI lines 16 and 31	unused		
Flash global interrupt	unused		
RCC and CRS global interrupts	unused		
EXTI line 4 to 15 interrupts	unused		
USART2 global interrupt / USART2 wake-up interrupt through EXTI line 26	unused		

^{*} User modified value

7. Power Consumption Calculator report

7.1. Microcontroller Selection

Series	STM32F0
Line	STM32F0x2
мси	STM32F072RBTx
Datasheet	025004 Rev4

7.2. Parameter Selection

Temperature	25
Vdd	3.6

8. Software Project

8.1. Project Settings

Name	Value
Project Name	UART-Debug-Test
Project Folder	D:\Projects\STM32\STM32F072-Nucleo-Debug-Uart-Setup\UART-Debug-Test
Toolchain / IDE	Makefile
Firmware Package Name and Version	STM32Cube FW_F0 V1.8.0

8.2. Code Generation Settings

Name	Value
STM32Cube Firmware Library Package	Copy all used libraries into the project folder
Generate peripheral initialization as a pair of '.c/.h' files	No
Backup previously generated files when re-generating	No
Delete previously generated files when not re-generated	Yes
Set all free pins as analog (to optimize the power	No
consumption)	