Cleaning the cellar

Cloth	Blue
PPE	• Safety gloves • Rubber apron • Rubber gloves • Goggles
Chemicals	• Sanitiser (Powder) • Spray sanitiser
Reference	• Safety policies • COSHH Manual • Risk Assessment Manual • Cask Widge Cleaning Instructions Poster (WIS) • SOP - C0001 - Handwash procedures • SOP - C0002 - Manual handling in the cellar • SOP - OF0021 - Use of ladders (working at heights) • SOP - OF0030 - Recycling procedures • SOP - OF0038 - Use of jet washers and hoses • SOP - OF0040 - Electrical safety
Equipment	• Hazard Warning Sign - 'Wet Floor' or 'Cleaning in progress' • Hosepipe/Jetwash • Stiff brush • Small bottle brush • Dust pan and brush • Mop and bucket (where no drain is available) • Bin liners

Step 1		Floor : Daily • Ensure all casks are hard pegged prior to commencing cleaning. • Clear the area to be cleaned - obtain assistance if moving barrels. • Sweep and remove all general debris - including under stillage, racking and fixed equipment. • Mix the sanitiser (powder) with hot water in line with the correct dosage. • Pour the sanitiser solution evenly over all floor area. • Allow 5 minutes contact time. • Brush the chemical over the floor to remove dirt. • Hose the floor with fresh water to remove all chemical residue. • Brush any standing water into the drain to prevent pooling. • A mop and bucket must be used where no drainage is available. • Drain and/or sump pump must be cleaned and cleared of any debris. • Place a hazard warning sign 'Wet Floor' or 'Cleaning in progress' in the area until fully dried.
Step 2	 	Walls/Doors/Ceilings : As required • For smooth surfaces e.g. stainless steel, laminate - spray walls with sanitiser and wipe clean using a blue cloth. • For rough surfaces e.g. brickwork - spray walls with sanitiser and clean using a brush. • Ladders must be used for cleaning surfaces which are beyond normal reach. Refer to SOP - OF0021 - Use of ladders (working at heights).
Step 3		Sink : Daily • Using sanitiser and a blue cloth, clean the sink inside and out, the overflow area and taps. • Never use the sink to store any items. • Ensure handwash location is set up correctly. Refer to SOP - C0001 - Handwash procedures.

Private and confidential – for internal use only

Sheet 1 of 2 – continued overleaf…

Cleaning the cellar

Step 4	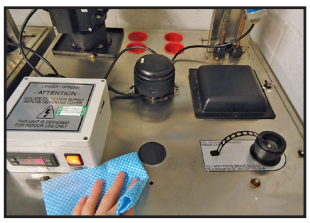 	Cellar equipment : Weekly Using a blue cloth and sanitiser, wipe the external areas of all the equipment including - (list not exhaustive) • Glycol cooler unit • Remote cooler • Cellar cooling unit • Post mix dispense unit • Compressor • Automatic line cleaning machine • Ensure all dust and debris is removed from the top and underneath of the units. • Ensure no items are stored on top of any appliance. • Clean the filters on the units (if applicable), using a small brush to remove all dust build up. • If a glycol overflow container is in place, empty weekly as a minimum. Glycol can be disposed of in the cellar sink. • Cellar fans must be switched off prior to cleaning.
Step 5		Stillage/Auto tilts : Weekly • Clean all areas thoroughly using sanitiser and a blue cloth.
Step 6	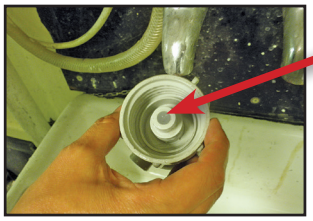 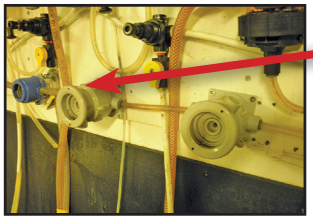 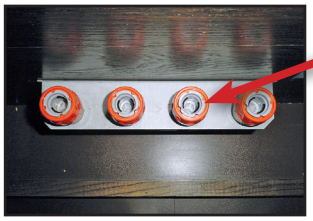	Line cleaning equipment : Weekly. • Empty keg simulators and satellite boards - spray with sanitiser and scrub with a small brush paying particular attention to the internal ridges. Rinse under hot water and allow to air dry. • Line cleaning sockets (on ring main) - spray with sanitiser and wipe using a blue cloth. • Gullies - spray with sanitiser, wipe with a blue cloth, rinse with fresh water. Bar • Wipe all external areas of the line cleaning pipes using a clean blue cloth and sanitiser. Allow to air dry. • Under bar waste sockets - spray with sanitiser and wipe using a blue cloth.

Private and confidential – for internal use only

Sheet 1 of 2 – continued on sheet 2…

Cleaning the cellar

Step 7		Beer dispense equipment : Weekly : • Keg connectors - using hot water and sanitiser clean with a small brush paying particular attention to the rubber 'O' ring and the inner ridge. • Beer line pipework - clean using a blue cloth and sanitiser. Between use : • Cask taps - dismantle one tap at a time and scrub each component with a bottle brush in hot water. Reassemble the tap and allow to air dry on the cellar tidy. Repeat the process for each tap. • Race cask ventilator and hop filters - rinse in hot water and allow to air dry. • Widge system - refer to Cask Widge Cleaning Instructions Poster.
Step 8	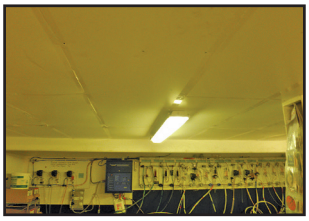	Lighting : • Check all lights are working. • Remove the strip light diffuser when dust and debris is evident. Clean the diffuser using a blue cloth and warm water. Refer to SOP - OF0021 - Use of ladders (working at heights). • Allow to air dry prior to refitting.
Step 9		Refuse bin : • A bin liner must be used at all times. • Empty the bin regularly - do not allow to overflow. • Wash the inside and outside of the bin with hot soapy water on a weekly basis. • Allow the bin to air dry prior to placing in a new bin liner. • Never put any glass into the refuse bin. Dispose of glass in the designated glass bin. • Plastics and cardboard must be recycled - refer to SOP - OF0030 - Recycling procedures.
Step 10	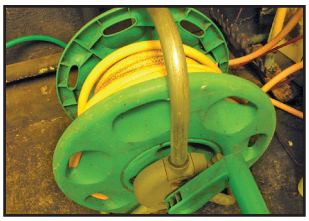	Hosepipe/Jetwash : • Turn off water supply when not in use. • Return hosepipe to storage area. • Do not leave any trailing hose. • Refer to SOP - OF0038 - Use of jet washers and hoses.
Step 11		• Do not climb onto barrels to complete cleaning tasks. • Do not stack barrels or boxes around coolers. • When using a hose pipe/jetwash, never spray water onto electrical equipment, alarm sensors or light fittings. Refer to SOP - OF0040 - Electrical safety. • Do not soak any equipment in water, always drain and allow to air dry. • Do not use any lubricants on cask taps. • All beer spillage must be cleaned up immediately. • All stains and mould growth must be removed. • Beer is classified as a food product and the cellar must be treated as a food preparation area. • If equipment has been switched off for cleaning, ensure this is turned back on.

Private and confidential – for internal use only