SECURITY AUDIT REPORT

Configuration: fortinet_insecure.conf

Audit ID: AUD-998777

Configuration ID: CFG-994545

Vendor: Fortinet

Status: COMPLETED

Generated: 2026-09-09 04:47 UTC

Status: COMPLETED

Executive Summary

This report presents the results of an automated security audit conducted on the configuration file **fortinet_insecure.conf** from vendor **Fortinet**. The audit evaluated 10 security controls across multiple compliance domains.

Metric	Value
Compliance Score	75.0%
Risk Level	HIGH
Risk Score	72.75
Controls Passed	6
Controls Failed	2
Critical Issues	0
High Severity Issues	2
Medium Severity Issues	0
Low Severity Issues	0

Compliance & Risk Analysis

Overall Risk Level: HIGH

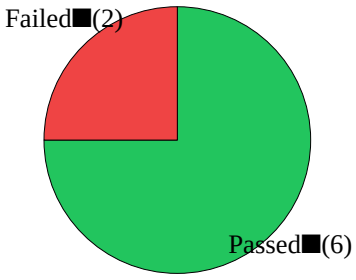

Detailed Findings

[HIGH] Telnet Must Be Disabled

Rule ID: NET-001

Description: Telnet is inherently insecure and must not be enabled. Use SSH version 2 for encrypted remote access.

Expected: False
Actual: True

Evidence:

```
set allowaccess ping https ssh telnet
```

Location: fortinet_insecure.conf, Line 19

Recommended Fix:

```
# Disable Telnet from management access config system interface edit "wan1" set allowaccess
ping https ssh next end
```

Risk Score: 72.75

[HIGH] HTTP Management Must Be Disabled

Rule ID: NET-004

Description: Unencrypted HTTP exposes management credentials and configuration. Use 'no ip http server' and enable HTTPS instead.

Expected: False
Actual: True

Evidence:

```
set allowaccess ping https ssh telnet http
```

Location: fortinet_insecure.conf, Line 26

Recommended Fix:

```
# HTTP is controlled per-interface config system interface edit "wan1" set allowaccess ping
https ssh ! Remove 'http' from allowaccess next end # Disable HTTP port globally if needed
config system settings unset gui-http-port end
```

Risk Score: 72.75