


Si se hace esto, se vuelve a hacer el merge de los RunType que hay en el RunTypeToBeMerged_v01 cp /eos/home-v/valcayne/nTOFDataProcessing/2026_Sm/2DHistos/v02GainCorrected/del.txt /eos/home-v/valcayne/nTOFDataProcessing/2026_Sm/2DHistos/v02GainCorrected/del1.txt


[21/04/2026,Adrian] Baseline oscillation in Det 1

Baseline oscillation increased in Det C6D6 1, starting at run 124724. Seems to be related with the connection of LaBr3 detectors to the DAQ of EAR1 (Pb measurement in NEL).

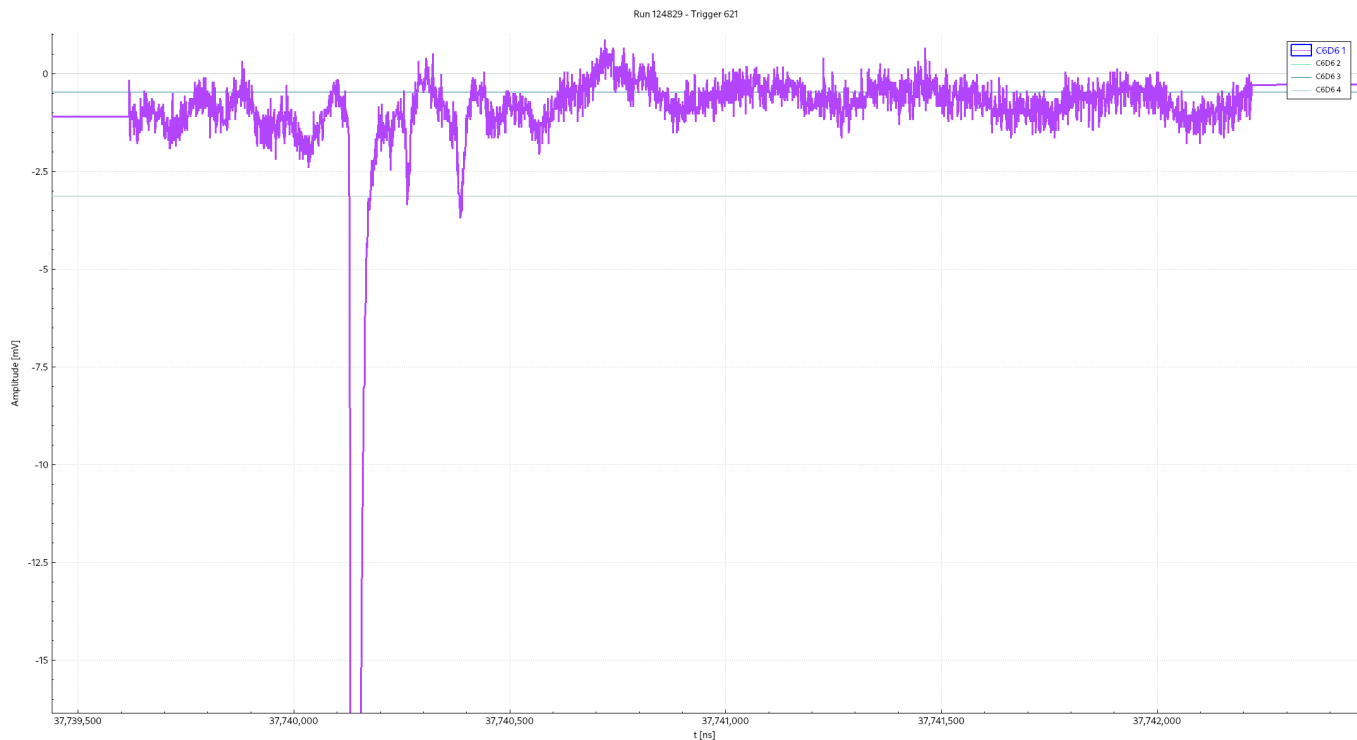


Some observations:

- C6D6 1 already had some oscillations on the baseline but now it is clearly worse (stronger).
- SignalAnalyzer inspected: the oscillations create fake signals fitted by the routine with maximum amplitudes about 150 ADC channels (~65 keV):

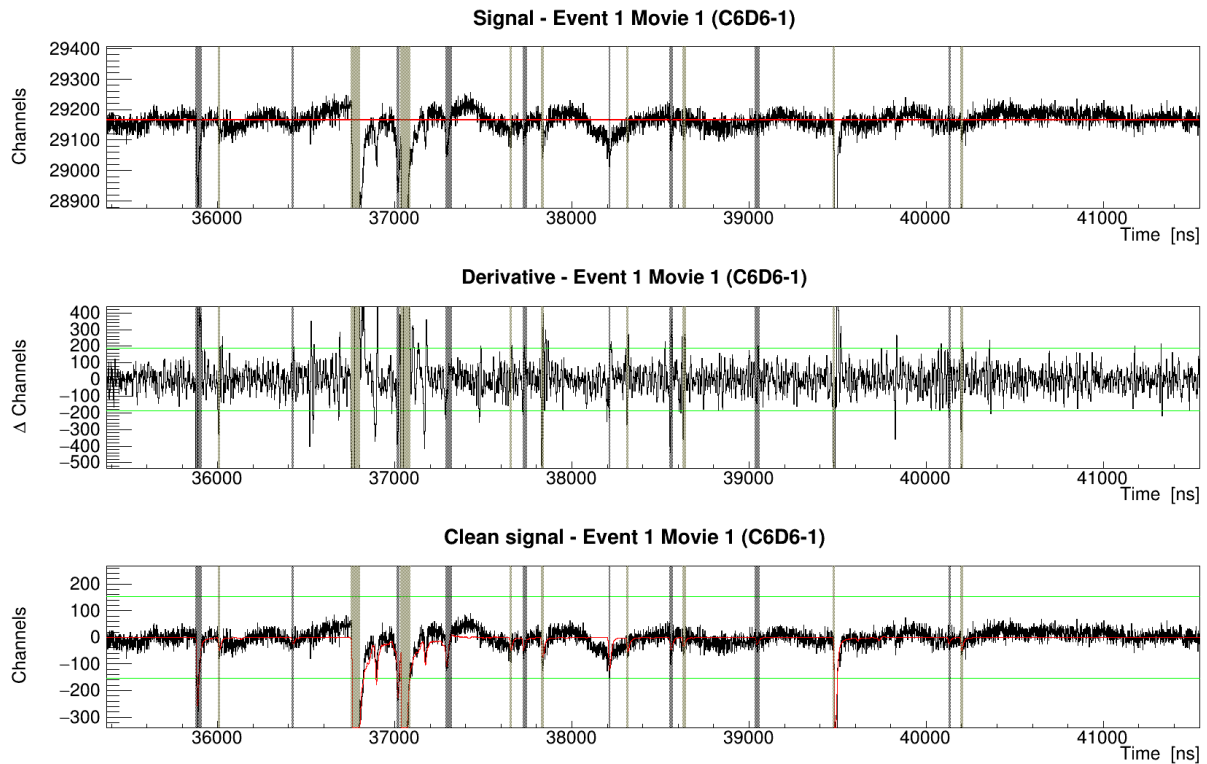

- The second rebound seem to be affected by this change, and sometimes the rebound is detected as a fake signal using the previous average pulse shapes (confirmed by Victor by extracting a new average pulse shape).
- The other three detectors seem to be unaffected.
- The increased oscillation does not seem to get worse since it began in run 124724.
- Inspecting the Edep, comparing before (Cs_8, Cs_11) and after (Cs_12) the connection of LaBr3 to DAQ, there is no visible effect on the shape of the Cs-137 spectrum:

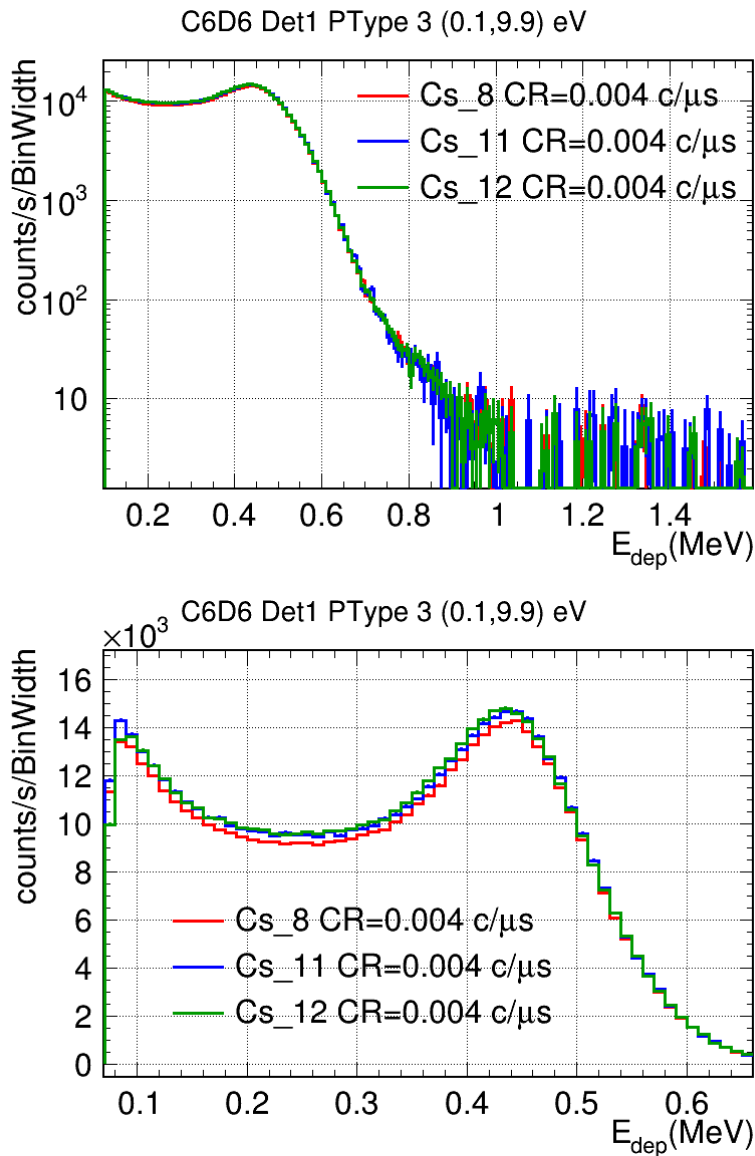

- **Conclusion:** the increased oscillations of baseline seem small enough to have a significant impact on the data analysis, and should not imply any problem.
- **Action:** we will continue like this since the oscillation appears to be stable during the runs.

[21/04/2026,Adrian] Cs_9 issue! 🔍

- There is a bump in the Edep spectrum of Cs_9 measurement at around 1.7 MeV, visible in all detectors.
- It seems that an Y-88 source was also in the experimental area and affected the measurement.
- **Action:** I remove this run for the Cs run type in the RunList.

