


1a8384c3f6

lidar tier · 5 rooms · 48.04 m² [44.88, 51.20] · 31.1 s

every value carries a nominal 90% interval · * means the sensor never saw it

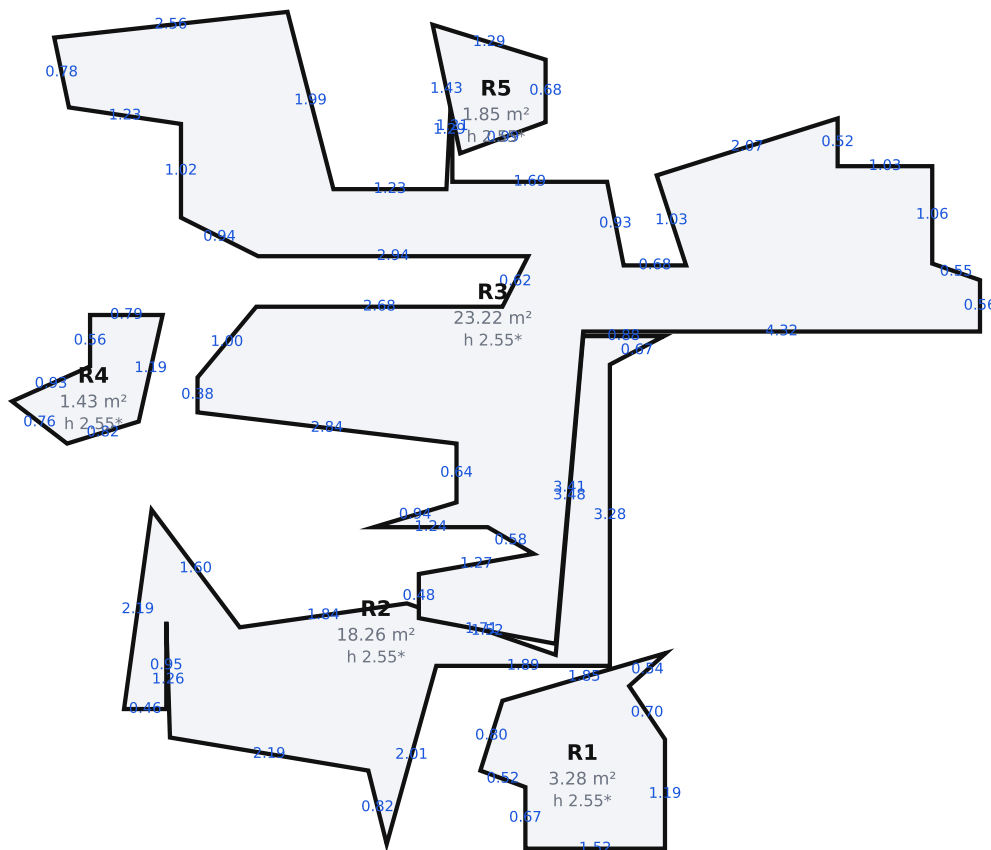

Rooms

Room	Area m²	Ceiling m	Walls	Openings
R1	3.28 (3.07-3.50)	2.55 *	8	2
R2	18.26 (17.06-19.47)	2.55 *	15	4
R3	23.22 (21.69-24.74)	2.55 *	34	3
R4	1.43 (1.34-1.52)	2.55 *	6	1
R5	1.85 (1.73-1.97)	2.55 *	4	2

Damage and scope

no damage regions found
class would be shape-derived; naming a defect needs appearance

What to be careful of (4)

[warning] tracking relocated 2 time(s) (largest 31 cm); geometry either side of a jump may not line up
[warning] mirrors and glass are NOT detected. Two geometric tests were built and neither separates a reflection from ordinary geometry; 9.5% of points sit outside the floor envelope here, which is normal for ceilings and occluded floor. Geometry near any mirror in this capture is wrong and unflagged. The capture protocol asks the operator to approach mirrors at an angle
[warning] the ceiling was never seen; ceiling heights are population typicals with wide intervals, flagged
observed=false
[info] rooms are split at doorway-width necks and under-split rather than over-split; a merged pair still reports a correct combined floor area, an invented room does not