AMERICAN SOCIETY FOR TESTING AND MATERIALS 100 Barr Harbor Dr., West Conshohocken, PA 19428 Reprinted from the Annual Book of ASTM Standards. Copyright ASTM

# Standard Test Method for Coating Flexibility of Prepainted Sheet<sup>1</sup>

This standard is issued under the fixed designation D 4145; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon  $(\epsilon)$  indicates an editorial change since the last revision or reapproval.

 $\epsilon^1$  Note—Keywords and the unit of measurement statement were added editorially in January 1996.

#### 1. Scope

- 1.1 This test method describes a procedure for determining the flexibility and adhesion of organic coatings (paints) on metallic substrates that are deformed by bending when the sheet is fabricated into building panels or other products.
- 1.2 The metal substrate must be capable of passing this test without fracturing and with no excessive grain development.
- 1.3 The values stated in inch-pound units are to be regarded as the standard. The values given in parentheses are for information only.
- 1.4 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.

### 2. Terminology


- 2.1 Definitions of Terms Specific to This Standard:
- 2.1.1 *T-bend*—a description of the severity of a bend in terms of the thickness (T) of the sheet to which the coating has been applied; *as used in this test method*, the T-bend rating is the minimum number of thicknesses of metal around which the coated sheet is bent (Fig. 1), or if bent around a die, the number of thicknesses of metal equivalent to the diameter of the die to achieve no fracture or removal of the coating.

# 3. Summary of Test Method


3.1 Prepainted panels are bent  $180^{\circ}$  around progressively more thicknesses of metal or larger diameter dies, the end point being when failures no longer occur. The panels are examined at low magnification (5 to  $10\times$ ) after each bend for fracture of the coating (cracking) and, for loss of adhesion pickoff, by means of a tape pull-off test.

#### 4. Significance and Use

4.1 Organic coatings on precoated sheet are subjected to stresses when fabricated into products by roll forming, brake bending, or other deformation processes. These stresses can exceed the flexibility or adhesive strength of the coating,



Current edition approved March 25, 1983. Published July 1983.

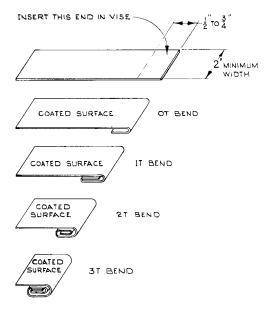

Note 1—The above bends are expanded for clarity. They are actually flat against themselves in the test.

FIG. 1 T-Bend Test in Which the Coated Specimen is Bent Around Itself

resulting in fracture of the coating, exposing the substrate, or loss of adhesion to the substrate. This test is a means of evaluating the ability of a coating system to withstand the stresses of fabrication.

4.2 The bend direction, whether the axis of bend is across or along the rolling diameter of the metal, and the temperature of the specimen when it is bent affect the results of this test and should be agreed upon between the supplier and the user.<sup>2</sup>

### 5. Apparatus

- 5.1 A means of holding one end of the specimen rigidly while making the bend is needed. A bench vise with smooth jaws or with smooth inserts, preferably of a soft metal to avoid damage to the coating, has been found to be satisfactory.
- 5.2 If the metal is not bent around itself as in Fig. 1, a series of bending dies with smoothly rounded ends may be used as guides around which the specimen is bent (Fig. 2).

<sup>&</sup>lt;sup>2</sup> Scotch Brand #610 tape manufactured by 3M Co., St. Paul, MN or equivalent, or as agreed upon between the supplier and the user.

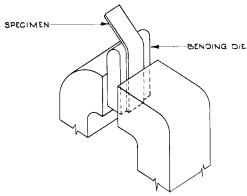


FIG. 2 T-Bend Test Using a Die Around Which the Specimen is Bent


5.3 Magnifier, capable of 5 to  $10\times$  magnification for examining the specimen for coating fracture and pickoff after testing. A stereomicroscope has been found useful for this purpose.

#### 6. Procedure

- 6.1 Bending the Coated Specimen Around Itself:
- 6.1.1 The coated specimen shall be at least 2 in. (50 mm) across the bend direction, by a length sufficient to make the required number of bends. A 2 by 6-in. (50 by 150-mm) size is convenient. The specimen shall be at  $\pm 2^{\circ}$ F of the temperature agreed on.

Note 1—A triangle-shaped specimen (Fig. 3) has been found convenient for making T-bend tests. This shape leaves a portion of each bend exposed for later examination and for a permanent record.

6.1.2 Secure about 0.5 to 0.75 in. (13 to 20 mm) of one end of the specimen in a vise or holding jig as shown in Fig. 1. Bend the free end of the specimen  $90^{\circ}$  in a smooth and uniform manner so that the coating is on the outside of the specimen after it is bent.

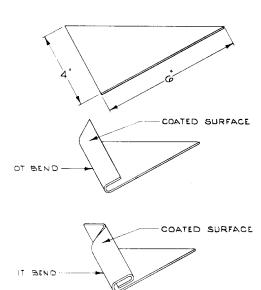

Note 1—The above bends are expanded for clarity. They are actually flat against themselves in the test.

FIG. 3 Triangular Specimen for T-Bend Test

- 6.1.3 Continue to bend the specimen until the bent end can be inserted in the jaws of the vise. Tighten the vise to complete the  $180^{\circ}$  bend, which is called an OT bend. Take care to tighten the vise sufficiently so that the apex of the bend is as flat as can be reasonably achieved.
- 6.1.4 Examine the bend using a hand lens or low-power microscope for cracks in the coating.
- 6.1.5 Apply pressure-sensitive tape<sup>2</sup> along the bend. Rub the tape flat; then, holding the specimen firmly, remove the tape with a rapid movement at an angle of 180° to the bend surface. Examine the tape for coating removed from the surface of the specimen (that is, pickoff). In the case of a coated steel specimen (for example, galvanized steel), examine the tape to determine whether pickoff is between the organic coating and the metallic surface or between the metallic coating and the base steel.
- 6.1.6 Secure the bent end of the specimen in the vise and bend the free end 90°. Continue to bend the free end around the first (OT) bend to complete a 180° bend, and tighten in the vise as before. This makes a 1T bend (Fig. 1). Examine under magnification and by taping for cracking and pickoff, as with the OT bend.
- 6.1.7 Repeat this procedure, making a 2T, 3T, etc., bends until no cracking or pickoff occurs.
  - 6.2 Bending the Coated Specimen Around a Die:
- 6.2.1 The coated specimen shall be at least 2 in. (50 mm) across the bend direction.
- 6.2.2 Secure the specimen and bending die in a vise or holding jig (Fig. 2). Bend the specimen  $180^{\circ}$  around the die in a smooth and uniform manner.
- 6.2.3 Examine the bend for cracking as in 6.1.4 and for loss of adhesion as in 6.1.5.
- 6.2.4 Express the T-bend to no cracking or no pickoff as the number of thickness around which the metal is being bent equal to the thickness of the die.

## 7. Report

- 7.1 Report the following information:
- 7.1.1 Identification of the material, such as coil number and location within the coil if the sample was coated on a coil line,
- 7.1.2 The coating system, coating thickness, and application and cure conditions,
  - 7.1.3 The temperature at which the specimen is bent,
- 7.1.4 The bend direction—whether across or along the rolling direction of the sheet,
  - 7.1.5 The minimum T-bend to no paint fracture, and
  - 7.1.6 The minimum T-bend to no pickoff.

## 8. Precision <sup>3</sup>

8.1 On the basis of an interlaboratory study of this test method, in which two operators in each of five laboratories tested panels coated with paints of different flexibility and adhesion, the standard deviation was found to be:

<sup>&</sup>lt;sup>3</sup> Supporting data are available from ASTM Headquarters. Request RR:D01-1034.



	Standard	Deviation	
T-bend to no fracture	Aluminum 0.55	Galvanized Steel 1.33	T-bend to no fracture T-bend to no pickoff
T-bend to no pickoff	0.76	2.09	Q 2 2 Panraduaihility

- 8.2 Based on these standard deviations, the following criteria should be used to judge the acceptability of results at the 95% confidence level:
- 8.2.1 *Repeatability*—Measurements obtained by two operators in a single laboratory should be considered suspect if they differ by more than:

		Galvanized
	Aluminum	Steel
T-bend to no fracture	0.4	1.8
T-bend to no pickoff	0.9	3.3

8.2.2 *Reproducibility*—Two measurements obtained in different laboratories, each the mean of measurements made by two operators within a laboratory, should be considered suspect if they differ by more than:

		Galvanized
	Aluminum	Steel
T-bend to no fracture	2.5	10.1
T-bend to no pickoff	1.8	10.6

### 9. Keywords

9.1 coating flexibility; prepainted sheet; T-bend flexibility

The American Society for Testing and Materials takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, 100 Barr Harbor Drive, West Conshohocken, PA 19428.