

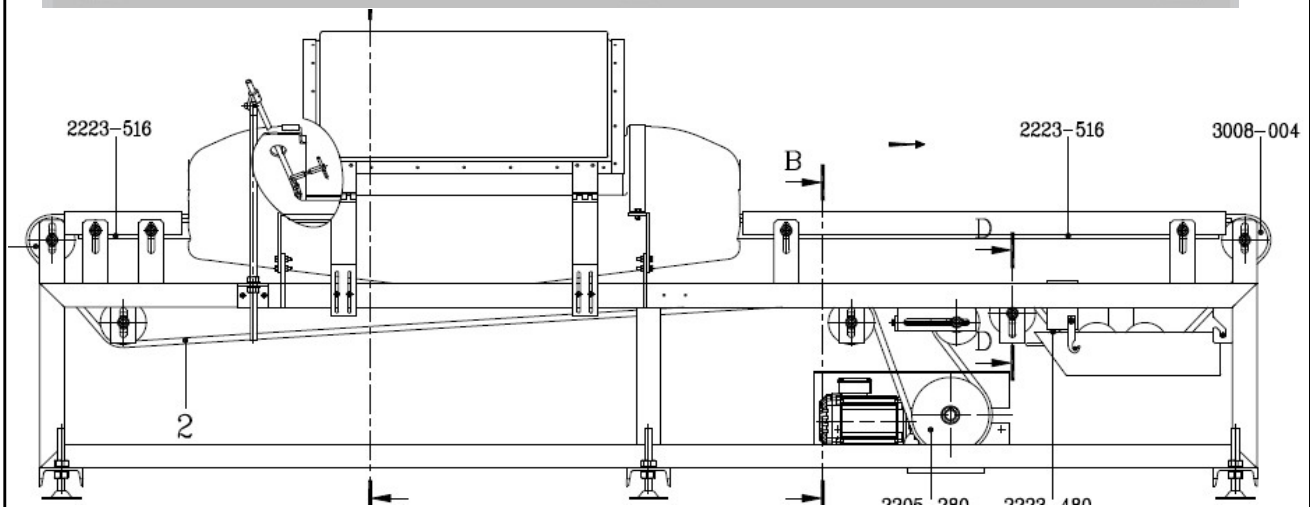
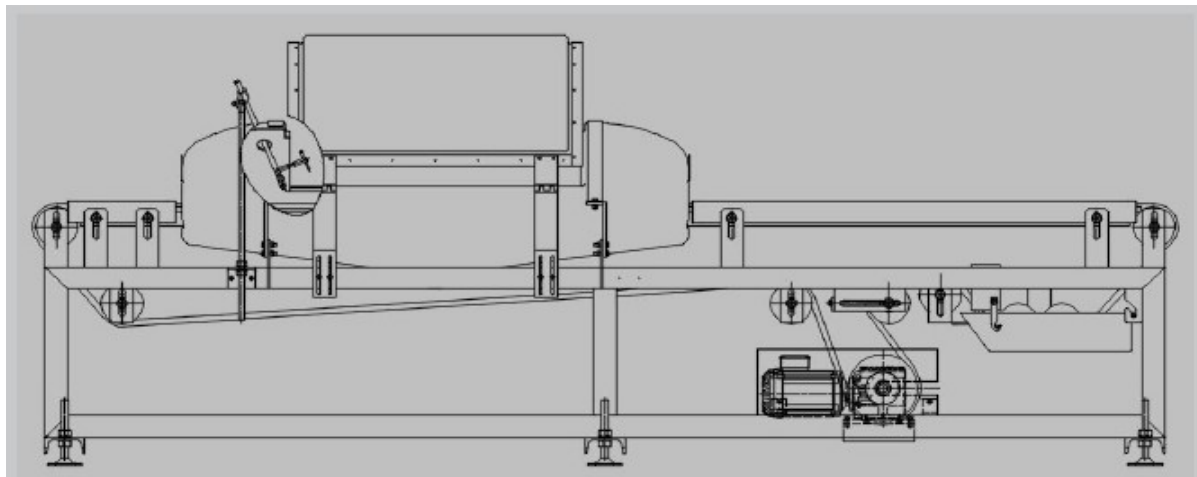
Acrylic Paint Applicator for water based paint on Dry Tiles-Relationship SOP

MACHINE TYPE: CO-101 SERIAL NUMBER :M.02217

FP McCANN (Cadeby)

ORDER : C22004

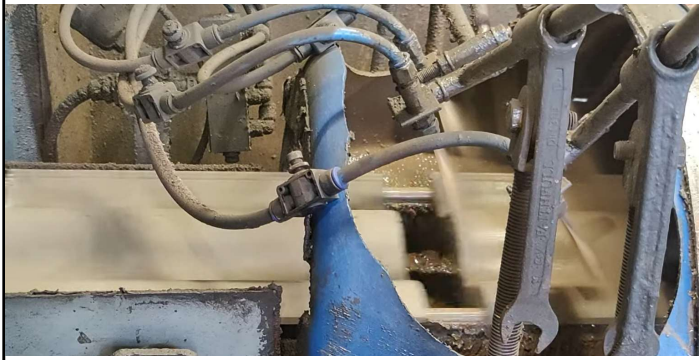
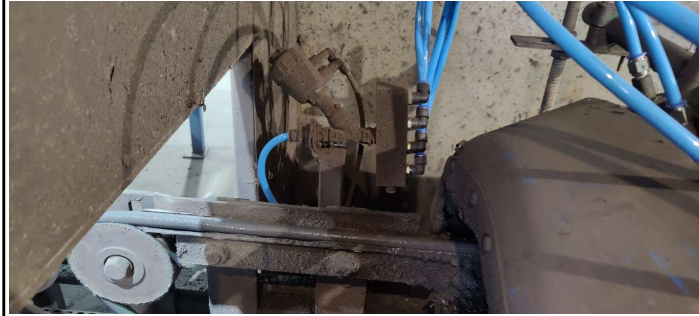
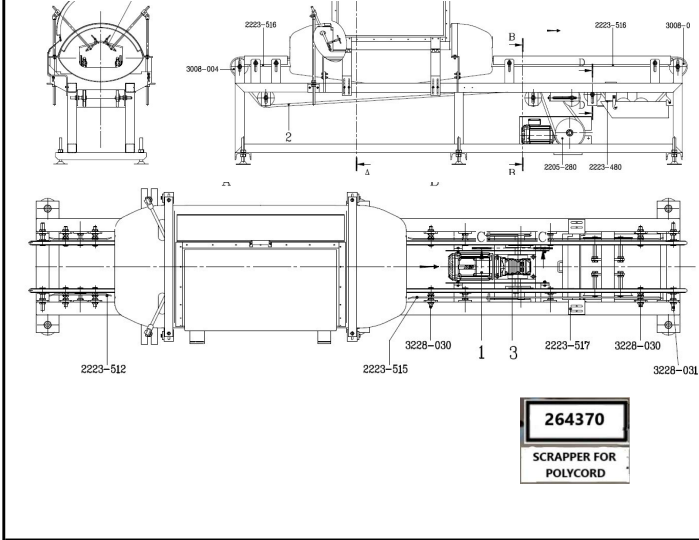
YEAR OF PRODUCTION 2023



SOP M.02217.00 Contents List Acrylic Paint Applicator for water based paint on Dry Tiles

SOP M.02217.01 Acrylic Paint Applicator with conveyor L=3850 mm

SOP M.02217.01A Polycord belt, Guide for polycord 20, Pulleys 250 / 148 / 100

VORTEX HYDRA	STANDARD OPERATING PROCEDURE	Code: SOP M.02217.01 Date: 15/12/25 Page: 2 de 3
Acrylic Paint Applicator for water based paint on Dry Tiles		
MACHINE TYPE: CO-101 SERIAL NUMBER :M.02217		
Transport line of dry tiles Acrylic Paint Applicator L=3850		
	General Description and Function *This conveyor is the primary system for tile accumulation and is subject to the highest level of contamination during operation. *Its function is to transport and accumulate tiles continuously between processes.	
	Critical Points and Risk Management Residue Accumulation: *Buildup of paint residue on guides and the polycord itself from the painting booth process. *Accumulation of dirt and particulate matter carried by the tiles. *The polycord scraper must be maintained in optimal condition to ensure maximum removal of debris from the polycord surface. *Its effectiveness is crucial for preventing premature wear and contamination transfer.	
	SHEET PROCESS Process documentation must include and keep the following reference values updated: Scraper Effectiveness: *Degree of polycord cleanliness after passing the scraper. Water Tray Status: * Fill level and functionality for polycord cleaning. Polycord Tension: *Optimal tension to prevent slippage and uneven wear. Guide Alignment: *Correct position to prevent polycord tracking issues.	
 264370 SCRAPPER FOR POLYCORD	SUPERVISION LEVEL DAILY 17055 Polycord belt (18,4 m) 274324 Guide for polycord 20 (1 u) 274322 Guide for polycord 20 (1 u) 274323 Lateral guide (2 units) 274325 Lateral guide (2 units) 274321 Scraper (1 u) 264370 Scraper for polycord (2 units) Visual inspection and cleaning. Scraper effectiveness is critical. WEEKLY 19498 Bearing CUS 6304 2RSR (Pulleys 148)(16 units) 3422 Driving pulley 250 for polycord 20 (2 units) 8233 Chamfered snub pulley 148 for polycord 20 (4 units) 8234 Snub pulley 148 for polycord 20 (12 units) Functional check, cleaning, and wear inspection. MONTHLY 289649 Gearmotor MOTR-SA57 (1 u) Comprehensive inspection and verification. CLEANING WEEKLY Cleaning Procedure: *Clean all surfaces using a high-pressure water pump and scrapers. Special Attention: *Pay special attention to the Polycord Cleaning Water Tray, ensuring it is empty and functional. *Remove accumulated paint residue and general debris from guides, structure, and accessible components.	

VORTEX HYDRA		STANDARD OPERATING PROCEDURE		Code: SOP M.02217.01A Date: 15/12/25 Page: 3 de 3						
Acrylic Paint Applicator for water based paint on Dry Tiles										
MACHINE TYPE: CO-101 SERIAL NUMBER :M.02217										
Polycord belt, Guide for polycord 20, Pulleys 250 / 148 / 100										
<table><tr><td>17055 POLYCORD BELT POLY-20</td></tr><tr><td>3422 DRIVING PULLEY 250 / POLYCORD 20</td></tr><tr><td>274324 GUIDE FOR POLYCORD 20</td></tr><tr><td>274322 GUIDE FOR POLYCORD 20</td></tr><tr><td>8233 CHAMFERED PULLEY 148 / POLYCORD 20</td></tr><tr><td>8234 SNUB PULLEY 148 / POLYCORD 20</td></tr></table>					17055 POLYCORD BELT POLY-20	3422 DRIVING PULLEY 250 / POLYCORD 20	274324 GUIDE FOR POLYCORD 20	274322 GUIDE FOR POLYCORD 20	8233 CHAMFERED PULLEY 148 / POLYCORD 20	8234 SNUB PULLEY 148 / POLYCORD 20
17055 POLYCORD BELT POLY-20										
3422 DRIVING PULLEY 250 / POLYCORD 20										
274324 GUIDE FOR POLYCORD 20										
274322 GUIDE FOR POLYCORD 20										
8233 CHAMFERED PULLEY 148 / POLYCORD 20										
8234 SNUB PULLEY 148 / POLYCORD 20										
1. For the POLYCORD (e.g., Ø 20 mm) The polycord is worn and must be changed when it exhibits one or more of the following defects: Diameter Reduction: *The diameter measured at any point is ≤ 18 mm (a loss of 10% or more of the nominal diameter). Cut or Laceration Damage: * Presence of deep cuts that expose the internal core or compromise structural integrity. Irregular Wear (Erosion): *Surface with deep grooves, localized flattening, or an oval shape that compromises uniform contact with guides and pulleys. Loss of Elastic Properties: *The cord is stiff, shows oxidation cracks (crazing), or has lost its nominal tension and elasticity. Verdict: "The polycord exhibits critical wear. It must be replaced."			Wear Criterion (When to Change?) 1. Diameter ≤ 18 mm. 2. Deep cuts or lacerations. 3. Oval shape or deep grooves. 4. Stiffness and cracking. Verification: Caliper / Visual / Tactile							
2. For the GUIDES (Round or Angular) The guide is worn and must be changed when one or more of the following defects are observed: Pronounced Groove or Wear Track: *Presence of a visible and palpable groove (channel) in the polycord's contact and running area. *It is considered critical if the groove depth exceeds 1 mm. Sharp Edges or Burrs: *The sliding surface has developed sharp edges or irregularities (burrs) that could damage the polycord. *Deformation: *The guide is bent, twisted, or has lost its original geometry (straight or with the designed curvature) Excessive Play: *The polycord has abnormal lateral movement or "play" within the guide, indicating wear that has unacceptably increased the clearance. Verdict: "The guide exhibits critical wear. It must be replaced."			Wear Criterion (When to Change?) 1. Groove depth > 1 mm. 2. Presence of sharp edges or 3. Visible deformation. 4. Excessive polycord play. Verification: Visual / Tactile / Feeler gauge							
										