

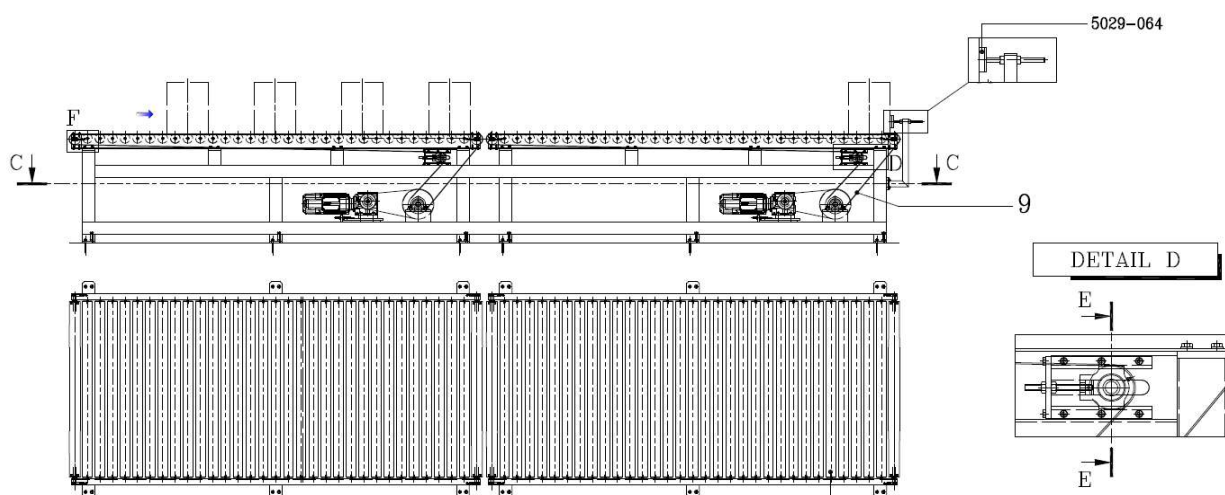
Automatic Strapping Line with 1 vertical y 1 horizontal Endra Strapping Units-Relation SOPs

MACHINE TYPE: PK-111 SERIAL NUMBER :M.02244

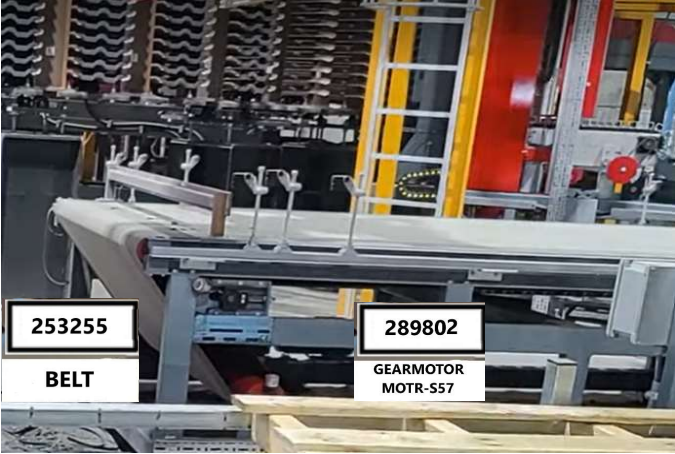
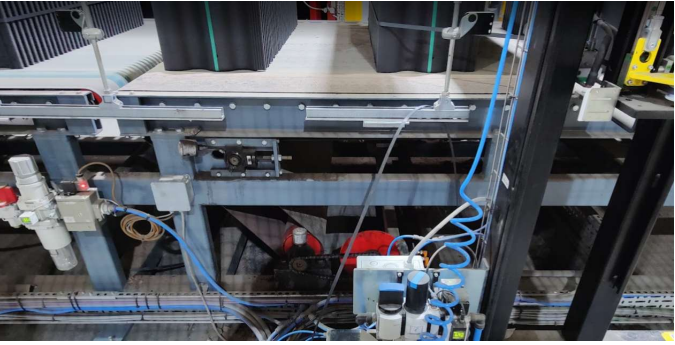
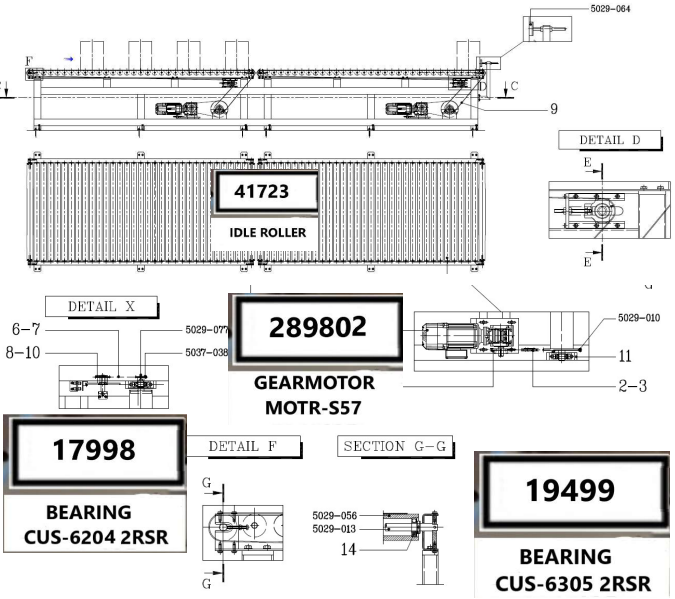
FP McCANN (Cadeby)

ORDER : C22004

YEAR OF PRODUCTION 2023



SOP M.02244.00 Automatic Strapping Line with 1 vertical y 1 horizontal Endra Strapping Units-Relation SOPs
SOP M.02244.01 Belt conveyors Idler Roller Bed

VORTEX HYDRA	STANDARD OPERATING PROCEDURE	Code: SOP M.02244.01 15/12/2025 Page: 2 de 2
Automatic Staping Line with 1 vertical y 1 horizontal Endra Strapping Units.		
MACHINE TYPE: PK-111 SERIAL NUMBER :M.02244		
Belt conveyors Idler Roller Bed		
	General Description and Function *This set consists of 2 belt conveyors with idler roller beds *The first conveyor receives the bundle from the packaging robot and positions it in the first zone for vertical strapping. *As it advances, horizontal strapping is performed, and it waits in a third position for transfer. *The second conveyor moves the bundle to the final pickup position by the palletizing robot, which places it in the 3 or 6 bundle pallet forming area. Critical Points and Risk Management Belt Tension and Tracking: *Correct tension is the main point for belt tracking. *Misalignment would place the bundle in an incorrect for the palletizing robot and could damage the belt edges. Bundle Alignment at Stop: *At the stop of the second conveyor, a lateral stop align the bundle. If the bundle slides too much before stopping, stopping, abrasions on the belt's support surface can occur. Drive Component Integrity: *Chains, sprockets, and bearings must be kept in good condition for precise and repeatable advancement. Sensor Cleanliness: *Dirt on photocells and reflectors causes false detections and production stoppages.	
	SHEET PROCESS *Must keep updated reference settings for the bundle stop/advance positions and belt speeds as master reference points to ensure process repeatability.	
	SUPERVISION LEVEL	
	DAILY	
	253255 Belt (2 units)	
	Quick visual inspection of the belt in operation to detect edge wear, cuts, or misalignment.	
	WEEKLY	
	41723 Idle roller (62 units) 16829 Chain 3/4 S (2,71m) 16838 Connecting link for chain (2 u) 16826 Chain 1/2S (0,94m) 16837 Connecting link for chain (1 u) 17998 Bearing (2 units) 19499 Bearing CUS 6305 2RSR (8 units) 22879 Support UCP207 22887 Support UCT205 (4 units) 18401 Capacitive proximity sensor (1 u) 252094 Inductive proximity switch (6 units) 252355 Axial reflection photoelectric switch (8 units) 18952 Reflector (8 units)	
	Verification of chain tension and wear, condition of bearings and supports, and cleaning/verification of all optical and proximity sensors.	
	MONTHLY	
	41695 Crown Z=40 x 3/4" (2 units) 285503 Pack support plate (1 u) 47525 Cam disc Ø230 (Z=23x1/2") + 289802 Gearmotor MOTR-S57 (2 units)	
	Inspection of sprocket and cam wear, gearmotor verification, and general lubrication.	
	Lubrication:	
	*Apply grease to the bearings of all wheels according to manufacturer specifications. *Check levels in automatic systems.	
	Area Inspection: *Look for oil contamination on the maintenance platform in the gearbox area	
	CLEANING	
	*Belt cleaning frequency will be determined by the level of surface contamination.	
	For adhered residue (resin/paint):	
	*Use wooden or plastic scrapers or non-metallic brushes.	
	Loose Residue/Dust:	
	*Use a low-pressure air gun (< 3 bar) followed by dry cloths.	