



FLOW INVERTER-Relationship SOP

MACHINE TYPE:TM-106 SERIAL NUMBER :M.02211


FP McCANN (Cadeby)

ORDER : C22004

YEAR OF PRODUCTION 2023

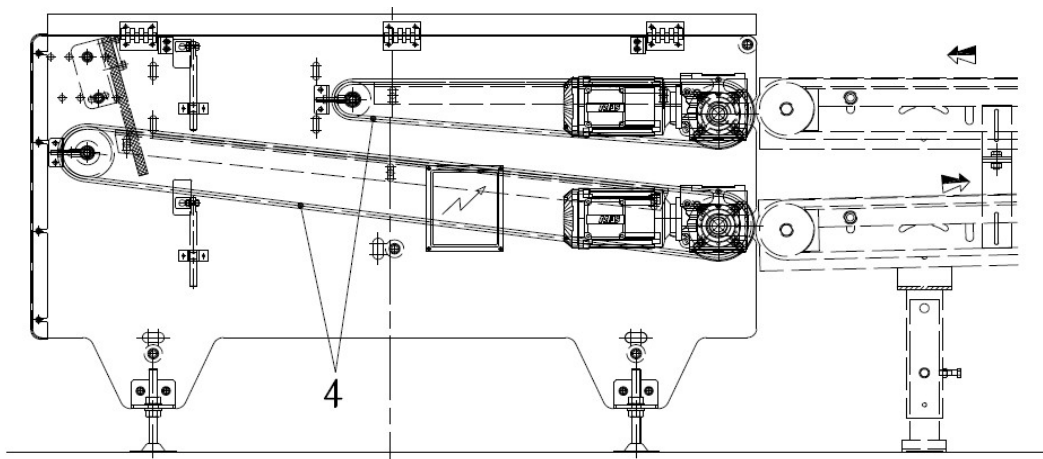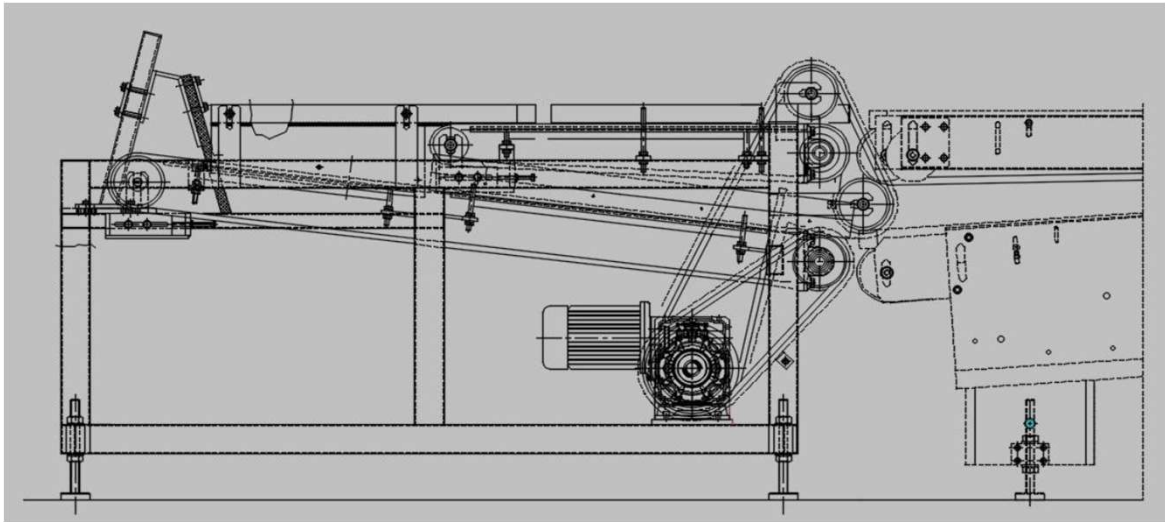

SOP M.02211.00 Contents List Flow Inverter
SOP M.02211.01 Flow Inverter

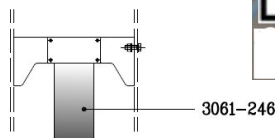FLOW INVERTER**MACHINE TYPE: TM-104 SERIAL NUMBER :M.02211****Flow Inverter****RUBBER DETAIL****51923****SHOCK
ABSORBER****General Description and Function**

*This mould direction-change system subjects specific components to high stress and wear.

The most critical components are:

Polycords:

*Experience constant friction and tension during direction changes.

Shock Absorber:

*Undergoes repetitive impact to stop the mould , crucial for precise positioning.

Critical Points and Risk Management

*Special attention must be paid to shock absorber wear. Excessive wear can lead to improper mold stopping positions, causing misalignment on the extruder's mould conveyor and potential downstream defects.

SUPERVISION LEVEL**DAILY**

51923 Shock Absorber (1 u)
17059 Poly 15 (13 m)
100059 Infeed polycord guide (2 units)
100064 Outfeed polycord guide (2 units)

Visual inspection for wear and impact damage**WEEKLY**

17999 Bearing (Pulleys) (4 units)
22867 Support UCF207 (2 units)
4934 Snub Pulley 148 / Poly 15 (2 units)
59483 Driving Pulley 148 / Poly 15 (4 units)
289865 Driving Shaf / Poly 15 (2 units)
252355 Axial reflection photoelectric switch (1 u)

**Functional check, cleaning, and lubrication
Cleaning/verification optical sensor****Area Inspection:**

*Look for oil Oil contamination on floor in the gearbox area.

MONTHLY

289643 Gearmotor SAF57 (2 units)
Comprehensive inspection and alignment verification

Lubrication

*Check the automatic grease delivery system to the supports.

**CLEANING
WEEKLY**

* Polycord, guides, and all pulleys.

*Use appropriate tools (scrapers, brushes, dry cloths) to remove all accumulated debris, dust, and residual material from surfaces.

*Clean photocell lens and mirror with a soft, lint-free cloth.