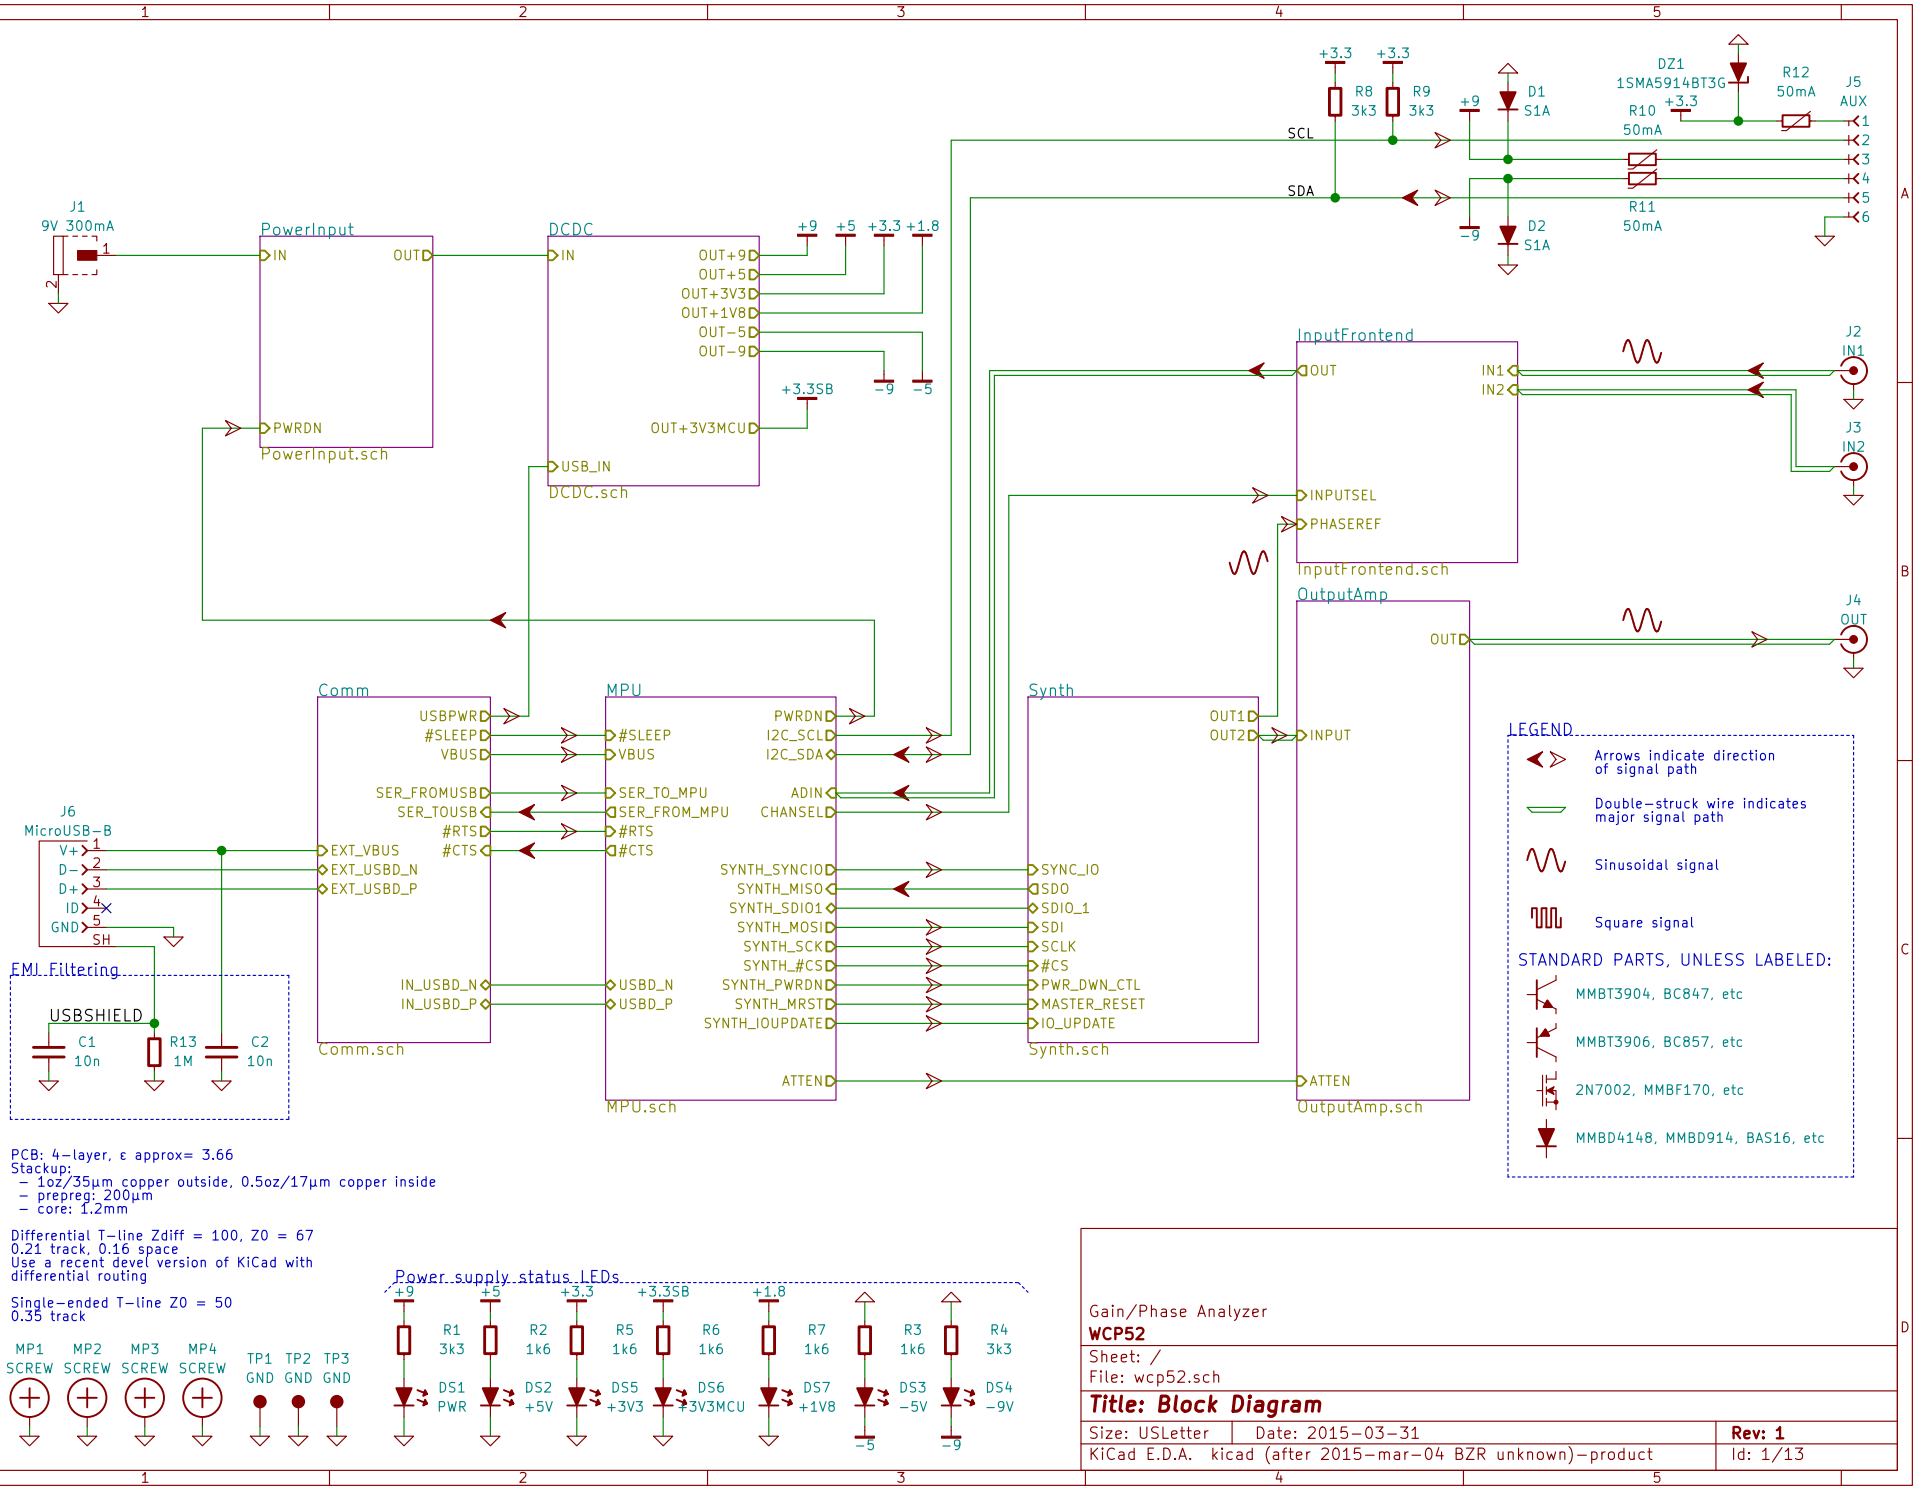
J1
9V 300mA
PowerInput
IN
OUT
PWRDN
PowerInput.sch
DCDC
IN
OUT+9
OUT+5
OUT+3V3
OUT+1V8
OUT-5
OUT-9
OUT+3V3MCU
USB_IN
DCDC.sch
+3.3SB
+9
+5
+3.3
+1.8
-9
-5
SCL
SDA
R8 3k3
R9 3k3
D1 S1A
D2 S1A
DZ1 1SMA5914BT3G
R10 50mA
R11 50mA
R12 50mA
J5 AUX
InputFrontend
OUT
IN1
IN2
INPUTSEL
PHASEREF
InputFrontend.sch
J2 IN1
J3 IN2
OutputAmp
OUT
INPUT
ATTEN
OutputAmp.sch
J4 OUT
Comm
USBPWR
#SLEEP
VBUS
SER_FROMUSB
SER_TOUSB
#RTS
#CTS
EXT_VBUS
EXT_USBD_N
EXT_USBD_P
IN_USBD_N
IN_USBD_P
Comm.sch
MPU
#SLEEP
VBUS
SER_TO_MPU
SER_FROM_MPU
#RTS
#CTS
USBD_N
USBD_P
PWRDN
I2C_SCL
I2C_SDA
ADIN
CHANSEL
SYNTH_SYNCIO
SYNTH_MISO
SYNTH_SDIO1
SYNTH_MOSI
SYNTH_SCK
SYNTH_#CS
SYNTH_PWRDN
SYNTH_MRST
SYNTH_IOUPDATE
ATTEN
MPU.sch
Synth
OUT1
OUT2
INPUT
SYNC_IO
SDO
SDIO_1
SDI
SCLK
#CS
PWR_DWN_CTL
MASTER_RESET
IO_UPDATE
Synth.sch
J6
MicroUSB-B
V+
D-
D+
ID
GND
SH
EMI Filtering
USBSHIELD
C1 10n
R13 1M
C2 10n
LEGEND
Arrows indicate direction of signal path
Double-struck wire indicates major signal path
Sinusoidal signal
Square signal
STANDARD PARTS, UNLESS LABELED:
MMBT3904, BC847, etc
MMBT3906, BC857, etc
2N7002, MMBF170, etc
MMBD4148, MMBD914, BAS16, etc
PCB: 4-layer, ε approx= 3.66
Stackup:
- 1oz/35µm copper outside, 0.5oz/17µm copper inside
- prepreg: 200µm
- core: 1.2mm
Differential T-line Zdiff = 100, Z0 = 67
0.21 track, 0.16 space
Use a recent devel version of KiCad with differential routing
Single-ended T-line Z0 = 50
0.35 track
MP1 SCREW
MP2 SCREW
MP3 SCREW
MP4 SCREW
TP1 GND
TP2 GND
TP3 GND
Power supply status LEDs
R1 3k3
R2 1k6
R5 1k6
R6 1k6
R7 1k6
R3 1k6
R4 3k3
DS1 PWR
DS2 +5V
DS5 +3V3
DS6 +3V3MCU
DS7 +1V8
DS3 -5V
DS4 -9V
Gain/Phase Analyzer
WCP52
Sheet: /
File: wcp52.sch
Title: Block Diagram
Size: USLetter
Date: 2015-03-31
Rev: 1
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product
Id: 1/13

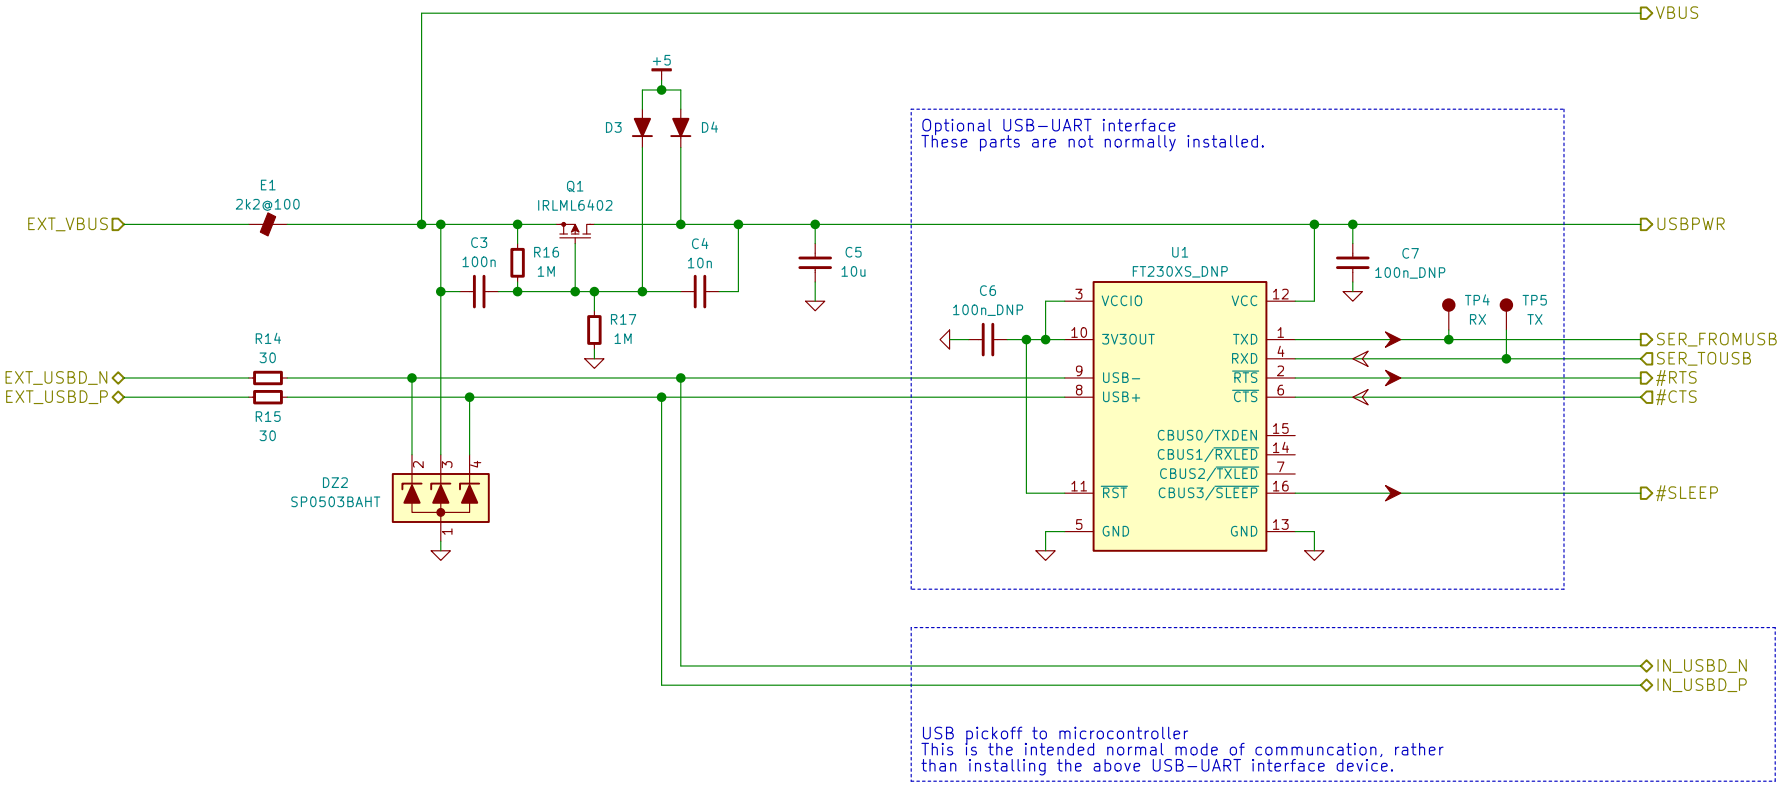

TODO (REV 2):
- Remove unnecessary U1, tidy routing

Gain/Phase Analyzer
WCP52

Sheet: /Comm/
File: Comm.sch

Title: USB Communications

Size: USLetter	Date: 2015-03-31	**Rev: 1**
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product		Id: 2/13

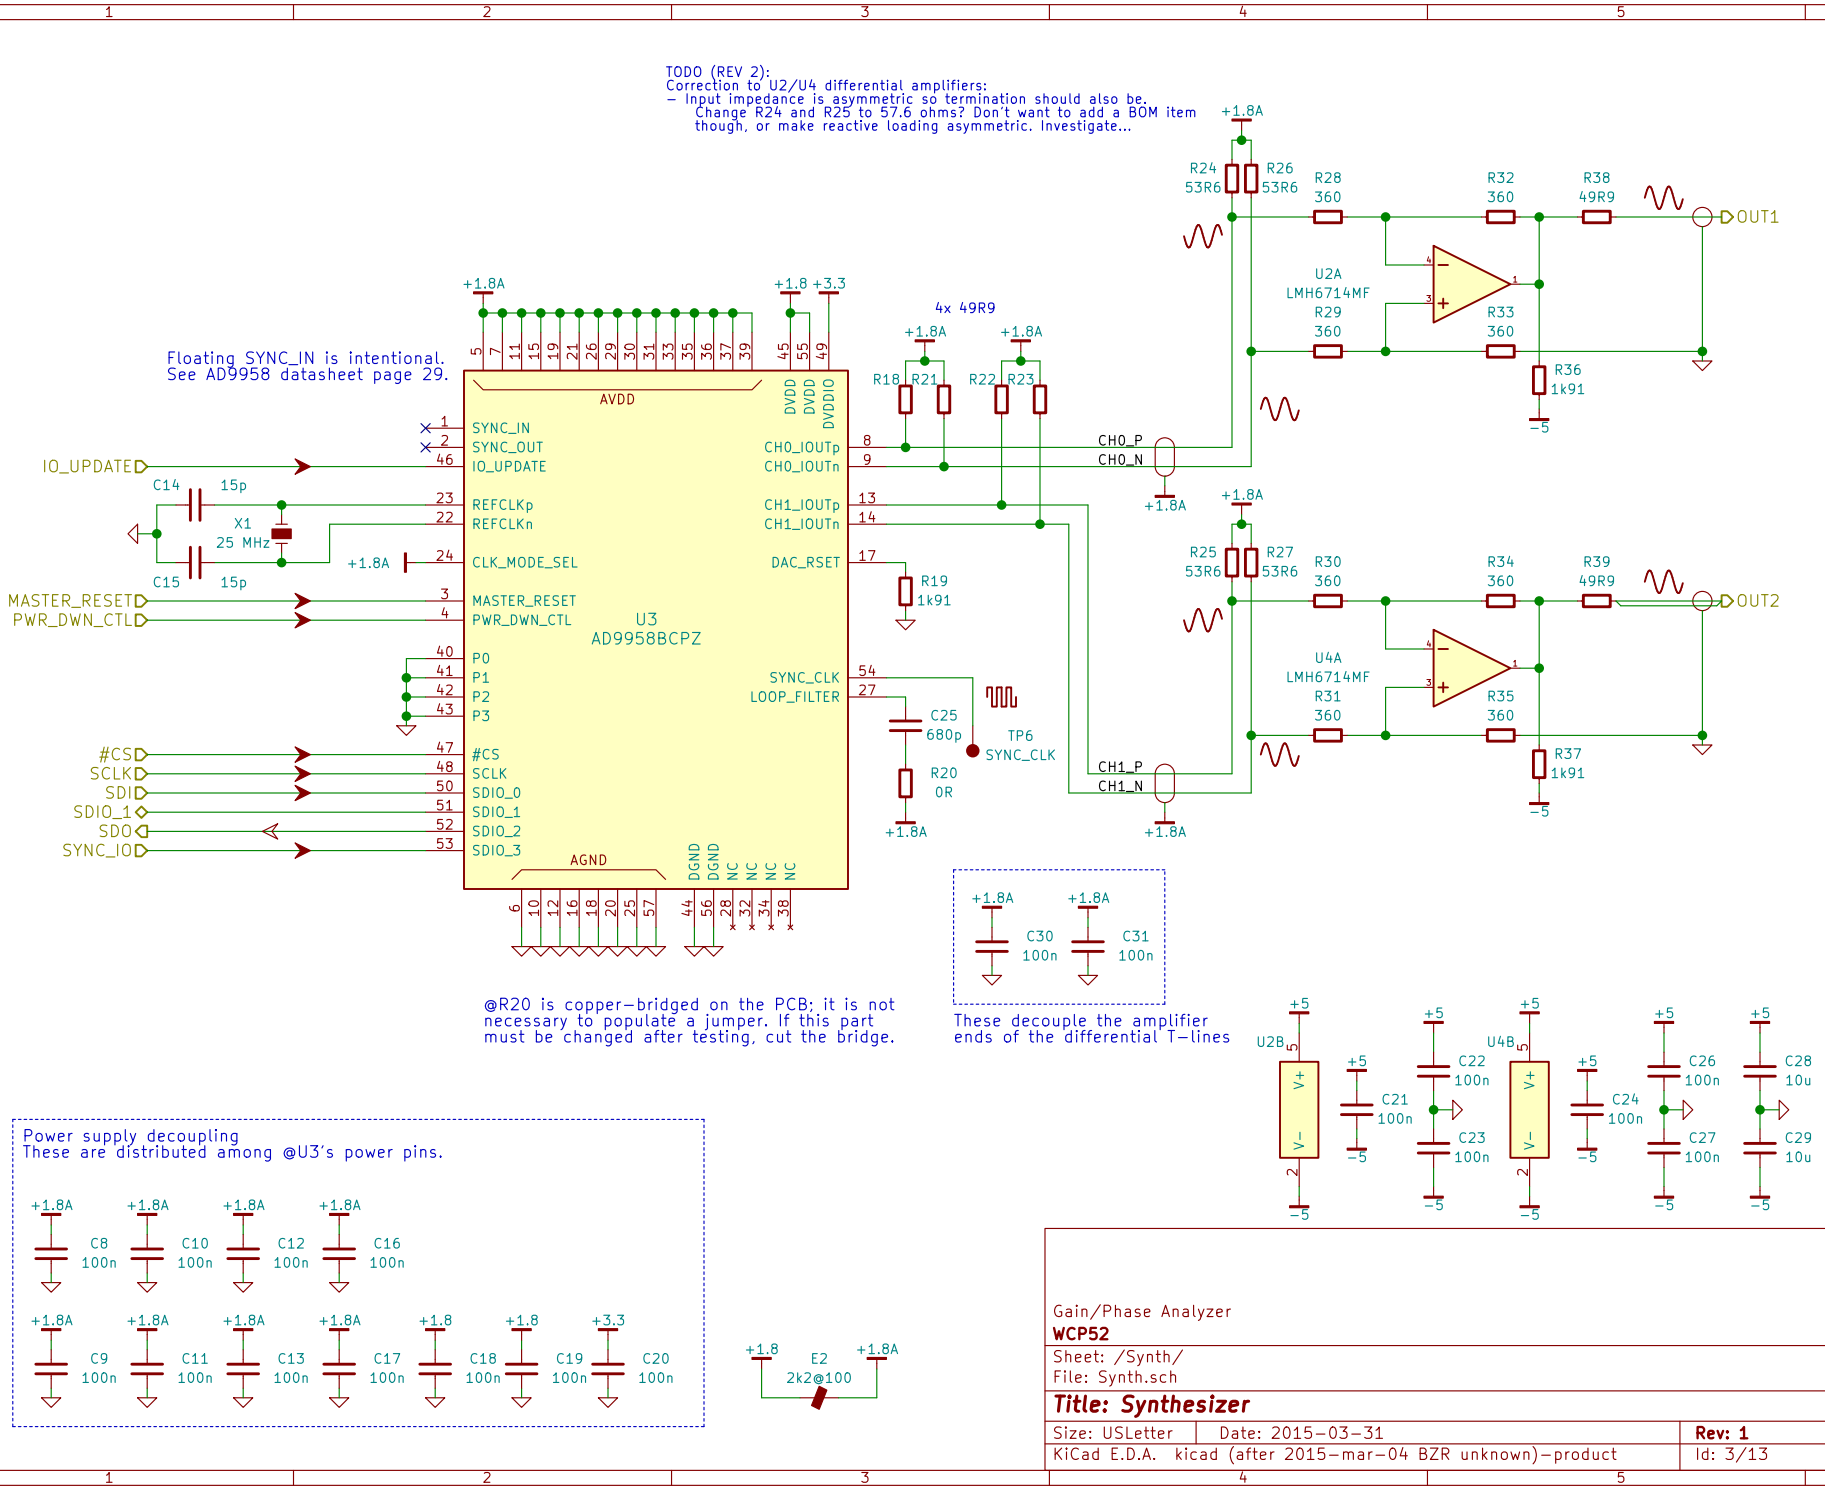
TODO (REV 2):
Correction to U2/U4 differential amplifiers:
– Input impedance is asymmetric so termination should also be.
Change R24 and R25 to 57.6 ohms? Don't want to add a BOM item
though, or make reactive loading asymmetric. Investigate...
Floating SYNC_IN is intentional.
See AD9958 datasheet page 29.
U3
AD9958BCPZ
SYNC_IN
SYNC_OUT
IO_UPDATE
REFCLKp
REFCLKn
CLK_MODE_SEL
MASTER_RESET
PWR_DWN_CTL
P0
P1
P2
P3
#CS
SCLK
SDIO_0
SDIO_1
SDIO_2
SDIO_3
AVDD
DVDD
DVDD
DVDDIO
CH0_IOUTp
CH0_IOUTn
CH1_IOUTp
CH1_IOUTn
DAC_RSET
SYNC_CLK
LOOP_FILTER
AGND
DGND
DGND
NC
NC
NC
NC
IO_UPDATE
MASTER_RESET
PWR_DWN_CTL
#CS
SCLK
SDI
SDIO_1
SDO
SYNC_IO
C14 15p
C15 15p
X1
25 MHz
4x 49R9
R18 R21
R22 R23
R19 1k91
C25 680p
R20 0R
TP6
SYNC_CLK
CH0_P
CH0_N
CH1_P
CH1_N
R24 53R6
R26 53R6
R25 53R6
R27 53R6
R28 360
R29 360
R30 360
R31 360
R32 360
R33 360
R34 360
R35 360
R36 1k91
R37 1k91
R38 49R9
R39 49R9
U2A
LMH6714MF
U4A
LMH6714MF
OUT1
OUT2
@R20 is copper–bridged on the PCB; it is not
necessary to populate a jumper. If this part
must be changed after testing, cut the bridge.
C30 100n
C31 100n
These decouple the amplifier
ends of the differential T–lines
U2B
U4B
C21 100n
C22 100n
C23 100n
C24 100n
C26 100n
C27 100n
C28 10u
C29 10u
Power supply decoupling
These are distributed among @U3's power pins.
C8 100n
C10 100n
C12 100n
C16 100n
C9 100n
C11 100n
C13 100n
C17 100n
C18 100n
C19 100n
C20 100n
E2
2k2@100
Gain/Phase Analyzer
WCP52
Sheet: /Synth/
File: Synth.sch
Title: Synthesizer
Size: USLetter
Date: 2015–03–31
Rev: 1
KiCad E.D.A. kicad (after 2015–mar–04 BZR unknown)–product
Id: 3/13

TODO (REV 2):
- Can we capacitively couple the signal into U5? The diff amp can produce significant offset. Cap-coupling 50R is impractical, but directly before U5 would allow removing the bias post-termination.
- Along those lines, can U5 become a transistor amplifier? BFR540?

@C42 and @R44 are optional compensation devices to boost gain slightly at high frequency, if post-fab testing shows that stray capacitance from layout results in a rolloff. In the first revision, do not populate them.

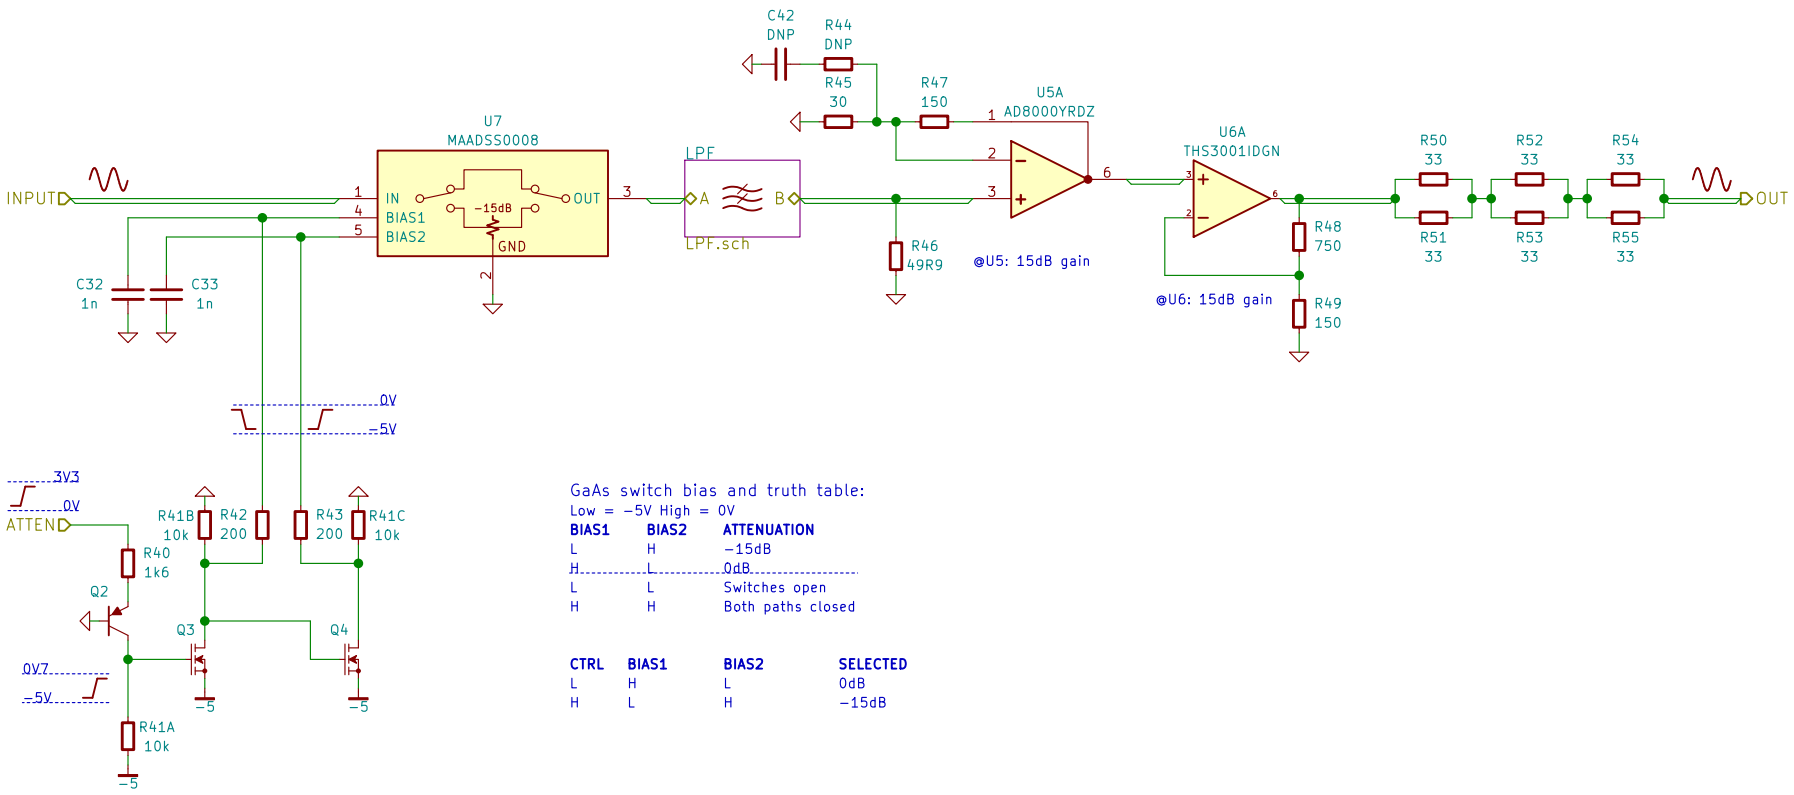

GaAs switch bias and truth table:
Low = -5V High = 0V

BIAS1	BIAS2	ATTENUATION
L	H	-15dB
H	L	0dB
L	L	Switches open
H	H	Both paths closed

CTRL	BIAS1	BIAS2	SELECTED
L	H	L	0dB
H	L	H	-15dB

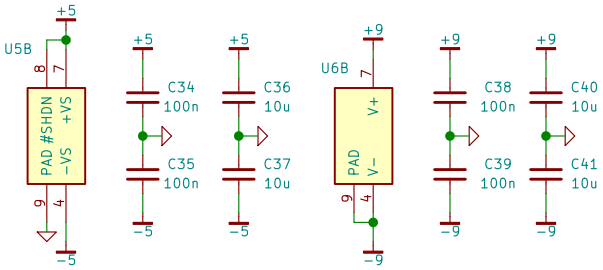

Gain/Phase Analyzer
WCP52
Sheet: /OutputAmp/
File: OutputAmp.sch

Title: Output Amplifier

Size: USLetter	Date: 2015-03-31	**Rev: 1**
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product		Id: 4/13

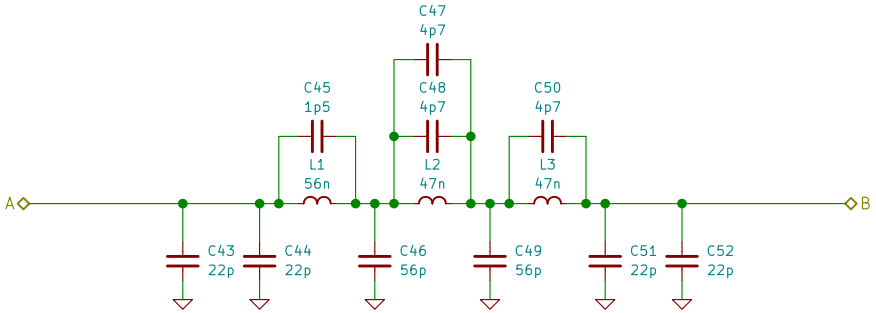

Intended frequency response of filter:

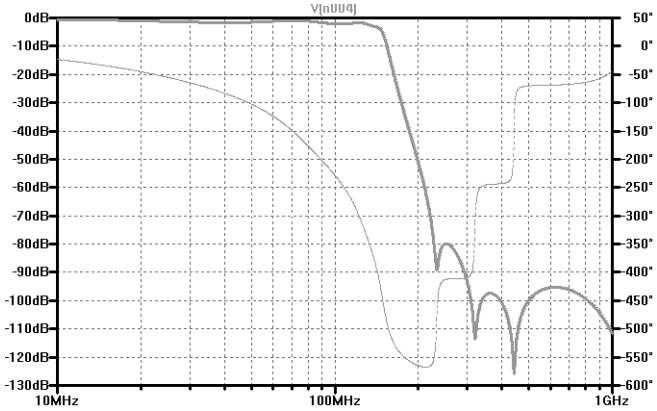

Gain/Phase Analyzer
WCP52

Sheet: /OutputAmp/LPF/
File: LPF.sch

Title: LPF for Output Amplifier

Size: USLetter	Date: 2015-03-31	**Rev: 1**
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product		Id: 5/13

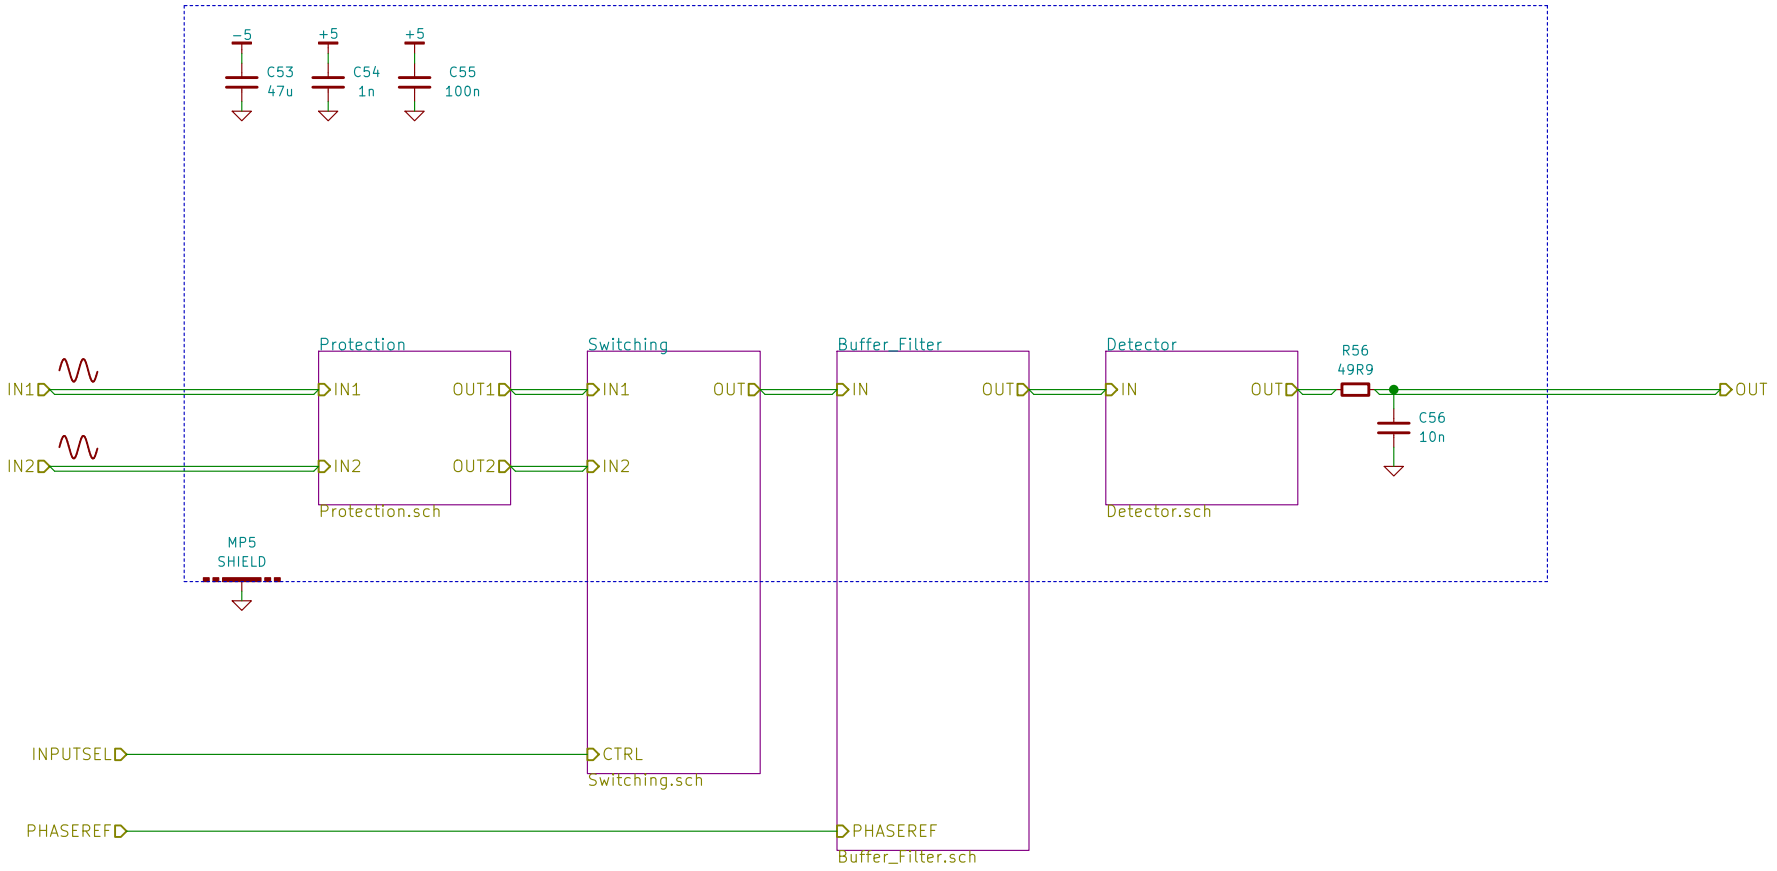

Gain/Phase Analyzer **WCP52**		
Sheet: /InputFrontend/ File: InputFrontend.sch		
Title: Input Frontend		
Size: USLetter	Date: 2015-03-31	**Rev: 1**
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product		Id: 6/13

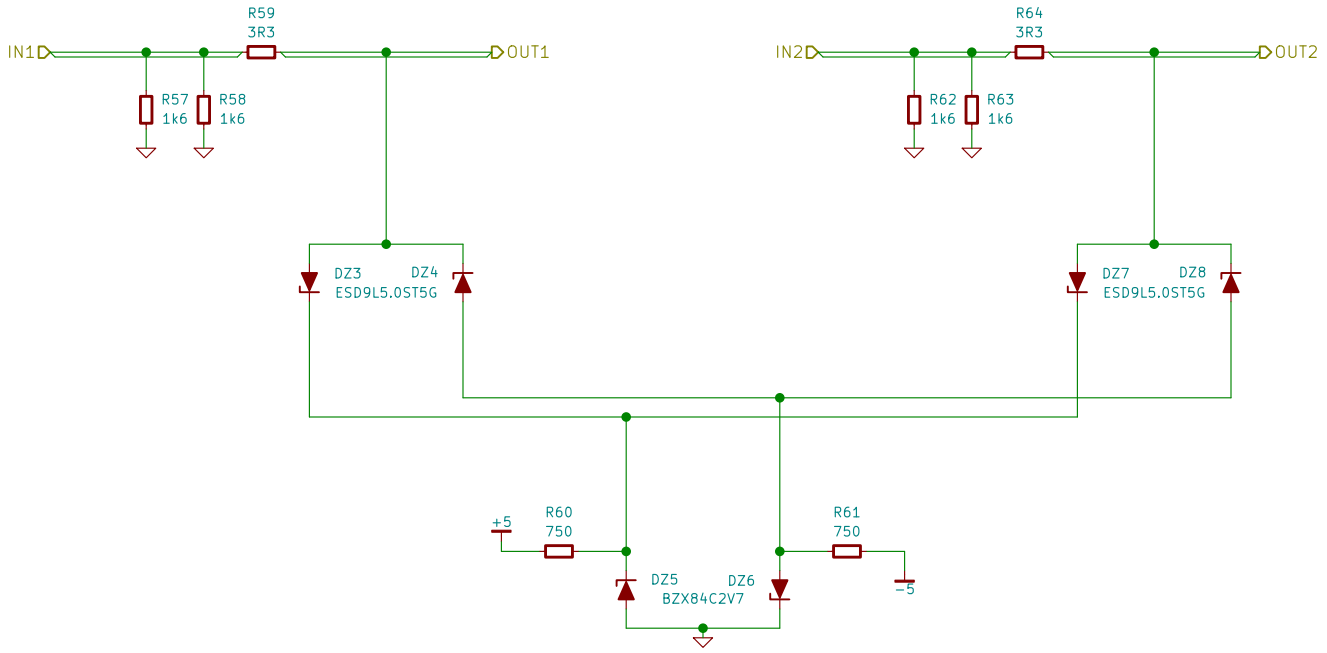

Gain/Phase Analyzer
WCP52

Sheet: /InputFrontend/Protection/
File: Protection.sch

Title: Input Protection

Size: USLetter	Date: 2015-03-31	**Rev: 1**
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product		Id: 7/13

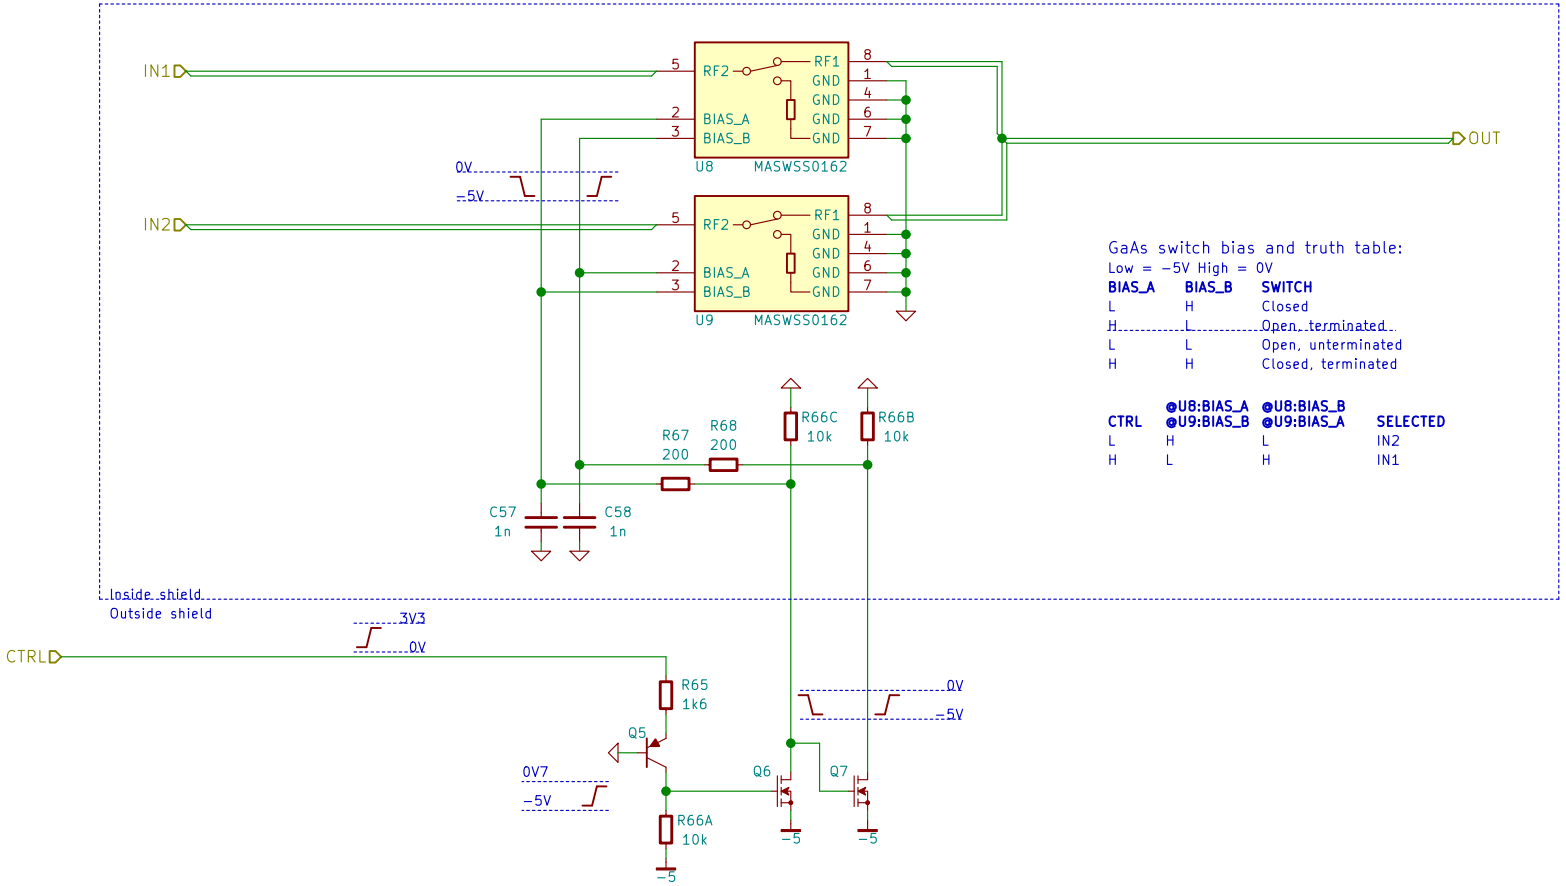

Gain/Phase Analyzer
WCP52

Sheet: /InputFrontend/Switching/
File: Switching.sch

Title: Input Switching

Size: USLetter	Date: 2015-03-31	**Rev: 1**
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product		Id: 8/13

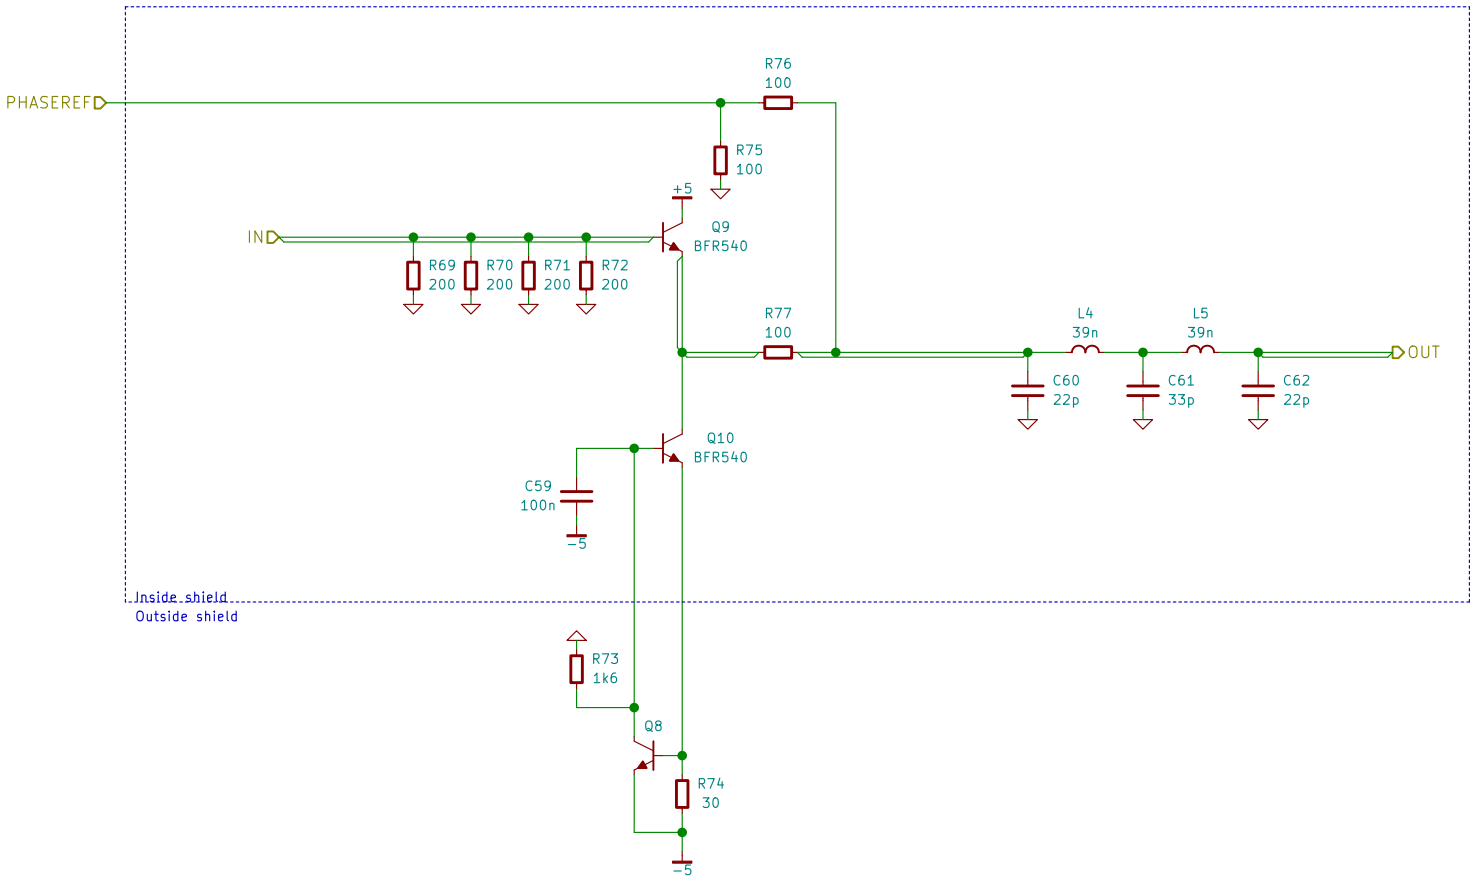

Gain/Phase Analyzer **WCP52**		
Sheet: /InputFrontend/Buffer_Filter/ File: Buffer_Filter.sch		
Title: Input Buffer and Filter		
Size: USLetter	Date: 2015-03-31	**Rev: 1**
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product		Id: 9/13

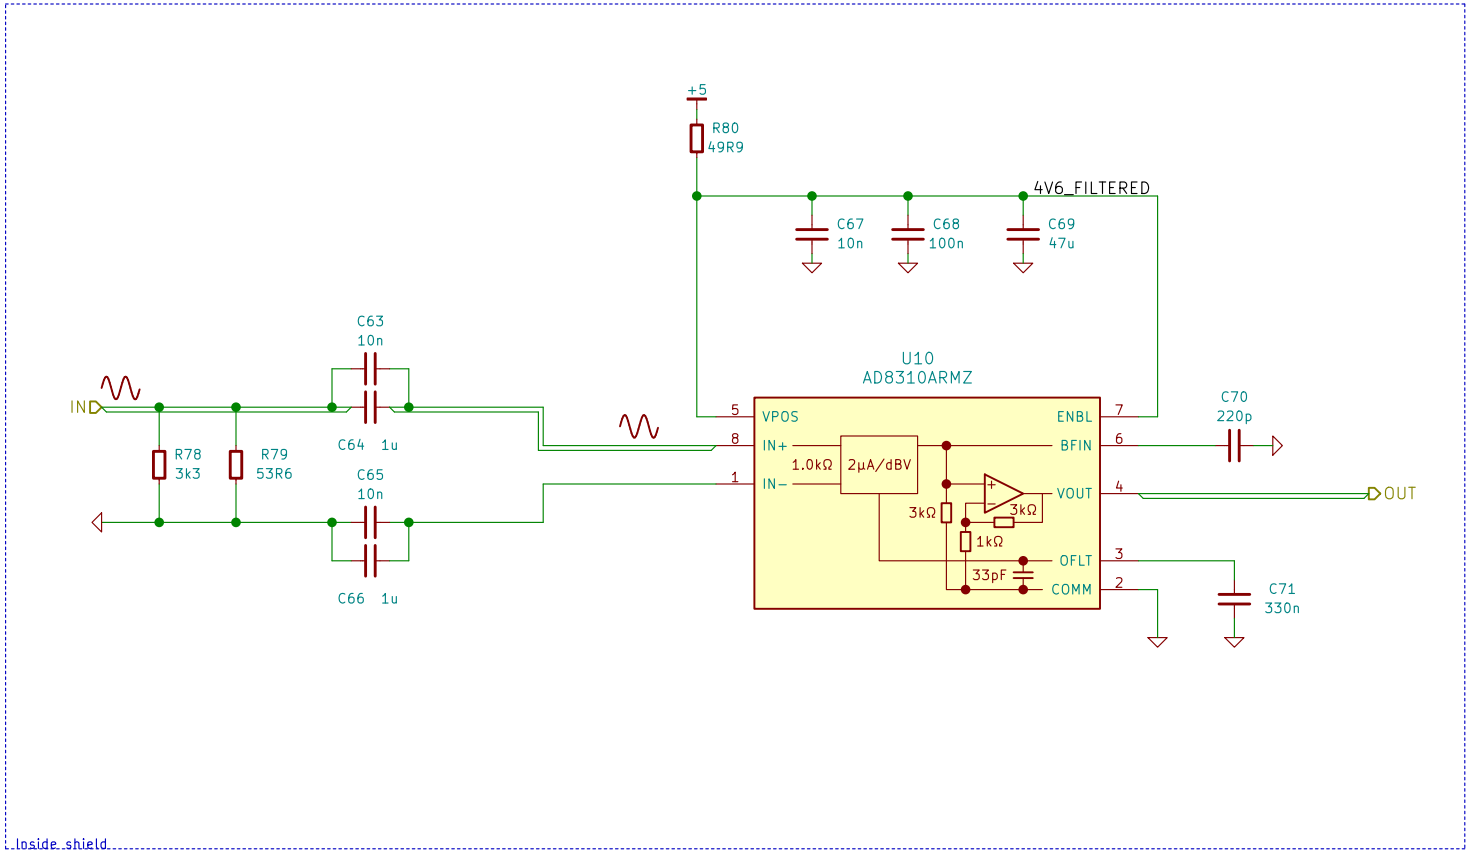

Gain/Phase Analyzer **WCP52**		
Sheet: /InputFrontend/Detector/ File: Detector.sch		
Title: Logarithmic Detector		
Size: USLetter	Date: 2015-03-31	**Rev: 1**
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product		Id: 10/13

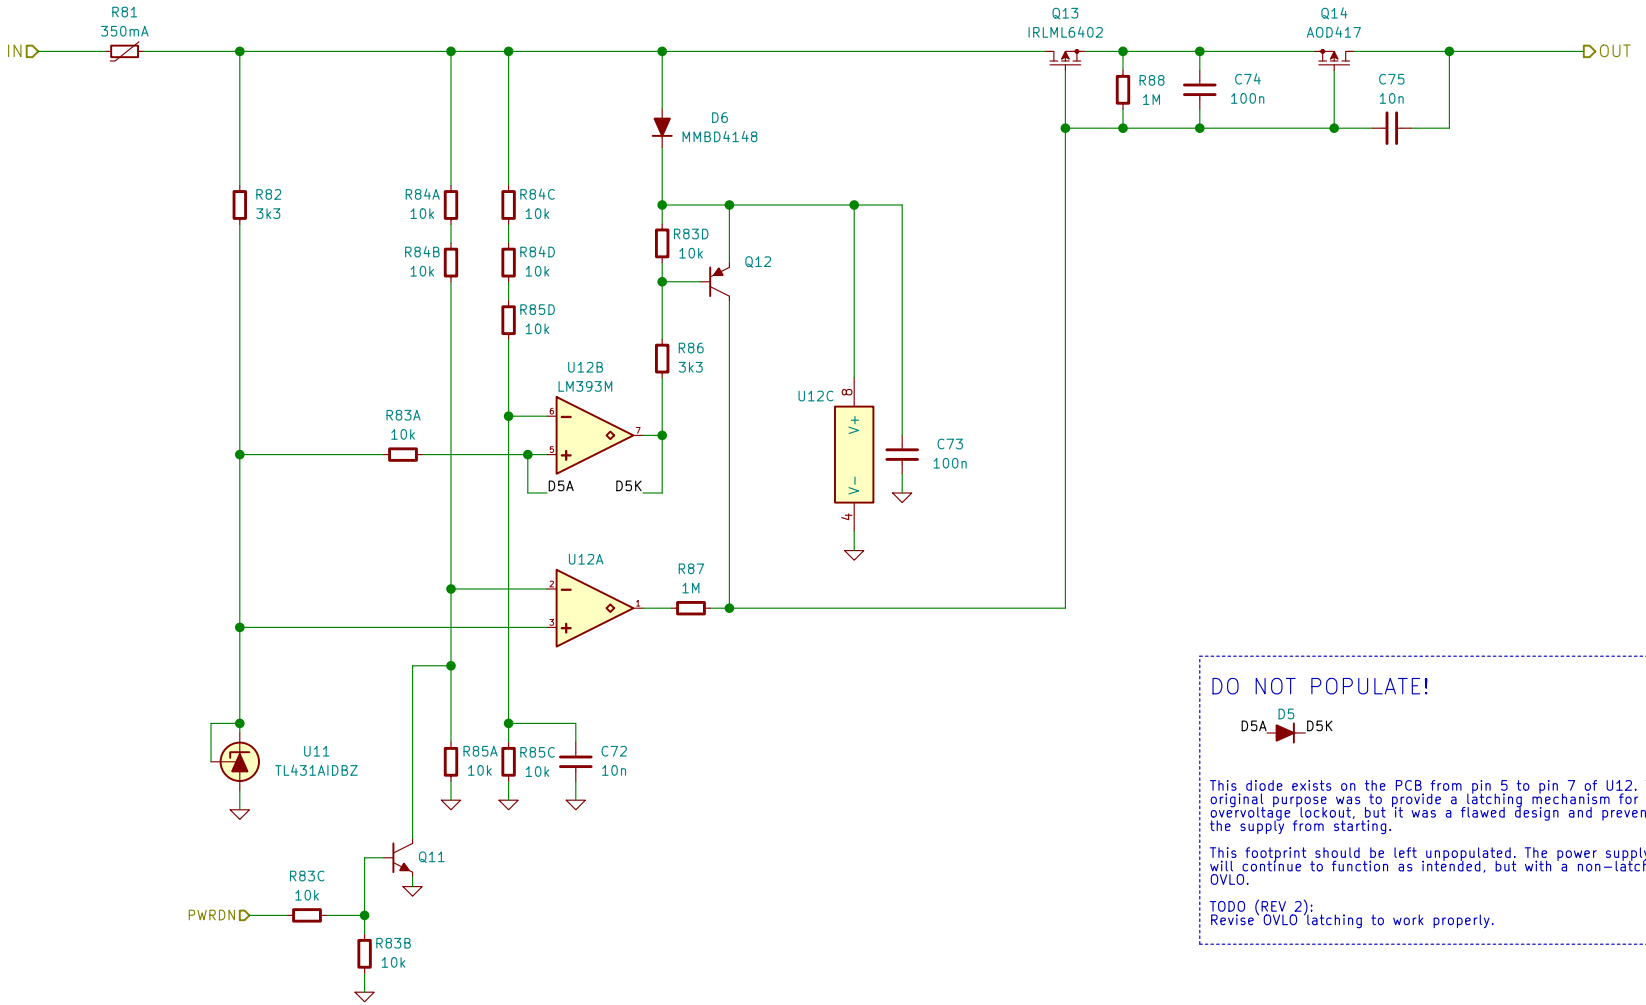

DO NOT POPULATE!

D5

D5A — D5K

This diode exists on the PCB from pin 5 to pin 7 of U12. The original purpose was to provide a latching mechanism for the overvoltage lockout, but it was a flawed design and prevented the supply from starting.

This footprint should be left unpopulated. The power supply will continue to function as intended, but with a non-latching OVLO.

TODO (REV 2):
Revise OVLO latching to work properly.

Gain/Phase Analyzer
WCP52

Sheet: /PowerInput/
File: PowerInput.sch

Title: Power Input Circuit

Size: USLetter	Date: 2015-03-31	**Rev: 1**
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product		Id: 11/13

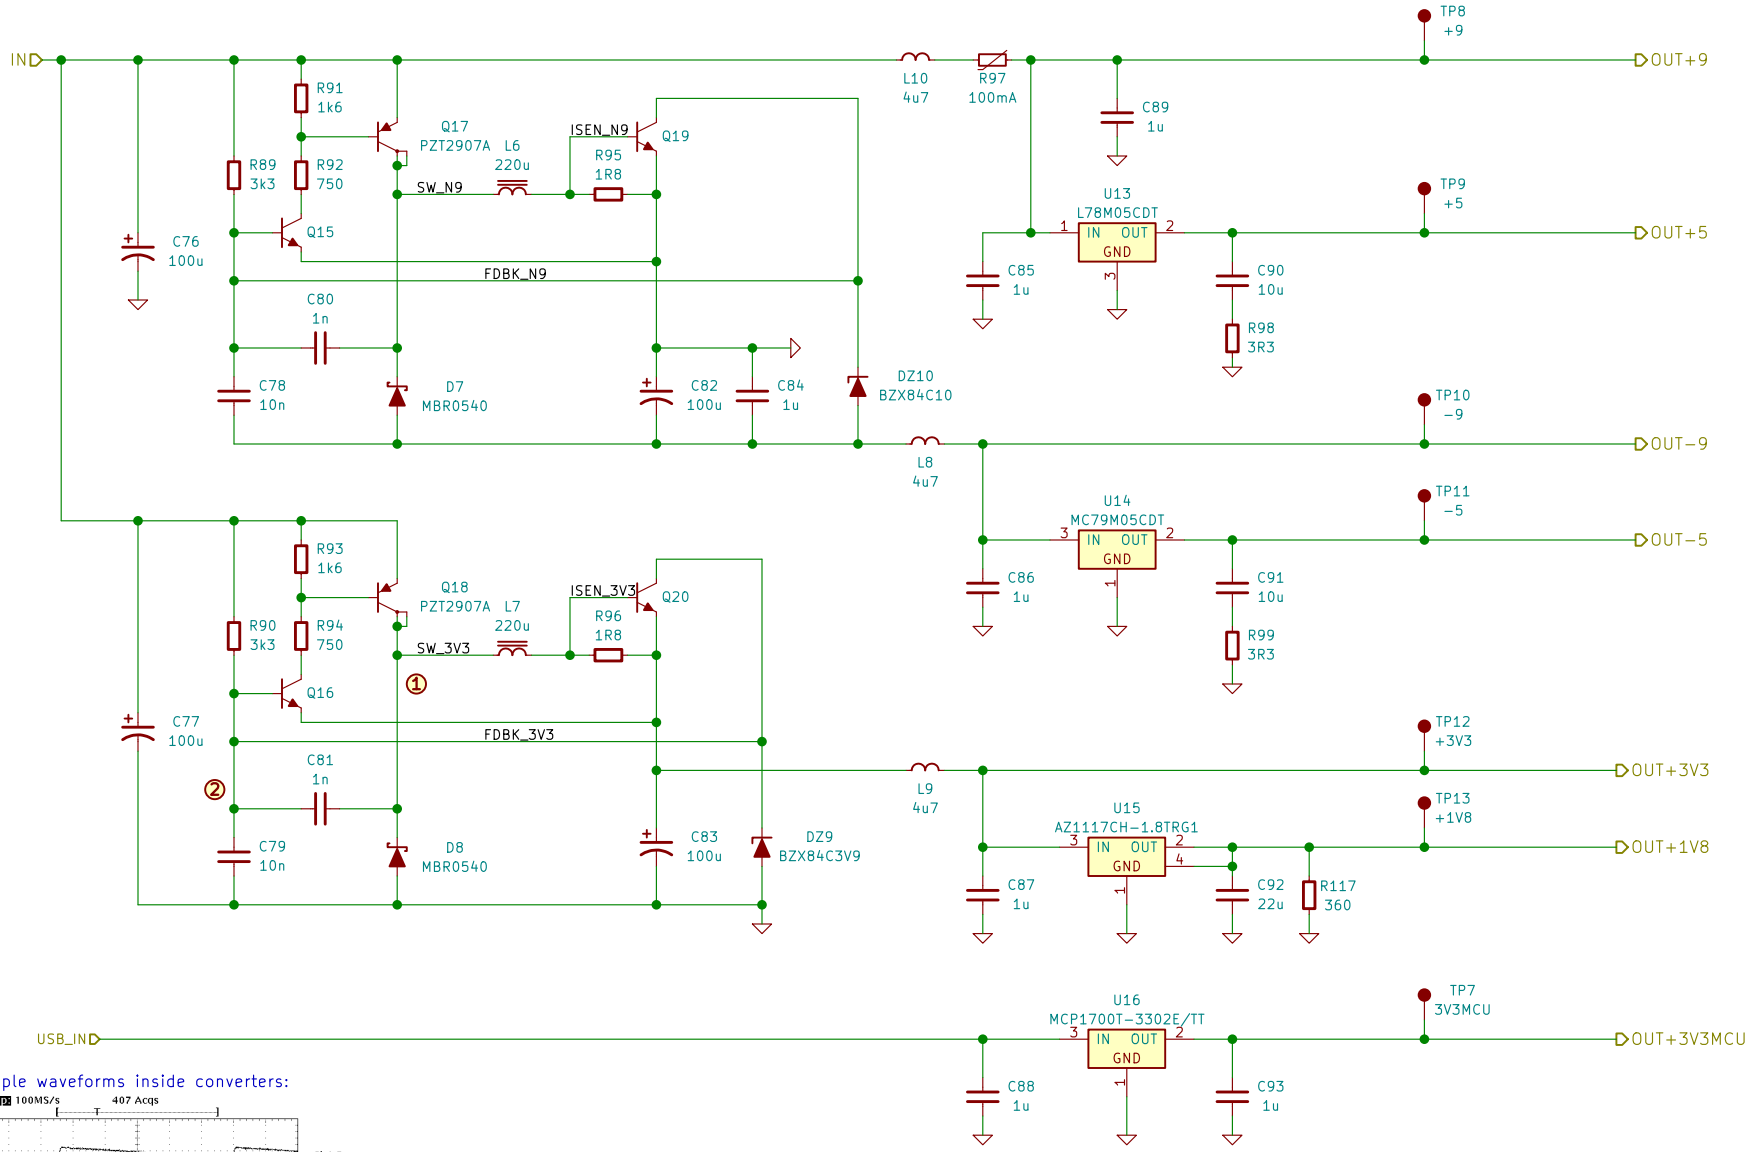

Example waveforms inside converters:

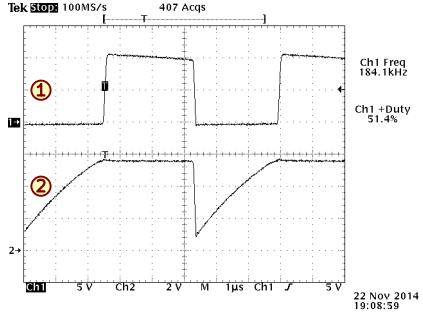

TODO (REV 2):
- C92 could be 2x 10uF, eliminating a BOM item.
- Can Q17 and Q18 be upgraded to PMOS? In simulation testing it was difficult to switch them off quickly and they lost significant power. However, the low current gain of the PZT2907A required changing the current-limiting resistors to 1R8 and sacrificing output current.

  Also possible: higher gain BJTs? Darlingtons/Sziklais? (probably too slow)

Gain/Phase Analyzer
WCP52

Sheet: /DCDC/
File: DCDC.sch

Title: DC-DC Converters

Size: USLetter	Date: 2015-03-31	**Rev: 1**
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product		Id: 12/13

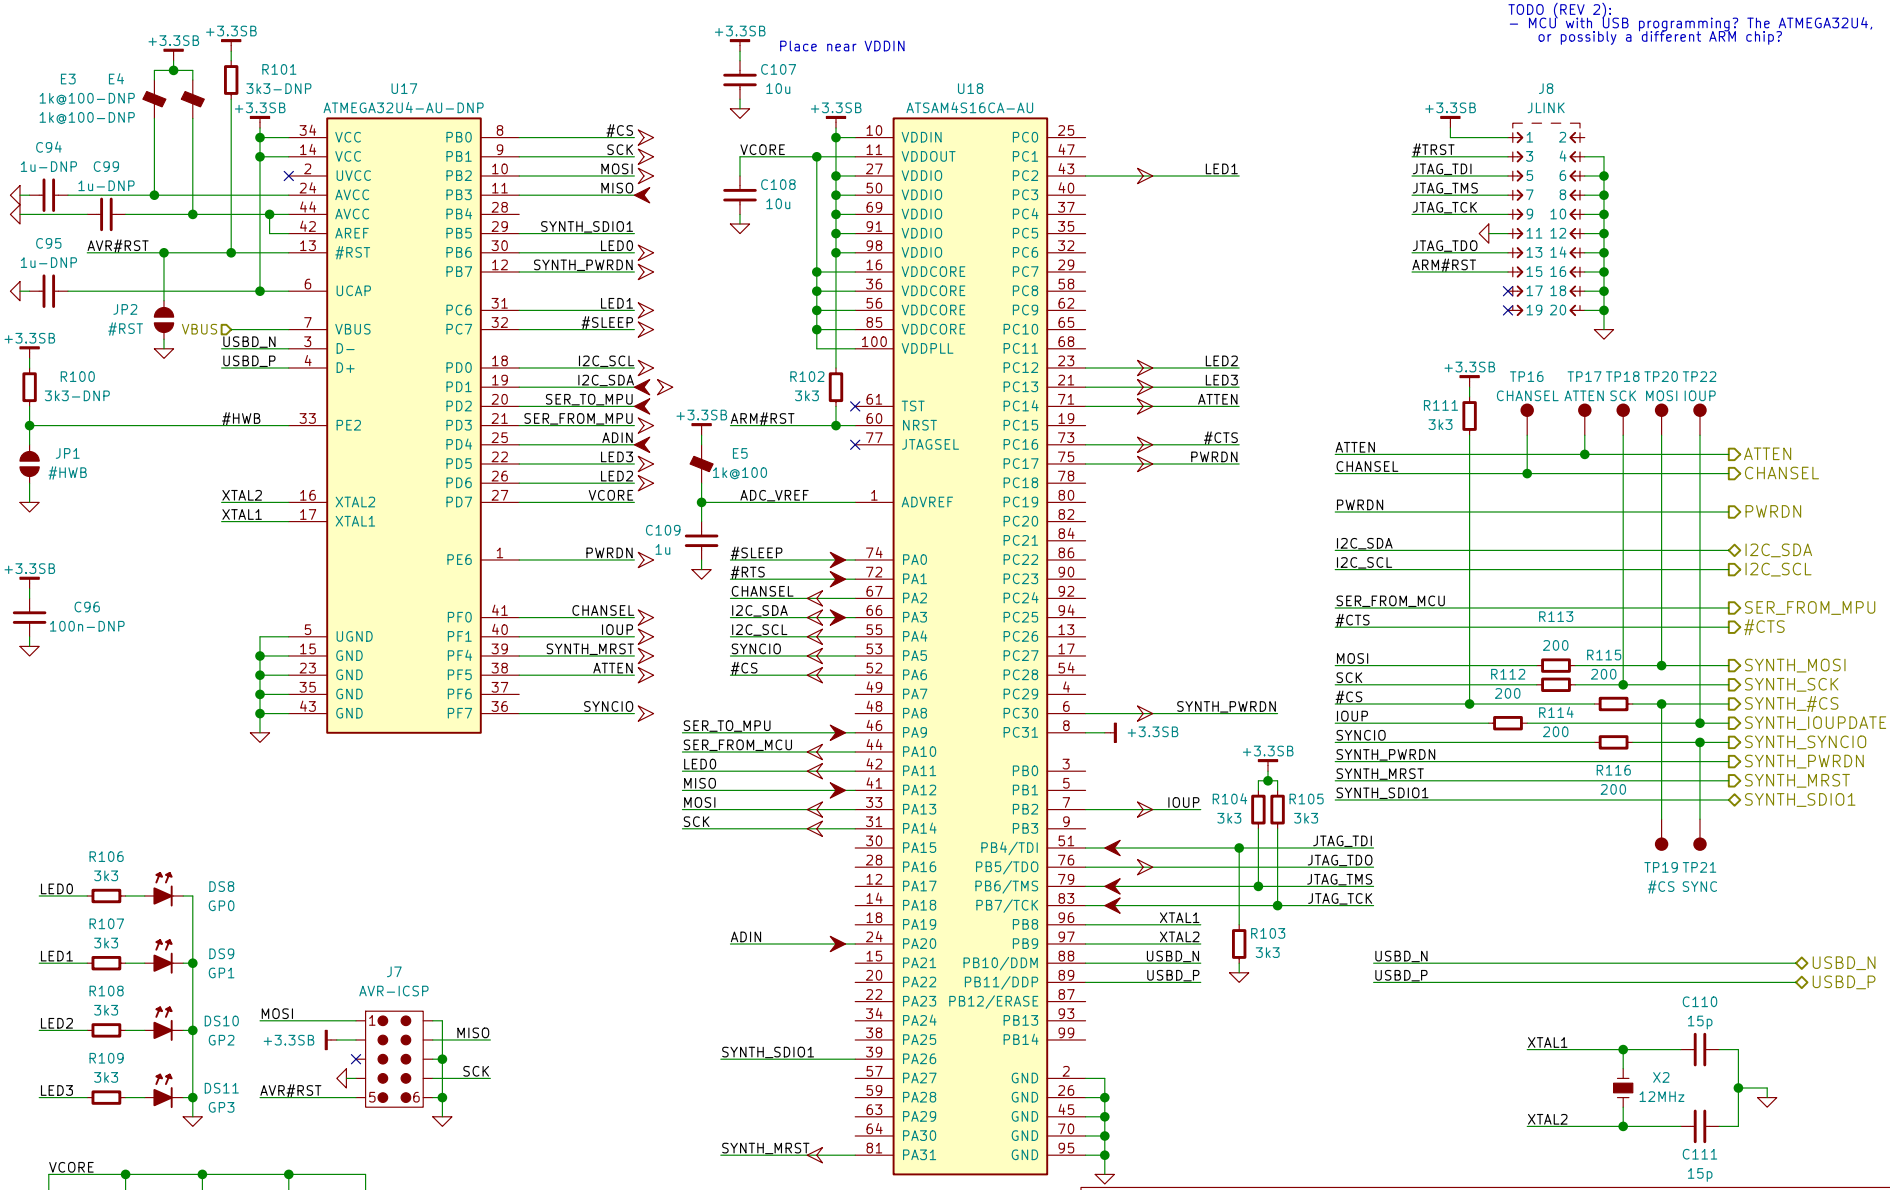
TODO (REV 2):
– MCU with USB programming? The ATMEGA32U4, or possibly a different ARM chip?
U17
ATMEGA32U4-AU-DNP
U18
ATSAM4S16CA-AU
J8
JLINK
J7
AVR-ICSP
Place near VDDIN
@U17 is an alternative microcontroller. Not used in first revision.
Note duplicate connections. These are used to facilitate routing. Make sure to set all duplicate connections as inputs.
Gain/Phase Analyzer
WCP52
Sheet: /MPU/
File: MPU.sch
Title: MPU
Size: USLetter
Date: 2015-03-31
Rev: 1
KiCad E.D.A. kicad (after 2015-mar-04 BZR unknown)-product
Id: 13/13