## Version 8.3.2 - What's New?

 ${\rm WFRC}\;/\;{\rm MAG}$ 

## **Input Processing**

## Inbound/Outbound and HOV Capacity

A couple bugs were corrected in the input processing script:

- Corrected inbound/outbound designations for EB/WB links.
- Removed FT=37-38 as a condition for populating link additional HOV capacity (Ad-HOVCap1H) values since related HOV fields are populated on GP links not HOV links. Also, corrected capacity lookup to be for FT=37 and not FT of link.

## Walk Buffer Modifications

The walk buffer script was improved with a couple simple modifications to the routes and stops that are included in walk buffer creation: - Removed local bus route buffers along expressways and freeways (anything with FT>=12). Only local bus routes along arterials or collectors are now included in route buffers. - Removed buffers that were calculated from local bus stops, which were redundant with local bus route buffers. - The remaining combined walk buffer areas are shown in green. The '\_WalkBuffer\_ArcMap103.mxd' file was updated to version 10.3 of ArcMap, and the scripts were modified to copy the walk buffer mxd to scenario folders.

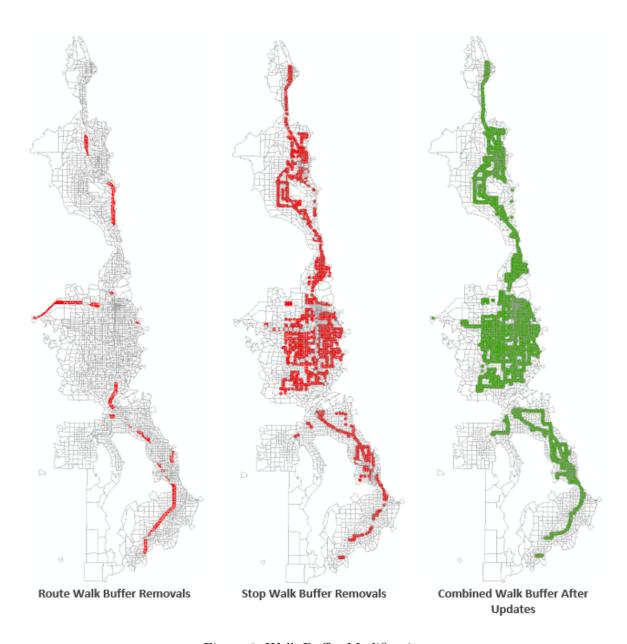


Figure 1: Walk Buffer Modifications.