

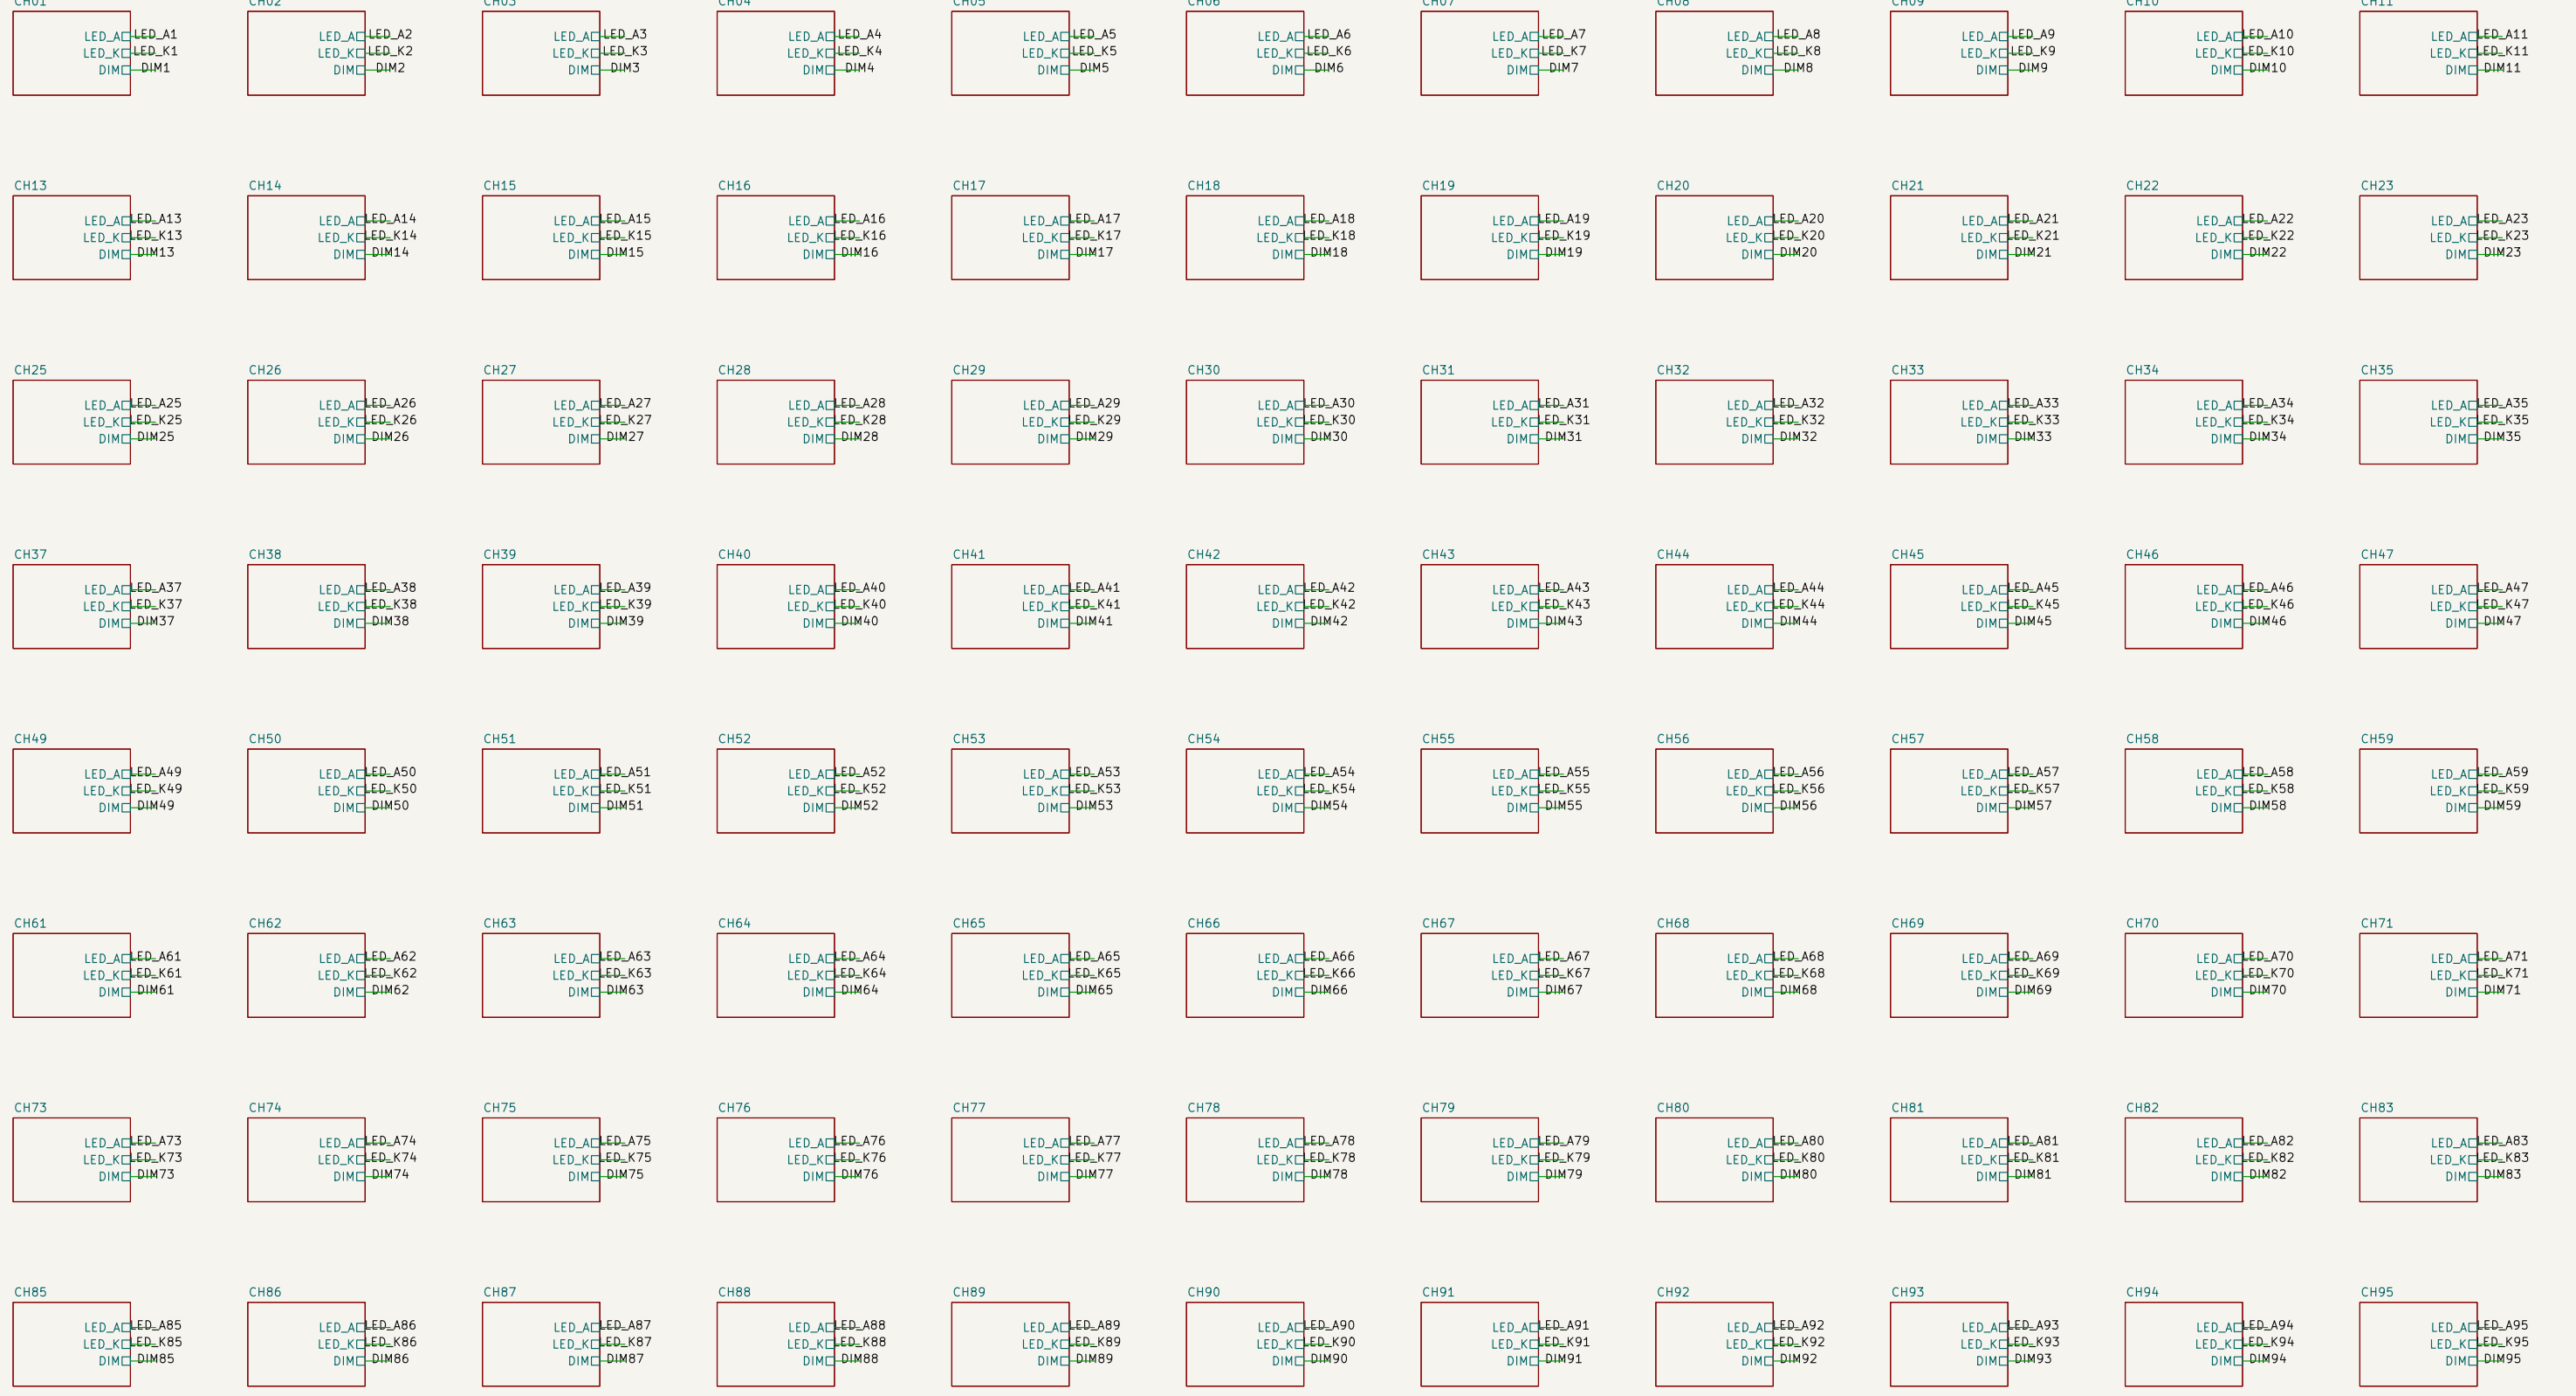



96 DRIVER CHANNELS (CH01..CH96) – see channel.kicad_sch

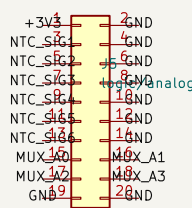


RIBBONS TO LED BOARD

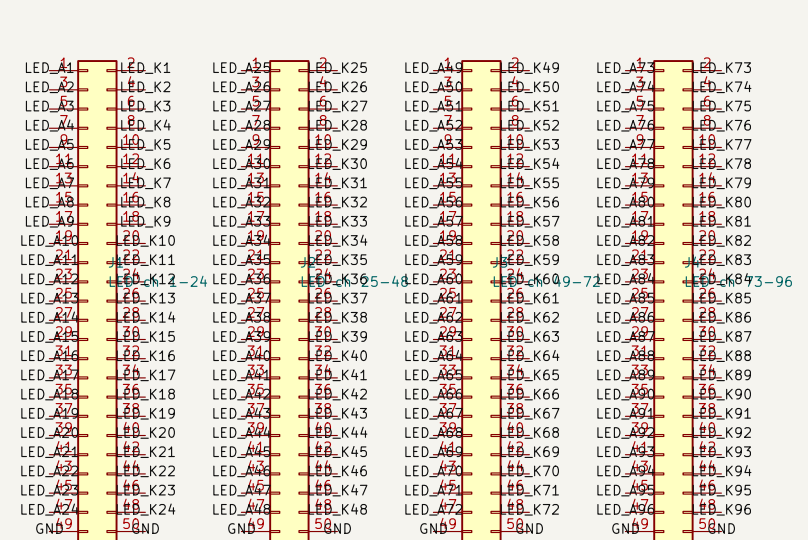







PCA9685 PWM BANK 0x40–0x45

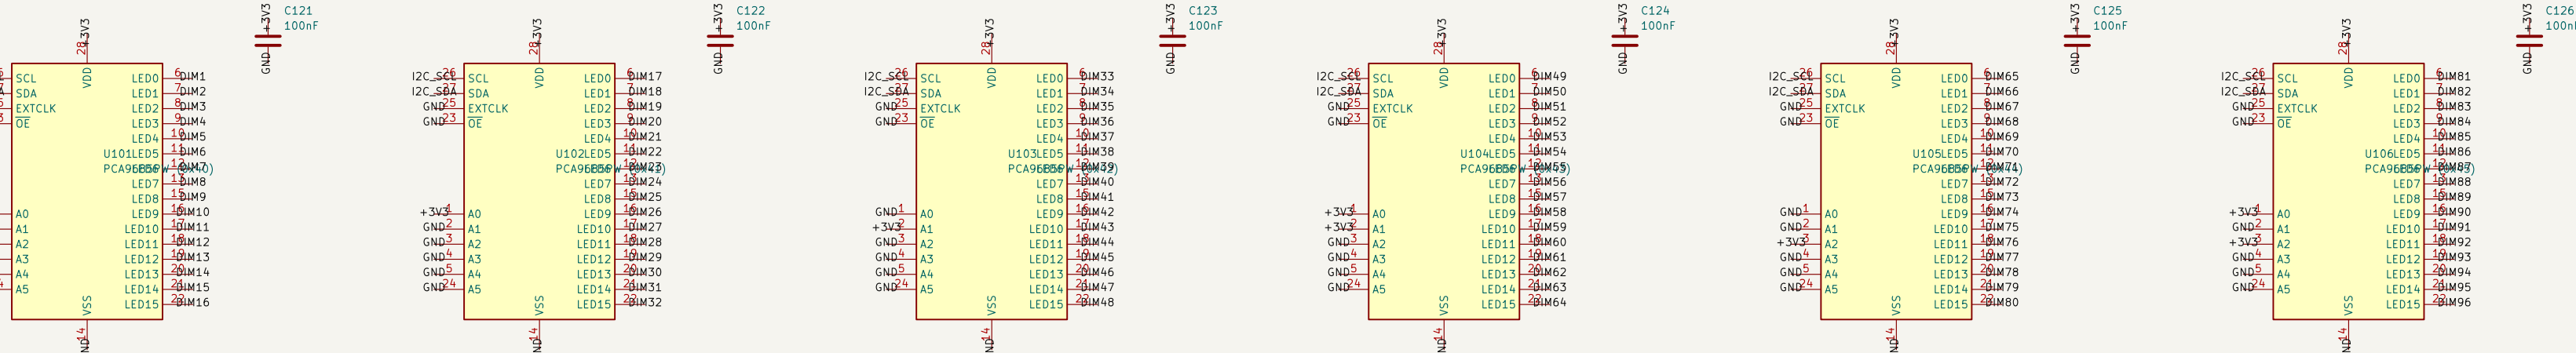


ESP32 DEVKITC–38 SOCKET (J10 left / J11 right, pin1 = 3V3/GND end)

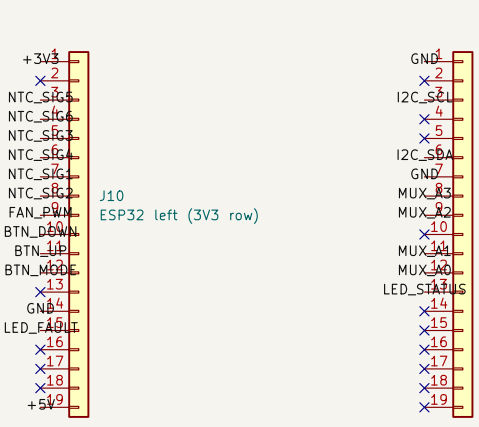

5V RAIL + 24V INPUT

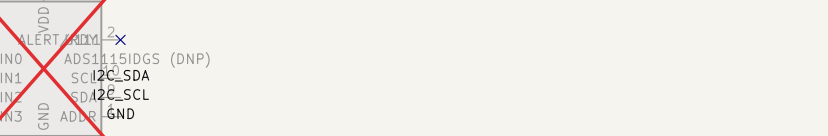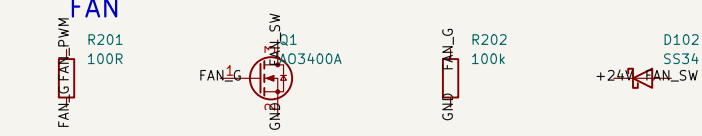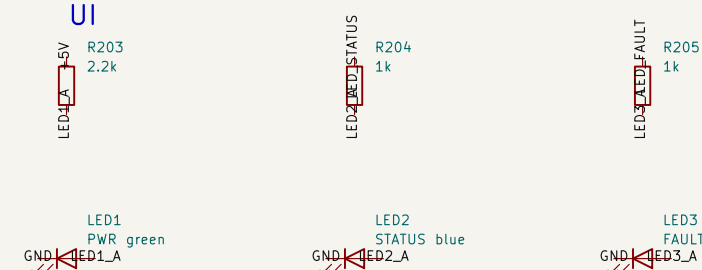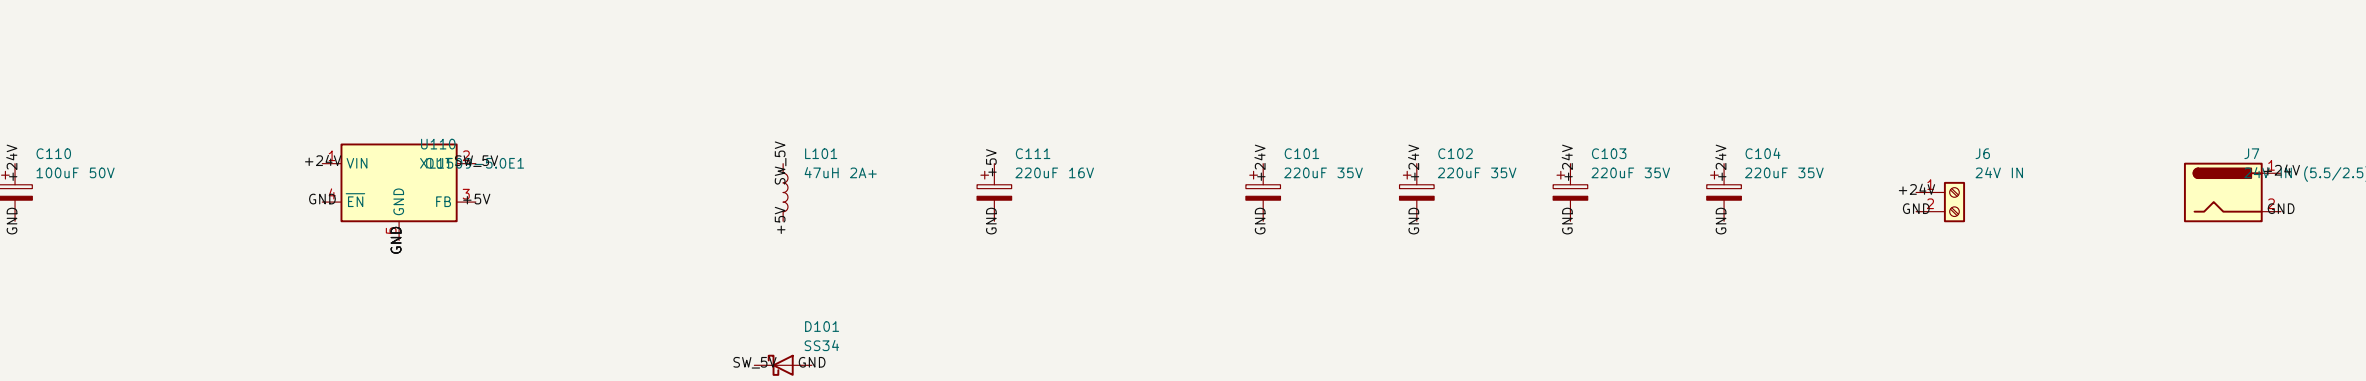

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

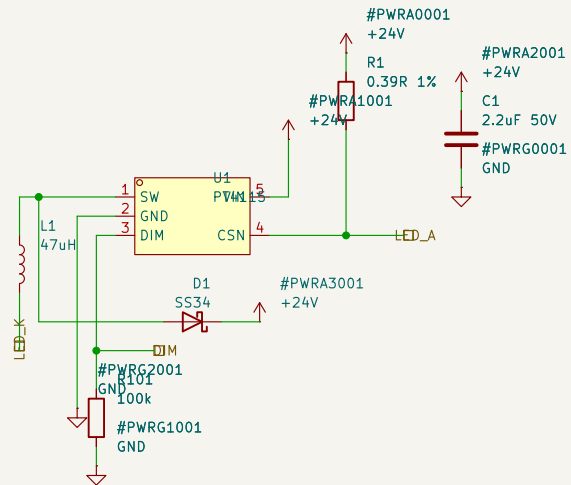

Sheet: /CH01/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 2/97

A	
B	
C	
D	




File: channel.kicad_sch

Size: A4

Date: 2026-07-13

Rev:

D

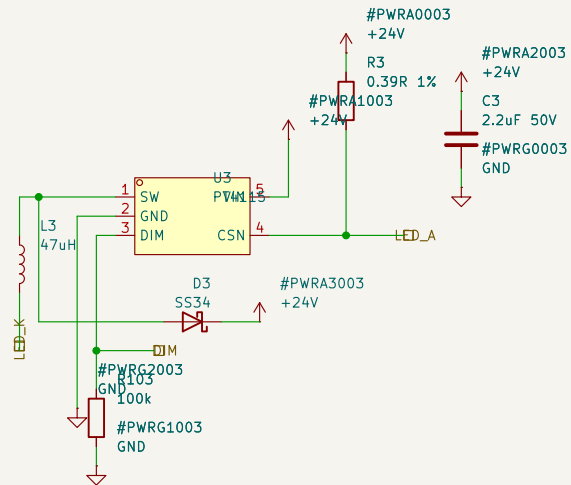[illegible]

File: channel.kicad_sch

Size: A4


Date: 2026-07-13

SIZE: A1	5
KiCad E.D.A. 10.0.3	

Rev:

Id: 4/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

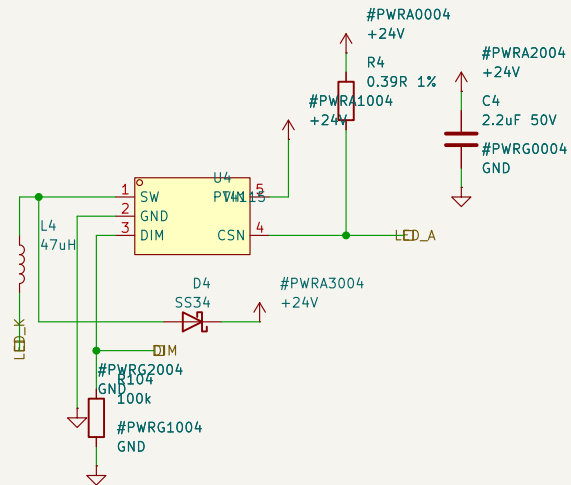

Sheet: /CH04/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 5/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

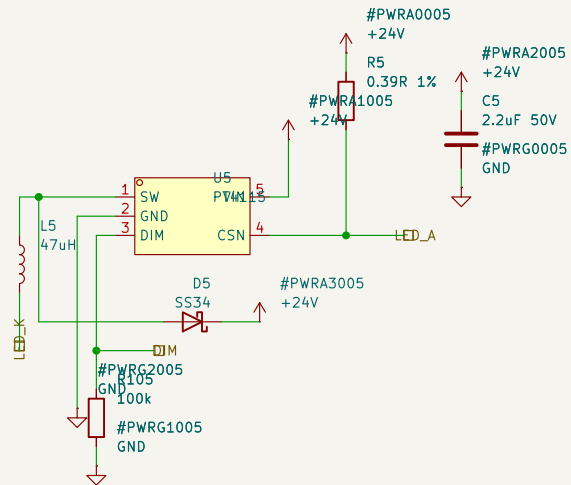


Sheet: /CH05/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 6/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

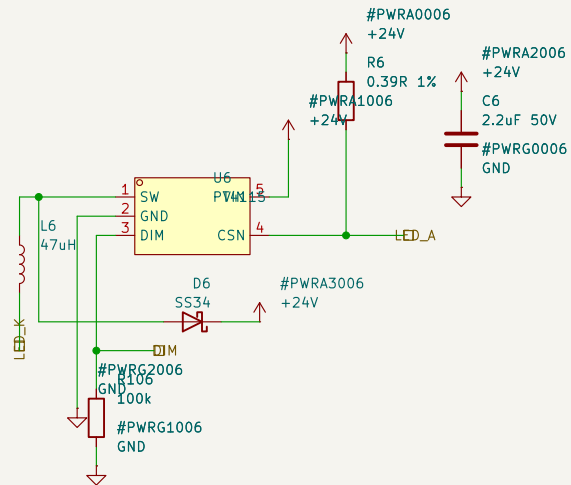

Sheet: /CH06/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 7/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

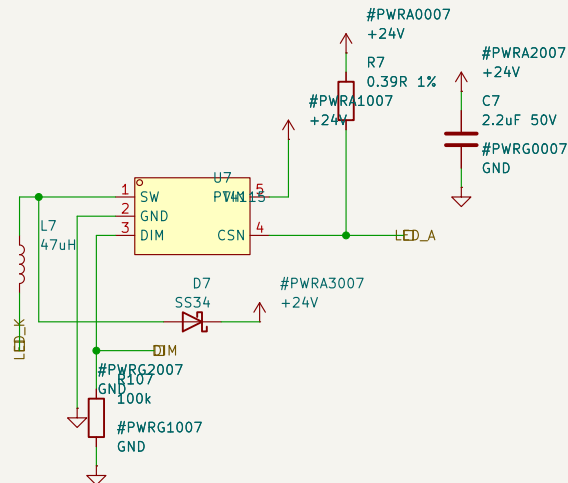

Sheet: /CH07/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3

Id: 8/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

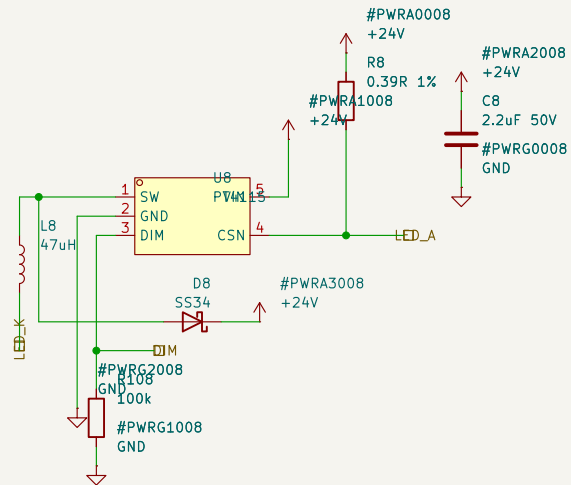

Sheet: /CH08/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3

Id: 9/97


One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

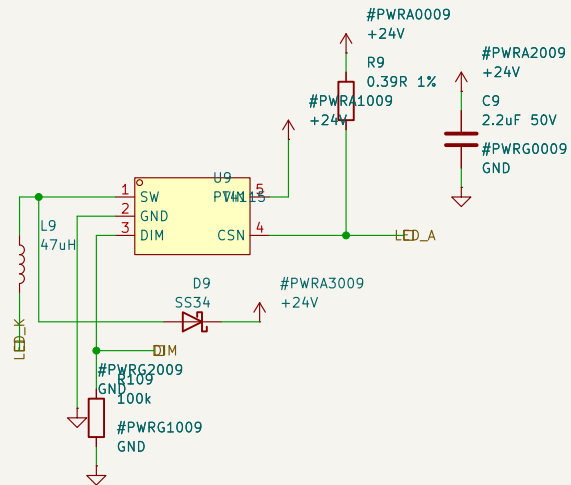

Sheet: /CH09/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 10/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

The schematic diagram illustrates a PT4115 buck converter circuit. The PT4115 IC (U10) is the central component, with its pins connected as follows: SW (pin 1) to a 47uH inductor (L10) and a SS34 diode (D10); GND (pin 2) to ground; DIM (pin 3) to a 100k resistor (R10) and ground; and CSN (pin 4) to the LED_A pin. The circuit is powered by a +24V source (#PWA0010) and grounded (#PWA2010, #PWA3010, #PWRG0010, #PWRG2010). A 2.2uF capacitor (C10) is connected to the GND pin.

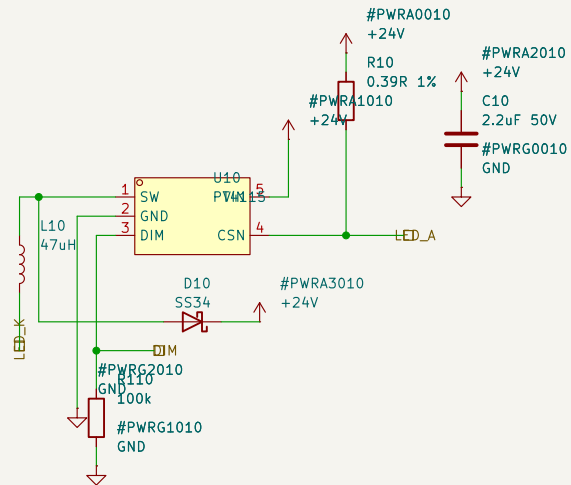

File: channel.kicad_sch

Size: A4


Date: 2026-07-13

SIZE: A1	5
KiCad E.D.A. 10.0.3	

Rev:


Id: 11/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

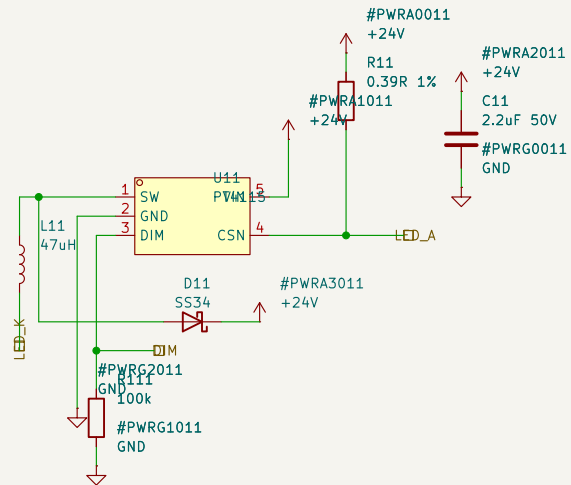


Sheet: /CH11/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 12/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

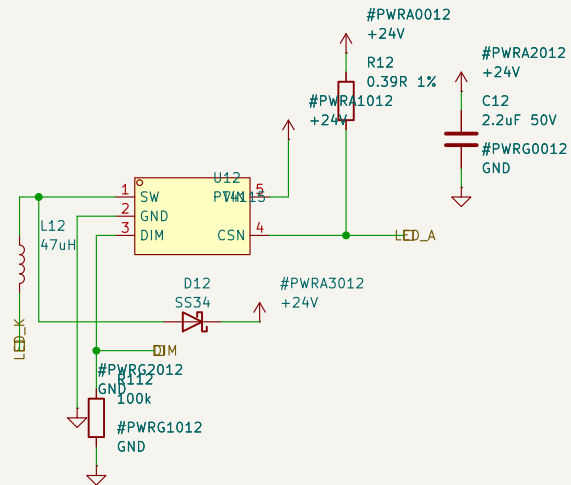


Sheet: /CH12/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 13/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

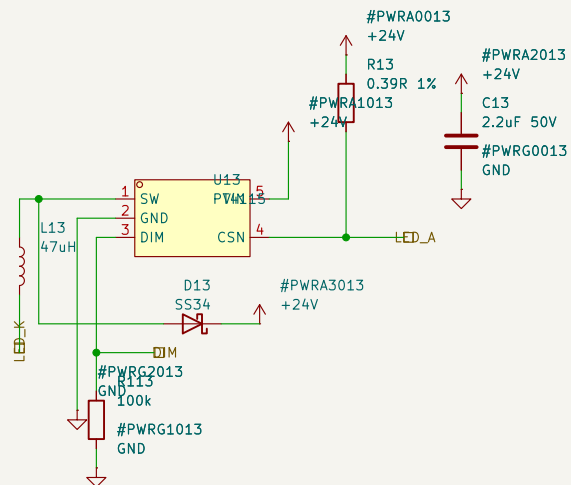


Sheet: /CH13/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 14/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

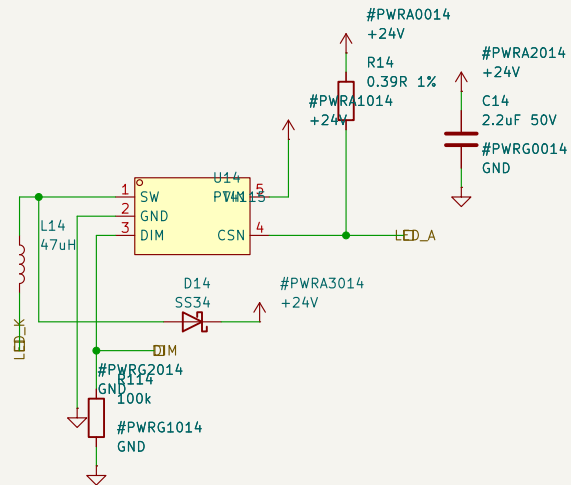


Sheet: /CH14/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 15/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

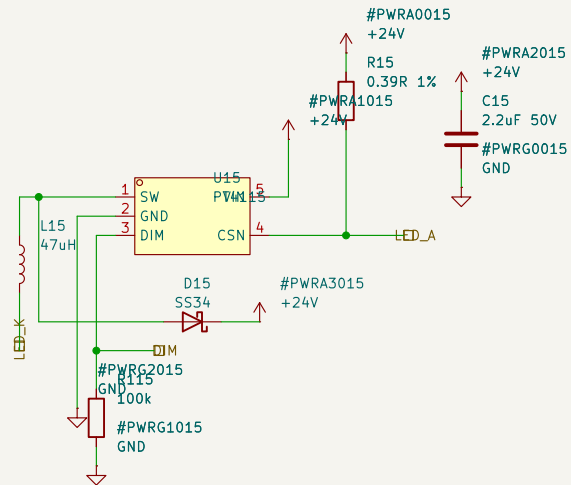


Sheet: /CH15/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3	Id: 16/97	

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

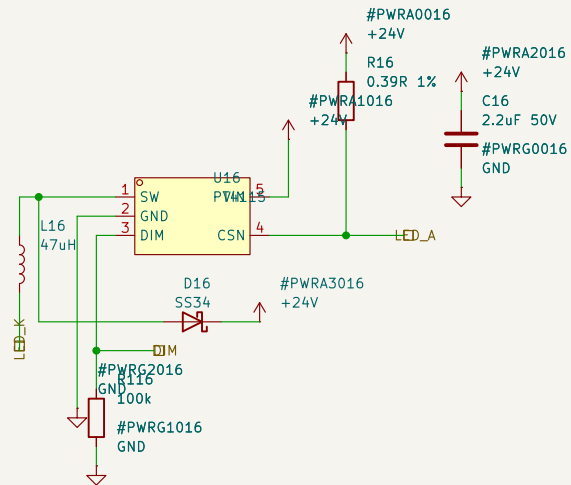

Sheet: /CH16/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 17/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

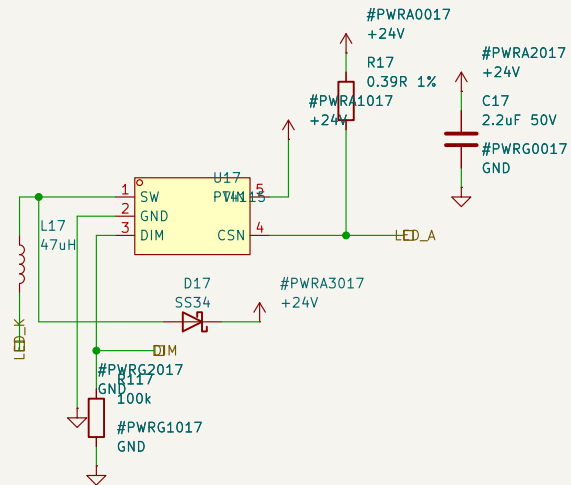


Sheet: /CH17/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 18/97

A	
B	
C	
D	



Id: 19/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

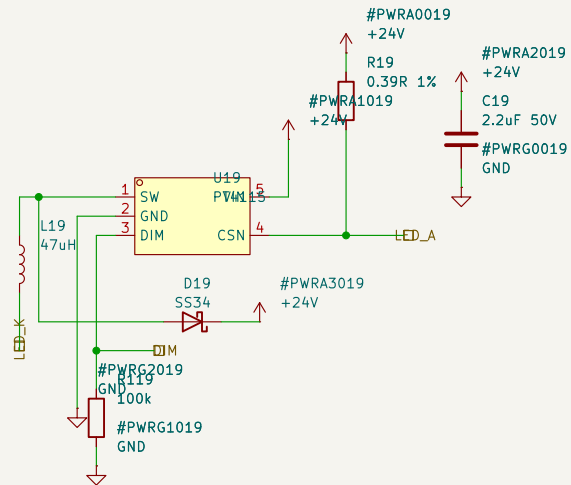

Sheet: /CH19/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 20/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

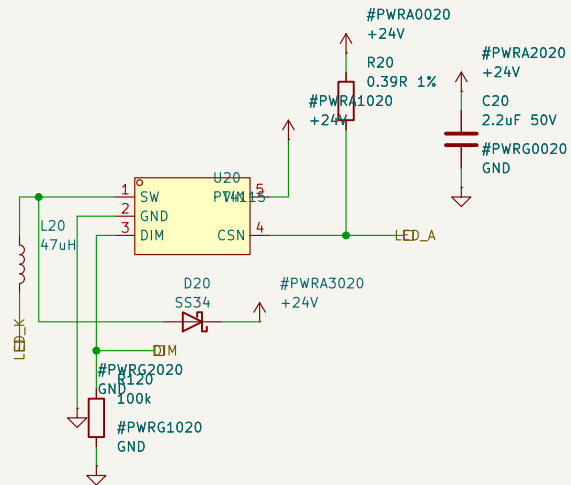

Sheet: /CH20/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 21/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

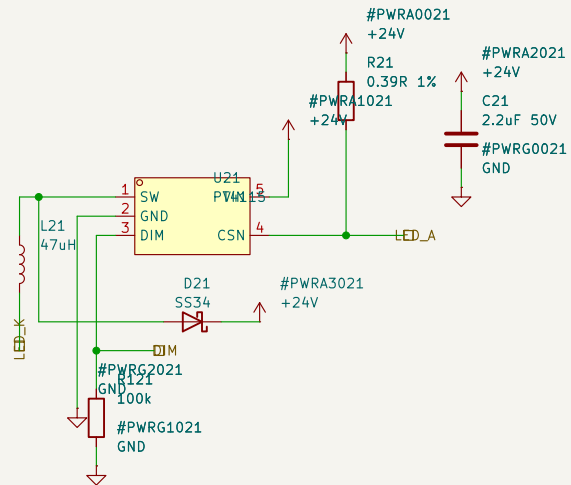

Sheet: /CH21/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 22/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

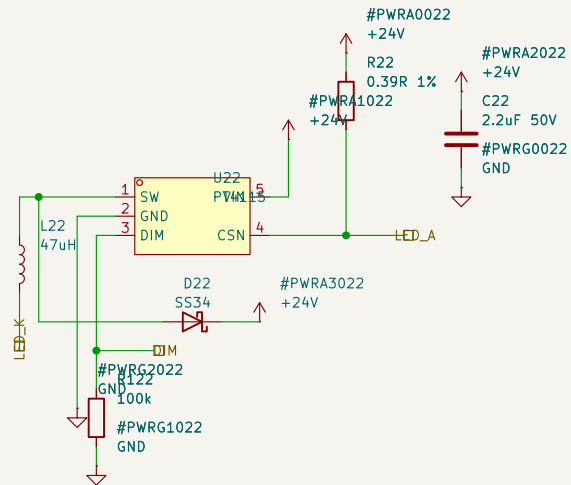


Sheet: /CH22/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 23/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

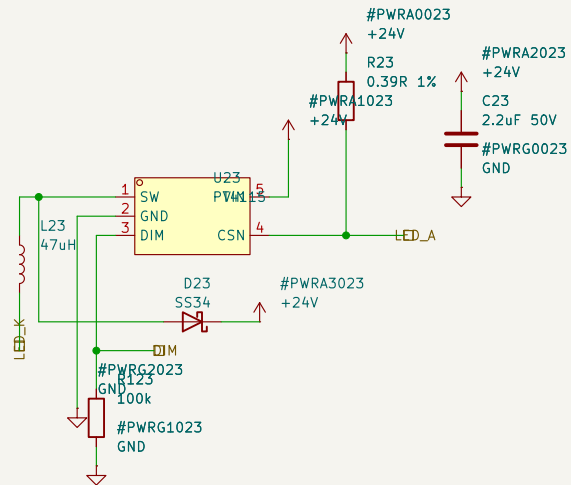

Sheet: /CH23/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3	Id: 24/97	

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

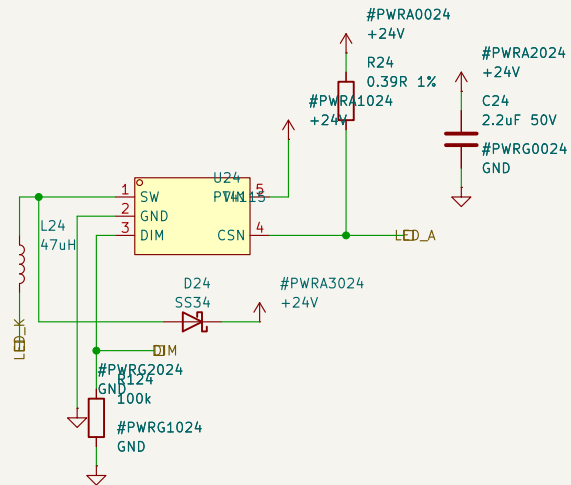


Sheet: /CH24/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 25/97

[illegible]


Id: 26/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

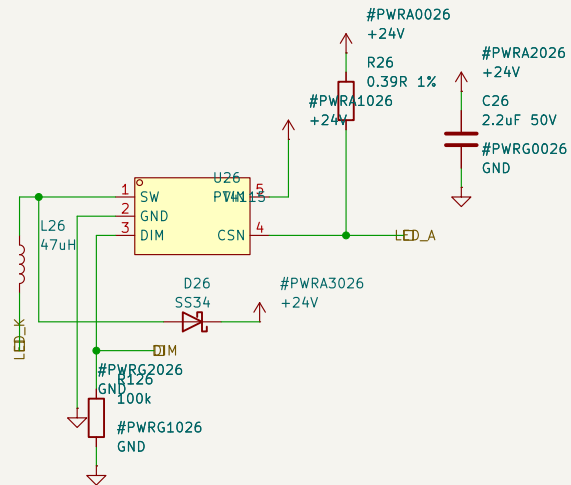


Sheet: /CH26/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 27/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

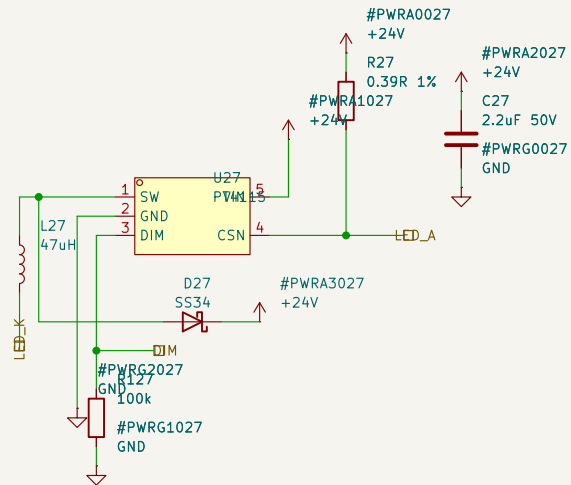


Sheet: /CH27/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 28/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

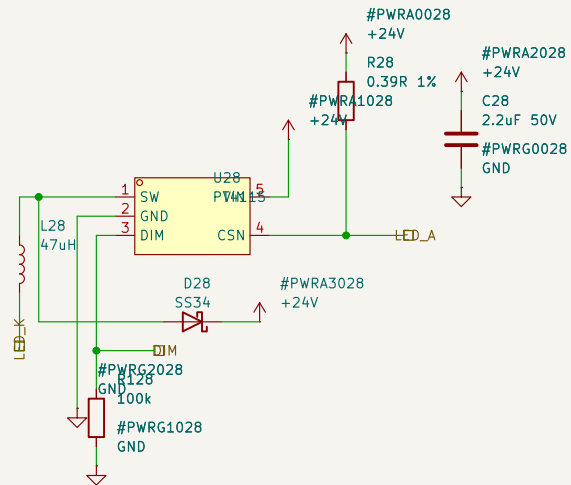


Sheet: /CH28/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 29/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

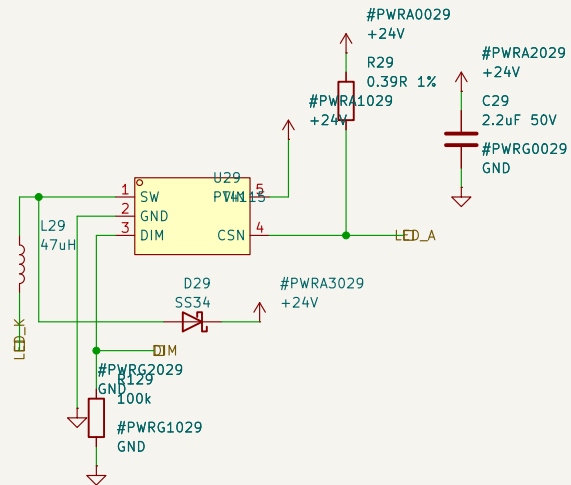

Sheet: /CH29/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 30/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

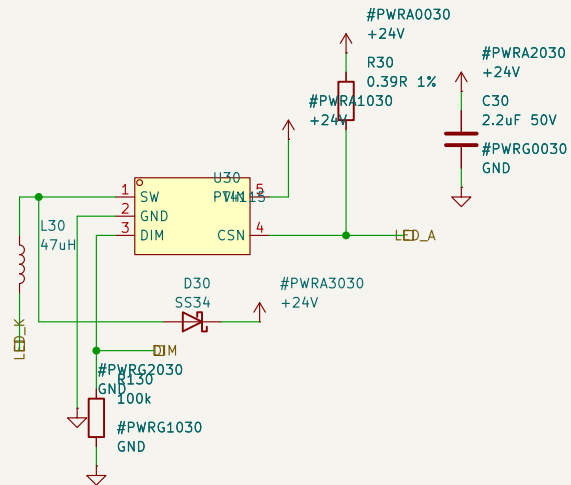

Sheet: /CH30/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 31/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

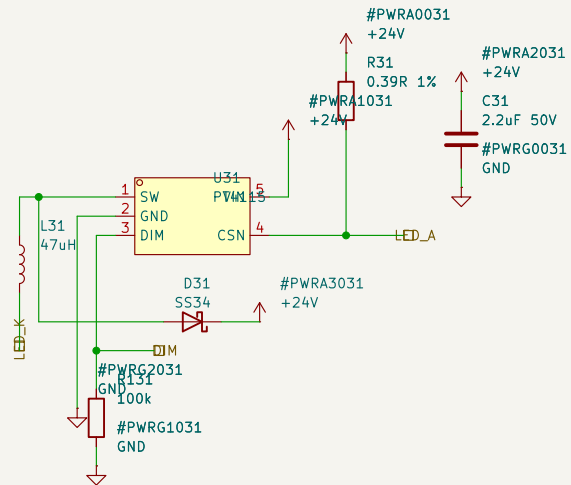


Sheet: /CH31/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 32/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

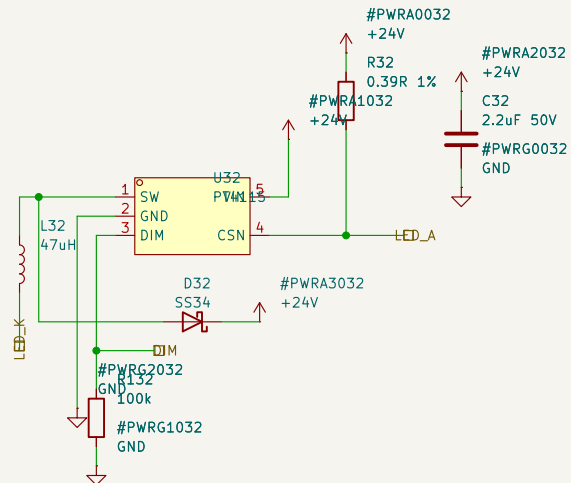

Sheet: /CH32/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 33/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

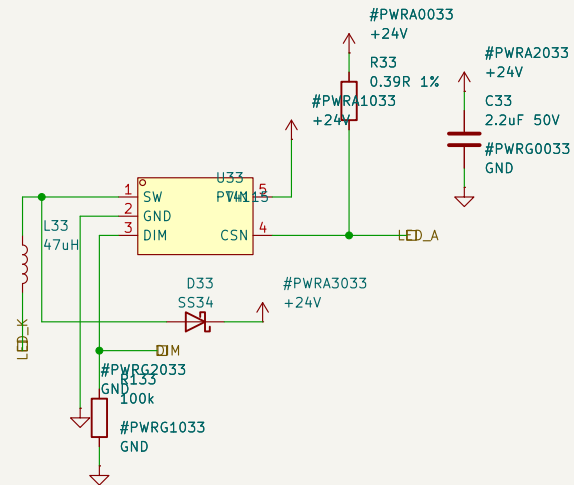

Sheet: /CH33/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3

Id: 34/97


One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

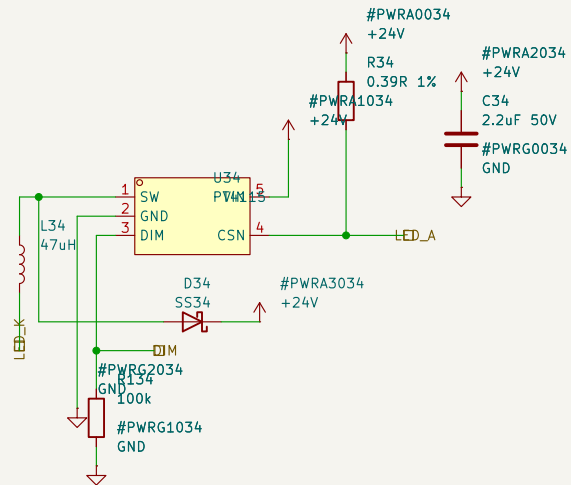

Sheet: /CH34/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 35/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

Sheet: /CH35/
File: channel.kicad_sch
Title: Channel: PT4115 buck 256mA
Size: A4 Date: 2026-07-13 Rev:
KiCad E.D.A. 10.0.3 Id: 36/97

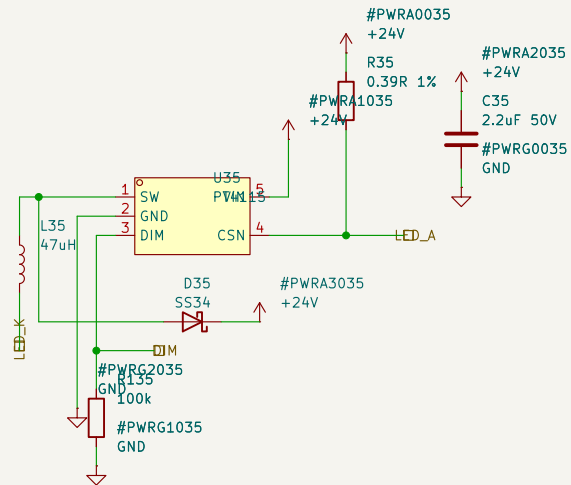

File: channel.kicad_sch

Size: A4


Date: 2026-07-13

SIZE: A1	5
KiCad E.D.A. 10.0.3	

Rev:


Id: 36/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

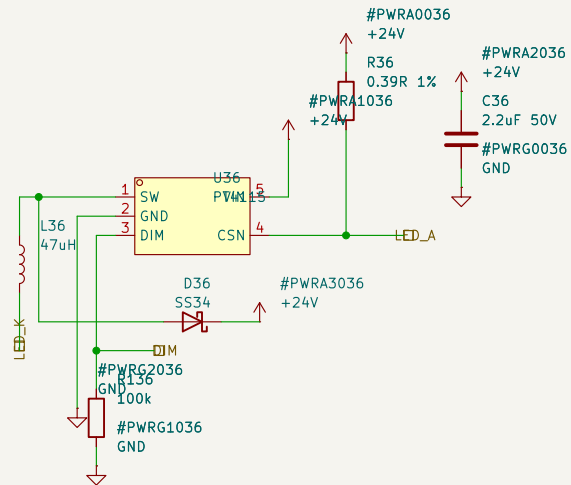


Sheet: /CH36/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 37/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

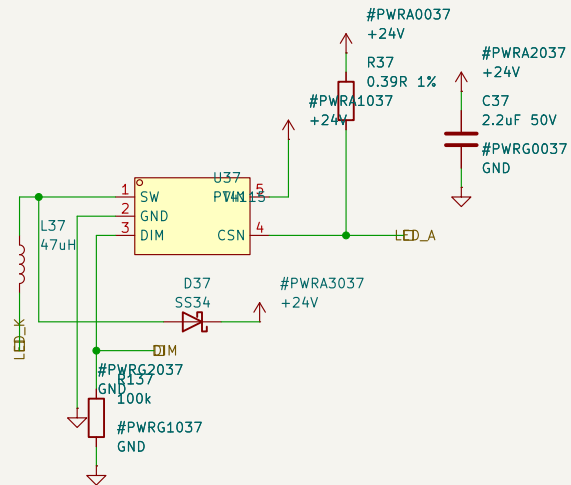


Sheet: /CH37/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 38/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

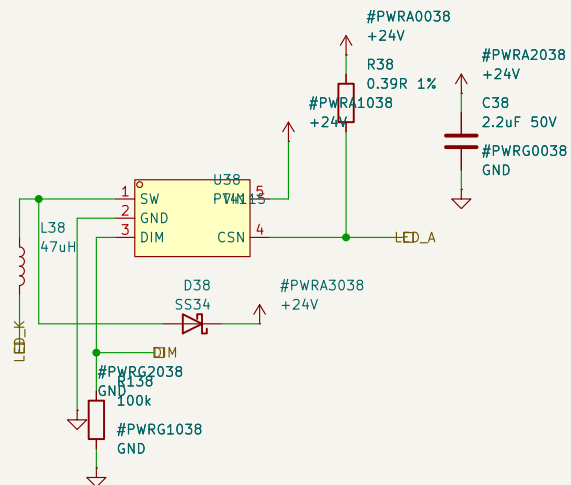


Sheet: /CH38/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 39/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

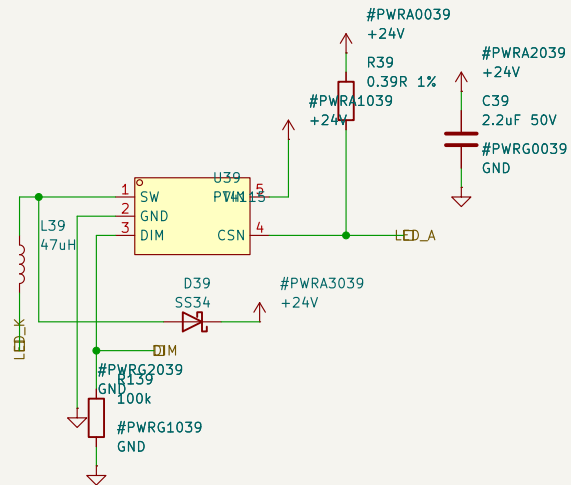


Sheet: /CH39/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 40/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

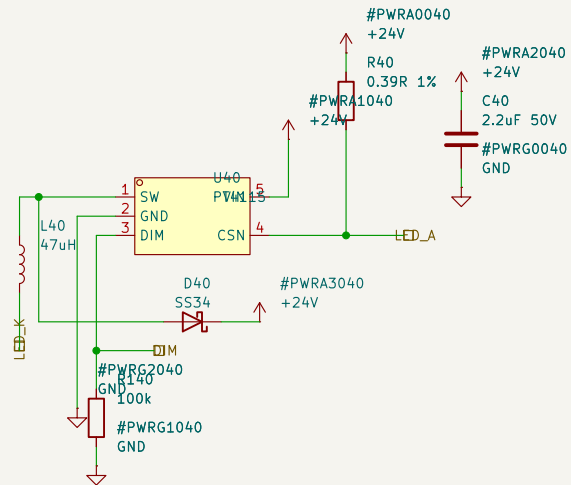


Sheet: /CH40/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 41/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

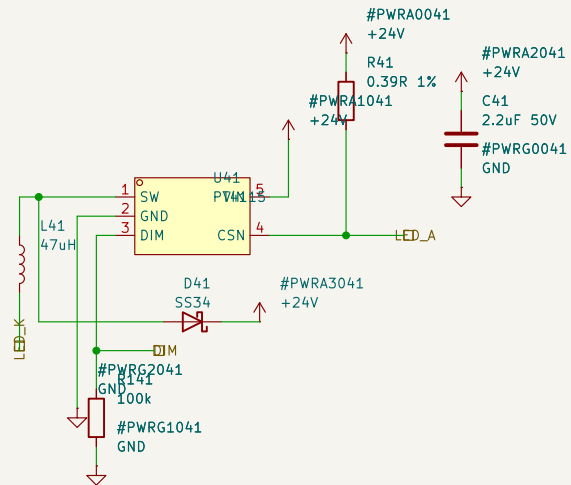

Sheet: /CH41/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 42/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

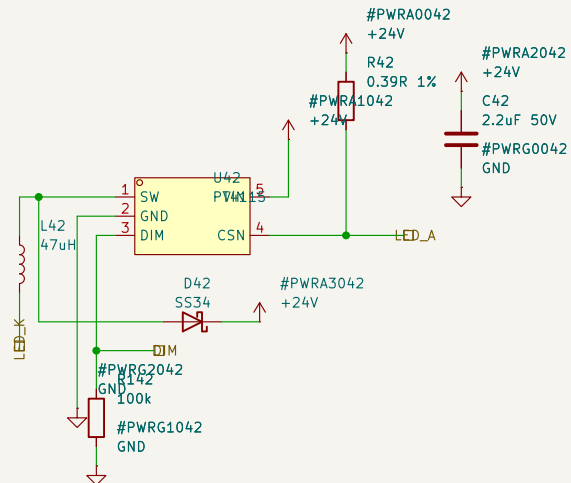

Sheet: /CH42/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 43/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

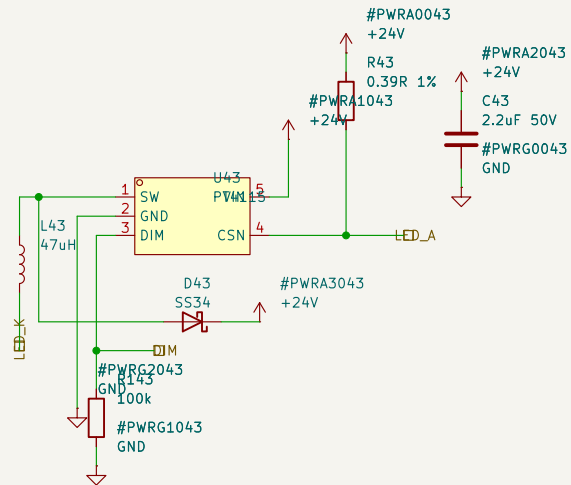


Sheet: /CH43/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 44/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

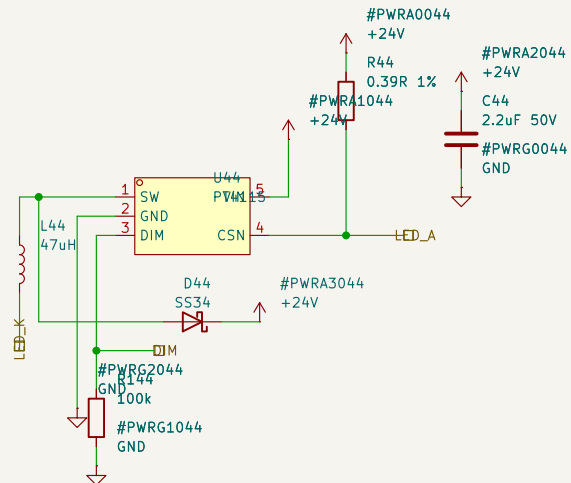

Sheet: /CH44/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 45/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

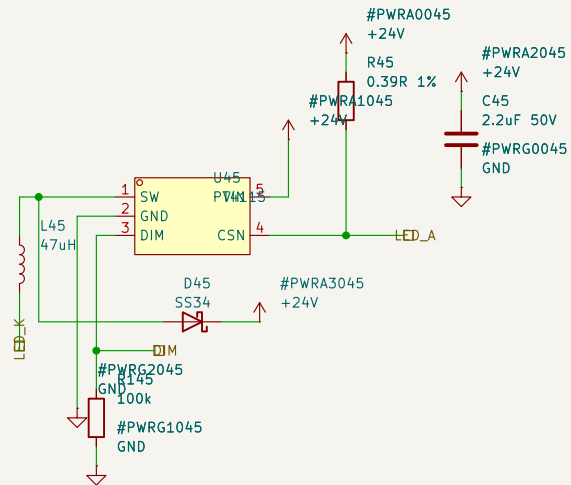

Sheet: /CH45/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3

Id: 46/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

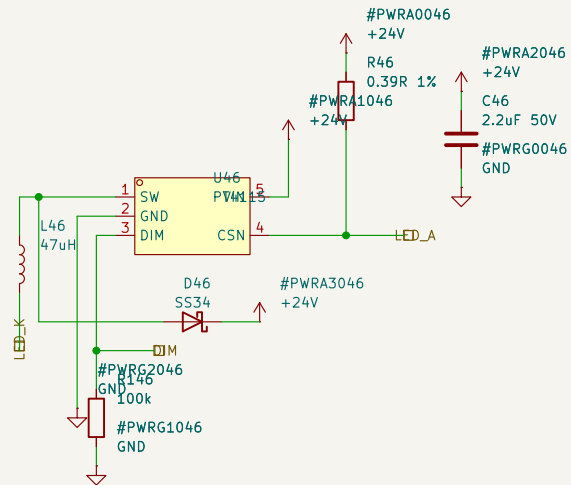

Sheet: /CH46/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4

Date: 2026-07-13

Rev:


KiCad E.D.A. 10.0.3

Id: 47/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

The schematic diagram illustrates a single-channel PT4115 buck converter circuit. The input is a +24V supply (#PWRA0047) connected through a resistor R47 (0.39R, 1%) to the SW pin of the PT4115 IC (U47). A 47µH inductor (L47) is connected between the SW pin and the LED_K terminal. The GND pin of the IC is connected to ground (#PWRG2047) via a 100k resistor (#PWRG1047). The DIM pin is also connected to ground through a 100k resistor. The CSN pin is connected to the LED_A terminal. An SS34 diode (D47) is connected between the SW node and the +24V supply. A 2.2µF capacitor (C47) is connected across the output terminals LED_A and LED_K. Component footprints are labeled as #PWARA0047, #PWRA2047, #PWRA1047, #PWRA3047, #PWRG0047, #PWRG2047, #PWRG1047, L47, D47, C47, U47, and R47.

Sheet: /CH47/ File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 48/97

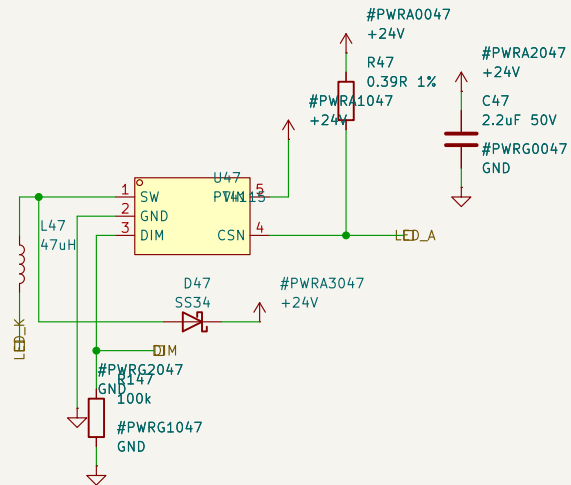

File: channel.kicad_sch

Size: A4


Date: 2026-07-13

SIZE: A1	5
KiCad E.D.A. 10.0.3	

Rev:


Id: 48/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

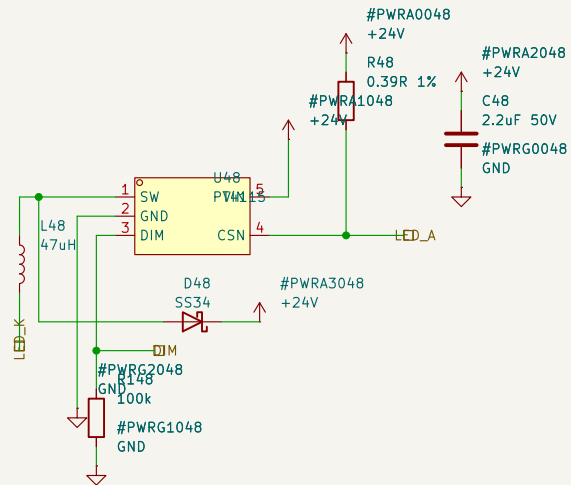

Sheet: /CH48/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 49/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

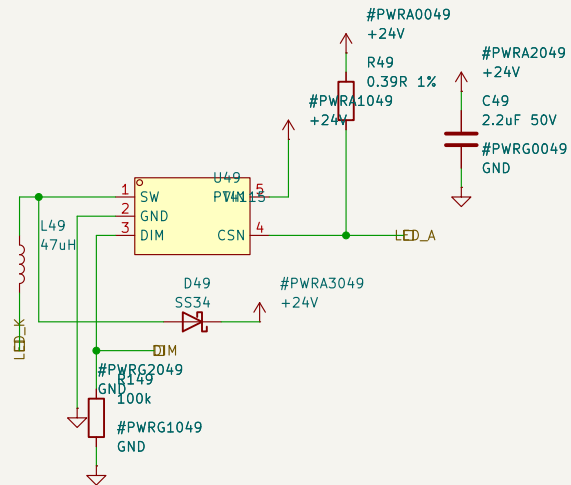

Sheet: /CH49/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4

Date: 2026-07-13


Rev:

KiCad E.D.A. 10.0.3

Id: 50/97

[illegible]

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

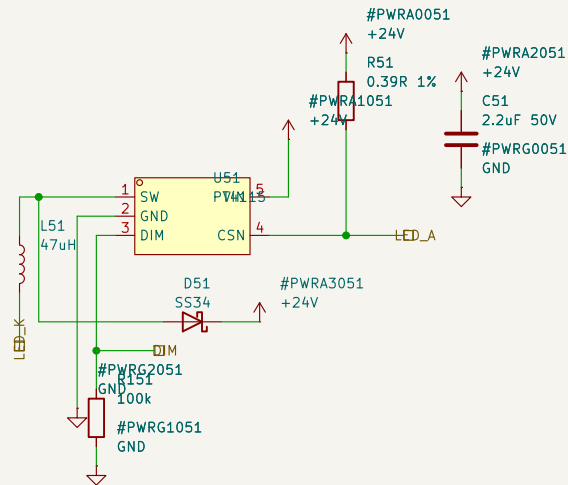


Sheet: /CH51/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 52/97

A
B
C
D




Id: 53/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

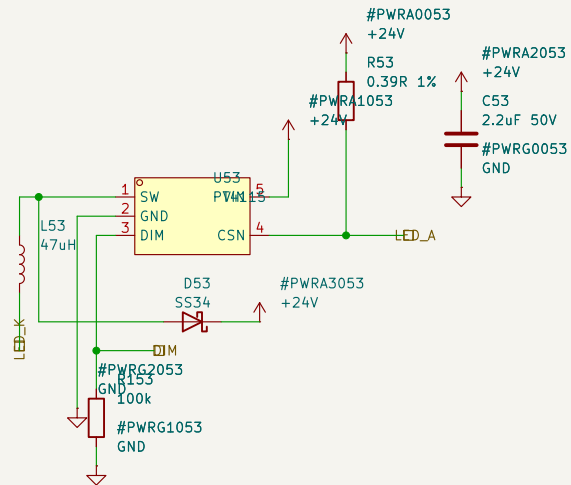


Sheet: /CH53/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 54/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

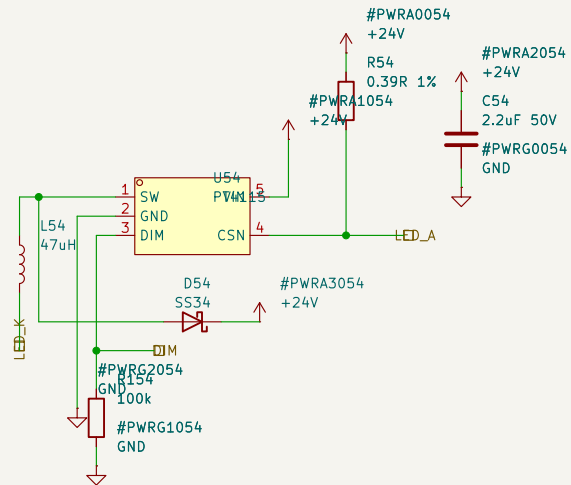


Sheet: /CH54/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3	Id: 55/97	

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

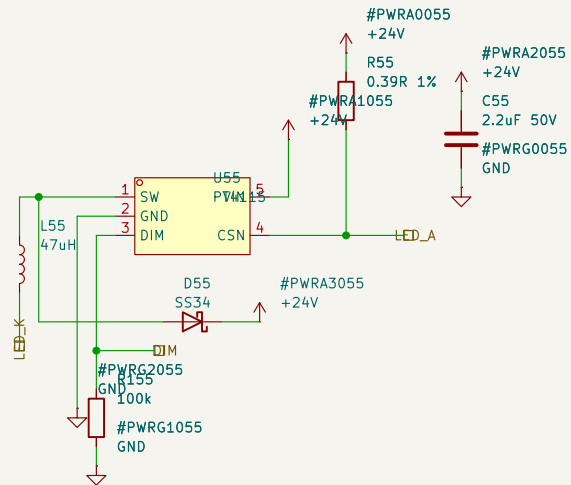


Sheet: /CH55/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 56/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

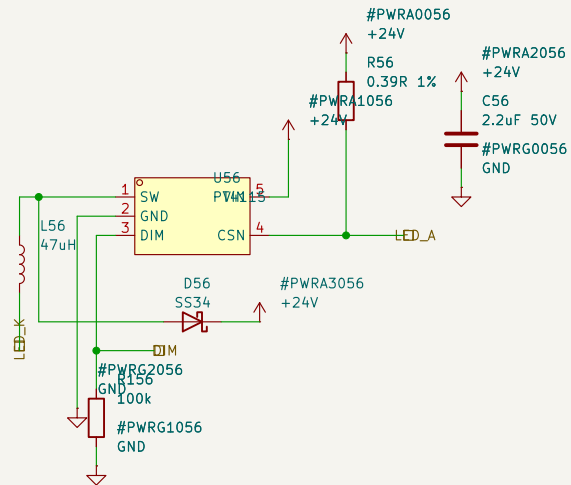


Sheet: /CH56/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 57/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

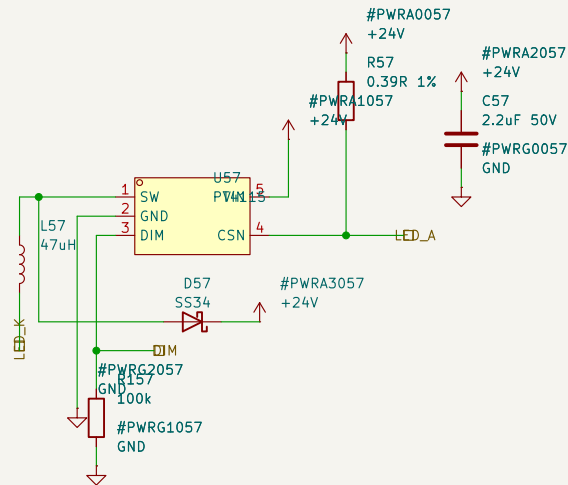

Sheet: /CH57/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 58/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

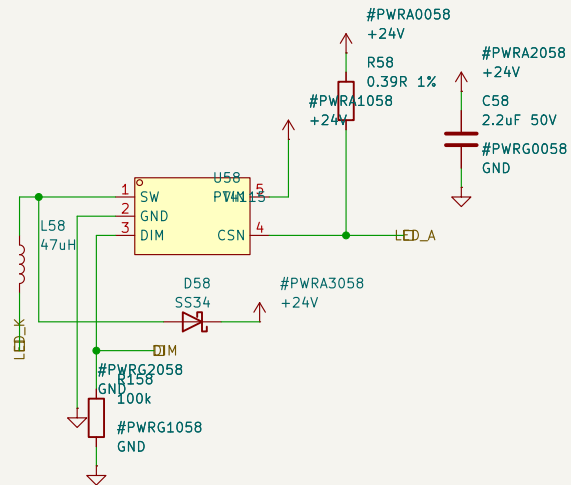

Sheet: /CH58/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 59/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

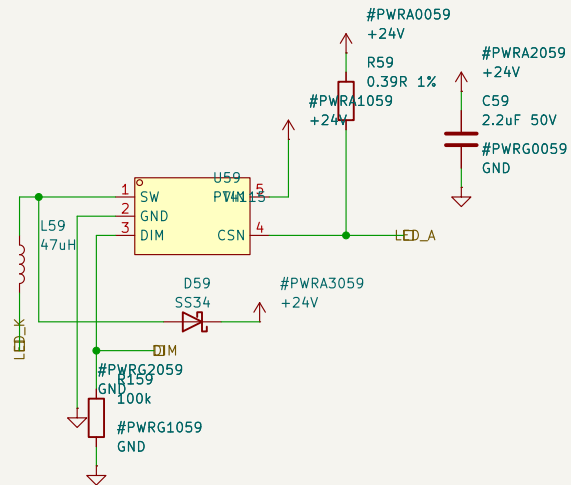

Sheet: /CH59/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3	Id: 60/97	

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

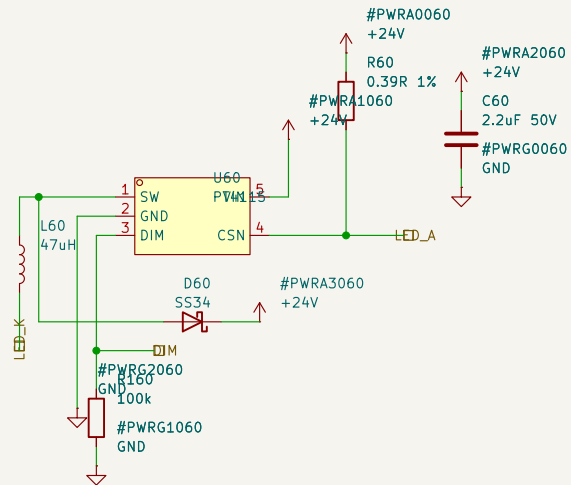

Sheet: /CH60/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 61/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

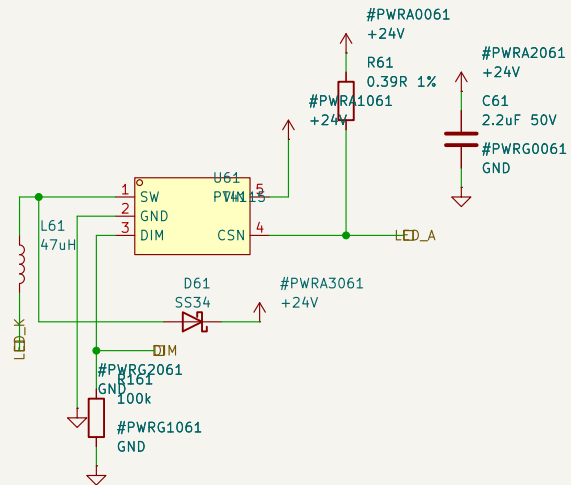


Sheet: /CH61/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 62/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

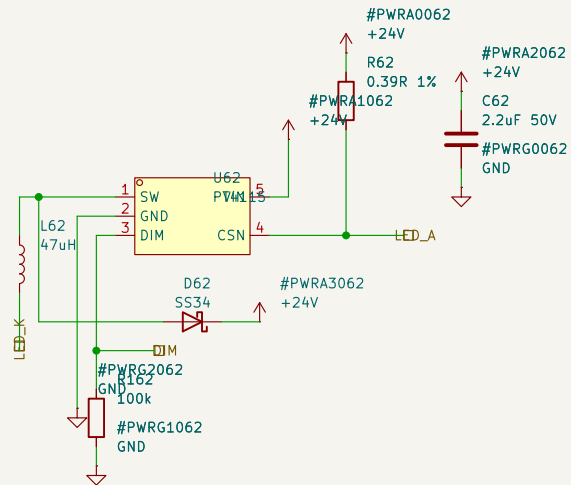

Sheet: /CH62/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 63/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

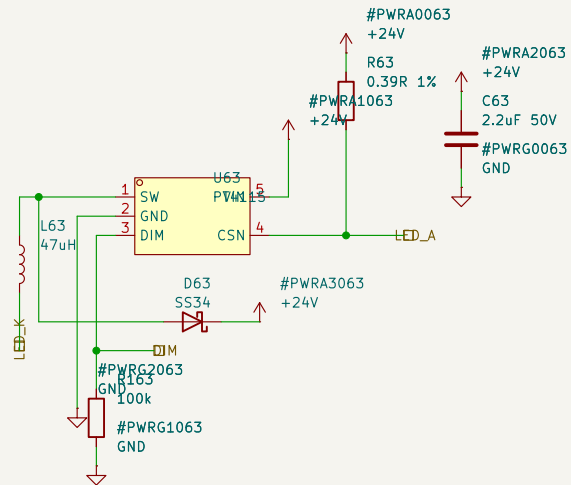


Sheet: /CH63/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 64/97

A
B
C
D




Id: 65/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

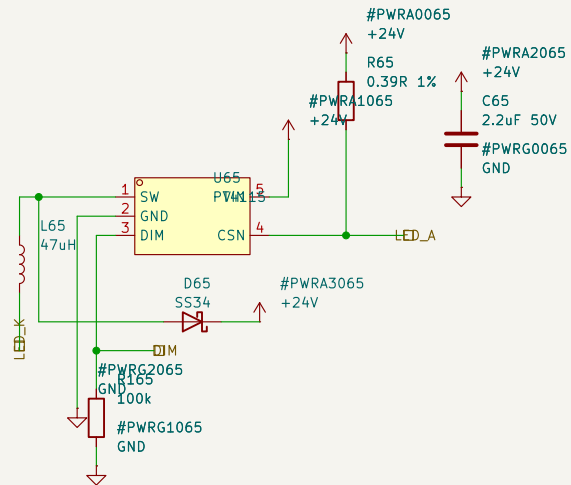

Sheet: /CH65/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 66/97


One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

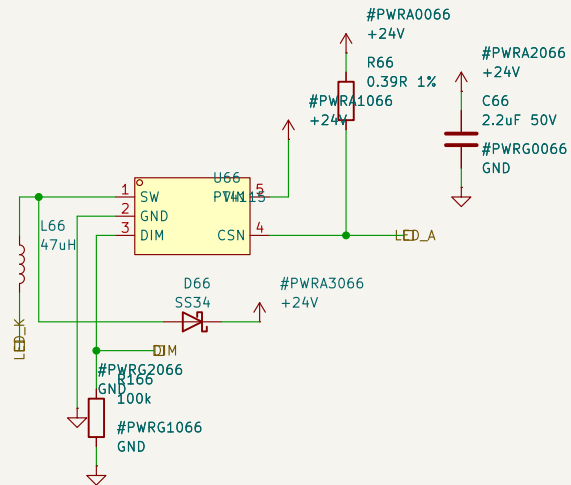

Sheet: /CH66/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 67/97


[illegible]

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

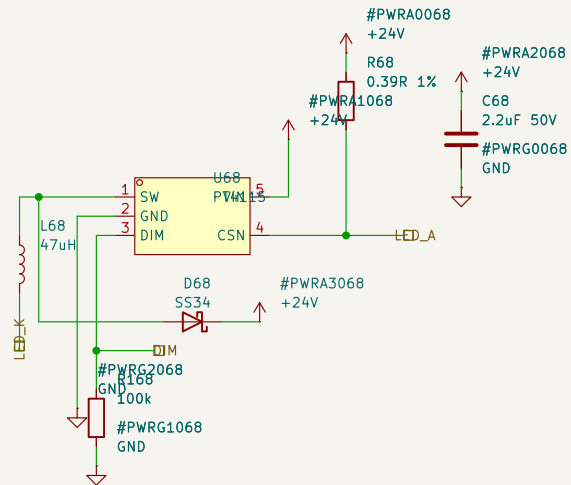


Sheet: /CH68/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 69/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

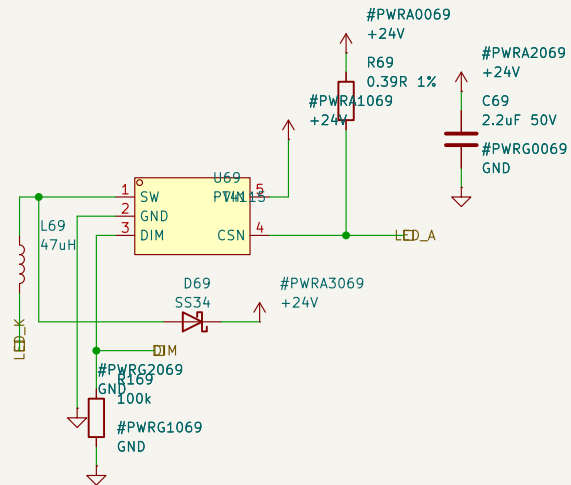


Sheet: /CH69/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 70/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

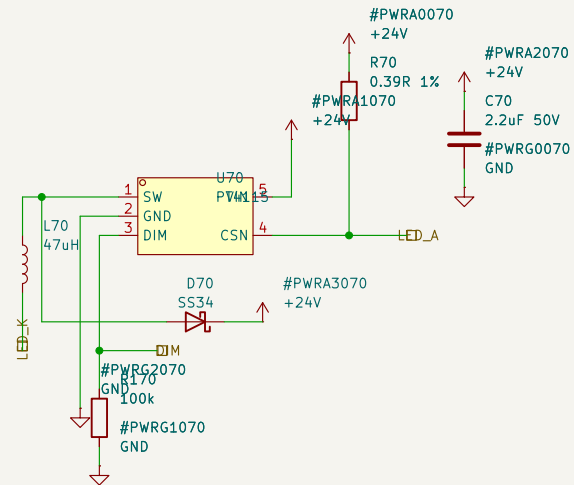

Sheet: /CH70/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 71/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

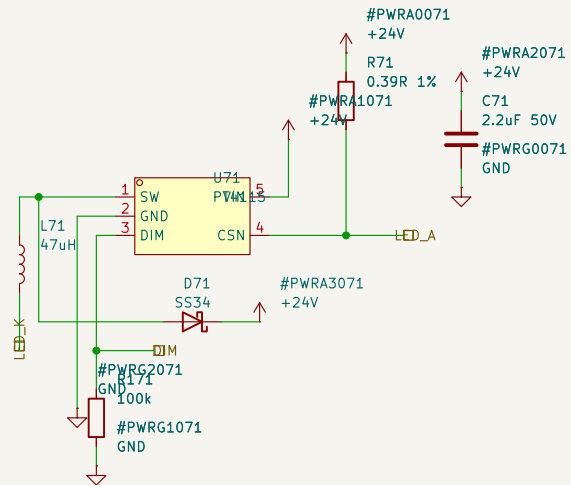

Sheet: /CH71/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 72/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

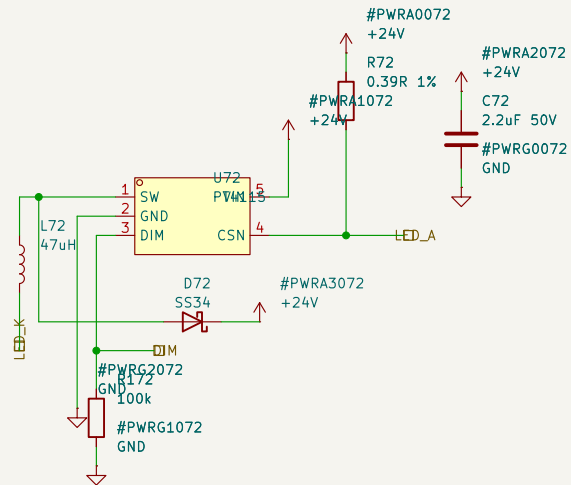


Sheet: /CH72/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 73/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

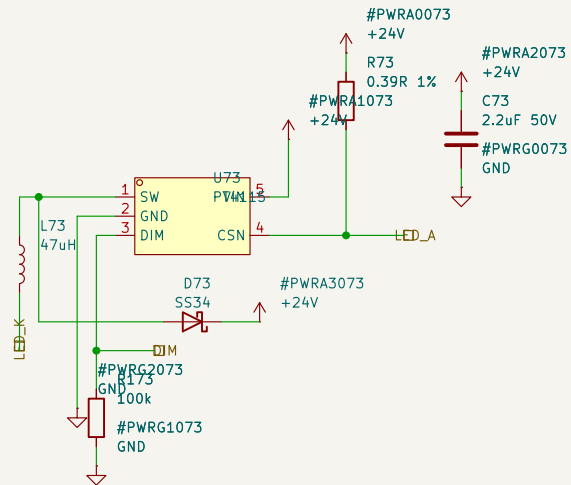


Sheet: /CH73/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 74/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

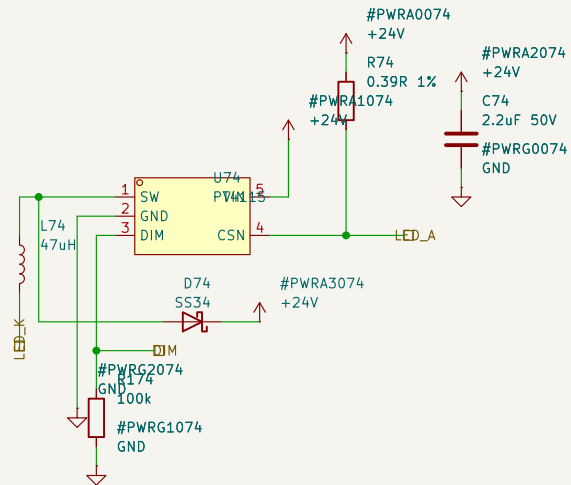

Sheet: /CH74/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 75/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

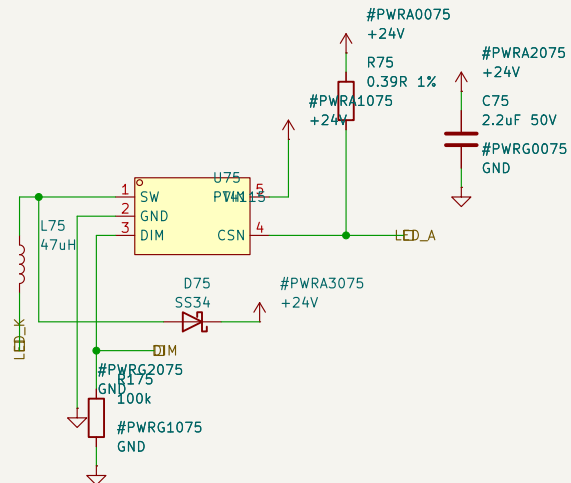

Sheet: /CH75/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 76/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

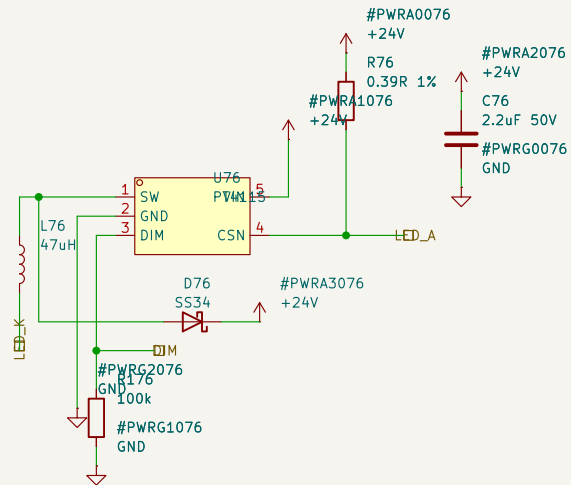

Sheet: /CH76/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 77/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

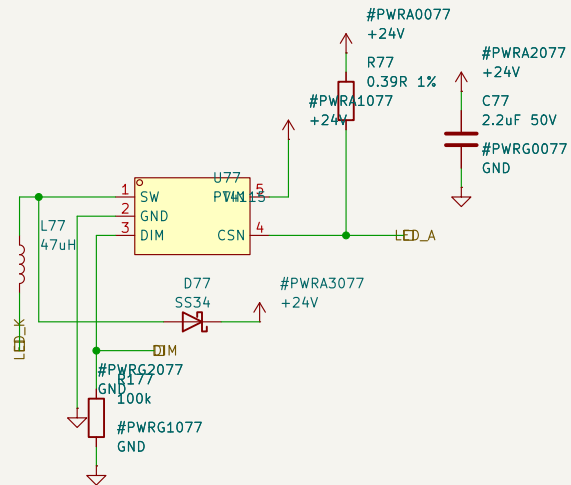

Sheet: /CH77/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3

Id: 78/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

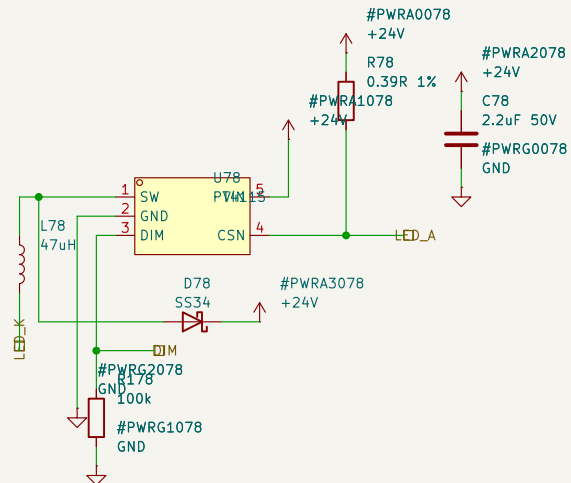

Sheet: /CH78/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3

Id: 79/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

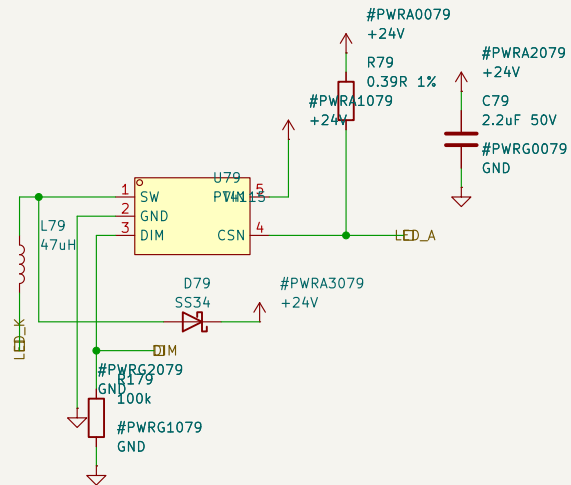

Sheet: /CH79/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 80/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

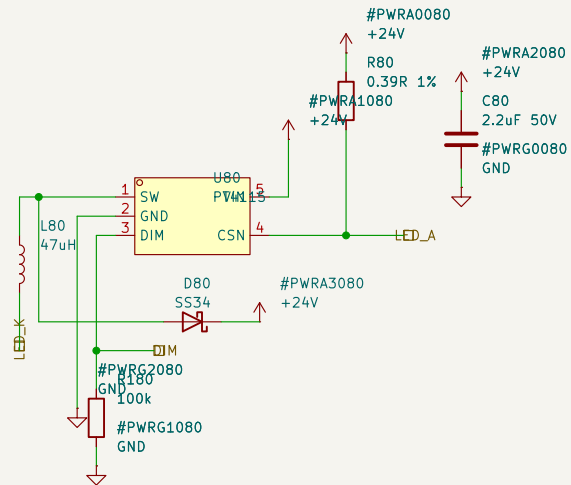

Sheet: /CH80/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 81/97


One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

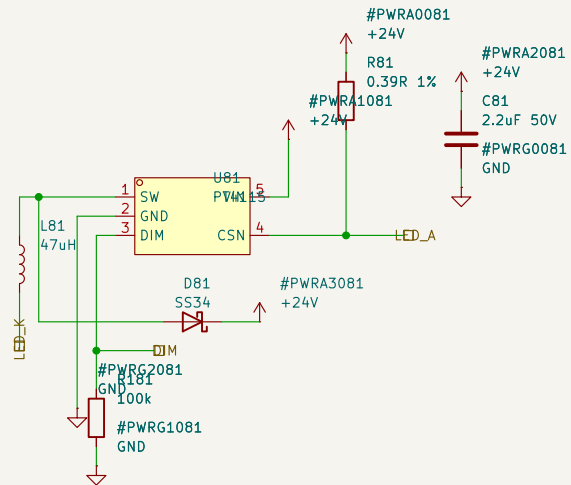

Sheet: /CH81/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 82/97


[illegible]

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

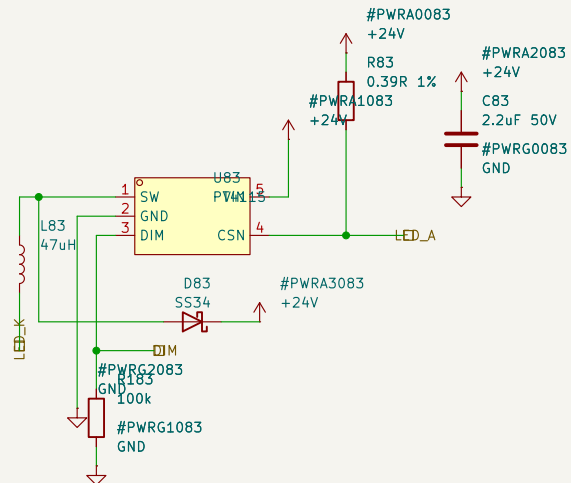

Sheet: /CH83/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 84/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

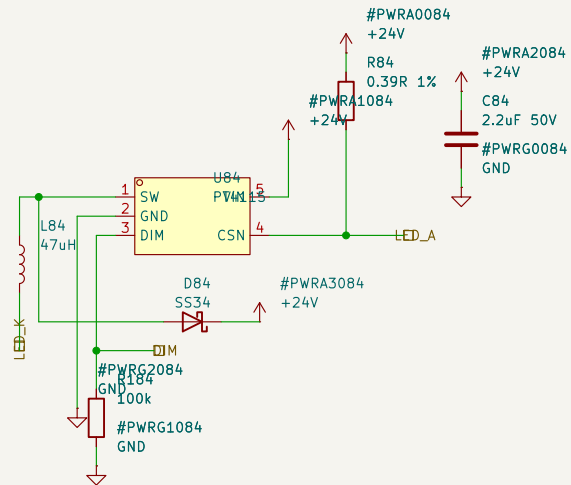

Sheet: /CH84/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 85/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

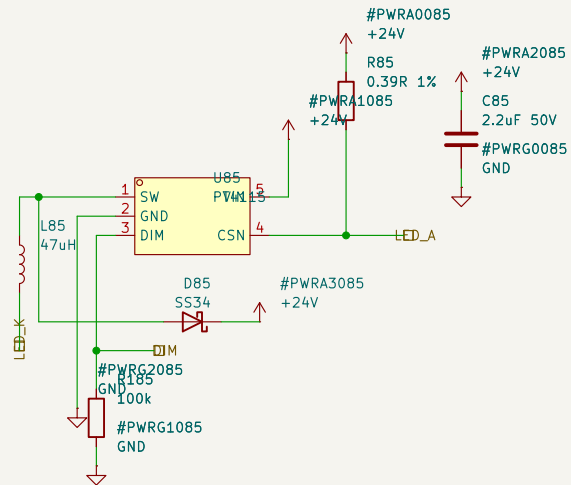

Sheet: /CH85/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 86/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

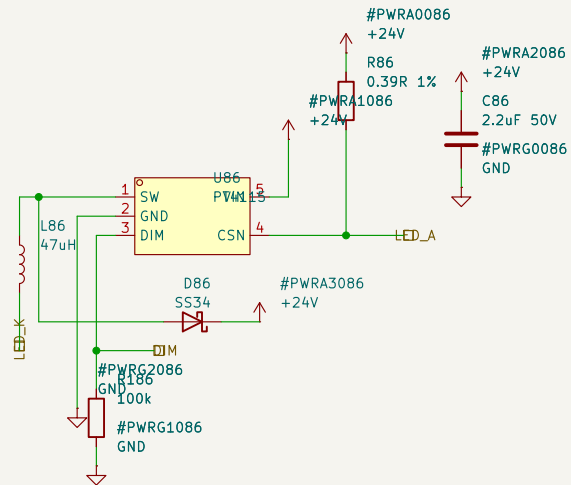

Sheet: /CH86/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 87/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

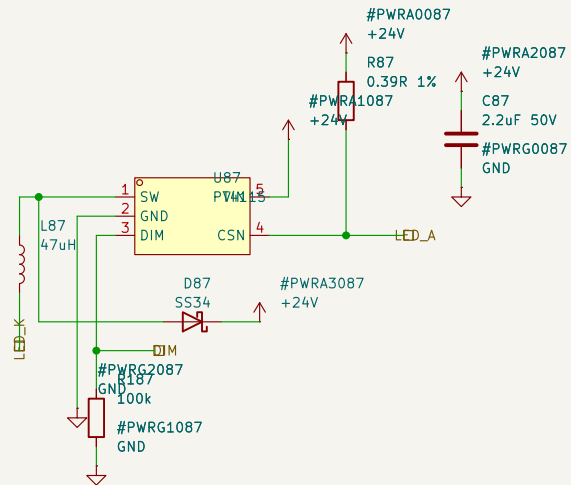

Sheet: /CH87/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 88/97


One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

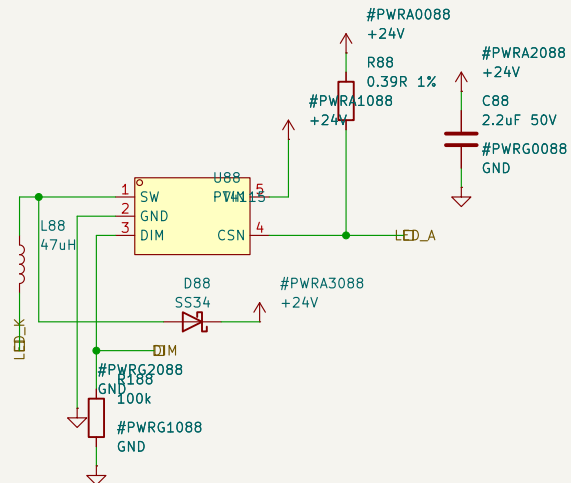

Sheet: /CH88/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 89/97

[illegible]

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

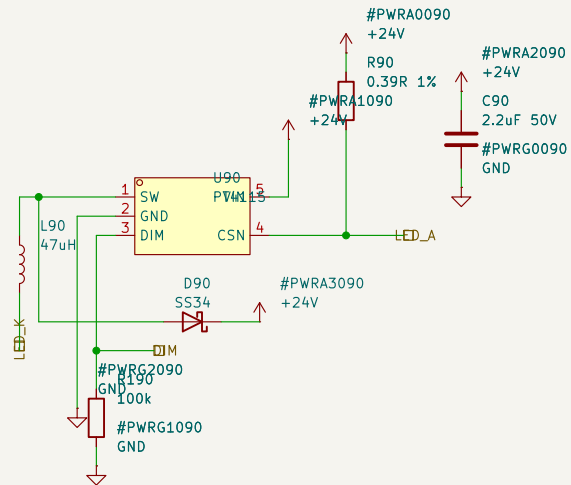

Sheet: /CH90/

File: channel.kicad_sch

Title: Channel: PT4115 buck 256mA

Size: A4


Date: 2026-07-13

Rev:

KiCad E.D.A. 10.0.3


Id: 91/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

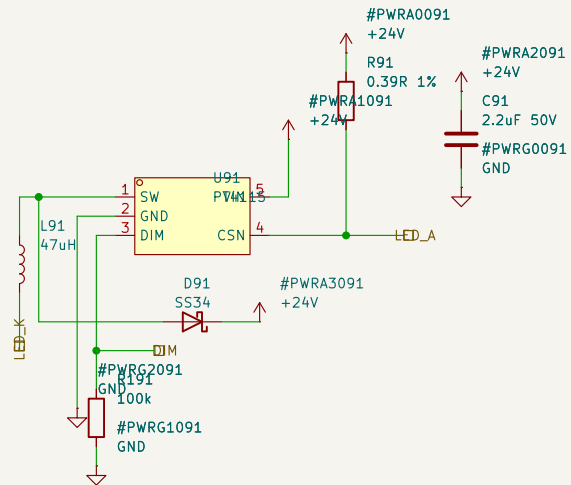


Sheet: /CH91/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 92/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

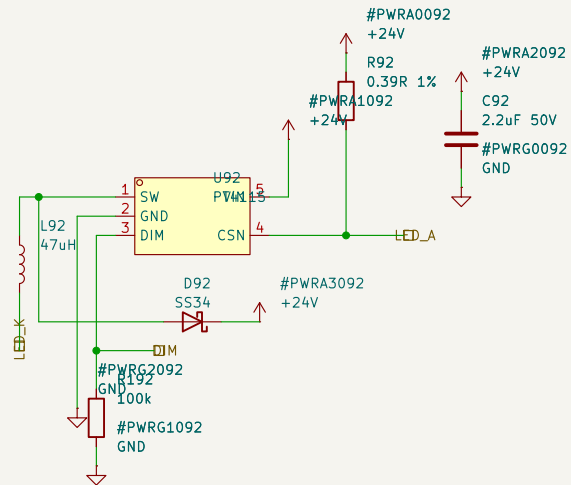


Sheet: /CH92/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 93/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

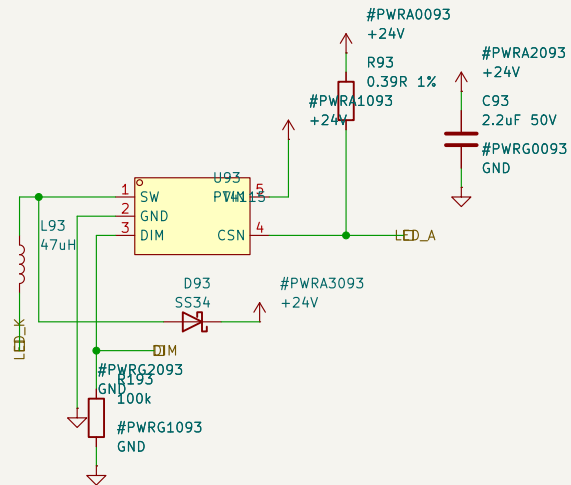


Sheet: /CH93/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 94/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

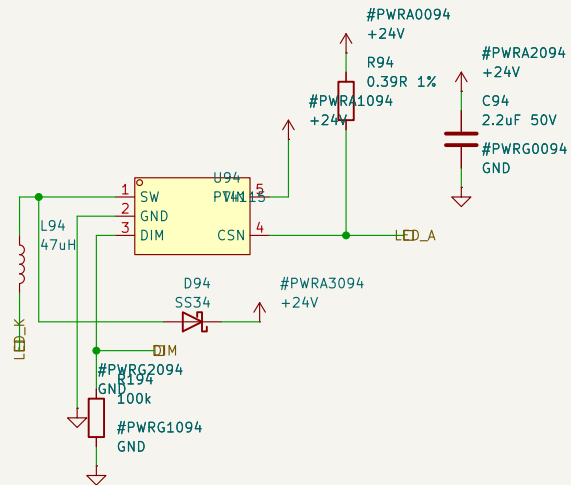


Sheet: /CH94/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 95/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

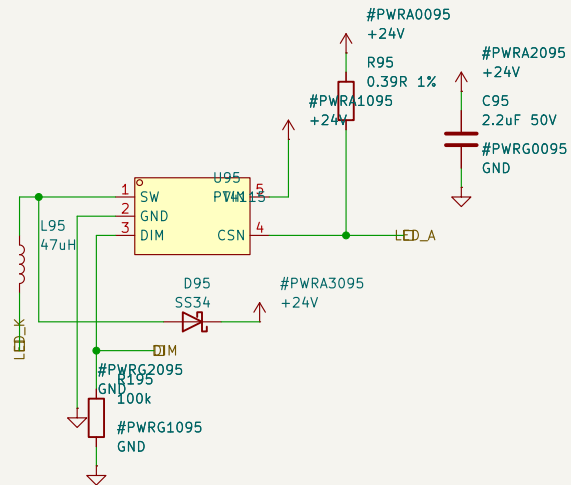

Sheet: /CH95/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 96/97

One channel: PT4115 buck CC @ 256mA ($R_s=0.39R$). SS34 band to +24V. DIM: 100k pulldown = dark boot.
LED_A/LED_K go to the ribbon; wire crossings without junction dots are NOT connected.

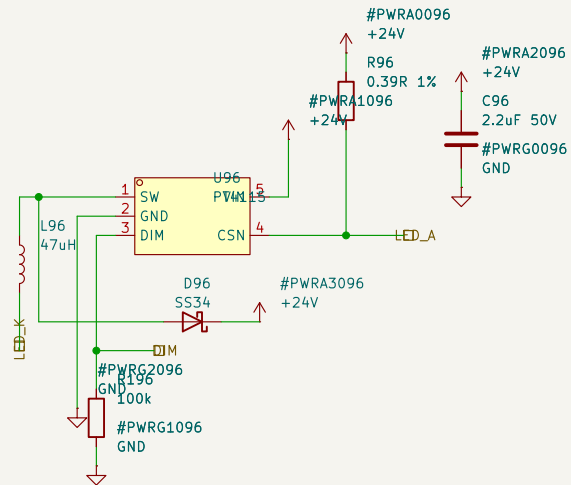

Sheet: /CH96/		
File: channel.kicad_sch		
Title: Channel: PT4115 buck 256mA		
Size: A4	Date: 2026-07-13	Rev:
KiCad E.D.A. 10.0.3		Id: 97/97