

Carlson Testing, Inc.

Bend Office (541) 330-9155
Geotechnical Office (503) 601-8250
Eugene Office (541) 345-0289
Salem Office (503) 589-1252
Tigard Office (503) 684-3460

REPORT OF 4 X 8 CONCRETE CYLINDRICAL TEST SPECIMENS

Test Methods: ASTM C39/C172/C1064/C31/C143/C231/C1231

Date Molded: 08/31/2023

Date Received: 09/01/2023

Job Number: T2302374.

Permit #: NOT APPLICABLE

Client: OREGON ON-SITE CONCRETE - ANDY WALLENDER

Project: OREGON ONSITE CONCRETE - CYLINDER TESTING

Address: 26045 SW GRAHAMS FERRY RD SHERWOOD

Jurisdiction: X

Contractor:

Subcontractor: OREGON ON SITE

Cast By: R. LOVELADY

Concrete Supplier: OREGON ON-SITE CONCRETE

Truck #: N/A

Load #: N/A

Ticket#: N/A

Weather: RAINY

Test Time: 2:30

Air Temp. at Sampling Time: 63

Cylinders were cast for the following locations:

N/A

Total Concrete Placement Location:

N/A

Strength Requirement: 4000 psi f'c @ 28 Days Slump: 3.50" % Air: 3.5%

Mix Number: PDX4000

Concrete Temp: 70

Max Agg: 1"

Admix/Amt: N/A

Cubic Yards: 0/0

Register Number: 00180700

Lab Location: TIGARD

Curing: High **
Low **

Set No.	Test @ Days	Test Date	Total Load	Avg Diameter	Area	Unit PSI	Type Of Fracture	Cap Type	Tested By
II	7	09/07/2023	53035	4.00	12.57	4220	3	PAD 60	NW
II	28	09/28/2023							
II	28	09/28/2023							
II	28	09/28/2023							

☐ Distribute attachments.

Average f'c @ 28 days


Please see reverse side for additional information.

Job Number: T2302374.


Register Number: 00180700

Date Molded: 08/31/2023

Project: OREGON ONSITE CONCRETE - CYLINDER TESTING

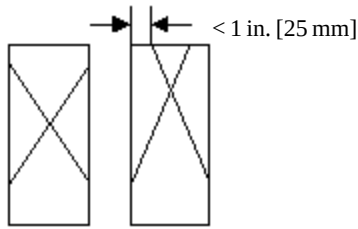

Type 1
Reasonable well-formed
cones on both ends, less
than 1 in. [25 mm] of
cracking through caps

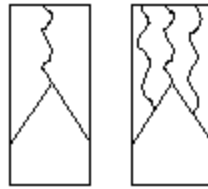


Type 2
Well-Formed cone on one
end, vertical cracks running
through caps, no well-defined
cone on other end



Type 3
Columnar vertical cracking
through both ends, no
well-formed cones



Type 4
Diagonal fracture with
no cracking through
ends; tap with hammer to
distinguish from Type 1

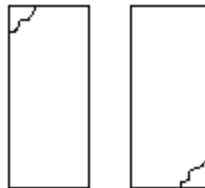

Type 5
Side fractures at top or
bottom (occur commonly
with unbonded caps)



Type 6
Similar to Type 5 but
end of cylinder is pointed

** Not measured - Departure from ASTM C31 standard

Remarks:

CC: OREGON ON-SITE CONCRETE - ANDY WALLENDER

ANDY@OREGONONSITE.COM

X

Project Manager: Jason Bryant

Reviewed By: Project Manager On 09/11/2023

Our reports pertain to the material tested/inspected only. Information contained herein is not to be reproduced, except in full, without prior authorization from this office. Under all circumstances, the information contained in this report is provided subject to all terms and conditions of CTI's General Conditions in effect at the time this report is prepared. No party other than those to whom CTI has distributed this report shall be entitled to use or rely upon the information contained in this document.