1290 Weston Road, Suite 306
Weston, FL 33326
U.S.A.
www.Micrium.com

The Real-Time kernel

Release Notes

Phone: +1 954 217 2036   FAX: +1 954 217 2037

(2014/04/16)

This is a minor release as it contains only a few items that were not caught prior to releasing V2.92.10.

CHANGES TO V2.92.10

1) **OS_TASK.C:**

In OSTaskResume(), fixed resuming a task that was suspended while multi-pending.

(2013/12/27)

This is a minor release as it contains only a few items that were not caught prior to releasing V2.92.09.

CHANGES TO V2.92.09

1) **OS_TLS.C:**
   Fixed compilation errors when using the full IAR DLIB library.

This is a minor release as it contains only a few items that were not caught prior to releasing V2.92.08.

CHANGES TO V2.92.08

1) **OS_CORE.C:**
   In `OS_EventTaskRemove()`, `ptcb->OSTCBEventPtr` is now set to `(OS_EVENT *)0` before exiting. This created problems when changing the priority of a task made ready to run but hasn't been scheduled yet.

This is a minor release and only contains the addition of one feature: Thread Local Storage (TLS).

ADDED FEATURES

Thread Local Storage (TLS) allows each task to have task specific variables that are typically required by compilers and their run-time library. TLS is optional and only currently available for a couple of compilers (CCES from Analog Devices and Embedded Workbench from IAR). TLS requires that you enable this feature by setting the TLS table size (see the MicroC/OS-II user's manual) through the `#define` `OS_TLS_TBL_SIZE` and, if defined, must be greater than 0.

TLS is mandatory if you use non-reentrant library functions that are not protected by either a mutex or a semaphore. For example the '`strtok()`' function needs to keep a copy of a pointer for further invocations of `strtok()`. This local pointer is now saved as part of the TLS management when TLS is enabled and thus does not require that you protect the non-reentrant code with a mutex or a semaphore.

1) A number of 'internal' functions have been added to support TLS. However, as the user, you only need to:
    a. Include '`os_tls.c`' in your build
    b. Set the value of `OS_TLS_TBL_SIZE` to a size sufficiently large as required by the tool vendor support by this TLS implementation.
    c. Enable semaphores (set `OS_SEM_EN` to `1` in `os_cfg.h`).

This is a minor release as it contains only a few items that were not caught prior to releasing V2.92.

ADDED FEATURES

Below is a list of the features added to V2.92:

2)	Added `OSTaskRegGetID()` which allows your application to obtain a task register dynamically (i.e. at run-time) instead of using `#define` to set task register IDs. It's important that you either use 'dynamic task register ID allocation' or 'static register ID allocation' but not both. The preferred method is to use `OSTaskRegGetID()` throughout your code.

3)	Added `#define MICRIUM_SOURCE` to all the `.C` files to identify that the files contain Micrium source files.

4)	Version numbering now contains 3 fields: X.YY.ZZ where X is the version of the kernel (µC/OS-II is 2), YY is the major release number (92) and ZZ is a minor release number (07). Calling `OSVersion()` will return the version number multiplied by 10000. In other words, V2.92.07 will be returned as 29207.

CHANGES TO V2.92

1)	**OS_CORE.C:**
In `OSSchedUnlock()`, moved the test to check if called from an ISR before the test of the lock nesting level.

2)	**OS_FLAG.C:**
Added 'pend_stat' to `OS_FlagTaskRdy()` to allow `OSFlagDel()` to returns `OS_ERR_PEND_ABORT` when called with the `OS_DEL_ALWAYS` option.

3)	**OS_MBOX.C:**
`OSMboxDel()` now returns `OS_ERR_PEND_ABORT` when called with the `OS_DEL_ALWAYS` option.

4)	**OS_MUTEX.C:**

Changed PIP to PCP to reflect that the mutex services implement a 'Priority Ceiling Protocol' instead of a 'Priority Inheritance Protocol'.

Added an option to `OSMutexCreate()` to allow to disable the priority ceiling protocol making the mutex behave like a plain binary semaphore. This is done by specifying 'OS_PRIO_MUTEX_CEIL_DIS' for the 'prio' argument.

5) **OS_Q.C:**
`OSQDel()` now returns `OS_ERR_PEND_ABORT` when called with the `OS_DEL_ALWAYS` option.

6) **OS_SEM.C:**
`OSSemDel()` now returns `OS_ERR_PEND_ABORT` when called with the `OS_DEL_ALWAYS` option.

7) **OS_TASK.C:**
Added `OSTaskRegGetID()` to dynamically assign task IDs instead of assigning task IDs statically through `#define` constants. It's important that you either use 'dynamic task register ID allocation' or 'static register ID allocation' but not both. The preferred method is to use `OSTaskRegGetID()` throughout your code.

You now need to allocate an `INT8U` variable for each task register IDs and use those variables to specify the desired task register. In other words:

```
INT8U  MyTaskRegID;

   :
   :
   MyTaskRegID = OSTaskRegGetID(&err);
   :
   :
```

7) **uCOS_II.H:**
Added `OS_PRIO_MUTEX_CEIL_DIS`
Changed `OS_ERR_PIP_LOWER` to `OS_ERR_PCP_LOWER`
Added `OS_ERR_NO_MORE_ID_AVAIL`
Changed `OSMutexPIP` to `OSMutexPCP` in the `OS_MUTEX_DATA` structure.
Added the variable `OSTaskRegNextAvailID`
Added the prototype for `OSTaskRegGetID()`

This is a minor release as it contains only a few items that were not caught prior to releasing V2.90.

CHANGES TO V2.90

You should follow these steps in order to upgrade from a previous version to V2.90.

1) **OS_TASK.C:**
   Corrected error description in `OSTaskCreateExt()` and `OSTaskCreate()` for return error `OS_ERR_PRIO_EXIST`.

2) **OS_TASK.C:**
   Added safety critical check for '`perr`' argument in `OSTaskRegGet()` and `OSTaskRegSet()`.

3) **OS_TASK.C:**
   Changed `OSTaskStkChk()` to return used/free stack space in number of entries.

4) **OS_TMR.C:**
   Overwrite timer name to '?' if a `NULL` '`pname`' argument is passed to `OSTmrCreate()` to prevent statistics and kernel awareness to try to de-reference a `NULL` pointer.

5) **OS_CORE.C:**
   Added extended argument check for `NULL` pointer passed to `OS_StrLen()`.

6) **OS_CORE.C:**
   Corrected comment on `OS_TaskStatStkChk()` to reflect used stack space stored in number of entries.

7) **uCOS_II.H:**
   Corrected comment on `OS_STK_DATA` to reflect used/free stack space in number of entries.

8) **All Files:**
   Added return statements following all `OS_SAFETY_CRITICAL_EXCEPTION()` macros to allow custom implementation to continue execution.

This is a minor release as it contains only a few items that were not caught prior to releasing V2.89.

CHANGES TO V2.89

You should follow these steps in order to upgrade from a previous version to V2.89.

1) **OS_CORE.C:**
   Added `OSSafetyCriticalStart()` to indicate that all initialization has been completed and that kernel objects are no longer allowed to be created.

2) **All Files:**
   Modified the source code to reduce the number of MISRA-C 2004 rules not respected:

   > 8.5 - there shall be no definition of objects or functions in a header file
   > 14.7 - a function should have a single point of exit
   > 15.2 - every non-empty case clause in a switch statement shall be terminated with a break statement
   > 15.4 - only one case - a switch expression should not represent a Boolean value
   > 17.4 - array indexing shall only be applied to objects defined as an array type
   > 17.4 - pointer arithmetic should not be used

3) **uCOS_II.H:**
   Corrected compilation error when `OS_EVENT_EN` is disabled and `OS_FLAG_EN` is enabled.

4) **OS_FLAG.C:**
   Replaced safety critical test to check `OSSafetyCriticalStartFlag` set by `OSSafetyCriticalStart()` on `OSFlagCreate()`.

5) **OS_MBOX.C:**
   Replaced safety critical test to check `OSSafetyCriticalStartFlag` set by `OSSafetyCriticalStart()` on `OSMboxCreate()`.

6) **OS_MEM.C:**
   Replaced safety critical test to check `OSSafetyCriticalStartFlag` set by `OSSafetyCriticalStart()` on `OSMemCreate()`.

7) **OS_MUTEX.C:**
Replaced safety critical test to check `OSSafetyCriticalStartFlag` set by `OSSafetyCriticalStart()` on `OSMutexCreate()`.

8) **OS_Q.C:**
Replaced safety critical test to check `OSSafetyCriticalStartFlag` set by `OSSafetyCriticalStart()` on `OSQCreate()`.

9) **OS_SEM.C:**
Replaced safety critical test to check `OSSafetyCriticalStartFlag` set by `OSSafetyCriticalStart()` on `OSSemCreate()`.

10) **OS_TASK.C:**
Replaced safety critical test to check `OSSafetyCriticalStartFlag` set by `OSSafetyCriticalStart()` on `OSTaskCreateExt()` and `OSTaskCreate()`.

11) **OS_TMR.C:**
Replaced safety critical test to check `OSSafetyCriticalStartFlag` set by `OSSafetyCriticalStart()` on `OSTmrCreate()`.

This is a minor release as it contains only a few items that were not caught prior to releasing V2.88.

CHANGES TO V2.88

You should follow these steps in order to upgrade from a previous version to V2.88.

1) **All Files:**
   Added 'u' as a suffix to all constant values to denote that these numbers are unsigned. This was done to satisfy one of the MISRA-C:2004 rules.

   Added cast to (INT8U *) for all constants strings.

2) **OS_CORE.C:**
   The 'pname' argument of OSEventNameGet() needed to be a '**pname' instead of '*pname'.

   If OS_TASK_SUSPEND_EN is not set to 0 then OS_TaskStat() will call OSTimeDly(OS_TICKS_PER_SEC) if OSIdleCtrMax is zero.

3) **OS_MEM.C:**
   The 'pname' argument of OSMemNameGet() needed to be a '**pname' instead of '*pname'.

4) **OS_MUTEX.C:**
   Needed to set OSPrioCur to 'prio' in internal function OSMutex_RdyAtPrio().

5) **OS_TASK.C:**
   The 'pname' argument of OSTaskNameGet() needed to be a '**pname' instead of '*pname'.

   Added OS_TaskReturn() to catch tasks from returning without deleting themselves. This function requires that a new hook function be declared: OSTaskReturnHook().

6) **OS_TASK.C:**
   The 'pname' argument of OSTaskNameGet() needed to be a '**pname' instead of '*pname'.

(2009/01/21)

This is a minor release as it contains only a few items that were not caught prior to releasing V2.87.

CHANGES TO V2.87

You should follow these steps in order to upgrade from a previous version to V2.87.

1)   **OS_CORE.C:**
     `OSIntExit()` and `OS_Sched()` have changed slightly because of a boundary condition found with the Cortex-M3 port. Specifically, we needed to move the statement:

          `OSTCBHighRdy = OSTCBPrioTbl[OSPrioHighRdy];`

     Before testing for the priority.

2)   **uCOS_II.H:**
     The function prototype for `OSEventPendMulti()` incorrectly declared the timeout as an `INT16U` instead of an `INT32U` since we changed all time delays and timeouts to now use 32-bit values.

3)   **All Files:**
     Changed the way functions are declared to be consistent with the prototypes in `ucos_ii.h`.

This is a major release as it contains changes to some of the elements of data structures as well as #define configuration constants. Also, some of the functionality has changed but this should not have any significant impact.

If you are using a Kernel Awareness plug-in for some of the debuggers, you will need to obtain a newer version of the Kernel Awareness plug-in which is compatible with V2.87 or higher. This is because ASCII strings for names are now referenced by using a pointer instead of storing the ASCII name in the kernel object.

UPGRADING TO V2.87

You should follow these steps in order to upgrade from a previous version to V2.87.

1) **OS_CFG.H:**
   You no longer need to specify the 'size' of ASCII strings used for names. That's because we now store a pointer to the name instead of actually allocating storage for it in the corresponding kernel object. This was done to significantly reduce the amount of RAM needed in your application. You will need to enable this feature. Follow the following table:

This #define …	Changed to
OS_EVENT_NAME_SIZE	OS_EVENT_NAME_EN
OS_TASK_NAME_SIZE	OS_TASK_NAME_EN
OS_FLAG_NAME_SIZE	OS_FLAG_NAME_EN
OS_MEM_NAME_SIZE	OS_MEM_NAME_EN
OS_TMR_CFG_NAME_SIZE	OS_TMR_CFG_NAME_EN

   The new value of these #defines are either 0 (to disable naming the object) or 1 (to enable naming the object).

2) **OS_TIME.C:**
   OSTimeDly() now accepts a 32-bit argument instead of a 16-bit argument. This was done to allow longer time delays and also to simplify OSTimeDlyHMSM(). In most cases, you will not need to change anything in your code.

3) **OS_CORE.C:**
   `OS_StrCopy()` has been eliminated since it's no longer used by   .
   You should not have been using this function in your code since it was meant to
   be an internal function. This change should thus not cause any problem.

4) **OS_CORE.C:**
   Added task specific registers. You can have as many as
   `OS_TASK_REG_TBL_SIZE` 32-bit unsigned registers for each task. These
   registers **ARE NOT** the same as the CPU registers; they are more like task
   specific variables. These 'registers' are typically used for such things as 'error
   codes' (or `errno` in other operating systems). You can also communicate
   information to tasks via these registers.

5) **OS_MBOX.C:**
   Timeouts on `OSMboxPend()` are now 32-bit values.

6) **OS_MUTEX.C:**
   Timeouts on `OSMutexPend()` are now 32-bit values.

7) **OS_Q.C:**
   Timeouts on `OSQPend()` are now 32-bit values.

8) **OS_SEM.C:**
   Timeouts on `OSSemPend()` are now 32-bit values.

9) **OS_TASK.C:**
   You can set and get task registers (see item 4 above) by calling
   `OSTaskRegSet()` and `OSTaskRegGet()`, respectively. Again, task registers
   ARE NOT the same as CPU registers.

10) **OS_TMR.C:**
    `OSTmr_Lock()` and `OSTmr_Unlock()` have been replaced with
    `OSSchedLock()` and `OSSchedUnlock()`, respectively. Now, timers no
    longer need to rely on semaphores being available. Also, this allows you to call
    other timer services from the timer callback.

This is a major release as it contains a new feature called 'Multi-Pend' (implemented in `OSEventPendMulti()`) which allows a task to pend on multiple objects (semaphores, mailboxes or queues). If any one of those objects is posted to, the function returns and indicates which (or all) events posted.

Multi-pend is the only feature added in this version and a number of changes throughout the code has been implemented in order to support this new feature.

Details on how to use `OSEventPendMulti()` can be found in the μC/OS-II reference manual.

UPGRADING TO V2.86

You should follow these steps in order to upgrade from a previous version to V2.86. Even though only Multi-Pend was added in V2.86, some of the items below are repeated from previous versions because they are important to follow.

1) **Timer Manager:**
   Timers **MUST** now be created by `OSTmrCreate()` before they can be used. In V2.82, a timer was created and started when you called `OSTmrStart()`. Now you **MUST** call `OSTmrCreate()` and then `OSTmrStart()` to create and start the timer, respectively.

   It is now your responsibility to delete a timer when it is no longer being used.

   The Timer Manager user-available functions are now:

   ```
   OSTmrCreate()
   OSTmrDel()
   OSTmrNameGet()
   OSTmrRemainGet()
   OSTmrStart()
   OSTmrStop()
   ```

   To create and start a timer, you need to call `OSTmrCreate()` and then `OSTmrStart()`. When you are done using a timer, you can delete it by calling `OSTmrDel()`.

2) **TRUE and FALSE changed to OS_TRUE and OS_FALSE:**

now uses and returns `OS_TRUE` and `OS_FALSE` instead of `TRUE` and `FALSE`. If you were using `TRUE` and `FALSE` in your application you will either need to define `TRUE` and `FALSE` yourself or change those to `OS_TRUE` and `OS_FALSE`.

3) **Create   :**

As of V2.81, you need to create a file called `APP_CFG.H` which would reside in your project. `APP_CFG.H` is used to hold configuration information about your project. Specifically, we expect that you place task priorities, task stack sizes and other application related configuration information. The following page shows an example of the contents of `APP_CFG.H`.

4) **Include   in your project:**

As of V2.81, you need to include `OS_TMR.C` in your builds in order to obtain the new services provided in `OS_TMR.C` and avoid compiler warnings/errors.

5) **New #defines are needed in   :**

You will need to include the following #defines (they are found in `OS_CFG_R.H`, the reference file for `OS_CFG.H`). See also the configuration manual:

```
OS_APP_HOOKS_EN

OS_EVENT_MULTI_EN

OS_TMR_EN
OS_TMR_CFG_MAX
OS_TMR_CFG_NAME_SIZE
OS_TMR_CFG_WHEEL_SIZE
OS_TMR_CFG_WHEEL_SIZE

OS_MBOX_PEND_ABORT_EN
OS_Q_PEND_ABORT_EN
OS_SEM_PEND_ABORT_EN
```

6) **Add   :**

If you use the timer manager, you will need to define the size of the timer task stack, i.e. `OS_TASK_TMR_STK_SIZE`. This is declared in your project's `OS_CFG.H`.

7) **Add   :**

If you use the timer manager, you will need to define the priority of the timer manager task, i.e. `OS_TASK_TMR_PRIO`. This is declared in your project's `APP_CFG.H`.

8) **Place prototypes in   :**
    As of V2.81, it's **IMPORTANT** that you place the prototypes for `OSCtxSw()`,
    `OSIntCtxSw()` and `OSStartHighRdy()` in `OS_CPU.H`. Typically, these
    functions would be prototyped as follows but, depending on the compiler, they
    may need to be different:

```
              (    );
        (    );
   (    );
```

9) **Start using   as error return values:**
    We recommend that you start using the new #define constants for error return
    values. All error return values start with `OS_ERR_` for consistency.

10) **   and   not callable from ISRs:**
    Since `OS????NameGet()` and `OS????NameSet()` can no longer be called
    from ISRs, make sure your code didn't make use of those in ISRs.

11) **   returns a   :**
    Since `OSMutexAccept()` now returns a `BOOLEAN` make sure you change
    your code accordingly.

CHANGES IN V2.86

`OSEventPendMulti()` was added.

Optimized `OS_EventTaskRdy()` and added support for multi-pend.

Optimized `OS_EventTaskWait()`.

Removed `OS_EventTOAbort()` and added `OS_EventTaskWaitMulti()`, `OS_EventTaskRemove()` and `OS_EventTaskRemoveMulti()`.

Optimized `OS_TaskStat()`.

Rearranged `OSMboxPend()` to support multi-pend.

Rearranged `OSMutexPend()` for consistency.

Rearranged `OSQPend()` to support multi-pend.

Rearranged `OSSemPend()` to support multi-pend.

Made cosmetic changes to `OSTaskChangePrio()` and added support for multi-pend.

Added support for multi-pend in `OSTaskDel()`.

Added support for multi-pend.

(2007/06/15)

In this release, we made some minor changes and are summarized below:

Added `OS_APP_HOOKS_EN` in `OS_CFG.H` to allow µC/OS-II to call application define hook functions.

`msg` was changed to `pmsg`.

`err` was changed to `perr`.

`OS????NameGet()` and `OS????NameSet()` can no longer be called from ISRs

`OSTimeDly()` and `OSTimeDlyHMSM()` now contain checks to prevent them from being called from an ISR.

`OSMutexAccept()` now returns a `BOOLEAN` instead of an `INT8U`.

Hook functions in port files now should call application specific hooks.

Added new error codes.

CHANGES IN V2.85

We removed all checks for `OS_VERSION` in the code. The reason is that you should actually upgrade your application when you upgrade your version of µC/OS-II. The extra checks for `OS_VERSION` created 'pollution' in the code which was not deemed necessary.

Replaced the 'magic number' `(OS_TCB *)1` to `OS_TCB_RESERVED` when reserving a TCB.

`msg` was changed to `pmsg`. `err` was changed to `perr` to reflect that these are pointers.

`OSEventNameGet()` and `OSEventNameSet()` can no longer be called from an ISR. The reason is to keep ISRs as short as possible. Getting and setting ASCII names is performed through loops and could increase ISR times. This change should not cause backwards compatibility issues since names for OS objects are typically set once when the object is created. If you call `OSEventNameGet()` from an ISR, the function will not be performed and you will get an `OS_ERR_NAME_GET_ISR` error code. If you call `OSEventNameSet()` from an ISR, the function will not be performed and you will get an `OS_ERR_NAME_SET_ISR` error code.

`OSFlagNameGet()` and `OSFlagNameSet()` can no longer be called from an ISR. The reason is to keep ISRs as short as possible. Getting and setting ASCII names is performed through loops and could increase ISR times. This change should not cause backwards compatibility issues since names for OS objects are typically set once when the object is created. If you call `OSFlagNameGet()` from an ISR, the function will not be performed and you will get an `OS_ERR_NAME_GET_ISR` error code. If you call `OSFlagNameSet()` from an ISR, the function will not be performed and you will get an `OS_ERR_NAME_SET_ISR` error code.

In `OSMemCreate()` we no longer require that a memory block be a multiple of a pointer size. However, we still require that a memory block contains storage for at least one pointer.

`OSMemNameGet()` and `OSMemNameSet()` can no longer be called from an ISR. The reason is to keep ISRs as short as possible. Getting and setting ASCII names is performed through loops and could increase ISR times. This change

should not cause backwards compatibility issues since names for OS objects are typically set once when the object is created. If you call `OSMemNameGet()` from an ISR, the function will not be performed and you will get an `OS_ERR_NAME_GET_ISR` error code. If you call `OSMemNameSet()` from an ISR, the function will not be performed and you will get an `OS_ERR_NAME_SET_ISR` error code.

We now cast `OS_MUTEX_KEEP_LOWER_8`, `OS_MUTEX_KEEP_UPPER_8` and `OS_MUTEX_MUTEX_AVAILABLE` to (`INT16U`) to prevent compiler warnings.

`OSMutexAccept()` now returns `OS_TRUE` or `OS_FALSE` based on whether the resource was available or not, respectively.

`OSMutexQuery()` now sets the `.OSValue` field to `OS_TRUE` or `OS_FALSE` based on whether the resource was available or not, respectively.

`OSTaskNameGet()` and `OSTaskNameSet()` can no longer be called from an ISR. The reason is to keep ISRs as short as possible. Getting and setting ASCII names is performed through loops and could increase ISR times. This change should not cause backwards compatibility issues since names for OS objects are typically set once when the object is created. If you call `OSTaskNameGet()` from an ISR, the function will not be performed and you will get an `OS_ERR_NAME_GET_ISR` error code. If you call `OSTaskNameSet()` from an ISR, the function will not be performed and you will get an `OS_ERR_NAME_SET_ISR` error code.

Even though `OSTimeDly()` and `OSTimeDlyHMSM()` should never have been called from ISRs, there were no checks to that effect. This has been corrected and we now check that `OSIntNesting` is `0` in order to allow this function to execute. If called from an ISR, `OSTimeDlyHMSM()` will return an error code of `OS_ERR_TIME_DLY_ISR`.

`OSTmrNameGet()` can no longer be called from an ISR. The reason is to keep ISRs as short as possible. Getting and setting ASCII names is performed through loops and could increase ISR times. This change should not cause backwards compatibility issues since names for OS objects are typically set once when the object is created. If you call `OSTaskNameGet()` from an ISR, the function will not be performed and you will get an `OS_ERR_NAME_GET_ISR` error code.

`OSTmrStop()` now returns `OS_TRUE` when the timer is stopped even if you passed an invalid 'opt' argument or we used the callback argument specified in the call. In other words, if we stop the timer, we return `OS_TRUE`.

Added `OS_ERR_???` `#define` constants for consistency.

Use …	Instead of …	Value
OS_ERR_NONE	OS_NO_ERR	0
OS_ERR_TIMEOUT	OS_TIMEOUT	10
OS_ERR_TASK_NOT_EXIST	OS_TASK_NOT_EXIST	11
OS_ERR_NAME_GET_ISR		17
OS_ERR_NAME_SET_ISR		18
OS_ERR_MBOX_FULL	OS_MBOX_FULL	20
OS_ERR_Q_FULL	OS_Q_FULL	30
OS_ERR_Q_EMPTY	OS_Q_EMPTY	31
OS_ERR_PRIO_EXIST	OS_PRIO_EXIST	40
OS_ERR_PRIO	OS_PRIO_ERR	41
OS_ERR_PRIO_INVALID	OS_PRIO_INVALID	42
OS_ERR_SEM_OVF	OS_SEM_OVF	50
OS_ERR_TASK_DEL	OS_TASK_DEL_ERR	60
OS_ERR_TASK_DEL_IDLE	OS_TASK_DEL_IDLE	61
OS_ERR_TASK_DEL_REQ	OS_TASK_DEL_REQ	62
OS_ERR_TASK_DEL_ISR	OS_TASK_DEL_ISR	63
OS_ERR_NO_MORE_TCB	OS_NO_MORE_TCB	70
OS_ERR_TIME_NOT_DLY	OS_TIME_NOT_DLY	80
OS_ERR_TIME_INVALID_MINUTES	OS_TIME_INVALID_MINUTES	81
OS_ERR_TIME_INVALID_SECONDS	OS_TIME_INVALID_SECONDS	82
OS_ERR_TIME_INVALID_MS	OS_ERR_TIME_INVALID_MS	83
OS_ERR_TIME_ZERO_DLY	OS_ERR_TIME_ZERO_DLY	84
OS_ERR_TIME_DLY_ISR		85
OS_ERR_TASK_SUSPEND_PRIO	OS_ERR_TASK_SUSPEND_PRIO	90
OS_ERR_TASK_SUSPEND_IDLE	OS_ERR_TASK_SUSPEND_IDLE	91
OS_ERR_TASK_RESUME_PRIO	OS_ERR_TASK_RESUME_PRIO	100
OS_ERR_TASK_NOT_SUSPENDED	OS_ERR_TASK_NOT_SUSPENDED	101
OS_ERR_MEM_INVALID_PART	OS_ERR_MEM_INVALID_PART	110
OS_ERR_MEM_INVALID_BLKS	OS_ERR_MEM_INVALID_BLKS	111
OS_ERR_MEM_INVALID_SIZE	OS_ERR_MEM_INVALID_SIZE	112
OS_ERR_MEM_NO_FREE_BLKS	OS_ERR_MEM_NO_FREE_BLKS	113
OS_ERR_MEM_FULL	OS_ERR_MEM_FULL	114
OS_ERR_MEM_INVALID_PBLK	OS_ERR_MEM_INVALID_PBLK	115
OS_ERR_MEM_INVALID_PMEM	OS_ERR_MEM_INVALID_PMEM	116
OS_ERR_MEM_INVALID_PDATA	OS_ERR_MEM_INVALID_PDATA	117
OS_ERR_MEM_INVALID_ADDR	OS_ERR_MEM_INVALID_ADDR	118
OS_ERR_MEM_NAME_TOO_LONG	OS_ERR_MEM_NAME_TOO_LONG	119
OS_ERR_TASK_OPT	OS_ERR_TASK_OPT	130
OS_ERR_FLAG_INVALID_PGRP	OS_ERR_FLAG_INVALID_PGRP	150
OS_ERR_FLAG_WAIT_TYPE	OS_ERR_FLAG_WAIT_TYPE	151
OS_ERR_FLAG_NOT_RDY	OS_ERR_FLAG_NOT_RDY	152
OS_ERR_FLAG_INVALID_OPT	OS_ERR_FLAG_INVALID_OPT	153
OS_ERR_FLAG_GRP_DEPLETED	OS_ERR_FLAG_GRP_DEPLETED	154

The `.OSValue` field of `OS_MUTEX_DATA` is now a `BOOLEAN` instead of an `INT8U`.

`OSMutexAccept()` now returns a `BOOLEAN`.

Hook functions have been changed in the **ports** as follows. In other words, we now assume that hook functions are declared in application code INSTEAD of port code. Hooks are thus enabled when `OS_APP_HOOKS_EN > 0` in `OS_CFG.H`.

In Hook …	Changed From …	To …
OSTaskCreateHook()	OSView_TaskCreateHook()	App_TaskCreateHook()
OSTaskDelHook()		App_TaskDelHook()
OSTaskIdleHook()		App_TaskIdleHook()
OSTaskStatHook()		App_TaskStatHook()
OSTaskSwHook()	OSView_TaskSwHook()	App_TaskSwHook()
OSTCBInitHook()		App_TCBinitHook()
OSTimeTickHook()	OSView_TickHook()	App_TimeTickHook()

Added a 'SAFETY CRITICAL USE' section to detect configuration issues when performing safety critical tests. This section does not generate any code and is thus harmless.

(2007/01/31)

In this release, we added new functionality to Mailbox, Queue and Semaphore management.

We also added new #define constants for error return values. For example, you can now use `OS_ERR_TIMEOUT` instead of `OS_TIMEOUT`. In fact, we added `OS_ERR_???` for consistency and you should now always use `OS_ERR_???` when checking for error codes. Note that you can still use the previous #define values since those were kept for backwards compatibility. However, we might remove those is a future version.

FIXED BUGS IN V2.83

Corrected a subtle bug in `OSTaskChangePrio()`. We now check if an event control block exist after readying a task at the new priority.

`OSTmr_Unlock()` was missing in a couple of places in `OSTmrStop()`.

CHANGES IN V2.84

We are now locking the scheduler when in `OSTimeTick()` instead of disabling interrupts. This reduces interrupt latency when this function is called.

Added `OS_ERR_???` #define constants for consistency. It turns out that not all error return values started with the prefix `OS_ERR_`. To correct this, new #define constants have been added. It's highly recommended that you start using the new `OS_ERR_???` error codes instead of their previous counterparts, see table below.

Use …	Instead of …	Value
OS_ERR_NONE	OS_NO_ERR	0
OS_ERR_TIMEOUT	OS_TIMEOUT	10
OS_ERR_TASK_NOT_EXIST	OS_TASK_NOT_EXIST	11
OS_ERR_MBOX_FULL	OS_MBOX_FULL	20
OS_ERR_Q_FULL	OS_Q_FULL	30
OS_ERR_Q_EMPTY	OS_Q_EMPTY	31
OS_ERR_PRIO_EXIST	OS_PRIO_EXIST	40
OS_ERR_PRIO	OS_PRIO_ERR	41
OS_ERR_PRIO_INVALID	OS_PRIO_INVALID	42
OS_ERR_SEM_OVF	OS_SEM_OVF	50
OS_ERR_TASK_DEL	OS_TASK_DEL_ERR	60
OS_ERR_TASK_DEL_IDLE	OS_TASK_DEL_IDLE	61
OS_ERR_TASK_DEL_REQ	OS_TASK_DEL_REQ	62
OS_ERR_TASK_DEL_ISR	OS_TASK_DEL_ISR	63
OS_ERR_NO_MORE_TCB	OS_NO_MORE_TCB	70
OS_ERR_TIME_NOT_DLY	OS_TIME_NOT_DLY	80
OS_ERR_TIME_INVALID_MINUTES	OS_TIME_INVALID_MINUTES	81
OS_ERR_TIME_INVALID_SECONDS	OS_TIME_INVALID_SECONDS	82
OS_ERR_TIME_INVALID_MS	OS_ERR_TIME_INVALID_MS	83
OS_ERR_TIME_ZERO_DLY	OS_ERR_TIME_ZERO_DLY	84
OS_ERR_TASK_SUSPEND_PRIO	OS_ERR_TASK_SUSPEND_PRIO	90
OS_ERR_TASK_SUSPEND_IDLE	OS_ERR_TASK_SUSPEND_IDLE	91
OS_ERR_TASK_RESUME_PRIO	OS_ERR_TASK_RESUME_PRIO	100
OS_ERR_TASK_NOT_SUSPENDED	OS_ERR_TASK_NOT_SUSPENDED	101
OS_ERR_MEM_INVALID_PART	OS_ERR_MEM_INVALID_PART	110
OS_ERR_MEM_INVALID_BLKS	OS_ERR_MEM_INVALID_BLKS	111
OS_ERR_MEM_INVALID_SIZE	OS_ERR_MEM_INVALID_SIZE	112
OS_ERR_MEM_NO_FREE_BLKS	OS_ERR_MEM_NO_FREE_BLKS	113
OS_ERR_MEM_FULL	OS_ERR_MEM_FULL	114
OS_ERR_MEM_INVALID_PBLK	OS_ERR_MEM_INVALID_PBLK	115
OS_ERR_MEM_INVALID_PMEM	OS_ERR_MEM_INVALID_PMEM	116
OS_ERR_MEM_INVALID_PDATA	OS_ERR_MEM_INVALID_PDATA	117
OS_ERR_MEM_INVALID_ADDR	OS_ERR_MEM_INVALID_ADDR	118
OS_ERR_MEM_NAME_TOO_LONG	OS_ERR_MEM_NAME_TOO_LONG	119
OS_ERR_TASK_OPT	OS_ERR_TASK_OPT	130
OS_ERR_FLAG_INVALID_PGRP	OS_ERR_FLAG_INVALID_PGRP	150
OS_ERR_FLAG_WAIT_TYPE	OS_ERR_FLAG_WAIT_TYPE	151
OS_ERR_FLAG_NOT_RDY	OS_ERR_FLAG_NOT_RDY	152
OS_ERR_FLAG_INVALID_OPT	OS_ERR_FLAG_INVALID_OPT	153
OS_ERR_FLAG_GRP_DEPLETED	OS_ERR_FLAG_GRP_DEPLETED	154

In this release, we made significant changes to the timer manager module. Please consult the Reference Manual for the new APIs of functions `OSTmrCreate()`, `OSTmrDel()`, `OSTmrStop()` and `OSTmrStart()`.

FIXED BUGS IN V2.82

You could not call `OSTmrNameGet()` and `OSTmrRemainGet()` when a timer was in one-shot mode and the timer expired because the timer was automatically deleted. This has now been fixed because timers are created and deleted by the user.

CHANGES IN V2.83

When a timer times out, it will no longer be deleted. In other words, it is now your responsibility to delete unused timers.

`OSTmrStop()` no longer deletes the timer.

You can now safely call `OSTmrRemainGet()` and `OSTmrNameGet()` whenever a timer is created until it gets deleted. In V2.81 and V2.82, you could not use these functions when a timer was configured in one-shot mode.

We added an entry in the `OS_TMR` data structure to allow us to verify that you are passing a pointer to an `OS_TMR` structure when you call timer manager services.

`OSTmrStart()` now ONLY starts (or restarts) a timer and does NOT create a timer. A timer must now be created before it can be started.

You must call `OSTmrDel()` to delete any unused timers.

Added `OSTmrStateGet()` which returns the state of a timer.

This is a minor release. However, we change the name of two (2) API calls: `OSTmrGetName()`, `OSTmrGetRemain()` and, we added an argument to `OSTmrStart()`.

FIXED BUGS IN V2.81

Fixed an error in `OSMutexDel()` (see `OS_MUTEX.C` below).

CHANGES IN V2.82

Changed `TRUE` and `FALSE` to `OS_TRUE` and `OS_FALSE`. µC/OS-II should not be dictating the value of `TRUE` and `FALSE`.

Added new constants to monitor the size of some variables and data structures, specifically related to the new Timer management module introduced in V2.81.

Added a check in `OSFlagPend()` to ensure that this function is not called from an ISR. Note that the documentation clearly warned about this but, we added the code just to be sure.

Added a check in `OSMboxPend()` to ensure that this function is not called from an ISR. Note that the documentation clearly warned about this but, we added the code just to be sure.

In `OSMboxPostOpt()` we added a new option called `OS_POST_OPT_NO_SCHED` which, when set, indicates that you do not want `OSMboxPostOpt()` to call the scheduler when you have completed the post.

Added a check in `OSMutexDel()` and the `OS_DEL_ALWAYS` case to make the owner of the mutex ready-to-run (if there was an owner). Because of some code similarities found in `OSMutexPost()`, we created the local function called

`OSMutex_RdyAtPrio()` to perform this operation and thus not increase the code by too much.

Added a check in `OSMutexPend()` to ensure that this function is not called from an ISR. Note that the documentation clearly warned about this but, we added the code just to be sure.

Added a check in `OSQPend()` to ensure that this function is not called from an ISR. Note that the documentation clearly warned about this but, we added the code just to be sure.

In `OSQPostOpt()` we added a new option called `OS_POST_OPT_NO_SCHED` which, when set, indicates that you do not want `OSQPostOpt()` to call the scheduler when you have completed the post.

Added a check in `OSSemPend()` to ensure that this function is not called from an ISR. Note that the documentation clearly warned about this but, we added the code just to be sure.

Changed the name of `OSTmrGetName()` to `OSTmrNameGet()` to be consistent with other similar services.

Changed the name of `OSTmrGetRemain()` to `OSTmrRemainGet()` to be consistent with other similar services.

Added an argument (`dly`) to `OSTmrStart()`. This, of course, will make the compiler issue an error if you previously used the timer manager in V2.81. The argument specifies an initial delay before the timer enters periodic mode (see drawing below). If you set the `dly` to the same value as the period then you will obtain the same result as in V2.81. If you specify a `dly` of 0, `period` will be used as the initial delay:
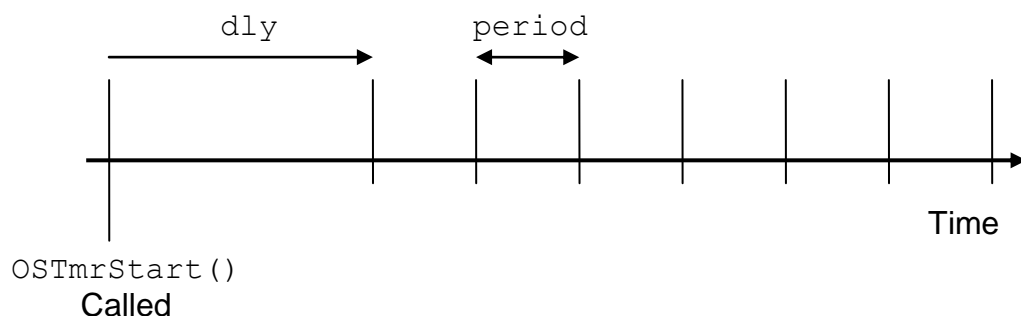
Added `OS_POST_OPT_NO_SCHED` and its value is `0x04`.

Added `.OSTmrDly` in the `OS_TMR` data structure

now provides support for periodic as well as one-shot timers. This functionality is found in `OS_TMR.C`. For more information about this new feature, consult the "*New Features and Services since V2.00*" document.

FIXED BUGS IN V2.80

Fixed a number of errors introduced when we increased the number of task to 255.

CHANGES IN V2.81

(see template in   )
Re-arranged the order of #defines in this file.

Added a number of `#define` constants to support timer management:

`OS_ISR_PROTO_EXT`

`OS_TMR_EN`
`OS_TMR_CFG_MAX`
`OS_TMR_CFG_WHEEL_SIZE`
`OS_TMR_CFG_NAME_SIZE`
`OS_TMR_CFG_TICKS_PER_SEC`
`OS_TASK_TMR_STK_SIZE`

Added call to `OSTmr_Init()`.

Added `OS_TASK_TMR_ID` and its value is `65533`.

Changed `OS_IDLE_PRIO` to `OS_TASK_IDLE_PRIO`

Changed `OS_STAT_PRIO` to `OS_TASK_STAT_PRIO`

Added `OS_ERR_TMR_???` and `OS_TMR_OPT_???`.

Added the `OS_TMR`, `OS_TMR_WHEEL` and `OS_TMR_CALLBACK` data types needed to support timer management.

This is a big release because µC/OS-II now supports up to **255** tasks.

We also made a number of minor changes related to MISRA C rules.

To support up to 255 tasks, we simply increased the ready list and event wait lists to a matrix of 16x16 instead of 8x8. In fact, the actual size of the matrix depends on the value of `OS_LOWEST_PRIO` in `OS_CFG.H`. If `OS_LOWEST_PRIO` is less than or equal to 63, we use an 8x8 matrix and thus µC/OS-II behaves exactly the same as it used to. If you specify a value for `OS_LOWEST_PRIO` to be greater than 63, we use the 16x16 matrix as show below.

OS_LOWEST_PRIO <= 63   **OS_LOWEST_PRIO > 63**
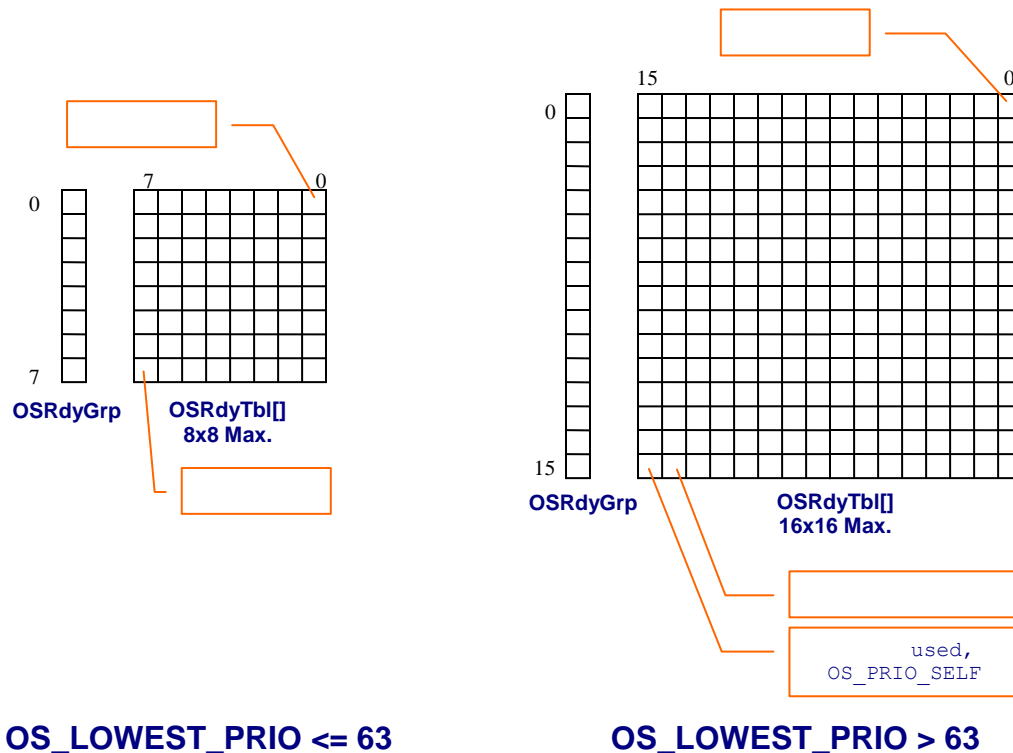
You should note that the actual size of the matrix depends on `OS_LOWEST_PRIO`. For example, if `OS_LOWEST_PRIO` is 10 then the matrix is actually 2x8 (two bytes of 8 bits). Similarly, if `OS_LOWEST_PRIO` is set to 47, the matrix will be 6x8. When `OS_LOWEST_PRIO` is above 63, we use 16-bit wide entries. For example, if you specify `OS_LOWEST_PRIO` to be 100 then the matrix will be 7x16 (7 entries of 16 bits each). You **CANNOT** have `OS_LOWEST_PRIO` at 255 because that value is reserved for `OS_PRIO_SELF`.

FIXED BUGS IN V2.77

No bugs were reported in V2.77.

CHANGES IN V2.80

`OS_LOWEST_PRIO` in `OS_CFG.H` can now be up to `254` thus supporting up to `255` tasks (including the idle task).

You now need to add the `#define OS_FLAGS_NBITS` which **MUST** be either 8, 16 or 32. This `#define` defines the number of bits used for event flags.

We **REMOVED** the type definition of `OS_FLAGS` and thus, you will also have to remove it in your `OS_CFG.H` file.

We removed the `OSMapTbl[]` and replaced its use in the code with a `1 << n` operation.

Added a new function called `OS_SchedNew()` to find the new highest priority task ready-to-run. In other words, this function determines the value of the variable `OSPrioHighRdy`. `OS_SchedNew()` is called by `OS_Sched()`, `OSIntExit()` and `OSStart()`.

Moved the `#define OS_VERSION` before the `#include` statements of `OS_CFG.H` and `OS_CPU.H` to allow these files to have definitions based on which version of µC/OS-II.

Added `OS_TASK_OPT_NONE` to allow this to be used in `OSTaskCreateExt()` instead of `0`.

Functions that used char now use `INT8U` to satisfy one of the MISRA C rules.

(2004/11/29)

This release corrects a number of very minor issues with V2.76.

FIXED BUGS IN V2.76

Bug V2.76-001:
There were a number of typos and incorrect comments that were fixed.

CHANGES IN V2.77

V2.77 adds a few minor enhancements to V2.76. However, none of these enhancements were critical.

The prototypes for   ,   and   are NOW assumed to be placed in   since they have been removed from `ucos_ii.h`. The reason this was done was to allow different declarations for these functions. For example, with the IAR ARM compiler, these functions are declared as follows:

```
__arm  void  OSStartHighRdy(void);
__arm  void  OSCtxSw(void);
__arm  void  OSIntCtxSw(void);
```

The 'standard' declarations should be:

```
void  OSStartHighRdy(void);
void  OSCtxSw(void);
void  OSIntCtxSw(void);
```

Please add these prototypes in **YOUR** `os_cpu.h` file.

We now expect the presence of OS_VIEW_MODULE in your OS configuration file. This is such that you can more easily add µC/OS-View to your product. Defining OS_VIEW_MODULE to 1 indicates that you will include µC/OS-View in your product's build. Setting OS_VIEW_MODULE to 0 indicates that you will not be using µC/OS-View.

If you DO NOT add this #define, the compiler will complain via a #error directive that we added in ucos_ii.h.

We now assign a name to the µC/OS-II idle task and statistics task if OS_TASK_NAME_SIZE is defined as being greater than 14 in OS_CFG.H. This is used for debugging purposes. The idle task is called: "uC/OS-II Idle" and the statistics task is called "uC/OS-II Stat".

In ALL the functions that pass *err so than an error code is returned to the caller, err is checked to make sure it's not a NULL pointer. The function returns if it is. Unfortunately, you are not told why because we have no way to give you an error code.

In ALL the functions that pass a pointer, we now check to make sure that the pointer is not a NULL pointer. This was previously done for some of the pointers but not all.

This release corrects a number of minor issues with V2.75 and also add a new Semaphore interface function (`OSSemSet()`).

FIXED BUGS IN V2.75

Bug V2.75-001:

`OSTaskDlyResume()` makes the same test as the new `OSTimeTick()` in that if a task was delayed and was pending on an event then, `.OSTCBPendTO` will be set to `TRUE` indicating that the task timed out.

Bug V2.75-002:

The following functions:

```
OSTaskChangePrio()
OSTaskDel()
OSTaskDelReq()
OSTaskNameSet()
OSTaskNameGet()
OSTaskResume()
OSTaskSuspend()
```

All needed to check for 'ptcb' pointing to (void *)1 in case the task was assigned to a Mutex PIP.

Bug V2.75-003:

`OSTaskDelReq()` had a local variable 'stat' which was declared as a `BOOLEAN` but was in fact used as an 8 bit integer. This local variable is now an `INT8U`.

NEW FEATURE

V2.76 adds a new semaphore function (`OSSemSet()`) that allows you to set the value (i.e. count) of the semaphore. This new feature is useful when you use semaphores as a signaling mechanism. You enable this function by setting `OS_SEM_SET_EN` to 1 in `OS_CFG.H` of your product. See details about this function in the reference manual.

This release corrects a number of issues that were reported by users of V2.70. This release also contains some changes. Probably the most significant improvement is that we made sure that µC/OS-II passes LINT without warnings and errors. PC Lint V8 by Gimpel Software was used to LINT µC/OS-II: http://www.gimpel.com/html/contact.htm.

FIXED BUGS IN V2.70

Bug V2.70-001:
`OSTaskSuspend()` and `OSTaskResume()` bug has been corrected. The problem and correction are described later.

Bug V2.70-002:
In `OSMemNameSet()`, a return statement was missing for the case when `pmem` is `NULL`. This bug has been corrected.

Bug V2.70-003:
In `OSQPostOpt()`, the test for `msg` being `NULL` must be deleted. This is because, as of V2.62, it's now possible to post `NULL` pointer messages to a message queue. This has been corrected.

Bug V2.70-004:
In `OSQDel()`, the first test should return `pevent` instead of a `NULL` pointer upon failure. This bug has been corrected.

Bug V2.70-005:
`OSTaskNameGet()` and `OSTaskNameSet()` were missing an `OS_EXIT_CRITICAL()` before the exit of the first test. This has been corrected.

Bug V2.70-006:
In `OSFlagPend()` the returned `flags_rdy` was not set correctly if you didn't specify `OS_FLAG_CONSUME`. This has been corrected.

Bug V2.70-007:

In `OSTaskQuery()` we needed to check to see if the TCB was assigned to a Mutex. An additional test has thus been added to correct the problem.

Bug V2.70-008:

In `OSMutexPend()` we removed a `&=` statement in an `if` statement for MISRA compliance.

Bug V2.70-009:

In `ucos_ii.h` we tested for `OS_MAX_EVENTS >= 256` when it should have been testing for `>= 65500`.

Bug V2.70-010:

Added test for `OS_ARG_CHK_EN` in `OSTimeDlyHMSM()`.

CHANGES IN V2.75

V2.75-001
We added a version number at the top of each file in the main comment header.

V2.75-002
`ucos_ii.h` now includes `os_cfg.h` and `os_cpu.h`. This allows you to compile µC/OS-II with only those three headers.

V2.75-003
Changed the data type for the variable `i` in `OS_InitRdyList()` from `INT16U` to `INT8U`.

V2.75-004
Added `cpu_sr = 0` in all the functions that need to use `OS_ENTER_CRITICAL()` and `OS_EXIT_CRITICAL()`. This is done because some compilers generate warnings when the variable is not directly referenced in the code because it's buried inside a macro. We could have used `cpu_sr = cpu_sr` but, LINT complained about the fact that `cpu_sr` is being assigned a value that has not been initialized.

V2.75-005
Removed the global variable `OSIntExitY` in `OSIntExit()` and replaced it with a local variable called `y`. Note that you will need to delete the line:

```
+ sizeof(OSIntExitY)
```

in the file `os_dbg.c` of your port file (if this file exits in your port).

IMPORTANT

If you use an OLD µC/OS-II port, you might need to adjust the constant to add to the `SP` (Stack Pointer) in `OSIntCtxSw()`. In other words, if you use a port that adjust the `SP` in `OSIntCtxSw()`, you might need to adjust the constant because your port will NOT WORK. If your port uses the new scheme outline in the hardcover edition of the µC/OS-II book, you will not have to do anything as your port will work just fine.

V2.75-006

Added a flag in `OS_TCB` (called `.OSTCBPendTO`) that indicates whether a 'pend' call has timed out or not. The addition of this flag was necessary to fix bug V2.70-001. Details about the changes are described on the next page.

V2.75-007

Added a test in `OSTaskCreate()` and `OSTaskCreateExt()` to prevent calling these functions from an ISR.

V2.75-008

Added a `(void)` in front of `OS_FlagTaskRdy()` in `OS_FLAG.C` and in front of `OS_EventTaskRdy()` in `OS_MBOX.C, OS_Q.C, OS_SEM.C` and `OS_MUTEX.C` because the return value is not being used. This was done to prevent LINT warnings.

V2.75-009

Changed `#if OS_EVENT_EN > 0` with `#if OS_EVENT_EN` because LINT was complaining that the boolean value `OS_EVENT_EN` was being compared with an integer value.

Correction of Bug V2.70-001

Problem description:

If a task pends on an event with a timeout but `.OSTCBDly` gets decremented to `0` before the task gets suspended (using `OSTaskSuspend()`) by another task then, when the suspension is removed, the task 'appears' to be waiting forever on the message queue

states apply to semaphores, mailboxes, mutexes and event flags. Below is a narration of the different states.

01 A running task calls `OSTimeDly()`. `.OSTCBStat` doesn't get changed and only `.OSTCBDly` is affected.

02 `OSTimeTick()` decrements `.OSTCBDly` to zero and the task is made ready-to-run.

03 A delayed task gets suspended by another task.

04 The task suspension is removed by another task.

05 `OSTimeTick()` decrements `.OSTCBDly` to zero but, since the task is still suspended, it doesn't get readied. Also, the flag `.OSTCBPendTO` gets set to `FALSE` since the task was not pending on anything.

06 A task gets suspended by itself or by another task. Of course, this task is removed from the ready list but is not waiting for any event.

07 The suspended task is readied by another task that calls `OSTaskResume()`.

08 A task calls `OSQPend()` and specifies a non-zero timeout value. This means that the task will be readied if a message is received within the timeout period or, if the timeout expires.

09 `OSTimeTick()` is called before a message is received. In this case, the flag `.OSTCBPendTO` is set and the `OS_STAT_Q` flag is cleared by `OSTimeTick()`. In previous versions, we didn't clear the `OS_STAT_Q` flag because we used it to indicate that the task timed out waiting for the event to occur. Since we now have the `.OSTCBPendTO` flag, we will use it for this purpose.

10 A task calls `OSQPost()` sending a message to the task via a message queue. In this case, the timeout is cancelled and the flag `.OSTCBPendTO` is set to `FALSE`.

11 A task calls `OSTaskSuspend()` to suspend a task that was already waiting on a message queue (with timeout).

12 A task calls `OSTaskResume()` to resume the task suspended. In this case, the task is still not ready-to-run because the message queue has not been posted and the timeout has not expired.

13 A task calls `OSQPost()` before the timeout expires. However, the task is still suspended. Note that the `OSQPost()` cancels the timeout (sets `.OSTCBDly` to `0`) and sets the flag `.OSTCBPendTO` to `FALSE` because we didn't get a timeout. Note also that the message is given to the task because it was the highest priority task waiting for the message, even though the task is still suspended.

14 `OSTimeTick()` occurs before the message gets posted to the queue. In this case, `OSTimeTick()` sets the `.OSTCBPendTO` flag to `TRUE` indicating that the message was not received within the specified timeout period. However, the task is still unconditionally suspended. If the message is posted before the task is resumed, the `.OSTCBPendTO` flag will be cleared.

15 A task calls `OSQPend()` and specifies a zero timeout value indicating that the task will wait forever to receive a message.

16 A task calls `OSTaskSuspend()` to suspend a task that was already waiting on a message queue (without timeout).

17 A task calls `OSTaskResume()` to resume the task suspended. In this case, the task is still not ready-to-run because it's waiting for an event that did not occur.

18 A task calls `OSQPost()`. However, the task is still suspended. The flag `.OSTCBPendTO` is set to `FALSE` because we didn't get a timeout. Note also that the message is given to the task because it was the highest priority task waiting for the message, even though the task is still suspended.

19 A task calls `OSQPost()`. The flag `.OSTCBPendTO` is set to `FALSE` because we didn't get a timeout.

(2003/04/01)

V2.70 is a considered a major release for a number of reasons:

1) The directory structure for ports has been completely revised. This doesn't really affect the source code for μC/OS-II per-se but it does imply that port files have been moved around.

2) Include files are now surrounded by brackets instead of double quotes. This allows you to locate μC/OS-II and the port files anywhere on your computer system, and let your compile environment resolve include paths. In other words, you now need to tell your compiler which path to search for include files since μC/OS-II file no longer assume an absolute path.

3) All calls to standard library functions have been removed from μC/OS-II and have been replaced with internal `OS_???()` functions. This was done to simplify third party certification.

4) Item #3 above has an additional advantage - compilation of μC/OS-II now only depends on the following three files: `os_cpu.h`, `os_cfg.h` and `ucos_ii.h`. In other words, if you define the contents of `os_cpu.h` and `os_cfg.h` for your product, you will be able to compile μC/OS-II files standalone.

5) Port files for the 80x86 CPU running in a DOS environment are no longer included with the distribution. This has been done for two reasons. First, we don't want μC/OS-II to be thought of as 'only' an 80x86 RTOS since it's been ported to a large number of processors. Second, all the other processor ports are available on the web site as a free download and now, the 80x86 ports are no different.

6) The DOS utility `TO.EXE` is no longer part of the distribution.

7) We now include two new files: `os_cfg_r.h` and `os_dbg_r.c`. These are described later.

8) Initialization of the statistic task now takes 1/10 of a second instead of 1 second. This has been done to reduce the boot time of an embedded system target.

9) Changed the returned value from `OSFlagAccept()` and `OSFlagPend()` to now return the value of the flags that caused the task to become ready-to-run. This was done because a lot of users requested this 'preferred' behavior.

This release corrects just one minor issue that was reported by a user of V2.62. This release also contains some minor changes. No new features or functions were added.

Important

`ucos_ii.h` now includes `#include` statements to include `os_cpu.h` and `os_cfg.h`. This means that you **MUST** now **REMOVE** these `#include` statements from `includes.h`. In other words, `ucos_ii.h` now has:

```
#include  <os_cpu.h>
#include  <os_cfg.h>
```

and those statements **MUST** be **REMOVED** from `includes.h` otherwise the above two files would be multiply included

---

FIXED MINOR ISSUE WITH V2.62

Bug V2.62-001:

In `OSTaskDel()`, we had added a statement to clear the stack pointer of the task being deleted. This statement appears on line 428 and has been since removed. The code was added originally to show that the stack of a task that has been deleted is no longer valid. This was to support Kernel Awareness but was found to cause side effects. The line to delete is:

```
ptcb->OSTCBStkPtr = (OS_STK *)0;  /* Show that TCB is 'unused' */
```

CHANGES IN V2.70

V2.70-001

In V2.70, we changed the directory structure of where ports are placed. This change was necessary because of the growing confusion about where ports should be placed. The new directory structure is explained in AN-2002 which can be downloaded from the Micriµm web site.

V2.70-002

The file `OS_DEBUG.C` has been renamed to `OS_DBG.C`. `OS_DEBUG.C` was introduced in V2.62.

V2.70-003

Conditional compilation of object names is now checking for greater than 1 (i.e. > 1) instead of greater than zero (i.e. > 0). The reason is because of the following code example:

```
#if OS_EVENT_NAME_SIZE > 1
    pevent->OSEventName[0] = '?';
    pevent->OSEventName[1] = OS_ASCII_NUL;
#endif
```

If `OS_EVENT_NAME_SIZE` was set to `1` then there would not be sufficient room in the `.OSEventName` file to hold the '?' as well as the `NUL` character. This was really not a big problem in the past because it would be unlikely that you would have allocated only ONE character to the name of an object.

V2.70-004

Removed all calls to standard library functions and replaced them with local functions which are found in `OS_CORE.C` as follows:

Standard Library Function:	Has been replaced by:
`memcpy()`	`OS_MemCopy()`
`memset()`	`OS_MemClr()`
`strlen()`	`OS_StrLen()`
`strcpy()`	`OS_StrCopy()`

V2.70-005

Added call to function `OSDebugInit()` in `OSInit()`. `OSDebugInit()` is a function that has been added in V2.70 because some compilers will actually optimize out all the 'const' variables in `os_dbg.c` if they are not referenced by any code. The 'const' in `os_dbg.c` are used by a Kernel Aware debugger and all of the 'const' are needed. `OSDebugInit()` is a function that really doesn't do anything except reference the 'const' variables in `os_dbg.c` to prevent the compiler from optimizing them out. Of course, if `OS_DEBUG_EN` is set to `0` in `os_cfg.h` then `OSDebugInit()` is not called and is thus not needed.

V2.70-006

Changed the name of all variables called 'pdata' and 'data' to more appropriate variable names. The reason for this change is that some 8051 compilers reserve the words `pdata` and `data` for storage classes.

V2.70-007

`ucos_ii.h` now includes `#include` statements to include `os_cpu.h` and `os_cfg.h` and thus, you **MUST** now **REMOVE** these include statements from the project's master include file, `includes.h` to prevent double inclusion of `os_cpu.h` and `os_cfg.h` in your project. Because of this change, all of the µC/OS-II source files now include `ucos_ii.h` instead of `includes.h`.

V2.70-008

Include files are now surrounded by brackets instead of double quotes. This allows you to locate µC/OS-II and the port files anywhere on your computer system, and let your compile environment resolve include paths. In other words, you now need to tell your compiler which path to search for include files since µC/OS-II file no longer assume an absolute path.

V2.70-009

Changed `OSStatInit()` and `OS_TaskStat()` so that the statistic task only needs 1/10 of a second to determine the CPU capacity. This change was done to speed up the boot time of an embedded system.

V2.70-010

Changed the returned value from `OSFlagAccept()` and `OSFlagPend()` to now return the value of the flags that caused the task to become ready-to-run. This was done because a lot of users requested this 'preferred' behavior.

V2.62 is a simple maintenance release. The release corrects a few very minor issues that were reported by users and also, contains some changes to better support Kernel Aware debuggers. No new features or functions were added.

FIXED MINOR ISSUES WITH V2.61

Bug V2.61-001:

In OS_FLAG.C, the second OS_ENTER_CRITICAL() in OSFlagPendGetFlagsRdy() needed to be changed to OS_EXIT_CRITICAL(). This problem has been corrected. The BAD code was:

```
OS_FLAGS OSFlagPendGetFlagsRdy (void)
{
    #if OS_CRITICAL_METHOD == 3
    OS_CPU_SR cpu_sr;
    #endif
    OS_FLAGS flags;


    OS_ENTER_CRITICAL();
    flags = OSTCBCur->OSTCBFlagsRdy;

    return (flags);
}
```

and should have been:

```
OS_FLAGS OSFlagPendGetFlagsRdy (void)
{
    #if OS_CRITICAL_METHOD == 3
    OS_CPU_SR cpu_sr;
    #endif
    OS_FLAGS flags;

    OS_ENTER_CRITICAL();
    flags = OSTCBCur->OSTCBFlagsRdy;

    return (flags);
}
```

Bug V2.61-002:

In OS_MEM.C, the following code on line #242 was:

```
if (len > (                    - 1)) {
```

and should have been:

```
if (len > (                    - 1)) {
```

Bug V2.61-003:

In OS_CORE.C, OS_TaskStatStkChk() didn't check for a task that was assigned to a MUTEX and thus attempted to compute the stack size of an invalid task. The correct code for this function is:

```
#if (OS_TASK_STAT_STK_CHK_EN   0)    (OS_TASK_CREATE_EXT_EN   0)
                     (    )

   OS_TCB      ptcb;
   OS_STK_DATA stk_data;
   INT8U       err;
   INT8U       prio;


       (prio   0; prio    OS_IDLE_PRIO; prio  )
       err              (prio, &stk_data);
         (err    OS_NO_ERR)
         ptcb   OSTCBPrioTbl[prio];
           (ptcb    (OS_TCB )0)                               /* Make sure task 'ptcb' is ...  */
           (ptcb    (OS_TCB )1)                               /* ... still valid.              */
#if OS_TASK_PROFILE_EN   0
                 #if OS_STK_GROWTH   1
                 ptcb  OSTCBStkBase   ptcb  OSTCBStkBottom   ptcb  OSTCBStkSize;
                 #else
                 ptcb  OSTCBStkBase   ptcb  OSTCBStkBottom   ptcb  OSTCBStkSize;
                 #endif
                 ptcb  OSTCBStkUsed   (INT32U)stk_data OSUsed;   /* Store the number of bytes used */
#endif



       #endif
```

Bug V2.61-004:

In OS_CORE.C, OS_TaskStatStkChk() had an error computing the stack base. The code presented in V2.61-003 above corrects the issue.

CHANGES IN V2.62

V2.62-001

In V2.62, we removed the 'debug' code from OS_CORE.C and created a NEW file called OS_DEBUG.C. On other words, in V2.61, there were a number of 'const' variables that were added to better support kernel aware debuggers. These consts have been moved to the new file OS_DEBUG.C for two reasons:

1) If you don't have a kernel aware debugger, OS_CORE.C would have added about 100 bytes of code that would serve no purpose. By moving the const to OS_DEBUG.C, if you don't have a kernel aware debugger, you don't need to compile and link OS_DEBUG.C with your µC/OS-II based application.

2) Some compilers (such as the IAR) compiles-out code or constants that don't appear to be used anywhere. In the case of the debug variables, the variables reside in ROM and are only there for the debugger. In other words, they serve no other purpose for µC/OS-II based applications and some compilers would be 'smart' enough to not include them. To prevent this from happening and thus make the variable available for the debugger, the debug variable were placed in OS_DEBUG.C so that you can use compiler specific directives to prevent this type of optimization. However, these directives are very compiler specific and could thus change from one compiler to another. This would cause compatibility problems if these directives were placed in OS_CORE.C because OS_CORE.C is supposed to be compiler and processor independent. Having a separate file (OS_DEBUG.C) solves this problem because the file can be associated with the PORT and not the processor independent code.

NOTE

This all means that a PORT should now contain OS_DEBUG.C if you use a Kernel Aware Debugger that requires the 'const' provided in OS_DEBUG.C. In fact, you might have to modify OS_DEBUG.C based on the compiler you are using.

V2.62-002

In OS_MUTEX.C, there were a couple of places where some of the MISRA C rules had not been followed (in OSMutexPend() and OSMutexPost()).

V2.62-003

Added 'tags' to structures.

V2.62-004

Added `OSEndianessTest` const in `OS_DEBUG.C` to allow the debugger to automatically determine whether the processor is little endian or big endian.

V2.61 is a simple maintenance release and no run-time bugs were found in µC/OS-II V2.60. The release only corrects a few very minor issues that mostly affected kernel awareness support, and adds a bit of internal code. No new features or functions were added.

FIXED MINOR ISSUES WITH V2.60

Bug V2.60-001:

In OS_CORE.C, the following ROM constant was set to:

```
INT16U  const  OSTaskStatStkChkEn = OS_TASK_STAT_EN;
```

And should have been:

```
INT16U  const  OSTaskStatStkChkEn =                    ;
```

Bug V2.60-002:

In uCOS_II.H, the following code was:

```
#if OS_EVENT_NAME_SIZE > 0
INT8U       OSEventNameGet(OS_EVENT *pevent, char *pname, INT8U *err);
void        OSEventNameSet(OS_EVENT *pevent, char *pname, INT8U *err);
#endif
```

and should have been:

```
#if                 (OS_EVENT_NAME_SIZE > 0)
INT8U       OSEventNameGet(OS_EVENT *pevent, char *pname, INT8U *err);
void        OSEventNameSet(OS_EVENT *pevent, char *pname, INT8U *err);
#endif
```

Bug V2.60-003:

In `uCOS_II.H`, the following code was:

```
#if OS_FLAG_NAME_SIZE > 0
INT8U       OSFlagNameGet(OS_FLAG_GRP *pgrp, char *pname, INT8U *err);
void        OSFlagNameSet(OS_FLAG_GRP *pgrp, char *pname, INT8U *err);
#endif
```

and should have been:

```
#if              (OS_FLAG_NAME_SIZE > 0)
INT8U       OSFlagNameGet(OS_FLAG_GRP *pgrp, char *pname, INT8U *err);
void        OSFlagNameSet(OS_FLAG_GRP *pgrp, char *pname, INT8U *err);
#endif
```

Bug V2.60-004:

In `OS_MEM.C`, the following code was missing in `OS_MemInit()`, for the last `OS_MEM` element:

Bug V2.60-005:

In `OS_CORE.C`, added conditional compilation for the following prototype:

```
static  void  OS_InitTaskStat(void);
```

ADDED CODE

Added V2.61-001:

In `OS_CORE.C`, added the following ROM constant for kernel awareness support:

(2002/09/28)

Changes were made to V2.52 for the following reasons:

a) To fix minor issues with V2.52.
b) To simplify FAA Level A certification by removing all MCDC (Modified Condition Decision Coverage).
c) To follow most of the guidelines of *The Motor Industry Software Reliability Association* "Guidelines for the use of the C language in vehicle based software".
d) To add support for kernel awareness.
e) To directly support μC/OS-View.
f) Added new features.
g) Made some changes to the code.

FIXED ISSUES WITH V2.52

Bug V2.52-001:

In OS_CORE.C, function OS_InitMisc(), there is no need to test OS_TASK_CREATE_EXT_EN:

```
#if (OS_TASK_STAT_EN > 0)
    OSIdleCtrRun  = 0L;
    OSIdleCtrMax  = 0L;
    OSStatRdy     = FALSE;
#endif
```

The correct code is thus:

```
#if OS_TASK_STAT_EN > 0
    OSIdleCtrRun  = 0L;
    OSIdleCtrMax  = 0L;
    OSStatRdy     = FALSE;
#endif
```

Bug V2.52-002:

In OS_TASK.C, function OSTaskDel(), the variable self was never used. The variable is now removed.

Bug V2.52-003:

In OS_TASK.C, function OSTaskStkChk() was missing a test. The incorrect code was:

```
ptcb = OSTCBPrioTbl[prio];
if (ptcb == (OS_TCB *)0) {
    OS_EXIT_CRITICAL();
    return (OS_TASK_NOT_EXIST);
}
```

The correct code is:

```
ptcb = OSTCBPrioTbl[prio];
if (ptcb == (OS_TCB *)0                     ) {
    OS_EXIT_CRITICAL();
    return (OS_TASK_NOT_EXIST);
}
```

Bug V2.52-004:

In `OS_MUTEX.C`, function `OSMutexPost()` the condition to check to see if the current task is the owner of the mutex has been changed from:

```
if (OSTCBCur->OSTCBPrio != pip &&
    OSTCBCur->OSTCBPrio != prio) {
    OS_EXIT_CRITICAL();
    return (OS_ERR_NOT_MUTEX_OWNER);
}
```

To:

```
if (                                ) {
    OS_EXIT_CRITICAL();
    return (OS_ERR_NOT_MUTEX_OWNER);
}
```

This change allows a task to obtain multiple mutexes. A task could thus have the following code:

```
Acquire Mutex #1;
Acquire Mutex #2;
Release Mutex #2;
Release Mutex #1;
```

Mutexes MUST be released in the same order as they were acquired.

Bug V2.52-005:

In `OS_MUTEX.C`, the function `OSMutexPend()` was changed to allow a mutex owner to pend on another kernel object such as a semaphore. In other words, a task could have the following code:

```
Acquire Mutex;        /* Mutex is available, task now owns it     */
Acquire Semaphore;    /* Semaphore is NOT available, suspend task! */
.
.
```

Then, a high priority task that would call `OSMutexPend()` on the same mutex would notice that the mutex owner has a lower priority than the task that needs the mutex. `OSMutexPend()` would then raise the priority of the task that owns the mutex and will notice that the task is also waiting on a semaphore. `OSMutexPend()` would then change the priority of the mutex owner in the semaphore wait list.

SIMPLIFYING 'FAA LEVEL A' CERTIFICATION

Changes were made to V2.52 to remove all MCDC (Modified Condition Decision Coverage). MCDCs are basically conditionals with multiple possible outcomes. For example, in the following code, there are eight (8) possible outcomes based on the different values of a, b, c, d, e and f:

```
if (a == b && c == d && e == f) {
    /* Conditions met */
}
```

A better way to write the above code (from a certification perspective) is shown below:

```
if (a == b) {
    if (c == d) {
        if (e == f) {
            /* Conditions met */
        }
    }
}
```

I went through all the µC/OS-II code and removed the MCDCs. Of course, the code behaves exactly the same as before.

FOLLOWED MOST OF THE MISRA GUIDELINES

MISRA stands for "The Motor Industry Software Reliability Association" and this association published back in April 1998, a list of 127 guidelines for programming applications using the C programming language. You can obtain this document by visiting:

http://www.misra.org.uk

The document is called:

"Guidelines For The Use Of The C Language In Vehicle Based Software"
ISBN 0 9524156 9 0

It so happens that μC/OS-II was written by following most of the MISRA guidelines even before the guidelines were ever published. At this time, μC/OS-II is not 'compliant' with the guidelines but simply follows most of them.

One of the most significant changes to μC/OS-II's code is the removal of assignments inside conditionals. For instance, the following code:

```
if ((pevent->OSEventTbl[y] &= ~bitx) == 0) {
    /* … */
}
```

Has been replaced by:

```
pevent->OSEventTbl[y] &= ~bitx;
if (pevent->OSEventTbl[y] == 0) {
    /* … */
}
```

SUPPORT OF KERNEL AWARE DEBUGGERS

Variables and constants have been added to help support kernel aware debuggers. Specifically, a number of variables can be queried by a debugger to find out about compiled-in options. For example, the debugger can find out the size of an `OS_TCB`, µC/OS-II's version number, the size of an event flag group (`OS_FLAG_GRP`) and much more. Those variables are enabled by `OS_DEBUG_EN` in `OS_CFG.H`.

SUPPORT OF µC/OS-View

Variables in `OS_TCB` have been added (see `OS_TASK_PROFILE_EN`) to support profiling tools such as µC/OS-View.

Also `OS_TaskStat()` can now check the stack of each of the active tasks (see `OS_TASK_STAT_STK_CHK_EN`).

An `OS_TCB` can also contain the name of each task which can then be displayed on the µC/OS-View Windows application.

µC/OS-View can 'step' tick interrupts one at a time. In other words, through a command sent by a user of µC/OS-View, µC/OS-II can process one tick at a time. Each tick requires a user to press a key from the µC/OS-View application.

ADDED NEW FEATURES

1) Find out which flag(s) caused task to wakeup.

Added the function `OSFlagPendGetFlagsRdy()` (file `OS_FLAG.C`) to allow to determine which flag(s) caused the current task to become ready. In other words, you will now be able to know what event flag(s) caused the pending task to wake up.

2) Posting NULL pointers to queues.

It is now possible to send `NULL` pointer message through queues. `OSQPost()` and `OSQPostFront()` no longer blocks `NULL` pointers from being deposited into queues. This means that `OSQPend()` will thus be able to receive `NULL` pointer messages. You should now check the status of the `err` argument to determine whether the return from the pend was caused by a timeout or the actual reception of a message.

Because of this change, I had to change the API for `OSQAccept()` so that it returns an error code indicating the outcome of the call.

3) Assigning names to Tasks and other kernel objects.

It is now possible to assign names to Tasks, Memory Partitions, Semaphores, Mutexes, Event Flags, Mailboxes and Queues. The names are useful when debugging applications. You assign names by calling one of the following functions:

```
OSEventNameSet()
OSFlagNameSet()
OSMemNameSet()
OSTaskNameSet()
```

You can obtain the name of a task or a kernel object by calling the following functions:

```
OSEventNameGet()
OSFlagNameGet()
OSMemNameGet()
OSTaskNameGet()
```

This version doesn't allow you to manipulate kernel objects using names. For example, you can't delete a task by specifying its name, you can't post to a queue by specifying the queue by its name, etc.

4) Disable calls to OSTaskSwHook() and OSTimeTickHook()

It is now possible to disable (at compile time) the need to have the functions `OSTaskSwHook()` and `OSTimeTickHook()`. This feature was requested because of the overhead involved in calling empty functions during a context switch and also every tick.

To disable `OSTaskSwHook()`, simply set `OS_TASK_SW_HOOK_EN` to `0` in `OS_CFG.H`. Of course, the port (`OS_CPU_A.ASM`) for the processor you are using must not call `OSTaskSwHook()`.

To disable `OSTimeTickHook()`, simply set `OS_TIME_TICK_HOOK_EN` to `0` in `OS_CFG.H`.

5) Added variables in OS_TCB to allow profiling

Variables have been added to `OS_TCB` to allow each task to be profiled. In other words, µC/OS-II contains variables that register the number of time a task is 'switched-in', how long a task takes to execute, how much stack space each task consumes and more. These variables have been added to better support µC/OS-View and other profiling tools.

6) Added tick stepping support for μC/OS-View

μC/OS-View can now 'halt' μC/OS-II's tick processing and allow you to issue 'step' commands from μC/OS-View. In other words, μC/OS-View can prevent μC/OS-II from calling `OSTimeTick()` so that timeouts and time delays are no longer processed. However, though a keystroke from μC/OS-View, you can execute a single tick at a time. If enabled, `OSTimeTickHook()` is still executed at the regular tick rate in case you have time critical items to take care of in your application.

7) Added new #defines in OS_CFG.H

Instead of edition your `OS_CFG.H`, I recommend that you copy one of the `OS_CFG.H` files provided with the V2.60 release and then modify it to satisfy your application requirements.

`OS_DEBUG_EN`
> This `#define` adds ROM constants to help support kernel aware debuggers. Specifically, a number of named ROM variables can be queried by a debugger to find out about compiled-in options. For example, the debugger can find out the size of an `OS_TCB`, μC/OS-II's version number, the size of an event flag group (`OS_FLAG_GRP`) and much more.

`OS_EVENT_NAME_SIZE`
> This `#define` determines the size of ASCII strings used to name either semaphores, mutexes, mailboxes and queues. If set to `0`, this feature will be disabled: no RAM will be allocated and the functions `OSEventNameGet()` and `OSEventNameSet()` will not be compiled. If set to a non-zero value, it determines the number of bytes allocated for the name. Please note that you need to accommodate for the `NUL` character and if you do use a non-zero value, you should have a minimum of `2` for this value.

`OS_FLAG_NAME_SIZE`
> This `#define` determines the size of ASCII strings used to name event flag groups. If set to `0`, this feature will be disabled: no RAM will be allocated and the functions `OSFlagNameGet()` and `OSFlagNameSet()` will not be compiled. If set to a non-zero value, it determines the number of bytes allocated for the name. Please note that you need to accommodate for the `NUL` character and if you do use a non-zero value, you should have a minimum of `2` for this value.

`OS_MEM_NAME_SIZE`
> This `#define` determines the size of ASCII strings used to name memory partitions. If set to `0`, this feature will be disabled: no RAM will be allocated and the functions `OSMemNameGet()` and `OSMemNameSet()` will not be compiled. If set to a non-zero value, it determines the number of bytes allocated for the name. Please note that you need to accommodate for the `NUL` character and if you do use a non-zero value, you should have a minimum of `2` for this value.

`OS_TASK_NAME_SIZE`
> This `#define` determines the size of ASCII strings used to name tasks. If set to `0`, this feature will be disabled: no RAM will be allocated and the functions `OSTaskNameGet()` and `OSTaskNameSet()` will not be compiled. If set to a non-zero value, it determines the number of bytes allocated for the name. Please note that you need to accommodate for the `NUL` character and if you do use a non-zero value, you should have a minimum of `2` for this value.

`OS_TASK_PROFILE_EN`

> This #define is used to allocate storage for variables used for run-time task profiling. These variables are used by μC/OS-View and some kernel aware debuggers.

`OS_TASK_STAT_STK_CHK_EN`

> This #define allows the statistic task to do run-time checking of all the stacks of all the active tasks. In other words, when set to 1, `OS_TaskStat()` calls the function `OS_TaskStatStkChk()`. Of course, for this to happen, `OS_TASK_STAT_EN` must also be set to 1.

`OS_TASK_SW_HOOK_EN`

> It is now possible to disable (at compile time) the need to have the functions `OSTaskSwHook()`. This feature was requested because of the overhead involved in calling empty functions during a context switch and also every tick. To disable `OSTaskSwHook()`, simply set `OS_TASK_SW_HOOK_EN` to 0 in `OS_CFG.H`. Of course, the port (`OS_CPU_A.ASM`) for the processor you are using must not call `OSTaskSwHook()`.

`OS_TICK_STEP_EN`

> μC/OS-View can now 'halt' μC/OS-II's tick processing and allow you to issue 'step' commands from μC/OS-View. In other words, μC/OS-View can prevent μC/OS-II from calling `OSTimeTick()` so that timeouts and time delays are no longer processed. However, though a keystroke from μC/OS-View, you can execute a single tick at a time. If `OS_TIME_TICK_HOOK_EN` (see below) is set to 1, `OSTimeTickHook()` is still executed at the regular tick rate in case you have time critical items to take care of in your application.

`OS_TIME_TICK_HOOK_EN`

> It is now possible to disable (at compile time) the need to have the functions `OSTimeTickHook()`. This feature was requested because of the overhead involved in calling empty functions during a context switch and also every tick. To disable `OSTimeTickHook()`, simply set `OS_TIME_TICK_HOOK_EN` to 0 in `OS_CFG.H`.

CHANGES

1) Added 'extern C' in uCOS_II.H

An "extern C" statement has been added to allow you to compile μC/OS-II using a C++ compiler.

2) Renamed ALL files to lower case

All the μC/OS-II files have been renamed to lower case to make it easier to compile under UNIX environments.

3) Changed the structure of OSTaskChangePrio()

I changed the structure of the code for `OSTaskChangePrio()` to reduce the indentation, simplify and make the code cleaner. I also removed the re-enabling of

interrupts when computing `x`, `y`, `bitx` and `bity`. There is thus, there is no need to 'reserve' the `OSTCBPrioTbl[]` entry by setting it to `(OS_TCB *)1`.

4) Assigning a NULL pointer to OSTCBStkPtr

I now assign a `NULL` pointer to `OSTCBStkPtr` when the free list of TCBs is created and when a task is deleted.

5) Posting NULL pointers to queues.

Because it is now possible to post `NULL` pointers to queues, I had to change the API for `OSQAccept()` so that it returns an error code indicating the outcome of the call.

6) Removed assignments inside   statements.

Code like shown below:

```
if ((pevent->OSEventTbl[y] &= ~bitx) == 0) {
    /* … */
}
```

Has been replaced by:

```
pevent->OSEventTbl[y] &= ~bitx;
if (pevent->OSEventTbl[y] == 0) {
    /* … */
}
```

7) Removed MCDCs.

Code like shown below:

```
if (a == b && c == d && e == f) {
    /* Conditions met */
}
```

Has been replaced by the following code:

```
if (a == b) {
    if (c == d) {
        if (e == f) {
            /* Conditions met */
        }
    }
}
```

8) Added memset() to clear RAM

Added calls to `memset()` to clear (i.e. initialize) the `OSTCBPrioTbl[]`, `OSTCBTbl[]`, `OSMemTbl[]`, `OSFlagTbl[]` and `OSEventTbl[]`. The reason `memset()` was used was for speed and to reduce code size. These tables are cleared during initialization to prevent a kernel aware debugger to display un-initialized values.

In most cases, the initialization code for the different kernel objects has also been reduced.

This release is for the new edition of the book: *MicroC/OS-II, The Real-Time Kernel, 2nd Edition*.

V2.52 fixes minor bugs reported in V2.51.

Bug V2.51-003:

In `uCOS_II.H`, the following code was corrected as follows:

```
#ifndef OS_FLAG_QUERY_EN
 #error "OS_CFG.H, Missing OS_FLAG_DEL_EN: Include code for OSFlagQuery()"
```

needs to be:

```
#ifndef OS_FLAG_QUERY_EN
```

Bug V2.51-002:

In `OS_Q.C`, the following code was corrected as follows:

The function `OSQQuery()` contains a BUG in the following code which is towards the end of the function.

```
pq = (OS_Q *)pevent->OSEventPtr;
if (pq->OSQEntries > 0) {
    pdata->OSMsg = pq->OSQOut;  /* Get next message to return if available */
} else {
    pdata->OSMsg = (void *)0;
}
```

The **CORRECT** code is shown below. Note that   was missing the .

```
pq = (OS_Q *)pevent->OSEventPtr;
if (pq->OSQEntries > 0) {
    pdata->OSMsg =  pq->OSQOut; /* Get next message to return if available */
} else {
    pdata->OSMsg = (void *)0;
}
```

Bug V2.51-001:

In `OS_CPU_A.ASM`, the following code was corrected as follows:

The *NEW* ISRs MUST check to see if `OSIntNesting == 1` *BEFORE* you save the `SP` in the current task's `OS_TCB`. The incorrect 'pseudo' code is:

```
OSTCBCur->OSTCBStkPtr = SP          /* Save SP onto current task's stack */
```

and should be:

```
if (OSIntNesting == 1) {
  OSTCBCur->OSTCBStkPtr = SP      /* Save SP onto current task's stack */
}
```

The reason we need this change is that we don't wa4(is t)-4(ha7nC661 0 0 1 117.62 7s6 Tm1 0 0 70 1 11

Because the compiler would first perform the `100 * OSIdleCtr` operation, an `OSIdleCtr` greater than `42,949,763` would overflow the calculation and thus report an incorrect result. The equation is now written as:

```
CPU Usage (%) = 100 - OSIdleCtr * (OSIdleCtrMax / 100);
```

This allows `OSIdleCtr` to reach `4,294,967,295` (i.e. $2^{32}-1$) before the equation fails. I don't expect this to happen for a while since `OSIdleCtr` is incremented in a loop. The loop contains instructions that would consume a few CPU cycles each iteration.

In `OSMboxPend()` (`OS_MBOX.C`), I moved the check for `OSIntNesting` at the beginning of the function because you should NEVER call `OSMboxPend()` from an ISR.

In `OSQPend()` (`OS_Q.C`), I moved the check for `OSIntNesting` at the beginning of the function because you should NEVER call `OSQPend()` from an ISR.

In `OSSemPend()` (`OS_SEM.C`), I moved the check for `OSIntNesting` at the beginning of the function because you should NEVER call `OSSemPend()` from an ISR.

Two weeks ago, I released V2.05 and today, I found a bug in it (bug V205-001). I decided to slightly change the numbering system of releases. Complex releases (like V2.04 to V2.05) will now increase by 0.10 and minor (bug fixes or slight improvements) will now be increasing by 0.01. This means that V2.51 is now called V2.50 and with this bug fix, the release is V2.51. The reason this is done is to allow you to call `OSVersion()` and get the proper release number. If I didn't change the numbering system, I would have had to call the release with the bug correction V2.06. I was reserving such releases as major releases.

Bug V2.51-001:
In the NEW port file, an ISR MUST first check to see `if OSIntNesting == 1` before we save the `SP` in the current task `OS_TCB`. This bug only applies to the NEW algorithm for the port files and thus does NOT affect previous ports.

See **New Algorithm For Ports** at the end of the V2.51 notes.

V2.51 is a big upgrade for μC/OS-II for the following reasons:

1) In this release, I added Event Flags (see `OS_FLAG.C`). Event flags are described in AN-1007 which can be downloaded from www.Micrium.com.

2) I received numerous e-mails requesting to reduce the footprint of μC/OS-II to a minimum. To address this issue, I added a number of `#define` constants in `OS_CFG.H` which allow you to take out most of the features in μC/OS-II that you might not be using. Specifically, there are `#defines` to remove the code for `OS???Accept()`, `OS???Query()`, `OS???Post()`, `OSSchedLock()` and `OSSchedUnlock()` and more.

3) This release comes with NEW ports for the Intel 80x86. These ports have been revised to REMOVE the dependency on compilers. Specifically, you no longer need to change the function `OSIntCtxSw()` in order to adjust the value of the Stack Pointer (i.e. the `SP`) register based on compiler options. The modification to accomplish this feature can ALSO be added to most processor ports!

WARNING

If you use the NEW port files in your product you **WILL** need to change ALL your Interrupt Service Routines (ISRs) to handle the new way the port works.

See **New Algorithm For Ports** at the end of the V2.51 notes.

---

4) All μC/OS-II **internal** functions are now prefixed with `OS_` instead of `OS`. This allows you to immediately determine that these functions should NOT be called by your application. Also, these functions have been moved at the end of their respective file to get them 'out-of-the-way'.

5) `OS_TaskIdle()` now calls `OSTaskIdleHook()` to allow you to do such things as STOP the CPU to conserve power when running the idle task. You will need to add code in `OSTaskIdleHook()` to execute whatever is necessary for your CPU to enter it's power down mode.

6) I added `OSMboxPostOpt()` and `OSQPostOpt()`. The new calls allow you to 'broadcast' a message to **all** tasks waiting on either a message mailbox or a message queue. In addition, `OSQPostOpt()` can replace both `OSQPost()` AND `OSQPostFront()`. This was done to further reduce the amount of code space needed by µC/OS-II. In other words, you can start using `OSQPostOpt()` INSTEAD of `OSQPost()` and `OSQPostFront()` and thus save a significant amount of code space.

7) Added `#error` directives in `uCOS_II.H` to have the compiler complain whenever there are missing `#defines` in your application. This will be useful to ensure that you have not forgotten any of the NEW `#defines` added in V2.51.

8) Previous versions required that you declared a minimum of 2 event control blocks, 2 message queues, and 2 memory partitions. V2.51 now allows you to reduce the RAM footprint by allowing you to declare only ONE of each of the data structures mentioned (and well as only 1 event flag group). In other words, you can now specify in `OS_CFG.H`:

```
#define  OS_MAX_EVENTS    1
#define  OS_MAX_FLAGS      1
#define  OS_MAX_MEM_PART   1
#define  OS_MAX_QS         1
```

9) All conditional compilation is now done as follows:

```
#if condition_name > 0
```

instead of:

```
#if condition_name
```

The condition name is checked for a non-zero value to enable the code. This will allow the compiler to complain in case you forget to define `condition_name`.

10) V2.51 correct the four know bugs that were reported in V2.04.

V2.04-001:

The wrong argument was being passed to the call `OSTaskCreateHook()` in `OSTCBInit()`. The bad code was:

```
OSTaskCreateHook(OSTCBPrioTbl[prio]);
```

It is now:

```
OSTaskCreateHook(ptcb);
```

V2.04-002:

The test in `OSMutexPost()` to see if the posting task owns the MUTEX was incorrect. The correct test needed to have `&&` instead of `||` as follows:

```
if (OSTCBCur->OSTCBPrio != pip
    OSTCBCur->OSTCBPrio != prio) {
    OS_EXIT_CRITICAL();
    return (OS_ERR_NOT_MUTEX_OWNER);
}
```

V2.04-003:

The function `OSMutexDel()` needed to release the priority of the PIP. The following line was added in `OSMutexDel()`:

```
OSTCBPrioTbl[pip] = (OS_TCB *)0;
```

V2.04-004:

The function prototype for `OSMutexDel()` needed to be added in `uCOS_II.H`.

Added a number of #define in OS_CFG.H to allow you to reduce the amount of code and data space. The reason this is done using #defines instead of simply using a librarian is to prevent having to support a large number of librarians and also to ensure that data space is also reduced when un-needed features (i.e. functions) also require data storage.

OS_MAX_FLAGS is used to determine how many event flags your application will support.

OS_FLAG_EN to Enable (1) or Disable (0) code generation for ALL event flag services and data storage. Also, OS_FLAG_WAIT_CLR_EN allows you to Enable (1) or Disable (0) code generation for code to wait for 'cleared' event flags.

The following table summarizes all the other #define constants ADDED in V2.51. The #defines are set to 1 by default, enabling the code.

name in	... to enable the function:
OS_FLAG_ACCEPT_EN	OSFlagAccept()
OS_FLAG_DEL_EN	OSFlagDel()
OS_FLAG_QUERY_EN	OSFlagQuery()
OS_MBOX_ACCEPT_EN	OSMboxAccept()
OS_MBOX_POST_EN	OSMboxPost()
OS_MBOX_POST_OPT_EN	OSMboxPostOpt()
OS_MBOX_QUERY_EN	OSMBoxQuery()
OS_MEM_QUERY_EN	OSMemQuery()
OS_MUTEX_ACCEPT_EN	OSMutexAccept()
OS_MUTEX_QUERY_EN	OSMutexQuery()
OS_Q_ACCEPT_EN	OSQAccept()
OS_Q_POST_EN	OSQPost()
OS_Q_POST_FRONT_EN	OSQPostFront()
OS_Q_POST_OPT_EN	OSQPostOpt()
OS_Q_QUERY_EN	OSQQuery()
OS_SEM_ACCEPT_EN	OSSemAccept()
OS_SEM_QUERY_EN	OSSemQuery()
OS_TASK_QUERY_EN	OSTaskQuery()
OS_TIME_DLY_HMSM_EN	OSTimeDlyHMSM()
OS_TIME_DLY_RESUME_EN	OSTimeDlyResume()
OS_TIME_GET_SET_EN	OSTimeGet() and OSTimeSet()
OS_SCHED_LOCK_EN	OSSchedLock() and OSSchedUnlock()

Added the typedef OS_FLAGS to allow you to specify the width of flags in an event flag group.

IMPORTANT

You **WILL** need to add **ALL** of the above #define in your OS_CFG.H files because uCOS_II.H contains error checks that will make your compiler complain if you don't include these #defines. The easiest way to accomplish this is to simply copy one of the OS_CFG.H files supplied in this release and paste it into your application and enable/disable the features you need.

Added call to OS_FlagInit() in OSInit() to support event flags.

Added call to OSTaskIdleHook() in OS_TaskIdle() to allow you to do such things as STOP the CPU to conserve power when running the idle task. You will need to add code in OSTaskIdleHook() to execute whatever is necessary for your CPU to enter it's power down mode.

Added conditional compilation so that when OS_SCHED_LOCK_EN is set to 1 in OS_CFG.H, the code for OSSchedLock() and OSSchedUnlock() will be produced.

Corrected a bug in OS_TCBInit(). OSTaskCreateHook() was being OSTCBPrioTbl[prio] passed INSTEAD of ptcb. OSTCBPrioTbl[prio] didn't contain a valid pointer when OSTaskCreateHook() was being called.

WARNING
If you use the NEW port files in your product you will need to change ALL your Interrupt Service Routines (ISRs) to handle the new way the port works.

See **New Algorithm For Ports** at the end of the V2.51 notes.

Added event flags to µC/OS-II, see AN-1007.

Added conditional compilation so that when `OS_MBOX_ACCEPT_EN` is set to `1` in `OS_CFG.H`, the code for `OSMboxAccept()` will be produced.

Added conditional compilation so that when `OS_MBOX_POST_EN` is set to `1` in `OS_CFG.H`, the code for `OSMboxPost()` will be produced. This allows you to reduce the amount of code space. The reason this conditional compilation has been added is because I added the more powerful function `OSMboxPostOpt()` which can emulate `OSMboxPost()` and also allows you to broadcast messages to all tasks waiting on the mailbox.

Added `OSMboxPostOpt()` which can emulate `OSMboxPost()` and also allows you to broadcast messages to all tasks waiting on the mailbox. The `#define` constant `OS_MBOX_POST_OPT_EN` found in `OS_CFG.H` allows you to enable (when `1`) or disable (when `0`) this feature.

Added conditional compilation so that when `OS_MBOX_QUERY_EN` is set to `1` in `OS_CFG.H`, the code for `OSMboxQuery()` will be produced. This allows you to reduce the amount of code space.

Added code to test the argument `addr` to make sure it's not a `NULL` pointer in `OSMemCreate()`.

Added code to test the argument `pmem` to make sure it's not a `NULL` pointer in `OSMemGet()`.

Added code to test the argument `pmem` and `pblk` to make sure they are not `NULL` pointers in `OSMemGet()`.

Added conditional compilation so that when `OS_MEM_QUERY_EN` is set to `1` in `OS_CFG.H`, the code for `OSMemQuery()` will be produced. This allows you to reduce the amount of code space.

Added code to test the argument `pmem` and `pdata` to make sure they are not `NULL` pointers in `OSMemQuery()`.

Added conditional compilation to allow you to declare storage for a single memory partition. In other words, you are now allowed to set OS_MAX_MEM_PART to 1 in OS_CFG.H.

Added conditional compilation so that when OS_MUTEX_ACCEPT_EN is set to 1 in OS_CFG.H, the code for OSMutexAccept() will be produced. This allows you to reduce the amount of code space.

Added conditional compilation so that when OS_MUTEX_QUERY_EN is set to 1 in OS_CFG.H, the code for OSMutexQuery() will be produced. This allows you to reduce the amount of code space.

Fixed a bug in OSMutexDel(). The entry in OSTCBPrioTbl[] was not being freed at the priority inheritance priority. This has been corrected.

Fixed a bug in OSMutexPost(). The current task priority was being tested for && instead of ||. This has been corrected.

Added conditional compilation so that when OS_Q_ACCEPT_EN is set to 1 in OS_CFG.H, the code for OSQAccept() will be produced. This allows you to reduce the amount of code space.

Added conditional compilation so that when OS_Q_FLUSH_EN is set to 1 in OS_CFG.H, the code for OSFlushAccept() will be produced. This allows you to reduce the amount of code space.

Added conditional compilation so that when OS_Q_POST_EN is set to 1 in OS_CFG.H, the code for OSQPost() will be produced. This allows you to reduce the amount of code space. The reason this conditional compilation has been added is because I added the more powerful function OSQPostOpt() which can emulate both OSQPost() and OSQPostFront() also allows you to broadcast messages to all tasks waiting on the queue.

Added conditional compilation so that when OS_Q_POST_FRONT_EN is set to 1 in OS_CFG.H, the code for OSQPostFront() will be produced. This allows you to reduce the amount of code space. The reason this conditional compilation has been added is because I added the more powerful function OSQPostOpt().

Added OSQPostOpt() which can emulate both OSQPost() and OSQPostFront() and also allows you to broadcast messages to all tasks

waiting on the queue. The `#define` constant `OS_Q_POST_OPT_EN` found in `OS_CFG.H` allows you to enable (when 1) or disable (when 0) this feature.

Added conditional compilation so that when `OS_Q_QUERY_EN` is set to 1 in `OS_CFG.H`, the code for `OSQQuery()` will be produced. This allows you to reduce the amount of code space.

Added conditional compilation to allow you to declare storage for a single message queue. In other words, you are now allowed to set `OS_MAX_QS` to 1 in `OS_CFG.H`.

Added conditional compilation so that when `OS_SEM_ACCEPT_EN` is set to 1 in `OS_CFG.H`, the code for `OSSemAccept()` will be produced.

Added conditional compilation so that when `OS_SEM_QUERY_EN` is set to 1 in `OS_CFG.H`, the code for `OSSemQuery()` will be produced. This allows you to reduce the amount of code space.

Added call to `OS_FlagUnlink()` in `OSTaskDel()` to support event flags. Note that this code is conditionally compiled in when `OS_FLAG_EN` is set to 1.

Added conditional compilation so that when `OS_TASK_QUERY_EN` is set to 1 in `OS_CFG.H`, the code for `OSTaskQuery()` will be produced. This allows you to reduce the amount of code space.

Added conditional compilation so that when `OS_TIME_DLY_HMSM_EN` is set to 1 in `OS_CFG.H`, the code for `OSTimeDlyHMSM()` will be produced. This allows you to reduce the amount of code space in case you chose not to use this function.

Added conditional compilation so that when `OS_TIME_DLY_RESUME_EN` is set to 1 in `OS_CFG.H`, the code for `OSTimeDlyResume()` will be produced. This allows you to reduce the amount of code space in case you chose not to use this function.

Added conditional compilation so that when `OS_TIME_GET_SET_EN` is set to 1 in `OS_CFG.H`, the code for `OSTimeGet()` and `OSTimeSet()` will be produced. This allows you to reduce the amount of code space in case you chose not to use this function.

Added `OS_FLAG.C`.

Changed `OS_VERSION` to `205`.

Added constants, data types and function prototypes to support Event Flags.

Added `OS_POST_OPT_???` which are the options to specify in `OSMboxPostOpt()` and `OSQPostOpt()` calls.

The global variable `OSTime` is not allocated when `OS_TIME_GET_SET_EN` is set to `0`. This reduces the RAM footprint by 4 bytes.

Added checks at the end of `uCOS_II.H` to ensure that you don't forget any `#defines` that are assumed to be declared in `OS_CFG.H`. If you do forget any of the required `#defines` in `OS_CFG.H`, the compiler will issue an error message. In other words, your compiler should complain about the fact that you didn't specify all the necessary `#defines`.

V2.51 comes with a new algorithm which prevents from having to adjust the stack pointer in `OSIntCtxSw()` and thus making the port independent of compilers and compiler options.

You should still be able to use your OLD (V2.04 and earlier) ports without change (except you'll need to add a few HOOK functions as described in the next section.

This new algorithm affects ALL your ISRs and thus you MUST play close attention to the following changes.

The OLD pseudo code for `OSIntCtxSw()` was:

```
OSIntCtxSw():                    /*      */



     Call OSTaskSwHook()
     OSTCBCur         = OSTCBHighRdy;
     OSPrioCur        = OSPrioHighRdy;
     CPU Stack Pointer = OSTCBHighRdy->OSTCBStkPtr;
     POP all the CPU registers from the new task's stack;
     Execute a return from interrupt instruction;
```

The **NEW** pseudo code for `OSIntCtxSw()` is now:

```
OSIntCtxSw():                    /*      */
     Call OSTaskSwHook()
     OSTCBCur         = OSTCBHighRdy;
     OSPrioCur        = OSPrioHighRdy;
     CPU Stack Pointer = OSTCBHighRdy->OSTCBStkPtr;
     POP all the CPU registers from the new task's stack;
     Execute a return from interrupt instruction;
```

You should notice that you NO LONGER need to adjust the `SP`. The reason this is possible is because, the SP of the task that can be switched out now NEEDS to be saved in ALL the ISRs as described below.

You MUST now change ALL your ISRs. The OLD pseudo code for your ISRs was:

```
YourISR():                    /*      */
      Save processor registers onto current task's stack;
      Call OSIntEnter() or increment OSIntNesting;
      .
      YOUR ISR Handler code;
      .
      Call OSIntExit();
      Restore processor registers from current task's stack;
      Execute a return from interrupt instruction;
```

The **NEW** pseudo code for OSIntCtxSw() is now:

```
YourISR():                    /*      */
      Save processor registers onto current task's stack;
      Call OSIntEnter() or increment OSIntNesting;



      .
      YOUR ISR Handler code;
      .
      Call OSIntExit();
      Restore processor registers from current task's stack;
      Execute a return from interrupt instruction;
```

You should be able to use processor ports made for V2.04 or earlier. Because I added new features, you will most likely need to change the following files:

1) `OS_CFG.H`:
   You will need to ADD all the new `#define` constants and also, declare the data type `OS_FLAGS`. As I mentioned previously, you can simply copy one of the `OS_CFG.H` files supplied with this release and paste it into your own and make the appropriate selection of features you need in your product.

2) `OS_CPU_C.C`:
   You will need to ADD an empty function for `OSTaskIdleHook()` as follows unless you actually want to add your own code to the function:

   ```
   void OSTaskIdleHook (void)
   {
   }
   ```

3) `OS_CPU_A.ASM`:
   If you want to use the new ALGORITHM described in the previous section, you will need to change `OSIntCtxSw()`, `OSTickISR()` **AND** all your ISRs. You should be able to use your OLD ports without change if you don't want to use the new algorithm.

4) `OS_CPU.H`:
   No change.

5) Your ISRs:
   If you want to use the new ALGORITHM described in the previous section, you will need to change ALL your ISRs. You should be able to use your OLD ports without change if you don't want to use the new algorithm.

(2000/10/31)

Removed revision history from all the source code. The revision history is now described in this document. This was done to reduce the amount of 'clutter' from the source files.

Added `OS_ARG_CHK_EN` to enable (when 1) MicroC/OS-II argument checking. By setting this configuration constant to 0, you would be able to reduce code size and improve on performance by not checking the range of the arguments passed to MicroC/OS-II functions. However, it is recommended to leave argument checking enabled.

Added Mutual Exclusion Semaphores (OS_MUTEX.C) that are described in AN1002.PDF.

Added support for `OS_CRITICAL_METHOD` #3 that allows the status register of the CPU to be saved in a local variable. The status register is assumed to be saved by `OS_ENTER_CRITICAL()` in a local variable called `cpu_sr` of type `OS_CPU_SR`. The data type `OS_CPU_SR` is assumed to be declared in `OS_CPU.H`. The status register (and thus the state of the interrupt disable flag) is assumed to be restored by `OS_EXIT_CRITICAL()` from the contents of this variable. The macros would be declared as follows:

```
#define OS_ENTER_CRITICAL()  (cpu_sr = OSCPUSaveSR())
#define OS_EXIT_CRITICAL()   (OSCPURestoreSR(cpu_sr))
```

Note that the functions `OSCPUSaveSR()` and `OSCPURestoreSR()` would be written in assembly language and would typically be found in `OS_CPU_A.ASM` (or equivalent).

The check for `OSIntNesting` in all µC/OS-II services is now being done without disabling interrupts in order to reduce interrupt latency. In other words, the following code:

```
OS_ENTER_CRITICAL();
if (OSIntNesting > 0) {
    .
    .
    OS_EXIT_CRITICAL();
}
```

Has been replaced by:

```
    if (OSIntNesting > 0) {
        .
        .
    }
```

The reason is that ALL currently known processors will treat this byte size variable (`OSIntNesting`) indivisibly.

Moved all local variables to `uCOS_II.H` making them all global variables. This helps when testing.

Calls to `OSTaskCreate()` and `OSTaskCreateExt()` in `OSInit()` now return (`void`) to indicate that the return value is not being used. This prevents warnings from LINT.

Although not critical, `OSInit()` was optimized for speed.

Added `OSInitHookBegin()` at the beginning of `OSInit()` to allow for a processor port to provide additional 'OS" specific initialization which would be done BEFORE MicroC/OS-II is initialized.

Added `OSInitHookEnd()` at the end of `OSInit()` to allow for a processor port to provide additional 'OS" specific initialization which would be done AFTER MicroC/OS-II is initialized.

Initialized `.OSEventType` to `OS_EVENT_TYPE_UNUSED` in `OSInit()`.

Added boundary check for `OSIntNesting` in `OSIntEnter()` to prevent wrapping back to `0` if `OSIntNesting` is already at `255`.

Added boundary check on `OSIntNesting` in `OSIntExit()` to prevent wrapping back to `255` if `OSIntNesting` is already at `0`.

Changed the test for rescheduling in `OSIntExit()` and `OSSched()` from:

```
    if ((--OSIntNesting | OSLockNesting) == 0) {
```

to

```
    if ((OSIntNesting == 0) && (OSLockNesting == 0)) {
```

for sake of clarity.

Removed unreachable code in `OSTaskStat()` for CPU usage > 100%.

Added call to `OSTCBInitHook()` in `OSTCBInit()` to allow user (or port) specific TCB extension initialization.

Moved the increment of `OSTimeTick()` immediately after calling `OSTimeTickHook()`.

Made `OSTime` `volatile`.

Removed checking of `pevent` from the critical section to reduce interrupt latency.

Removed checking of `msg` from the critical section to reduce interrupt latency.

Added `OSMBoxDel()` to delete a message mailbox and free up its Event Control Block. All tasks pending on the mailbox will be readied. This feature is enabled by setting `OS_MBOX_DEL_EN` to `1`.

Changed test:
```
    if (pevent->OSEventGrp)
```
to
```
    if (pevent->OSEventGrp != 0x00).
```

Moved the local variables `OSMemFreeList` and `OSMemTbl[]` to `uCOS_II.H`.

Added code to initialize all the fields of the last node in OSMemInit().

Added services to support Mutual Exclusion Semaphores that are used to reduce priority inversions.

Removed checking of `pevent` from the critical section to reduce interrupt latency.

Removed checking of `msg` from the critical section to reduce interrupt latency.

Added `OSQDel()` to delete a message queue and free up its Event Control Block. All tasks pending on the queue will be readied. This feature is enabled by setting `OS_Q_DEL_EN` to 1.

Changed test:
```
      if (pevent->OSEventGrp)
```
to
```
      if (pevent->OSEventGrp != 0x00).
```

Moved the definition of the data type `OS_Q` to `uCOS_II.H`.

Removed checking of `pevent` from the critical section to reduce interrupt latency.

Added `OSSemDel()` to delete a semaphore and free up its Event Control Block. All tasks pending on the semaphore will be readied. This feature is enabled by setting `OS_SEM_DEL_EN` to 1.

Changed test:
```
      if (pevent->OSEventGrp)
```
to
```
      if (pevent->OSEventGrp != 0x00).
```

Task stack is now cleared in `OSTaskCreateExt()` when either options `OS_TASK_OPT_STK_CHK` or `OS_TASK_OPT_STK_CLR` is set. The new code is:
```
      if (((opt & OS_TASK_OPT_STK_CHK) != 0x0000) ||
          ((opt & OS_TASK_OPT_STK_CLR) != 0x0000)) {
```

`OSTaskCreateHook()` has been removed from `OSTaskCreate()` and `OSTaskCreateExt()` and moved to `OSTCBInit()` so that the hook is called BEFORE the task is made ready-to-run. This avoids having the possibility of readying the task before calling the hook function.

If you don't specify any Mailboxes (`OS_MBOX == 0`), Queues (`OS_Q == 0`), Semaphores (`OS_SEM == 0`) or Mutexes (`OS_MUTEX == 0`) in `OS_CFG.H` in order to create a minimal system, `OSTaskChangePrio()` and `OSTaskDel()` will no longer reference `OSTCBEventPtr`.

Added cast to `INT16U` for all references of `tick` in `OSTimeDlyHMSM()`.

Added `OS_MUTEX.C`.

Changed `OS_VERSION` to `204`.

Moved all 'local' variables from `OS_MEM.C`, `OS_Q.C` and `OS_TASKS.C` to simplify debugging and unit testing.

Added constants, data types and function prototypes to support Mutual Exclusion Semaphores.

This page is intentionally blank.

The distribution of µC/OS-II now assumes the Borland C/C++ V4.51 or higher compiler instead of the V3.1 compiler.   The code should, however, compile and run using V3.1.

This release contains a slightly different directory structure.   The name of the compiler is added to the directory structure in order to support multiple compilers and have the same directory structure for all of these.

`\SOFTWARE\uCOS-II\SOURCE`
Contains the source files for the processor independent code of uC/OS-II.

`\SOFTWARE\uCOS-II\Ix86L\BC45`
Contains the source files for the 80x86 real mode, large model port.   The port now contains the function `OSTaskStkInit_FPE_x86()` which needs to be called before you create a task that will use Borland C/C++'s floating-point emulation (FPE) library.   See application note AN-1001 found on www.Micrium.com.

`\SOFTWARE\uCOS-II\Ix86L-FP\BC45`
Contains the source files for the 80x86 real mode, large model port. This port also contains hardware floating-point support.   In other words, µC/OS-II performs a context switch on the floating-point registers as well as the integer registers.   This port was not present on the original distribution of µC/OS-II (i.e. V2.00).

`\SOFTWARE\uCOS-II\EX1_x86L\BC45\SOURCE`
Contains the source code for the sample code of Example #1

`\SOFTWARE\uCOS-II\EX1_x86L\BC45\TEST`
Contains the build files (`MAKETEST.BAT` and `TEST.MAK`) as well as the executable for Example #1.   To build the executable for example #1, simply type `MAKETEST` at the DOS prompt.   You may have to change `TEST.MAK` to tell it where the Borland C/C++ V4.51 compiler is located. My compiler was located in the `E:\BC45` directory. To execute example #1, type `TEST` at the DOS prompt.

`\SOFTWARE\uCOS-II\EX2_x86L\BC45\SOURCE`
Contains the source code for the sample code of Example #2

`\SOFTWARE\uCOS-II\EX2_x86L\BC45\TEST`

Contains the build files (`MAKETEST.BAT` and `TEST.MAK`) as well as the executable for Example #2. To build the executable for example #2, simply type `MAKETEST` at the DOS prompt. You may have to change `TEST.MAK` to tell it where the Borland C/C++ V4.51 compiler is located. My compiler was located in the `E:\BC45` directory. To execute example #2, type `TEST` at the DOS prompt.

`\SOFTWARE\uCOS-II\EX3_x86L\BC45\SOURCE`
Contains the source code for the sample code of Example #3

`\SOFTWARE\uCOS-II\EX3_x86L\BC45\TEST`
Contains the build files (`MAKETEST.BAT` and `TEST.MAK`) as well as the executable for Example #3. To build the executable for example #3, simply type `MAKETEST` at the DOS prompt. You may have to change `TEST.MAK` to tell it where the Borland C/C++ V4.51 compiler is located. My compiler was located in the `E:\BC45` directory.

To execute example #3, type `TEST` at the DOS prompt.

`\SOFTWARE\uCOS-II\EX4_x86L.FP\BC45\SOURCE`
Contains the source code for the sample code of Example #4

`\SOFTWARE\uCOS-II\EX4_x86L\BC45\TEST`
Contains the build files (`MAKETEST.BAT` and `TEST.MAK`) as well as the executable for Example #4. Example #4 demonstrate the use of `Ix86L-FP`, the port that saves/restores the 80x86's floating-point registers during a context switch. This of course applies for 80x86 processors having a floating-point unit. You may have to change `TEST.MAK` to tell it where the Borland C/C++ V4.51 compiler is located. My compiler was located in the `E:\BC45` directory. To execute example #1, type `TEST` at the DOS prompt.

`\SOFTWARE\BLOCKS\PC\BC45`
Contains the source files for the PC services used to display characters on the screen, read the keyboard etc.

Example #1 (V2.00)

TEST.C was previously called EX1L.C

PC_DispClrLine() has been changed to PC_DispClrRow().

TaskClk() now calls PC_GetDateTime().

The floating-point code in TaskStart() has been removed so that the task only executes integer arithmetic instructions.

Example #2 (V2.00)

TEST.C was previously called EX2L.C
Added TaskStartCreateTasks() to create all the application tasks.
TaskStart() now uses the Borland C/C++ Floating-Point Emulation library and thus, the stack needs to be 'preconditioned' by calling the function OSTaskStkInit_FPE_x86() (see www.Micrium.com, AN-1001).

PC_DispClrLine() has been changed to PC_DispClrRow().

TaskClk() now calls PC_GetDateTime().

Example #3 (V2.00)

TEST.C was previously called EX3L.C

Added TaskStartCreateTasks() to create all the application tasks.

PC_DispClrLine() has been changed to PC_DispClrRow().

TaskClk() now calls PC_GetDateTime().

Floating-point operations have been replaced with integer operations.

Example #4 (V2.00)

Example #4 is a new example using hardware assisted floating-point.

TEST.C was previously called EX4L.C

PC_DispClrLine() has been changed to PC_DispClrRow().

TaskClk() now calls PC_GetDateTime().

PC Services (V2.00)

     `PC.C:`

Functions are now listed in alphabetical order in the file.

`PC_ElapsedStart()` and `PC_ElapsedStop()` now protect the critical section of code that accesses the timer ports.

`PC_VectGet()` and `PC_VectSet()` no longer depend on the Borland C/C++ functions `getvect()` and `setvect()`. This should make these functions more portable.

Changed the name of `PC_DispClrLine()` to `PC_DispClrRow()`.

Added function `PC_DispClrCol()`.

The following function now cast `MK_FP()` to `(INT8U far *)`:
       `PC_DispChar()`
       `PC_DispClrLine()`
       `PC_DispClrScr()`
       `PC_DispStr()`

`PC_ElapsedStop()`, cast `inp()` to `INT8U`.

`PC_GetKey()`, cast `getch()` to `INT16S`.

     `PC.H:`

Function prototypes are now listed in alphabetical order.

Added prototype for `PC_DispClrCol()`.

Changed the return type of `OSEventTaskRdy()` from `void` to `INT8U` to return the priority of the task readied even though the current version of MicroC/OS-II doesn't make use of this feature. This change was done to support future versions.

Moved `OSDummy()` from `OS_TASK.C` to `OS_CORE.C` to be able to call `OSDummy()` from other services.

Added check in `OSMboxPost()` to see if the caller is attempting to post a `NULL` pointer. By definition, you should NOT send a `NULL` pointer message. If you attempt to post a `NULL` pointer, `OSMboxPost()` will return `OS_ERR_POST_NULL_PTR`.

Added checks to make sure `pevent` is not a `NULL` pointer. If `pevent` is a `NULL` pointer, each of the following functions will return `OS_ERR_PEVENT_NULL`:

        `OSMboxPost()`
        `OSMboxQuery()`

Note that `OSMboxAccept()` will return a `NULL` pointer because it doesn't provide the capability of returning an error code.

`OSMboxPend()` sets `*err` to `OS_ERR_PEVENT_NULL` if `pevent` is a `NULL` pointer.

Added check in `OSQPost()` and `OSQPostFront()` to see if the caller is attempting to post a `NULL` pointer. By definition, you should NOT send a `NULL` pointer message. If you attempt to post a `NULL` pointer, `OSQPost()` and `OSQPostFront()` will return `OS_ERR_POST_NULL_PTR`.

Added checks to make sure `pevent` is not a `NULL` pointer. If `pevent` is a `NULL` pointer, each of the following functions will return `OS_ERR_PEVENT_NULL`:

      `OSQFlush()`
      `OSQPost()`
      `OSQPostFront()`
      `OSQQuery()`

Note that `OSQAccept()` simply returns a `NULL` pointer because it doesn't provide the capability of returning an error code.

`OSQPend()` sets `*err` to `OS_ERR_PEVENT_NULL` if `pevent` is a `NULL` pointer.

Added checks to make sure `pevent` is not a `NULL` pointer. If `pevent` is a `NULL` pointer, each of the following functions will return `OS_ERR_PEVENT_NULL`:

      `OSSemPost()`
      `OSSemQuery()`

Note that `OSSemAccept()` returns `0` because it doesn't provide the capability to return an error code.

`OSSemPend()` sets `*err` to `OS_ERR_PEVENT_NULL` if `pevent` is a `NULL` pointer.

Moved `OSDummy()` to `OS_CORE.C`

Added error code `OS_ERR_POST_NULL_PTR` (value is 3).

Changed the return type of `OSEventTaskRdy()` from `void` to `INT8U` to return the priority of the task readied.

Added function prototype for `OSDummy()`.

Added error code `OS_ERR_PEVENT_NULL` (value is 4)

Removed last `else` statement in `OSMboxPend()` because the code is unreachable.

Removed last `else` statement in `OSQPend()` because the code is unreachable.

`OSTaskCtr` is always included.

Added check for definition of macro `OS_ISR_PROTO_EXT` so that the prototype of `OSCtxSw()` and `OSTickISR()` can be changed based on compiler specific requirements. To use a different prototype, simply add:

```
#define OS_ISR_PROTO_EXT
```

in `OS_CPU.H` of the port and then define the new prototype format for `OSCtxSw()` and `OSTickISR()` in `OS_CPU.H` of the port.

`OSTaskCtr` is always included. Previously it was conditionally compiled only if `OS_TASK_CREATE_EN`, `OS_TASK_CREATE_EXT_EN` or `OS_TASK_DEL_EN` was set to `1`. It turns out that you MUST always have either `OS_TASK_CREATE_EN` or `OS_TASK_CREATE_EXT_EN` set to `1` anyway!

This page is intentionally blank.

Changed `for` loop inside `OSEventWaitListInit()` to inline code for speed. This eliminates the loop overhead.

The argument `stk_size` in `OSTCBInit()` has been changed from `INT16U` to `INT32U` to accommodate large stacks.

Changed `'for'` loop inside `'OSMboxQuery()'` to inline code for speed. This eliminates the loop overhead.

Added typecast to avoid compiler error/warning:
```
    pq = (OS_Q *)pevent->OSEventPtr;
         ^^^^^^^^^
```
Affected functions:
```
     OSQAccept()
     OSQFlush()
     OSQPend()
     OSQPost()
     OSQPostFront()
```

Changed `for` loop inside `OSQQuery()` to inline code for speed. This eliminates the loop overhead.

Added `msg = (void *)0;` in `if (OSIntNesting > 0)` case.

Second `if` statement in function `OSSemPend()` needed to be and `if/else` clause.

Stack filling is now done using the ANSI C function `memset()` for speed.

Copying of the `OS_TCB` structure in `OSTaskQuery()` is now done using `memcpy()` for speed.

Function `OSTaskStkChk()` now cast the value `0` to `(OS_STK)0` in while loops.

Changed the comment for `OSTCBStkSize` in the `OS_TCB` structure to indicate that the size is in number of elements and not bytes.

The argument `stk_size` in `OSTCBInit()` has been changed from `INT16U` to `INT32U` to accommodate large stacks.