

ZGSZ/SZX
BAOAN

JEPPESEN
9 MAY 25

10-1P

SHENZHEN, PR OF CHINA
Eff 14 May 1600Z **AIRPORT BRIEFING**

1. GENERAL

1.1. ATIS

D-ATIS 127.45
126.85 (Chinese)

1.2. WAKE TURBULENCE RE-CATEGORIZATION (RECAT-CN)

For Wake Turbulence Re-Categorization (RECAT-CN) Separation Standards see ATC pages.

1.3. RUN-UP TESTS

Engine run-ups are subject to GND or APN clearance, and shall be carried out at a designated location. Fast engine run-ups in the vicinity of boarding bridges or on apron are strictly forbidden.

1.4. RWY OPERATION

1.4.1. GENERAL

During changing the direction of RWY in use, if downwind speed is more than 3m/s (6 KT) and not exceeding 5m/s (10 KT), ATC shall inform ACFT of the ground wind direction and speed, and instruct downwind take-off or downwind landing for short time. If pilot decides not to take off or land on downwind RWY, inform ATC immediately.

1.4.2. RWY CLOSING TIME

RWY 15/33 closed on Monday, Wednesday, Friday and Saturday between 1800-2200UTC, but it is still available for taxiing during closure period.
RWY 16/34 closed on Tuesday, Thursday and Sunday between 1800-2200UTC.
If airlines want to use RWY in the closing time, contact the APT management department with 60 minutes PPR via
Tel: +86-755-23456111/23456222 or Fax: +86-755-23458415.
Also refer to latest NOTAMs.

1.5. TAXI PROCEDURES

1.5.1. GENERAL

TWYs A1 (East of A), A2 (East of A), A12, B (North of B3), D5, D6, F, G4 thru G6 (East of G), J, K2 (West of K), K3, K4 (West of K), Q(between D and G), T3 (East of G), T5 (East of G), V3 and W3 MAX wingspan 224'/68.4m.

TWYs B (between B3 and B4, South of K4), D9 thru D11 (West of D), G9 (East of G), G10, G11, K (South of K2), K1 (West of K), K2 (East of K), K3, L (South of L2), L2 thru L4 and T6 MAX wingspan 213'/65m.

TWYs D7, D8 (West of D), G7, G8 (East of G), W1 (South of W) and W2 (South of W) MAX wingspan 171'/52m.

TWY B (between K2 and K4) MAX wingspan 156?47.6m.

TWYs B (between B4 and K2), B3, K (North of K2), K1 (East of K), K4 (East of K), L (North of L2), L1 (East of B), T1, V4 and V5 MAX wingspan 118'/36m.

TWY B5 thru B7 MAX wingspan 102?31m.

Parallel taxiing on TWYs D7 and D8 as on G7 and G8 is strictly forbidden.

Without ATC clearance, 180° turnaround on TWY is forbidden.

B777-300/300ER, A340-600 and A350-1000 type ACFT shall use cross-the-line turn while making quarter turn on East of TWY D (exclude), and pay attention to avoid crushing TWY edge lights.

If the crew assesses that it is impossible to use cross-the-line turn, it must apply to ATC in advance to operate West of TWY D (include).

ZGSZ/SZX
BAOAN

JEPPESEN
9 MAY 25

10-1P1

SHENZHEN, PR OF CHINA
Eff 14 May 1600Z **AIRPORT BRIEFING**

1. GENERAL

1.5.2. RULES FOR CROSSING RWY 15/33

Read back ATC instructions concerning holding and crossing, verify any questions before crossing:

- Taxi to the designated holding position and hold short of RWY 15/33.
- Upon receiving crossing clearance from ATC, conduct crossing ASAP.
- Monitor TWR frequency for other information of RWY and observe activities on RWY and around carefully.
- While crossing RWY 15/33 following a taking off ACFT, pilot shall be responsible for safety separation with the taking off ACFT to avoid effect of wake turbulence.
- Report to TWR "RWY vacated" after crossing.
- ACFT shall hold short of TWY A after crossing RWY 15/33 from West to East, or short of TWY C after crossing from East to West and then wait for instructions from GND.

1.5.3. RWY HOLDING POSITIONS AND REQUIREMENTS

ACFT shall stop and wait for ATC instructions at the relative RWY holding positions.

The nose of ACFT shall get close to the RWY holding position marking without exceeding it when ACFT is waiting.

ACFT shall report to ATC when nose of ACFT exceeds holding position without instruction.

Mandatory holding position

- HP1 established at TWY A (157?48m South of TWY A2), without clearance, ACFT cannot exceed HP1 when taxiing from South to North along TWY A.
- HP2 established at TWY A (525?160m North of TWYA12), without clearance, ACFT cannot exceed HP2 when taxiing from North to South along TWY A.
- HP3 established at TWY A12 (157?48m east of TWY A), without clearance, ACFT cannot exceed HP3 when taxiing from East to West along TWY A12.
- HP4 established at the junction of D and T6 on TWY T6, without apron clearance, ACFT cannot exceed HP4 when taxiing from East to West along TWY T6. Pilot should stop taxiing and report to BAOAN Apron "close to HP4, request continuing to taxi" when close to HP4.

1.6. PARKING INFORMATION

Visual Docking Guidance System available at stands 301 thru 309, 314 thru 317, 317R, 318 thru 350, 350L, 350R, 351 thru 361, 361R, 362, 362R, 501, 502, 504, 505, 505R, 506, 507, 507R, 508 thru 510, 510R, 520 thru 528, 528R, 529, 529R, 530, 540 thru 545, 545R, 546, 547, 547R, 548, 549, 549R, 560 thru 566, 566R, 567, 568, 568R, 569, 569R and 570.

All stands are push-back except stands 26 thru 30, 27L/R, 29L/R, 30R, 52, 54, 56, 58, 60, 62, 64, 66, 68, 70, 72, 74, 76, 78, 102, 104, 106, 108, 110, 112, 114, 116, 118, Z01 and Z02. Taxiing on own power or push-back is strictly forbidden without ATC clearance.

ACFT parking on T3 and Satellite Hall bridge stands shall close APU and use 400 Hz GPU and A/C, except for following special situations:

- 400 Hz GPU and A/C are under maintenance;
- turn on APU to start up acft engine;
- APU is under maintenance;
- other malfunctions of ACFT;
- in case of exceptional circumstances influencing the regularity and safety of operation, such as public health events, extreme weather, special plane support or insufficient flight transition time;
- quality of power supply or capacity of A/C cannot satisfy demand of ACFT.

Stands 375 and 376 are used for helicopter parking.

ZGSZ/SZ
BAOAN

JEPPESEN
9 MAY 25

10-1P2
Eff 14 May 1600Z

SHENZHEN, PR OF CHINA
AIRPORT BRIEFING

1. GENERAL

1.7. OTHER INFORMATION

1.7.1. GENERAL

ACFT push-back, start-up, taxiing and other operations in the apron control areas shall follow the instructions of apron.

Two RWYs are parallel and wide-distance, RWY designator is not supplemented with "L" or "R", pilots shall pay attention to identify.

A freeway is located to the West of APT, do not mistake for RWY.

ACFT shall report to ATC immediately when realizing taxiing on the wrong way or an incursion of RWY.

Under certain adverse weather condition (e.g. wind shear, turbulence, downdrafts or crosswind) report the situation to controller immediately. According to the reports and weather information, ATC will take the appropriate methods to deal with it.

RWY 15 and 16 right hand circuit.

Birds in vicinity of APT.

1.7.2. OPERATIONS ON PARALLEL RWYS

From North to South segregated parallel approaches/departures, independent parallel approaches/departures and dependent parallel approaches are implemented for RWY 15 and RWY 16.

From South to North segregated parallel approaches/departures and independent parallel departures are implemented for RWY 33 and RWY 34.

When independent parallel departures are applied, departures to IDUMA, SULAS or OVGOT will be carried out via RWY 15/33 and departures to MIPAG, SIERA, TOMUD or LKC will be carried out via RWY 16/34.

2. ARRIVAL

2.1. SPEED RESTRICTIONS

Arriving ACFT shall follow speed limits as follows (unless otherwise instructed by ATC):

- MAX 250 KT below 10000' QNH;
- 220 KT within 30NM from ARP;
- 180 KT and continue flying until 8NM from TDZ when ACFT joins downwind leg or approach final leg.
- ACFT shall immediately inform ATC if ACFT cannot fulfill above speed limits.

2.2. RWY OPERATION

2.2.1. GENERAL

ACFT shall keep listening TWR frequency before vacating RWY; under low visibility conditions, report vacated RWY designation and TWY in use during initial contact with GND.

2.2.2. VACATING RWY VIA RAPID EXIT TWYs

ACFT shall vacate RWY as quickly as possible.

ACFT shall fully vacate RWY within 50 seconds after flying over THR. Flight crew shall inform TWR controller if more time needed before landing.

Each RWY is equipped with several rapid exit TWYs. ACFT shall vacate from the nearest available rapid exit TWY or follow ATC instruction. Flight crew shall inform TWR controller if can not use the suggested rapid exit TWY.

ZGSZ/SZX
BAOAN

9 MAY 25

JEPPESEN
(10-1P3)

Eff 14 May 1600Z

SHENZHEN, PR OF CHINA
AIRPORT BRIEFING

2. ARRIVAL

RWY 16/34 are equipped with rapid exit TWY lights to help pilot obtaining the distance information between rapid exit TWY during the night or under low visibility conditions. RWY 15/33 are not equipped with rapid exit TWY lights (rapid exit TWY lights indicate 300m, 200m and 100m from rapid exit TWY.)

Refer to 10-9 pages for LDAs for each rapid exit TWY.

ACFT is forbidden to stop at rapid exit TWY before fully cross the "NO ENTRY" on it.

2.3. TAXI PROCEDURES

ACFT shall turn transponder on Mode S after landing until entering parking stands. ACFT shall keep ADS-B equipment on while taxiing.

Within APN control area, ACFT shall contact APN for stands information and taxiing clearance before entering APN control areas.

Follow-me is not available, except special flight. If required, landing ACFT shall file for Follow-me service to APT Operation Control Center (AOC) in 30 minutes advance.

When taxiing into stands 503 and 543 ACFT with wingspan 171?52m and above are recommended to use taxiline type A first. ACFT with wingspan less than 171?52m can use either type A or type B taxiline.

2.4. OTHER INFORMATION

Upon receipt of approach clearance, pilot shall monitor the operating status of other ACFT in vicinity by airborne equipment and establish visual separation as practicable, then report "visual separation established" when controller notifies the relative position with other ACFT.

3. DEPARTURE

3.1. START-UP, PUSH-BACK AND TAXI PROCEDURES

ACFT shall keep ADS-B equipment on while push-back and taxiing.

Follow-me is not available.

Within APN operation control area, following rules for apply:

- Obtain delivery clearance from Delivery.
- Obtain push-back and start-up clearance from Delivery when ACFT is on standby.
- Obtain push-back and start-up clearance from apron after agreement with Delivery.
- Report parking stand number to APN controller at the first contact with APN.
- Follow APN controller instructions when pushing back and starting up.
- Obtain taxiing clearance from APN after pushing back and starting up.

Obtain delivery clearance by DCL or delivery frequency.

Report stand number and repeat call sign, SID and initial altitude to TWR delivery controller 5 minutes earlier than closing cabin door.

Inform delivery "ready to push-back and start-up", then keep on frequency until requested to change.

Push-back and start-up upon receiving clearance from GND or APN.

ACFT shall follow push-back and start-up instructions by ATC within 3 minutes or re-apply clearance if not fulfilled in time. After receiving ATC clearance for push-back, pilot shall repeat and tell ground worker.

Pilot shall leave TWR frequency without instruction as soon as airborne to contact assigned APP frequency and report departure RWY designation.

Under normal conditions, ACFT shall finish RWY alignment within 60 seconds after leaving holding position. If flight crew need more time, pilot shall inform ATC before entering RWY.

ZGSZ/SZX
BAOAN

JEPPESEN

SHENZHEN, PR OF CHINA

20 SEP 24

10-1P4

Eff 2 Oct 1600Z

AIRPORT BRIEFING

3. DEPARTURE

3.2. NOISE ABATEMENT PROCEDURES

Upon condition of complying with the requirement of obstacle clearance and climb gradient required by flight procedure, the following operating procedures for the take-off climb shall be implemented. If the procedures cannot be implemented due to any reason, pilot shall inform ATC before take-off (except for special flight):

1. Under the condition that ACFT performance allows, use the reduced thrust to take off.
2. At 450m (1500'):
 - Climb speed of $V_2 + 20\text{km/h}$ (10 KT);
 - Reduce engine power/thrust to climb power/thrust;
 - Maintain a speed with flaps and slats in the take-off configuration.
3. Above 900m (3000'):
 - Accelerate and retract flaps/slats on schedule;
 - Maintain a positive rate of climb;
 - Complete the transition to normal en-route climb speed.


ZGSZ/SZX
BAOAN

JEPPESSEN
22 NOV 24 10-2

SHENZHEN, PR OF CHINA
TERMINAL TRANSITION ROUTE

D-ATIS 127.45 (Chinese 126.85) Apt Elev 13 Alt Set: hPa Trans level: FL118 below 980 hPa
FL108 980 hPa or above

TERMINAL TRANSITION ROUTES
TRANSITING HONG KONG FIR
VIA J104 TO LANDA

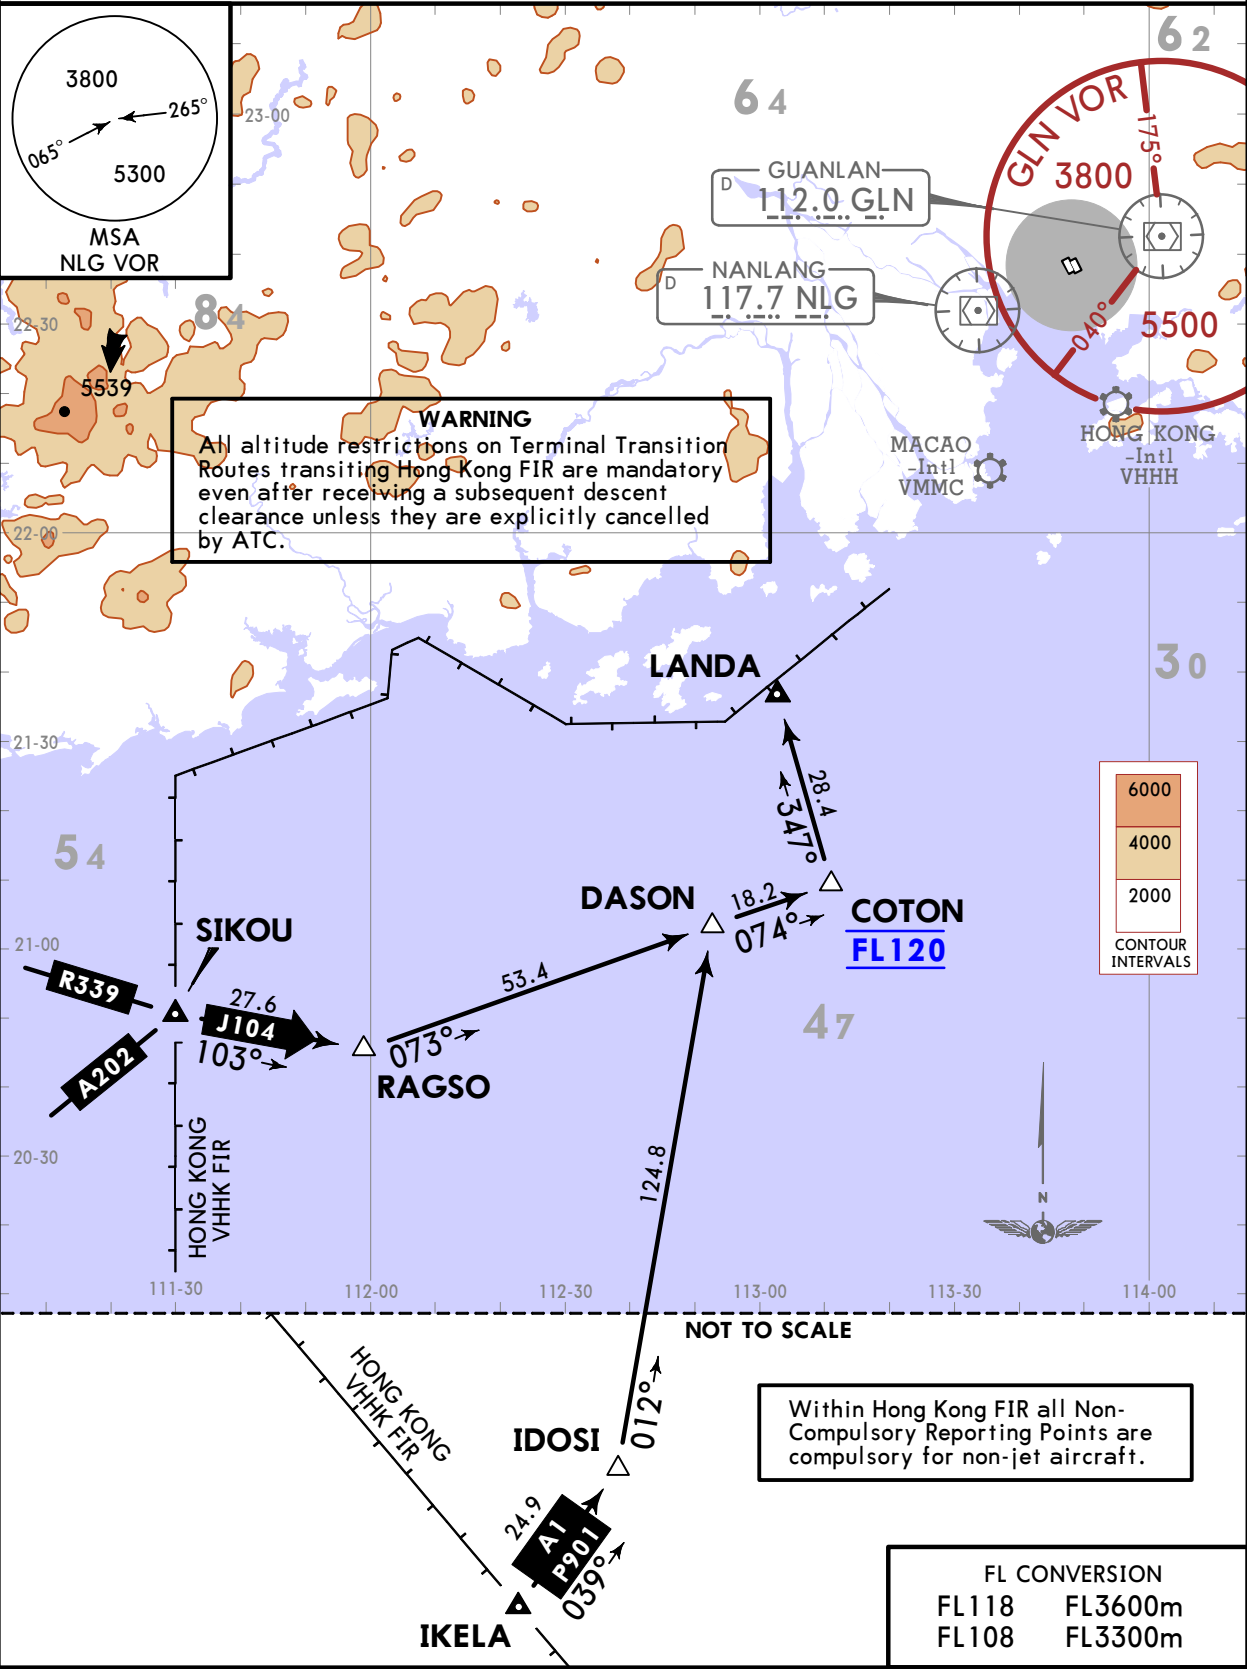


ZGSZ/SZX
BAOAN

JEPPESSEN
22 NOV 24 10-2A

SHENZHEN, PR OF CHINA
TERMINAL TRANSITION ROUTE

D-ATIS 127.45 (Chinese 126.85) Apt Elev 13 Alt Set: hPa Trans level: FL118 below 980 hPa
FL108 980 hPa or above

TERMINAL TRANSITION ROUTES
TRANSITING HONG KONG FIR
VIA J103 TO LANDA

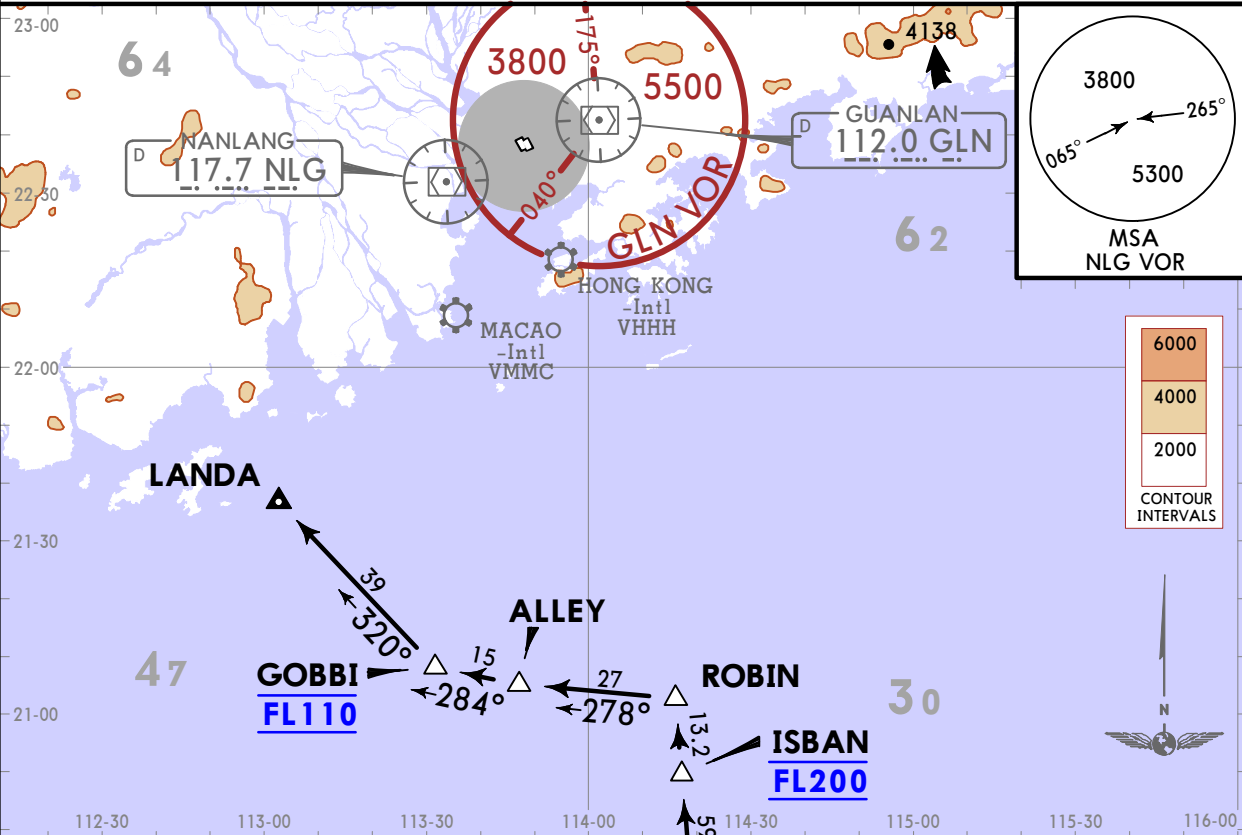

NOT TO SCALE

WARNING
All altitude restrictions on Terminal Transition Routes transiting Hong Kong FIR are mandatory even after receiving a subsequent descent clearance unless they are explicitly cancelled by ATC.

Within Hong Kong FIR all Non-Compulsory Reporting Points are compulsory for non-jet aircraft.

FL CONVERSION	
FL118	FL3600m
FL108	FL3300m

ENTRY ROUTE	ROUTING
A-583	From SABNO direct via TOFEE and SUKER to ALDOM, then along J-103 to ROBIN, then direct to ALLEY, then direct to GOBBI, then direct to LANDA. Cross SABNO at or below FL340, ISBAN at FL200 and GOBBI at FL110, do not descend without ATC clearance.
M-771	From DOSUT along M-771 to DUMOL, then along J-103 to ROBIN, then direct to ALLEY, then direct to GOBBI, then direct to LANDA. Cross ISBAN at FL200 and GOBBI at FL110, do not descend without ATC clearance.
M-772	From ASOBA along M-772 to DULOP, then along M-771 to DUMOL, then along J-103 to ROBIN, then direct to ALLEY, then direct to GOBBI, then direct to LANDA. Cross ISBAN at FL200 and GOBBI at FL110, do not descend without ATC clearance.