


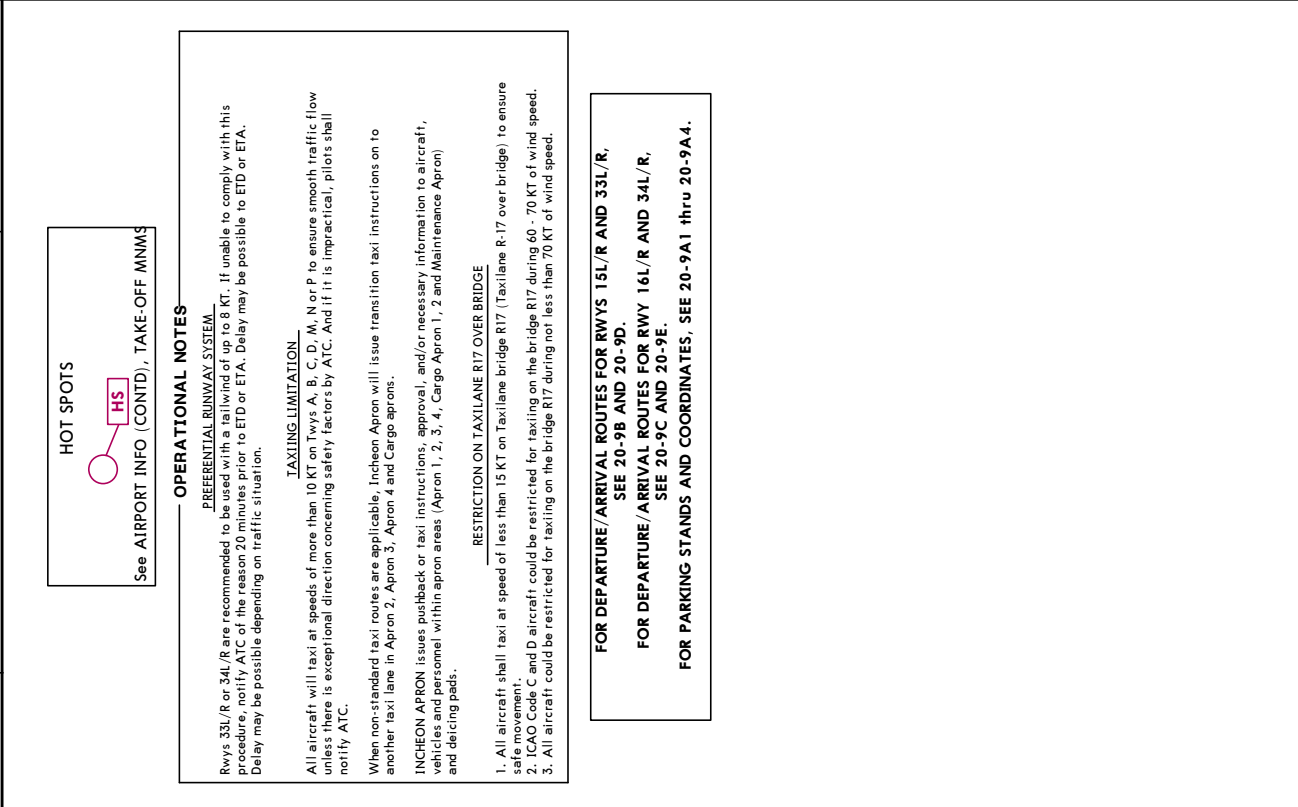

GENERAL
Pilots shall exercise extreme caution to avoid penetrating prohibited areas (P-518, P-73A/B, etc), and Special Use Airspace (ACMI, R-17, etc), especially when flying north of NCN VOR R-270 and R-080 around Incheon Intl Airport.
Rapid exit taxiways are grooved.
Birds in vicinity of airport.
Inbound cargo aircraft to Incheon Intl Airport are required to advise Seoul Approach that they are cargo operators. **See Airport Briefing pages.**
CAT I OPERATIONS:
Pilots are warned that during ILS CAT I operations to Rwy's 15L and 33R, aircraft may experience glidepath signal fluctuations or interference caused by aircraft taxiing in the vicinity of the glidepath aerial. Pilots should therefore closely monitor their ILS approach profile and rate of descent.
CAT I taxi routes are the same as CAT II/IIII taxi routes, refer to low visibility procedure charts (20-9F to 20-9J).
IFR ATC CLEARANCE: The following procedures are established for all turbojet departures from Incheon Intl Airport:
1. IFR ATC clearance may be obtained by Voice RTF or datalink Departure Clearance Service (DCL) (via ARINC 623)).
2. Pilot shall contact INCHEON DELIVERY via voice RTF or Data-link Departure Clearance Service (DCL) from TOBT -10 minutes (in case of NON A-CDM, EOBT -10 minutes) to +5 minutes and report the following information. If initial call takes to place too early, Clearance Delivery will ask the pilot to call again at TOBT -10 minutes.
In case of DCL, reject message will be received. **See Airport Briefing pages.**
a. Aircraft Identification
b. Destination
c. Gate or stand number
d. ATIS code.
3. In cases where ATC clearance is received via DCL, pilots should follow restrictions in the remarks of ATC clearance and acknowledge them within 5 minutes.
4. If unable to commence push-back by TSAT + 5 minutes(flight with TSAT) or within 10 minutes after receiving ATC clearance (flight without TSAT) due to the aircraft being unready, ATC clearance will be cancelled. Pilot shall contact again INCHEON DELIVERY for clearances (See 20-9L to 20-9L9).

4. After received final radar heading at an angle of not greater than 30 degrees, pilots shall intercept the localizer of landing RWY unless previously instructed to cross extended centerline when radio contact is temporarily impossible (e.g. radio failure, congestion or blocked).
5. Report preceding aircraft and/or RWY in sight as soon as possible.
6. If a pilot does not report visual preceding aircraft, RWY or adjacent aircraft, the controller may vector the aircraft away from the final approach for sequencing for a dependent parallel approach.
7. Comply with speed restriction(160 kt to 5 NM from THR). If unable to comply with speed restriction, inform ATC immediately.
8. Do not intentionally deviate from final approach course. Pilots are strongly recommended to track on normal instrument approach course until landing.
9. In the event of deviation from final approach course, maintain own separation from aircraft on adjacent final approach course.
10. When avoiding action is initiated, advise ATC immediately.
11. Pilots should commence an ILS missed approach procedure of the assigned RWY in case of a go-around.

ADDITIONAL RUNWAY INFORMATION					
RWY				USABLE LENGTHS	
				—LANDING Threshold	BEYOND Glide Slope
15R	HIRL (60m) PAPI-L (Angle 3.0°)	CL(15m)	ALSF-II TDZ grooved	RVR	11,313' 3448m 11,311' 3448m
15L	HIRL (60m) PAPI-L (Angle 3.0°)	CL(15m)	ALSF-II TDZ grooved	RVR	11,313' 3448m 11,313' 3448m
16L	HIRL (60m) PAPI-L (Angle 3.0°)	CL(15m)	ALSF-II TDZ grooved	RVR	12,071' 3679m 12,076' 3681m
16R	HIRL (60m) PAPI-L (Angle 3.0°)	CL(15m)	ALSF-II TDZ grooved	RVR	11,251' 3429m 11,256' 3431m
① length 900m					

HOT SPOTS

(for information only, not to be construed as ATC instructions.)

- HS 1

Aircraft taxiing on Twy K from Rwy 33R after landing use caution when ATC utilizes Rwy 33L for takeoffs. Do not cross the holding marking for Rwy 33L without ATC authorization.
- HS 2

Aircraft taxiing on Twy J from Rwy 15L after landing use caution when ATC utilizes Rwy 15R for takeoffs. Do not cross the holding marking for Rwy 15R without ATC authorization.
- HS 21

HS 23

Use caution of confusion on taxiways. Do not proceed taxiing beyond transfer of control points without clearance from Incheon Apron or Ground (Tower).
- HS 25

HS 26

Use caution of confusion on taxiways. Do not proceed taxiing beyond transfer of control points without clearance from Incheon Apron or Ground (Tower). And do not move when safety distance is not assured.
- HS 24

HS 27

Use caution of confusion on taxiways. Taxilane RW and RE are not compliant with code D. E. F aircraft. Use caution of vehicle around GSE (Ground Support Equipment) roads intersection areas (RE-R1, RW-R4).
- HS 28

HS 29

Use caution of confusion on taxiways. Taxilane RW and RE are not compliant with code D. E. F aircraft. Use caution of vehicle around GSE (Ground Support Equipment) roads intersection areas (RE-R1, RW-R4).


State


TAKE-OFF

	3 RVR Required				RL & CL	2 RL & RCLM	2 RL or RCLM	NIL (Day Only)
	1 TGS, HIRL, & CL	HIRL & CL		RL & CL				
Multi Engine Aircraft	R/V75m R/V300'	R/V125m R/V400'	R/V150m R/V500'	R/V200m R/V600'	R/V300m R/V1000'	R/V400m R/V1200'	R/V500m R/V1600'	

The TDZ RVR/VIS may be assessed by the pilot.
SIDs are designed in accordance with STANDARDS for FLIGHT PROCEDURE DESIGN.
① TGS (Take-off Guidance System).
② For Night Operations at least RL or CL and Rwy End Lights are available.

- c. Pilot procedures
1. Fly accurate assigned heading to final and do not pass through assigned runway extended centerline, unless otherwise instructed by ATC
 2. Other aircraft will be operating on the adjacent approach.
 3. Accurately track the extended runway centerline.

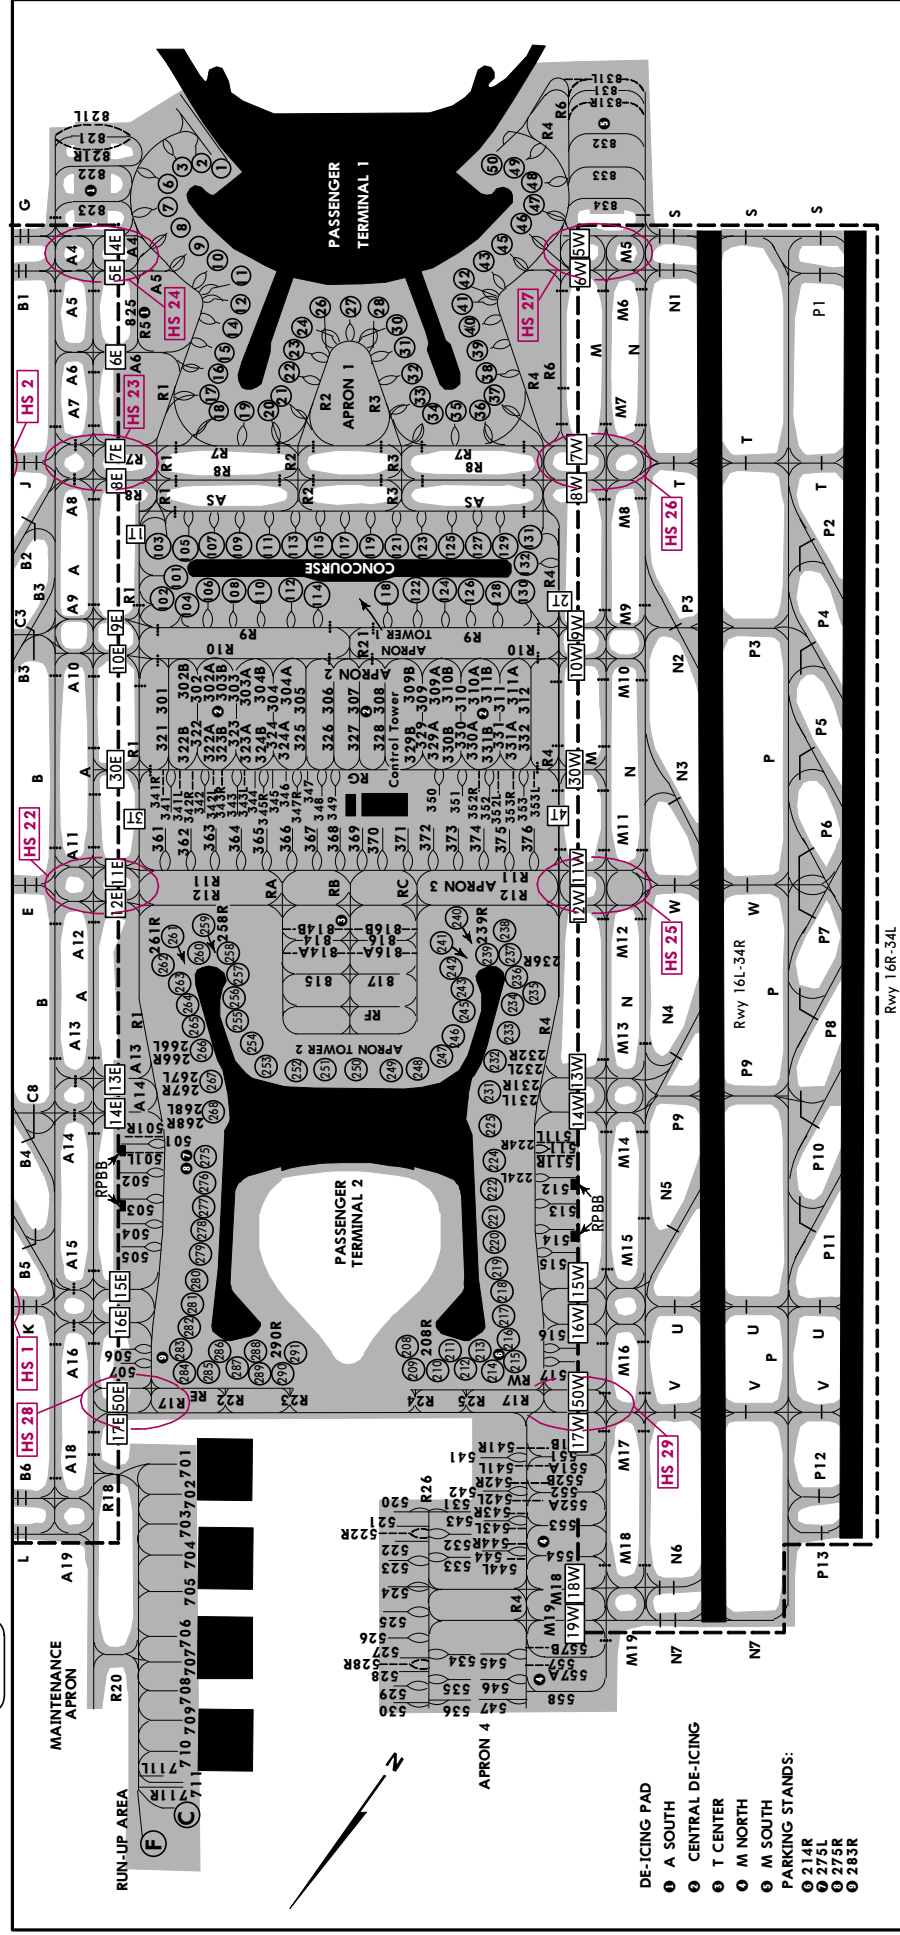

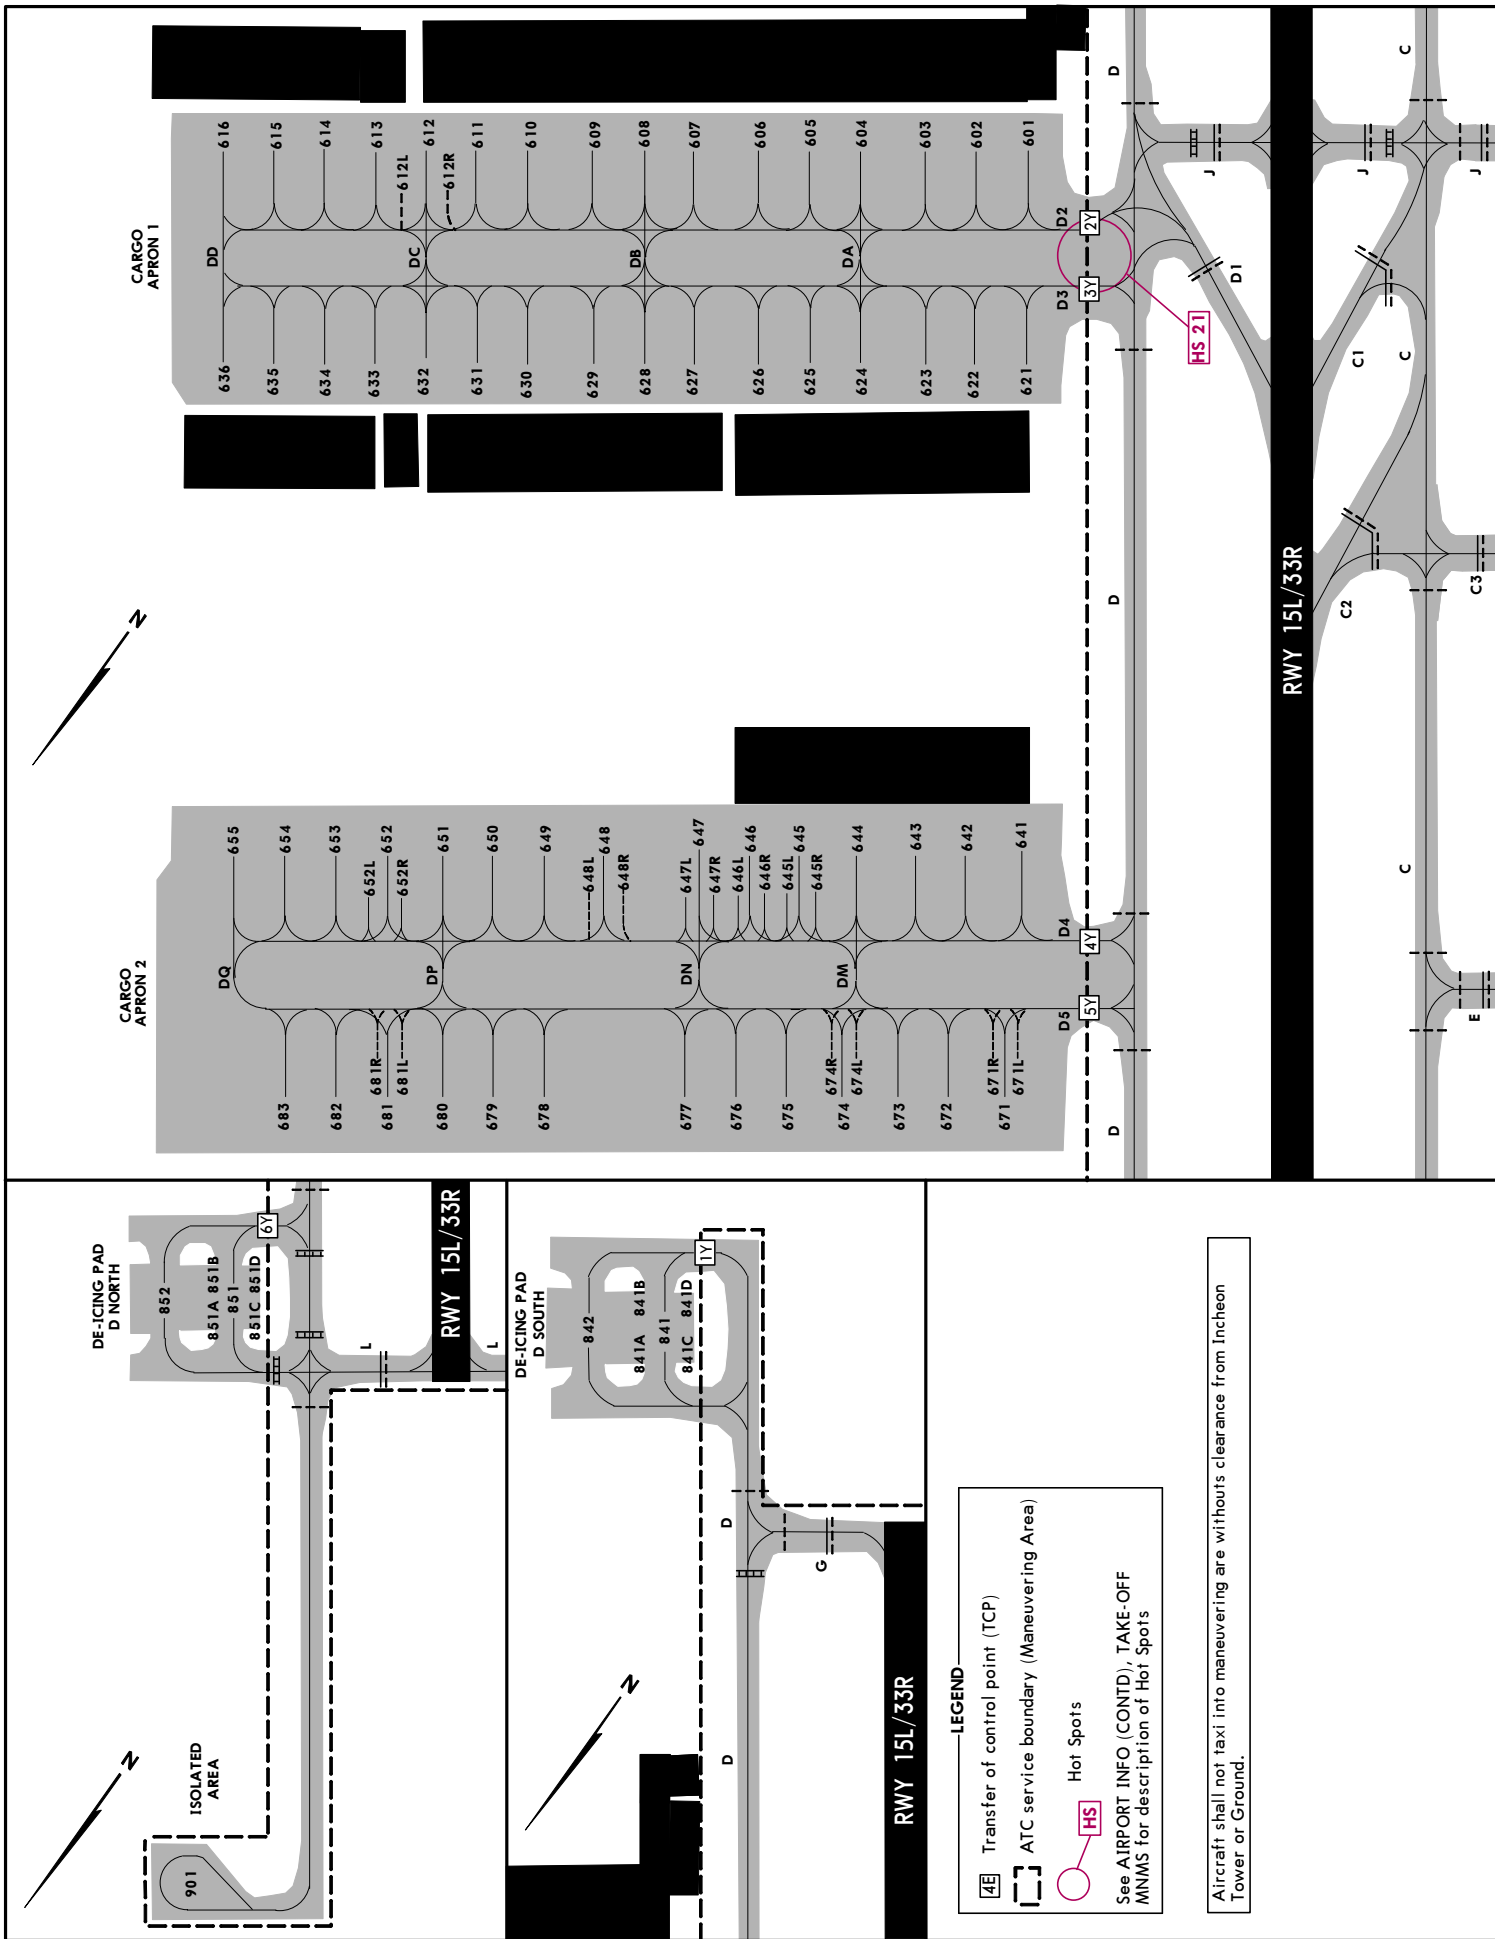

RKSI/ICN

JEPPesen

SEOUL/INCHEON, KOREA

17 JAN 25

20-9A3

Eff 22 Jan 1600Z

INCHEON INTL

PARKING STAND COORDINATES

STAND No.	COORDINATES	ELEV	STAND No.	COORDINATES	ELEV
Apron 1					
1, 2, 3, 6, 7	N37 27.0 E126 27.4	16'	342R	N37 27.8 E126 26.7	20'
8 thru 10	N37 27.1 E126 27.3	16'	342	N37 27.8 E126 26.7	16'
11	N37 27.1 E126 27.2	16'	342L	N37 27.8 E126 26.7	20'
12	N37 27.1 E126 27.1	16'	343R	N37 27.8 E126 26.6	20'
14 thru 17	N37 27.2 E126 27.1	16'	343	N37 27.8 E126 26.6	16'
18	N37 27.3 E126 27.1	16'	343L	N37 27.7 E126 26.6	20'
19 thru 22	N37 27.2 E126 27.0	16'	344, 345	N37 27.7 E126 26.6	16'
23, 24	N37 27.1 E126 27.1	16'	345R	N37 27.7 E126 26.6	20'
26 thru 28	N37 27.0 E126 27.0	16'	346	N37 27.7 E126 26.5	16'
30	N37 27.0 E126 26.9	16'	347R	N37 27.7 E126 26.5	20'
31, 32	N37 27.0 E126 26.8	16'	347 thru 349	N37 27.7 E126 26.5	16'
33	N37 27.1 E126 26.8	16'	350	N37 27.6 E126 26.3	16'
34, 35	N37 27.1 E126 26.7	16'	351	N37 27.6 E126 26.2	16'
36 thru 38	N37 27.0 E126 26.7	16'	352	N37 27.5 E126 26.2	16'
39, 40	N37 27.0 E126 26.8	16'	353	N37 27.5 E126 26.1	16'
41	N37 26.9 E126 26.8	16'	Apron 3		
42	N37 26.9 E126 26.9	16'	208 thru 210	N37 28.3 E126 25.7	20'
43	N37 26.8 E126 26.9	16'	211, 212	N37 28.3 E126 25.6	20'
45, 46	N37 26.8 E126 26.8	16'	213 thru 217	N37 28.2 E126 25.6	20'
47	N37 26.7 E126 26.8	16'	218 thru 221	N37 28.1 E126 25.7	20'
48 thru 50	N37 26.7 E126 26.9	16'	222, 224	N37 28.0 E126 25.8	20'
103, 105	N37 27.5 E126 27.0	16'	225	N37 27.9 E126 25.9	20'
107	N37 27.5 E126 26.9	16'	231	N37 27.9 E126 25.9	20'
109	N37 27.4 E126 26.9	16'	232, 233	N37 27.8 E126 25.9	20'
111, 113, 115	N37 27.4 E126 26.8	16'	234	N37 27.8 E126 26.0	20'
117, 119	N37 27.3 E126 26.7	16'	235	N37 27.7 E126 26.0	20'
121, 123	N37 27.3 E126 26.6	16'	236	N37 27.7 E126 26.0	16'
125	N37 27.2 E126 26.6	16'	236R	N37 27.7 E126 26.0	20'
127, 129, 131	N37 27.2 E126 26.5	16'	237, 238	N37 27.7 E126 26.0	16'
132	N37 27.2 E126 26.4	16'	239	N37 27.7 E126 26.1	16'
Apron 2			239R	N37 27.7 E126 26.1	20'
101	N37 27.5 E126 27.0	16'	240	N37 27.7 E126 26.1	16'
102, 104	N37 27.5 E126 26.9	20'	241, 242	N37 27.8 E126 26.1	20'
106	N37 27.5 E126 26.9	16'	243, 245	N37 27.8 E126 26.0	20'
108	N37 27.5 E126 26.9	20'	246, 247	N37 27.9 E126 26.0	20'
110	N37 27.5 E126 26.8	20'	248	N37 28.0 E126 26.0	20'
112	N37 27.4 E126 26.8	20'	249, 250	N37 28.0 E126 26.1	20'
114	N37 27.4 E126 26.7	20'	251	N37 28.0 E126 26.2	20'
118, 122	N37 27.3 E126 26.6	20'	252	N37 28.1 E126 26.2	20'
124, 126	N37 27.3 E126 26.5	16'	253, 254	N37 28.1 E126 26.3	20'
128	N37 27.3 E126 26.4	16'	255 thru 257	N37 28.0 E126 26.4	20'
130	N37 27.2 E126 26.4	16'	258	N37 27.9 E126 26.5	16'
321, 322	N37 27.7 E126 26.8	16'	258R	N37 28.0 E126 26.5	20'
323, 323B	N37 27.7 E126 26.7	16'	259 thru 261	N37 28.0 E126 26.5	16'
323A, 324, 324B	N37 27.6 E126 26.7	16'	261R thru 264	N37 28.0 E126 26.5	20'
324A, 325	N37 27.6 E126 26.6	16'	265 thru 267L	N37 28.1 E126 26.4	20'
326	N37 27.6 E126 26.5	16'	267, 267R	N37 28.1 E126 26.3	20'
327, 328	N37 27.5 E126 26.5	16'	268	N37 28.2 E126 26.3	20'
329	N37 27.5 E126 26.4	16'	275	N37 28.2 E126 26.2	20'
330A, 330	N37 27.4 E126 26.3	16'	276	N37 28.3 E126 26.2	20'
330B	N37 27.5 E126 26.4	16'	277, 278	N37 28.3 E126 26.2	20'
331	N37 27.4 E126 26.3	16'	279	N37 28.4 E126 26.2	20'
332	N37 27.4 E126 26.2	16'	280, 281	N37 28.4 E126 26.1	20'
341R	N37 27.8 E126 26.7	20'	282, 283	N37 28.5 E126 26.1	20'
341	N37 27.8 E126 26.7	16'	283R	N37 28.5 E126 26.0	20'
341L	N37 27.8 E126 26.7	20'			

Run-up Area

1. Engine Run-up Area: North of Maintenance Apron.

2. In case of run-up area unusable, temporary run-up area 14A (North part of twy A) can be allocated.

3. 122.175 Mhz shall be monitored during engine performance check in temporary run-up areas.

CHANGES: None.

© JEPPESEN, 2001, 2024. ALL RIGHTS RESERVED.

RKSI/ICN

17 JAN 25

Eff 22 Jan 1600Z

20-9A4

JEPPESSEN

SEOUL/INCHEON, KOREA

INCHEON INTL

PARKING STAND COORDINATES

STAND No.	COORDINATES	ELEV	STAND No.	COORDINATES	ELEV
Apron 3			625	N37 28.0 E126 27.9	20'
284 thru 287	N37 28.5 E126 26.0	20'	626	N37 28.1 E126 27.9	20'
288	N37 28.4 E126 26.0	20'	627 thru 629	N37 28.1 E126 28.0	20'
289 thru 291	N37 28.4 E126 25.9	20'	630, 631	N37 28.2 E126 28.1	20'
361	N37 27.9 E126 26.7	16'	632, 633	N37 28.2 E126 28.2	20'
362	N37 27.8 E126 26.7	16'	634	N37 28.2 E126 28.3	20'
363, 364	N37 27.8 E126 26.6	16'	635, 636	N37 28.3 E126 28.3	20'
365	N37 27.8 E126 26.5	16'	Cargo Apron 2		
366, 367	N37 27.7 E126 26.5	16'	641	N37 28.2 E126 27.4	20'
368 thru 370	N37 27.7 E126 26.4	16'	642, 643	N37 28.3 E126 27.5	20'
371, 372	N37 27.6 E126 26.3	16'	644	N37 28.3 E126 27.6	20'
373, 374	N37 27.6 E126 26.2	16'	645L	N37 28.4 E126 27.6	23'
375	N37 27.5 E126 26.2	16'	645	N37 28.3 E126 27.6	20'
376	N37 27.5 E126 26.1	16'	645R	N37 28.3 E126 27.6	23'
501L	N37 28.3 E126 26.4	20'	646L	N37 28.4 E126 27.6	23'
501	N37 28.3 E126 26.4	16'	646	N37 28.4 E126 27.6	20'
501R	N37 28.3 E126 26.4	20'	646R	N37 28.4 E126 27.6	23'
502	N37 28.3 E126 26.4	16'	647L, 647	N37 28.4 E126 27.7	20'
503 thru 505	N37 28.4 E126 26.3	16'	647R	N37 28.4 E126 27.7	23'
506	N37 28.5 E126 26.2	16'	648L, 648	N37 28.4 E126 27.8	20'
507	N37 28.6 E126 26.2	16'	648R	N37 28.4 E126 27.7	20'
511L	N37 27.9 E126 25.7	20'	649, 650	N37 28.5 E126 27.8	20'
511	N37 27.9 E126 25.7	16'	651	N37 28.5 E126 27.9	20'
511R	N37 27.9 E126 25.7	20'	652L	N37 28.6 E126 27.9	20'
512	N37 27.9 E126 25.7	16'	652, 652R	N37 28.5 E126 27.9	20'
513 thru 515	N37 28.0 E126 25.6	16'	653, 654	N37 28.6 E126 28.0	20'
516	N37 28.1 E126 25.5	16'	655	N37 28.6 E126 28.1	20'
517	N37 28.2 E126 25.4	16'	671	N37 28.4 E126 27.3	20'
Apron 4			672	N37 28.4 E126 27.4	20'
520	N37 28.5 E126 25.6	16'	673, 674, 674L	N37 28.5 E126 27.4	20'
521, 522	N37 28.5 E126 25.5	16'	674R, 675, 676	N37 28.5 E126 27.5	20'
523, 524, 525	N37 28.6 E126 25.5	16'	677	N37 28.5 E126 27.6	20'
526 thru 530	N37 28.7 E126 25.4	16'	678, 679	N37 28.6 E126 27.7	20'
531, 541,	N37 28.4 E126 25.5	16'	680, 681	N37 28.7 E126 27.8	20'
542, 542R			682, 683	N37 28.7 E126 27.9	20'
532, 533, 544	N37 28.5 E126 25.4	16'	Maintenance Apron		
534, 545	N37 28.6 E126 25.3	16'	701	N37 28.6 E126 25.9	16'
535	N37 28.7 E126 25.3	16'	702, 703	N37 28.7 E126 25.9	16'
542L, 543	N37 28.4 E126 25.4	16'	704, 705	N37 28.8 E126 25.8	16'
546	N37 28.6 E126 25.2	16'	706	N37 28.9 E126 25.8	16'
536, 547	N37 28.7 E126 25.2	16'	707, 708	N37 28.9 E126 25.7	16'
558	N37 28.6 E126 25.1	16'	709	N37 29.0 E126 25.7	16'
Cargo Apron 1			710 thru 711R	N37 29.0 E126 25.6	16'
601	N37 27.8 E126 27.8	20'	DE-ICING APRONS		
602, 603	N37 27.8 E126 27.9	20'	Central De-icing Zone		
604 thru 606	N37 27.9 E126 28.0	20'	301	N37 27.7 E126 26.9	16'
607	N37 27.9 E126 28.1	20'	302A, 302B	N37 27.7 E126 26.8	16'
608	N37 28.0 E126 28.1	20'	302, 303	N37 27.6 E126 26.8	16'
609, 610	N37 28.0 E126 28.2	20'	303A thru 304B	N37 27.6 E126 26.7	16'
611	N37 28.0 E126 28.3	20'	305, 306	N37 27.5 E126 26.6	16'
612L thru 613	N37 28.1 E126 28.3	20'	307, 308	N37 27.5 E126 26.5	16'
614, 615	N37 28.1 E126 28.4	20'	309	N37 27.5 E126 26.4	16'
616	N37 28.2 E126 28.5	20'	310A	N37 27.4 E126 26.3	16'
621	N37 27.9 E126 27.7	20'	310, 310B	N37 27.4 E126 26.4	16'
622	N37 28.0 E126 27.7	20'	311, 312	N37 27.4 E126 26.3	16'
623, 624	N37 28.0 E126 27.8	20'			

Run-up Area

1. Engine Run-up Area: North of Maintenance Apron.
2. In case of run-up area unusable, temporary run-up area 14A (North part of twy A) can be allocated.
3. 122.175 Mhz shall be monitored during engine performance check in temporary run-up areas.

RKSI/ICN



SEOUL/INCHEON, KOREA


2 AUG 24
Eff 7 Aug 1600Z (20-9A5)

INCHEON INTL

PARKING STAND COORDINATES					
STAND No.	COORDINATES	ELEV	STAND No.	COORDINATES	ELEV
M North Zone					
551, 551A	N37 28.3 E126 25.3	16'			
551B	N37 28.3 E126 25.4	16'			
552 thru 552B	N37 28.3 E126 25.3	16'			
553	N37 28.4 E126 25.3	16'			
554	N37 28.4 E126 25.2	16'			
557 thru 557B	N37 28.5 E126 25.1	16'			
T Center Zone					
814, 814A	N37 27.9 E126 26.3	20'			
814B	N37 27.9 E126 26.4	20'			
815	N37 27.9 E126 26.3	20'			
816 thru 816B	N37 27.8 E126 26.2	20'			
817	N37 27.8 E126 26.2	16'			
A South Zone					
821L	N37 27.1 E126 27.6	16'			
821, 821R	N37 27.0 E126 27.6	16'			
822	N37 27.1 E126 27.6	16'			
823	N37 27.1 E126 27.5	16'			
825	N37 27.2 E126 27.3	16'			
M South Zone					
831L thru 831R	N37 26.5 E126 26.8	16'			
832	N37 26.6 E126 26.8	16'			
833, 834	N37 26.6 E126 26.7	16'			
D South Zone					
841 thru 841B	N37 27.4 E126 28.2	20'			
841C	N37 27.4 E126 28.1	20'			
841D, 842	N37 27.4 E126 28.2	20'			
D North Zone					
851	N37 29.1 E126 26.6	16'			
851A, 851B	N37 29.1 E126 26.7	16'			
851C, 851D	N37 29.1 E126 26.6	16'			
852	N37 29.1 E126 26.7	16'			
Isolated Security Parking Position					
901	N37 29.5 E126 26.3	16'			

Run-up Area
1. Engine Run-up Area: North of Maintenance Apron.
2. In case of run-up area unusable, temporary run-up area 14A (North part of twy A) can be allocated.
3. 122.175 Mhz shall be monitored during engine performance check in temporary run-up areas.

CHANGES: None.
© JEPPESEN, 2008, 2024. ALL RIGHTS RESERVED.

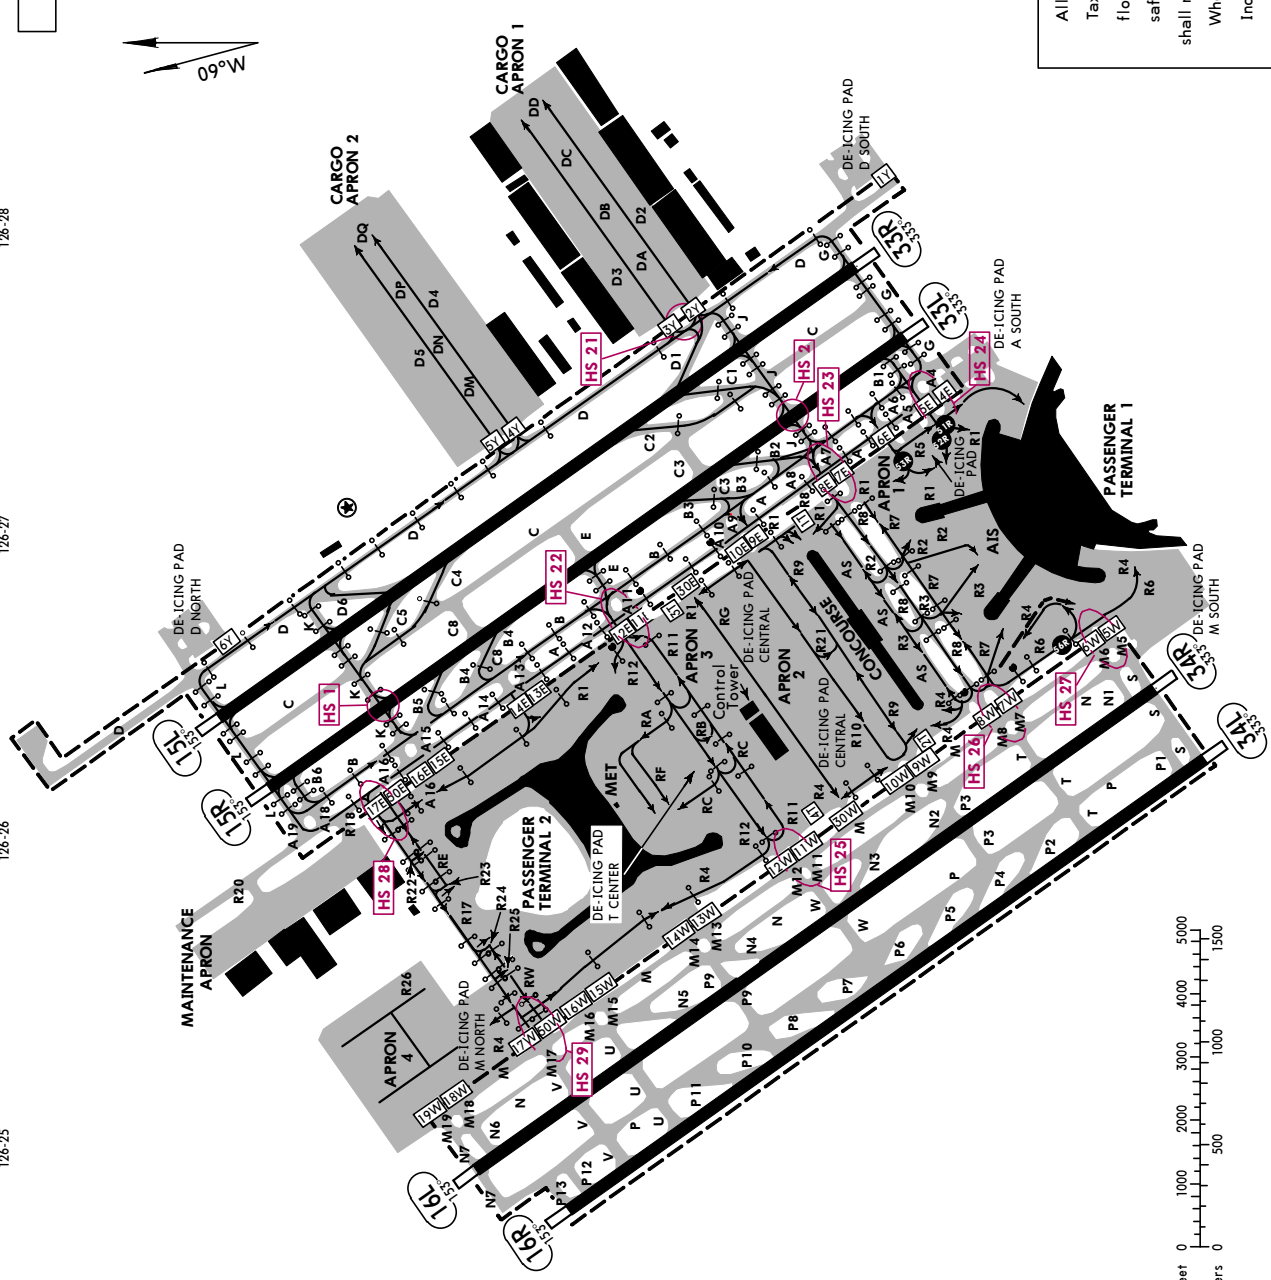


All aircraft will taxi at speeds of more than 10 KT on Taxiways A, B, C, D, M, N or P to ensure smooth traffic flow unless there is exceptional direction concerning safety factors by ATC. And if it is impractical, pilots shall notify ATC.

When non-standard taxi routes are applicable, Incheon Apron will issue transition taxi instructions to another taxi lane in Apron 2, Apron 3, Apron 4 and Cargo Aprons.

	Tower	SEOUL Departure (R)
ST (W): Rwy 16L/R, 34L/R	EAST (E): Rwy 15L/R, 33L/R	
118.8	118.2	121.4 124.8 125.15

CHANGES: Twvs R22, R23, R24 and R25 added.

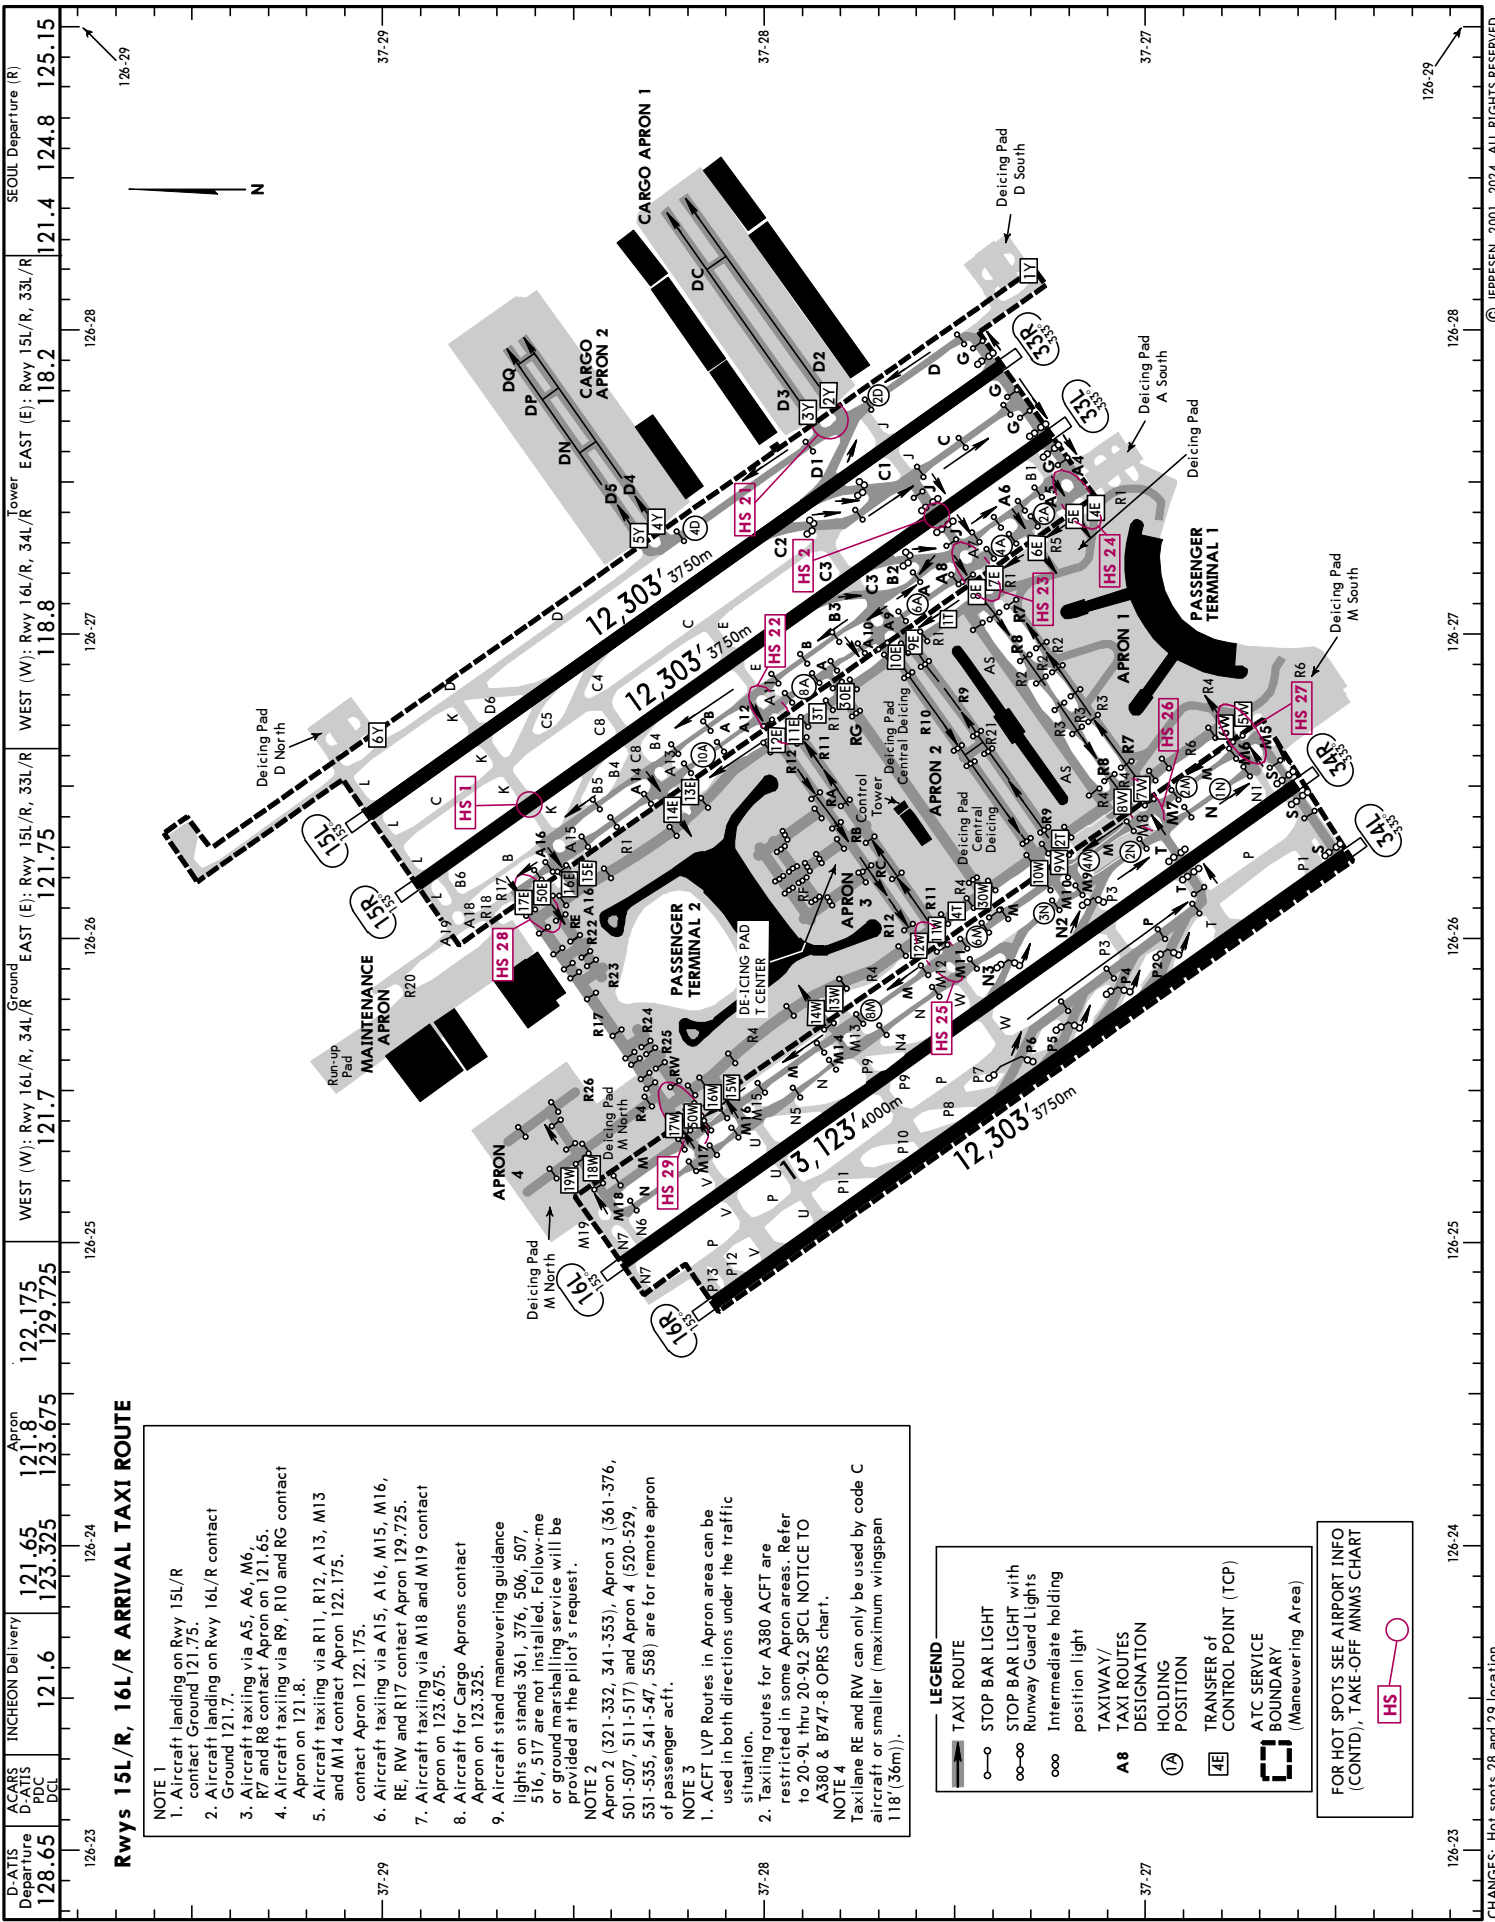



D-ATIS Departure	ACARS D-ATIS PDC DCL	INCHEON Delivery	Apron
128.65		121.6	121.8
		123.325	123.67

Rwys 33L/R, 34L/R DEPARTURE TAXI ROUTE

NOTE 1

1. Aircraft taking off from Rwy 33L/R contact Ground 121.75.
2. Aircraft taking off from Rwy 34L/R contact Ground 121.7.
3. Aircraft at Gates 1-50, odd number Gates 103-131 and Gate 152 contact Apron on 121.65.
4. Aircraft at Gate 101, even number Gates 102-130 and Remote stands 301-312, 321-332, 341-353 contact Apron 121.8.
5. Aircraft at Gate 225-268, remote stands 361-376 contact Apron 122.175.
6. Aircraft at Gate 208-224, 275-291, remote stands 501-507, 511-517 contact Apron 129.725.
7. Aircraft at Remote stands 520-529, 531-535, 541-547, 558 contact Apron 123.675.
8. Aircraft at Cargo stands 601-616, 621-636 and 671-683 contact Apron on 123.325.

9. Aircraft stand maneuvering guidance lights on aircraft stands 361, 376, 506, 507 516, 517 are not installed. Follow-me or ground marshalling service will be provided at the pilot's request.

NOTE 2

- Apron 2 (321-332, 341-353), Apron 3 (361-376, 501-507, 511-517) and Apron 4 (520-529, 531-535, 541-547, 558) are for remote apron of passenger actf.


NOTE 3

1. ACFT LVP Routes in Apron area can be used in both directions under the traffic situation.

2. Taxiing routes for A380 ACFT are restricted in some Apron areas. Refer to 20-9L thru 20-9L2 SPCL NOTICE 1 A380 & B747-8 OPRs chart.

NOTE 4

Taxilane RE and RW can only be used by code C aircraft or smaller (maximum wingspan 118' (36m)).

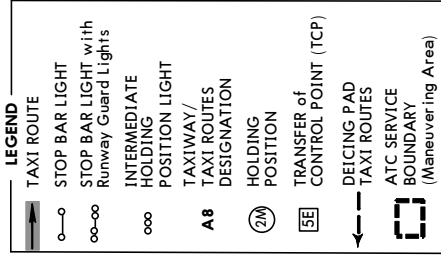

FOR HOT SPOTS SEE AIRPORT INFO
(CONTD), TAKE-OFF MNMS CHART

