

Refitting of shaft No. 2:

See drawing No. 41-31767.

The shafts are positioned in their respective openings in the gearbox (bearing housings not fitted yet). Right hand shaft (seen facing gearbox front) is taken through the rear side, the left through the front. The gearwheel is well supported against the wall in the gearbox by means of wooden blocks.

The shaft is pressed into the gearwheel hub by means of six extraction bolts, as seen on drawing No. 41-31767.

The wheel is locked on the shaft by the stopper (item 81) which is well secured.

Gearwheel and shaft are displaced axially, until the wheel is close to the wall, where it is supported by means of wooden blocks.

One of the shaft journals is now sticking out of the gearbox and is accessible for mounting of bearings. When the bearing housing with snap ring (items 9 and 43) has been fitted to the gearbox, the bearing with tapered sleeve and end washer (items 35, 37 and 19) can be fitted to the shaft journal. When fitting bearings, the instructions must be closely followed. See section about mounting of roller bearings.

The shaft inclusive the gearwheel and bearing is now guided axially inwards until the outer race of bearing trust against the snap ring in the bearing housing.

The bearing in the other end of the shaft is fitted and then the corresponding bearing housing. Finally the bearing covers (item 10) are fitted. For both shafts No. 2 the same procedure of assembly is followed.

Remember fiber gaskets for bearing covers and housings.

Repositioning of input shaft:

The input shaft (item 25) including fitted bearing (item 36) is guided into the gearbox through the opening in the front wall.

The bearing housing and bearing in the rear wall is mounted as described for shaft No. 2.

Bearing housing in the front wall is fitted.

When the bearing cover has been put on, ensure that the oil seal (item 46) is not damaged.

Stord Twin Screw Press Type RS-64SF

Data sheet

1. Weight, Volume and Principal Dimensions:

Total weight net, approx.	20,6 tons	(23,0 US tons)
Overall length of press	7,38 m	(24,5 ft)
Max. width of press	1,97 m	(6,5 ft)
Total height of press	2,17 m	(7,1 ft)

2. Drive and Power:

The overall reduction in the gearbox is 125 : 1.

Speed Input Screws	Shaft	Consumption of power, approx.
3,5 rpm	437 rpm	Recommended
4,5 rpm	563 rpm	motor size
5,5 rpm	687 rpm	90 kW

3. Type of Motor:

The motor should have a power rating allowing ample reserves of power.

For fixed speed drive by 3 ph. squirrel cage motor, the starting torque should be at least twice the normal running torque, to enable start of fully charged press.

For variable speed drive, power allowance must be made for various losses caused by inefficient methods of speed regulation. An overall ratio of speed regulation of 1 : 3 is recommended.

4. Quantity of Lubricating Oil:

Gearbox	220 Litre	(48 Imp. gals/ 58 US gals)
---------	-----------	-------------------------------

(quality according to the lubrication chart)

Stord Twin Screw Press**MS-64SF****Weight of parts**

	Approx. net weights	
Cover for cage,	400 kg	(880 lbs)
Press cage, two upper parts	3 970 kg	(8 800 lbs)
Press Screws, each	2 350 kg	(5 200 lbs)
Inlet chute	100 kg	(220 lbs)
Outlet chute	70 kg	(150 lbs)
Middle & rear supports for frame	300 kg	(660 lbs)
Gearbox, complete	6 300 kg	(13 900 lbs)
Gearbox, upper section	800 kg	(1 800 lbs)
Gearbox, middle section	950 kg	(2 100 lbs)
Gearbox, lower section	1 010 kg	(2 200 lbs)
Gearbox output shaft incl. spur wheel, flange and bearings, each	1 120 kg	(2 500 lbs)
Intermediate spur wheel incl. shaft, bearings and pinion, each	410 kg	(900 lbs)
Small spur wheel incl. shaft bearings and pinion, each	200 kg	(450 lbs)
Input shaft with bearings	75 kg	(170 lbs)
Press frame incl. cage lower part and sling clamps	8 200 kg	(18 000 lbs)
Transmission parts	140 kg	(300 lbs)

No.	Description:	Item:	Drawing/ Material:
1	Press screw, left	1	21-37841-C
1	Press screw, right	2	21-37841-C
24	Hex.head screw M 36 x 100, galvanised	3	21-37841-C
12	Locking washer	4	41-34177-B
8	Sling clamp, inlet end	5	31-35769-B
8	Bolt for sling clamp, inlet	6	41-32800-B
16	Snap ring, Seeger, A 35 x 1,5, phosphor-bronze	7	41-32800-B
26	Sling clamp, outlet	8	31-35771-C
26	Bolt for Sling clamp, outlet	9	41-33497-B
52	Snap ring, Seeger, A 50 x 2, phosphor-bronze	10	41-33497-B
34	Screw for sling clamp	11	41-33496-B
1	Bridge No. 1, lower part (outlet bridge)	12	21-42087-A
1	Bridge No. 1, upper part (outlet bridge)	13	21-42087-A
10	Bridge No. 2 - 10 and 12, lower part	14	21-42087-A
10	Bridge No. 2 - 10 and 12, upper part	15	21-42087-A
1	Bridge No. 11, lower part	16	21-42087-A
2	Bridge No. 11, upper part	17	21-42087-A
1	Bridge No. 13 at cone, lower part	18	21-42087-A
1	Bridge No. 13 at cone, upper part	19	21-42087-A
1	Bridge No. 14 at cone, lower part	20	21-42096-A
1	Bridge No. 14 at cone, upper part	21	21-42096-A
2	Bridge No. 15 and 16, lower part	22	21-42096-A
3	Bridge No. 15, 16 and 17, upper part	23	21-42096-A
1	Bridge No. 17, lower part	24	21-42096-A
1	Backing plate at end bearing	25	31-38979-B
4	Backing plate L = 934	26	11-34367-A
4	Backing plate L = 799	27	11-34367-A
4	Backing plate L = 888	28	11-34367-A
4	Backing plate L = 638	29	234279-B
2	Backing plate, L = 328, upper left - lower right fra inlet	30A	234275-B
2	Backing plate, L = 328, upper right - lower left fra inlet	30B	234275-B
4	Backing plate L = 348	31	234275-B
4	Backing plate L = 768	32	234275-B
2	Frame for strainer plate under inlet	33	21-37532-B
4	Strainer plate L = 952	34	234279-B
4	Strainer plate L = 816	35	234279-B
4	Strainer plate L = 906	36	234279-B
4	Strainer plate L = 656	37	234279-B
4	Strainer plate L = 410	38	234275-B
4	Strainer plate L = 367	39	234275-B
4	Strainer plate L = 788	40	234275-B
2	Strainer plate L = 657	41	21-37532-B
16	Distance ring	42	234279-B
10	Distance ring	43	234275-B
2	Distance ring	44	234275-B
1	Central bar, lower L = 3323	45	21-42093-A
1	Central bar, upper L = 2673	46	21-42093-A
1	Central bar, lower L = 1786	47	21-42093-A

0.8

1.2

2.5

3.0

No.	Description:	Item:	Drawing/ Material:
1	Central bar, upper L = 1200	48	21-42093-A
1	Central bar, upper L = 650	49	21-42093-A
2	Central bar, upper and lower, L = 367	50	21-42093-A
1	Side bar, lower left, L = 2673	51	21-42094-B
1	Side bar, lower left, L = 650	52	21-42094-B
1	Side bar, lower right, L = 2673	53	21-42094-B
1	Side bar, lower right, L = 650	54	21-42094-B
1	Side bar, lower left, L = 1140	55	21-42094-B
1	Side bar, lower right, L = 1140	56	21-42094-B
1	Side bar, lower left, L = 646	57	21-42094-B
1	Side bar, lower right, L = 646	58	21-42094-B
2	Side bar, lower left - upper right, L = 359	59	21-42094-B
2	Side bar, lower right - upper left, L = 359	60	21-42094-B
1	Side bar, upper left, L = 2673	61	21-42094-B
1	Side bar, upper right, L = 2673	62	21-42094-B
1	Side bar, upper right, L = 650	63	21-42094-B
1	Side bar, upper left, L = 650	64	21-42094-B
1	Side bar, upper left, L = 1200	65	21-42094-B
1	Side bar, upper right, L = 1200	66	21-42094-B
83	Socket head cap screw, M 16 x 35	67	21-42093-A/21-42094-B
41	Socket head cap screw, M 12 x 35	68	21-42093-A/21-42094-B
2	Stay L = 2700	69	11-43927-B
2	Stay L = 2180	70	11-43927-B
4	Hex. head nut M 30	71	11-43927-B
32	Distance tube	72	11-43927-B
1	Frame with press liquid tray	73	11-43918-A
4	Support under frame	74	31-34782-B
8	Hex.head screw M 30 x 120	75	31-34782-B
8	"Nylock" lock nut M 30, galv.	76	31-34782-B
2	Distance bolt	77	31-38947-A
34	Hex.head screw M 24 x 55, w/spring washer	78	11-43918-A
2	Hex.head screw M 16 x 55, w/spring washer	79	11-43918-A
1	Flange $\varnothing 280^{\circ} 160 \times 20$	80	11-43918-A
8	Hex.head screw M 20 x 65, m/mtr.	81	11-43918-A
1	Inspection glass $\varnothing 160$	82	231549-B
1	Outlet chute	83	31-31551-B
1	Gear box, 3-sectioned, i = 1 : 125	84	11-32359-B
1	Air filter, type EK 2", brass	85	21-32054-B
1	Inlet chute	86	11-43920-B
1	End plate, split	87	21-42097-A
2	Stuffing box	88	31-38977-A
1	Cover plate for frame, inlet	89	31-38976-A
4	Joint ring, "Walkersele"	90	11-43929-B
2	Bearing house SNH 524-620	91	11-43929-B
2	Spherical roller bearing, 22224 EK	92	11-43929-B
2	Split taper socket H 3124 w/nut and lock washer	93	11-43929-B
2	Double lip seal, TSNA 224G	94	11-43929-B
4	Nipple for grease gun, 1/4" thr., straight	95	11-43929-B
2	End cover ASNH 524-620	96	11-43929-B
2	Bearing sleeve	97	41-39807-B

		Press MS-64SF		Nr. 41-39985-A	
DATO 14 Feb. 94		SIGN. EK/LIS		BL. NR. 3	ANT. BL. 4
		List of parts for drwg. No. 11-43928		ERSTATNING FOR:	ERSTATTET AV:

No.	Description:	Item:	Drawing/ Material:
4	Hex.head screw M 24 x 100 w/nut	98	11-43929-B
4	Washer for M 24	99	11-43929-B
8	Hex.head screw M 12 x 55	100	11-43929-B
26	Hex.head screw M 12 x 20	101	11-43929-B
9	Hex.head screw M 10 x 15	102	11-43929-B
4	Clamping sleeve $\varnothing 6$ x 70	103	11-43929-B
2	Clamping sleeve $\varnothing 4$ x 24	104	11-43929-B
2	Distance ring $\varnothing 4$	105	11-43929-B
2,4 m	Rubber joint 40 x 3	106	41-30270-B
3	Cover, topp section	107	21-40028-B
1	Top section, outlet end	108	21-40038-B
2	Side hatch, outlet end	109	21-40039-B
4	Side hatch, inner	110	21-40031-B
6	Side hatch, external	111	21-40032-B
1	End plate for gear box, i = 1 : 125	112	21-40021-B
24	Mounting screw for cover, M 10 x 20	113	11-40694-B
12	Hex.head screw M 10 x 20	114	11-40694-B
24	Lock handle	115	11-40694-B
8	lock angle, compl. w/screw, nut and washer	116	31-37806-B
6	Hex.head screw M 30 x 80	117	11-32359-B
4	Hex.head screw M 36 x 120	118	11-32359-B
4	Hex.head lock nut, M 36	119	11-32359-B
1	Squirrel cage motor	120	11-32075-C
1	"Delta" pump, type JSDG, $\frac{3}{4}$ "	121	11-32075-C
1	Coupling, Eupex, type BT-80	122	11-32075-C
1	Cover guard	123	41-31462-B
4	Hex.head screw M 10 x 25, galv.	124	11-32075-C
6	Spring washer $\varnothing 10$, galv.	125	11-32075-C
2	Hex.head screw M 10 x 16, galv.	126	11-32075-C
6	Hex.head screw M 12 x 30, galv.	127	11-32075-C
8	Spring washer, $\varnothing 12$	128	11-32075-C
1	Baseplate	129	31-32237-B
1	Strainer, EPE S 75, 1"	130	11-32075-C
1	Pipe 1", L = ca. 205	131	11-32075-C
2	Back nut 1"	132	11-32075-C
2	Hex.head screw M 12 x 45	133	11-32075-C
1	Union coupling, 1"	134	11-32075-C
3	Pipe joint, 1" x $\frac{3}{4}$ "	135	11-32075-C
1	Pipe union, $\frac{3}{4}$ " inner/outer	136	11-32075-C
1	Pipe $\frac{3}{4}$ " L = ca. 1175	137	11-32075-C
1	Flanged cross, $\frac{3}{4}$ "	138	11-32075-C
1	Plug, $\frac{3}{4}$ "	139	11-32075-C
1	Thermometer 0 - 100°C, $\frac{1}{2}$ " Thr.	140	11-32075-C
1	Transition joint, $\frac{3}{4}$ " x $\frac{1}{2}$ "	141	11-32075-C
1	Pressure gauge 3F/63, 0-16 bar, R $\frac{1}{4}$ ", w/glycerine	142	11-320075-C
1	Pressure gauge cock, $\frac{1}{4}$ " inner/outer	143	11-32075-C
1	Transition joint, $\frac{1}{2}$ x $\frac{3}{4}$ "	144	11-32075-C
1	T-pipe, $\frac{3}{4}$ x $\frac{1}{2}$ x $\frac{3}{4}$ "	145	11-32075-C
2	Pipe joint, $\frac{3}{4}$ "	146	11-32075-C
1	Union coupling, $\frac{3}{4}$ "	147	11-32075-C

No.	Description:	Item:	Drawing/ Material:
1	Magnetic filter EPE, ES 125 MUE - LU, 1"	148	11-32075-C
1	Union coupling, 3/4"	149	11-32075-C
1	Pipe, 3/4" L = 245	150	11-32075-C
2	Back nut, 3/4"	151	11-32075-C
2	Plug, 1 1/4"	152	11-32075-C
	Oil head tank with piping	153	21-32054-B
	Flush water piping	154	11-43937-A
3	Hex.head screw M 20 x 65 m/ mutter	155	11-43927-B
3	Spring washer, Ø20	156	11-43927-B
4	Hex.head screw M 30 x 65	157	31-34782-B

Stord Twin Screw Press

MS-64SF

List of Tools

Item	Part		To fit	No. required
1	Wrench 46M		Sling Clamps	1
2	Ring Wrench	19 x 24	Nuts & bolts misc.	1
3	Socket Wrench	WM 39 (19)	Int. Hex. head Screws	1
4	Socket Wrench	WM 37 (17)	Int. Hex. head Screws	1
5	Socket Wrench	WM 34 (14)	Int. Hex. head Screws	1
6	Socket Wrench	WM 30 (10)	Int. Hex. head Screws	1
7	Socket Wrench	WM 28 (8)	Int. Hex. head Screws	1
8	Socket Wrench	WM 26 (6)	Int. Hex. head Screws	1
9	Socket Screw, fully threaded	M24 x 130	Extraction screws for flanged connection gearbox/press screws	2
10	Removal Nut	SKF KM 22	Roller Bearings	1
11	Hook Wrench	SKF HN 22	Roller Bearings	1
12	Hook Wrench	SKF HN 20	Roller Bearings	1
13	Removal Nut	SKF KM 30	Roller Bearings	1
14	Impact Wrench	SFK Nr. 718909	Roller Bearings	1
15	Extended Socket Wrench WM 39 (19)		Int. Hex. head bolts inside gearbox	1
16	Spanner	13 x 17	Hex. head bolts	1
17	Spanner	19 x 24	Hex. head bolts	1
18	Spanner	30 x 36	Hex. head bolts	1
19	Spanner	46 x 55	Hex. head bolts	1

Spanner Nos. 1, 10-15 are delivered with the press.

Stord Twin Screw Press MS-64SF List of Spare Parts

It is recommended to keep the following spare parts in stock:

Item No.	Description	Req. for		Ref. No.
		1-2 presses	3-4 presses	


Press Section Drawing No. 11-43928-A:

26	Backing plate	L = 934	1	2	11-34367
27	Backing plate	L = 799	1	2	11-34367
28	Backing plate	L = 888	1	2	11-34367
29	Backing plate	L = 638	1	2	234279
30A	Backing plate	L = 328	1	2	234275
30B	Backing plate	L = 328	1	2	234275
31	Backing plate	L = 348	1	2	234275
32	Backing plate	L = 768	1	2	234275
34	Strainer plate	L = 952	4	8	234279
35	Strainer plate	L = 816	4	8	234279
36	Strainer plate	L = 906	4	8	234279
37	Strainer plate	L = 656	4	8	234279
38	Strainer plate	L = 410	4	8	234275
39	Strainer plate	L = 367	4	8	234275
40	Strainer plate	L = 788	4	8	234275
41	Strainer plate	L = 657	4	8	21-37532
	Rivets for strainer plates		1/2 set	1 set	
90	Seals "Walkersle", Part No. 57 - 140		2	4	11-43929
94	Double lip seals, TSNA 224G		2	4	11-43929
10	Snap ring A50 x 2 DIN 471		30	60	41-33497

Re.: Drawing No. 41-31751 Gearbox:

25	Shaft with pinion, stage 1	T18 - M6	0	1	31-31325
24	Shaft with pinion, stage 2	T16 - M8	0	2	31-31299
26	Pinion shaft, stage 3,	T18 - M13	0	2	31-31330
44	Oil seal, Split Clozure		4	8	Gaco 238, 1 x 200
45	Oil seal		2	4	V 200
46	Oil seal		2	4	Angus SM 951201:
	Filter cartridge		2	4	

Spare parts will usually be kept in stock at our workshop in Norway, or could be delivered at short notice.

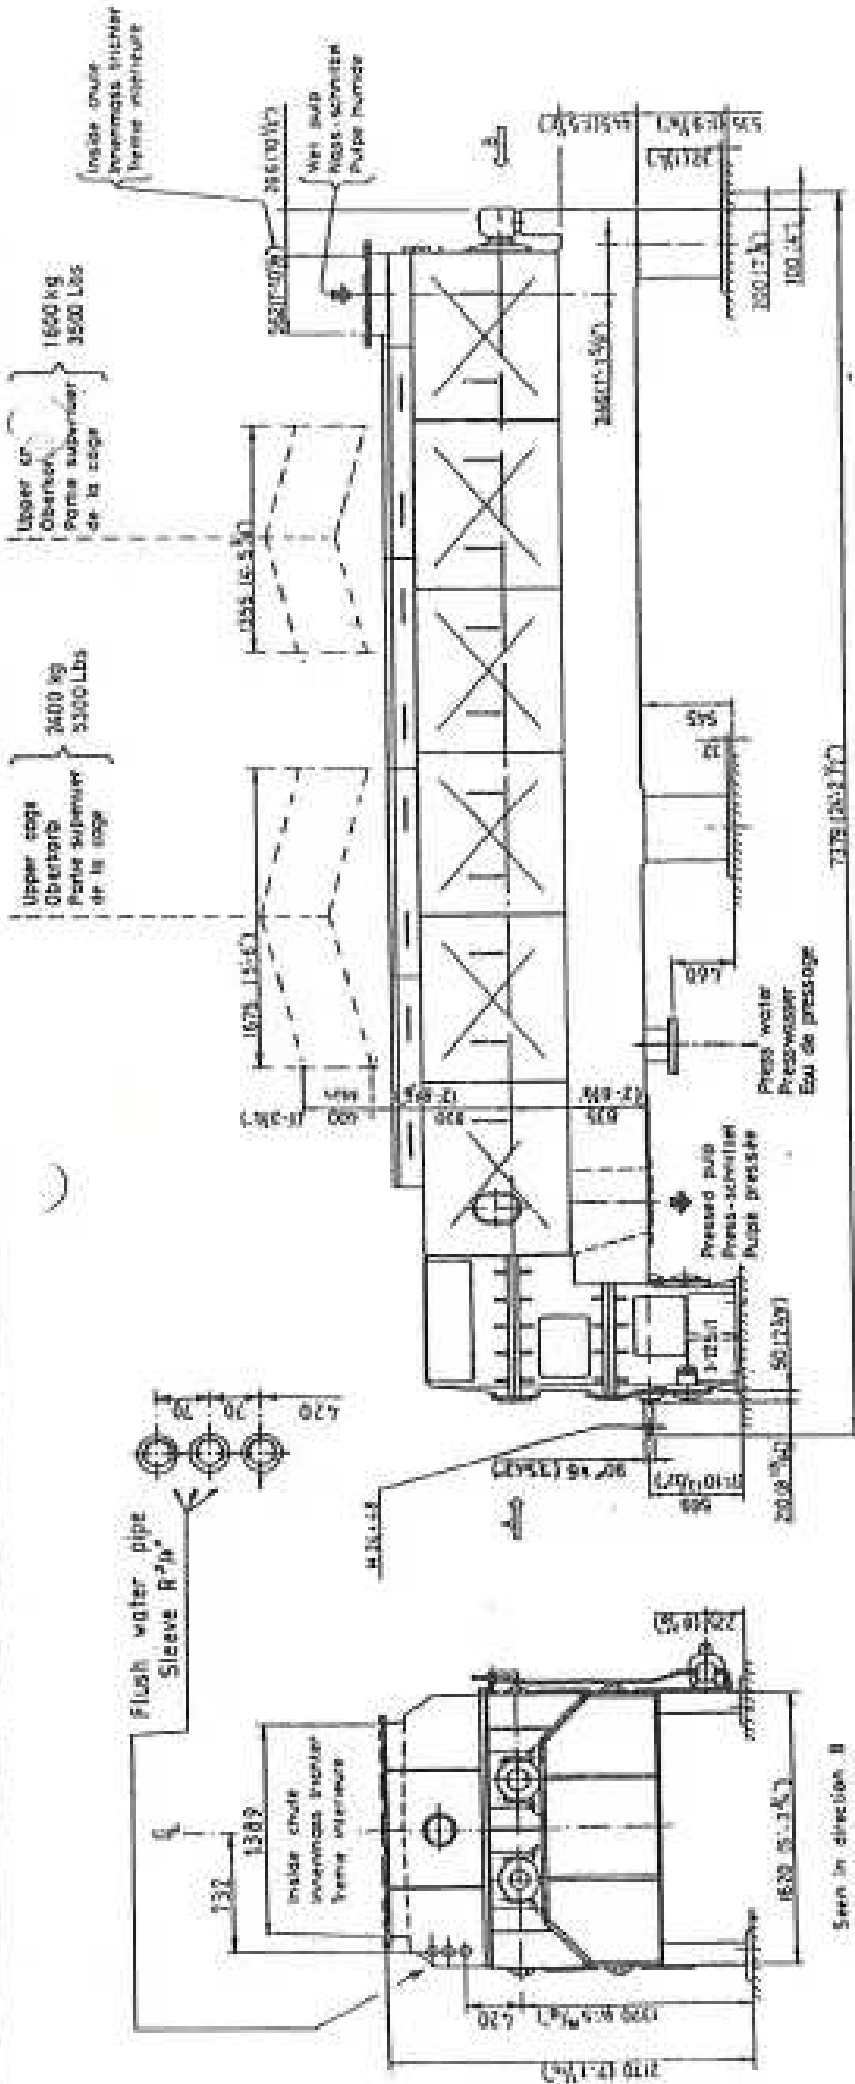


Seen in direction B
near B but quarter
from NW direction B


Total weight, net
Geometric mean, net
Ponds total, net

Total weight incl. pulp
Gesamtgewicht einsch. pulp
Poids total y compris les p.

	26000 kg	57350 lbs
Total weight incl. pulp		
Gesamtwegicht einsch. Pulp		
Poids total y compris les pulpes		
	Loss elimination and centre of gravity stored on foundation plate	
	Gesamtwegung und Schwerpunktunter quer auf Fundamentplatte ruhen	
	Separation du poids et centre de gravité sur le plan de fondation	

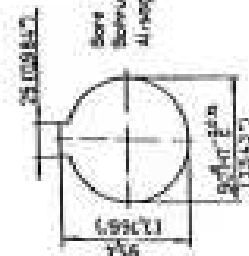

Sow in spring pulley
Schwung in der Herrenscheitel
Krone der 10 Jahre

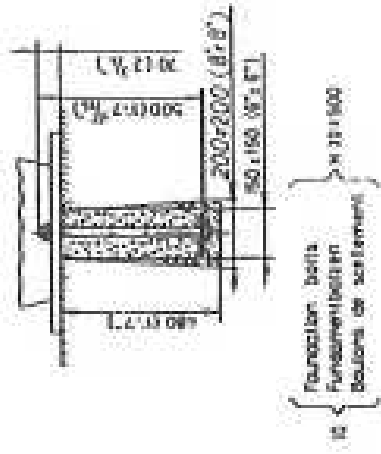

Seien im directions A
Von A aus gehen
Vus im direction A

water targets are included.
Gargantuan's then wanders amongst
Dome's brides, coming

Dimensions in mm (inch)
 Height in mm and (inch)
 Dimensions mm et (pouce)