

PLAN VIEW

red dashed = USB-Blaster II body inside (hidden)

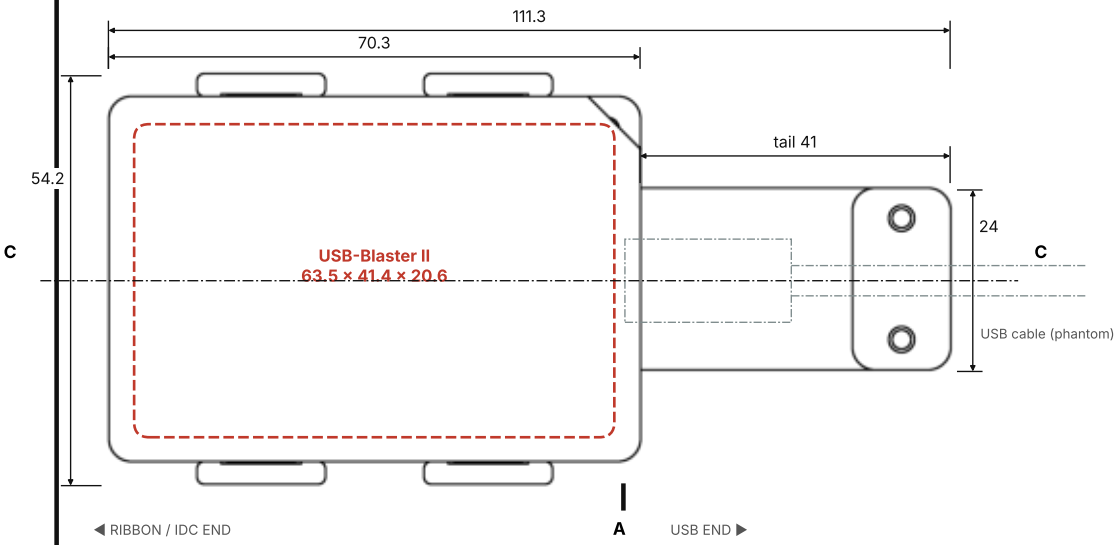


3-D VIEW (not to scale)

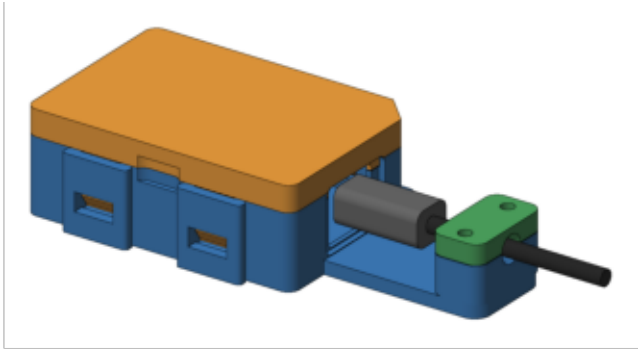


SECTION C-C

through the cable axis — shows how the pod, plug and cable sit

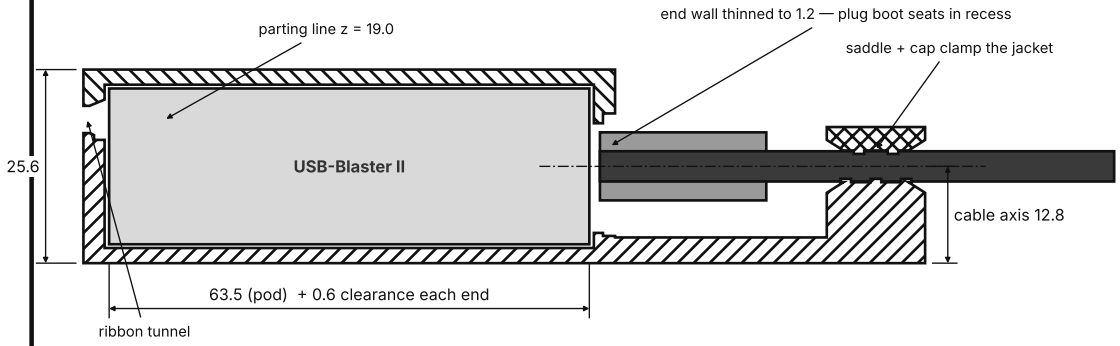

SECTION A-A

USB end wall, looking into the pod

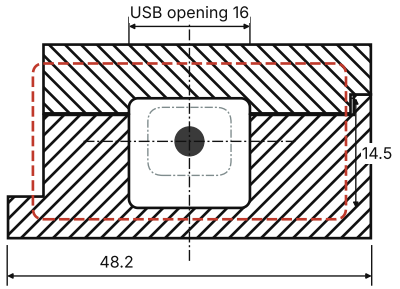

grey = generic plug boot 11 × 9
opening fits Type-B, mini-B, micro-B


0 10 20 30 40 50 60 70 80 90 100

SCALE CHECK — this bar must measure exactly 100 mm. If not, reprint at 100 % / "Actual size".


General tolerance on printed parts ±0.3 mm. Dimensions in mm. Third-angle projection.

PRODUCT **BLASTERPROOF II** — General arrangement		
PART / ASSEMBLY USB-Blaster II strain-relief enclosure	REV **2.2**	SHEET 1 / 2
UNITS mm TOLERANCE ±0.3 printed MATERIAL PETG (see PPD) DRAWN 2026-10-17 SOURCE cradle_cq.py v2.2	SCALE **1 : 1**	SIZE **A4**

SECTION B-B option S: self-tapping

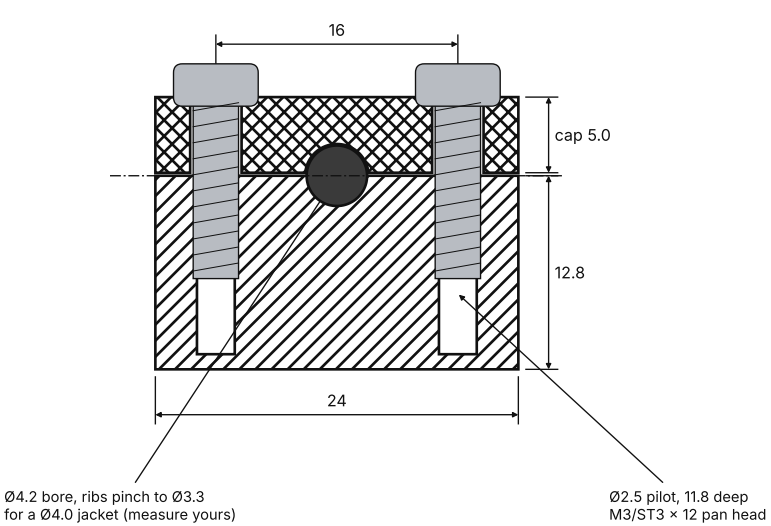

SECTION B-B option I: heat-set insert

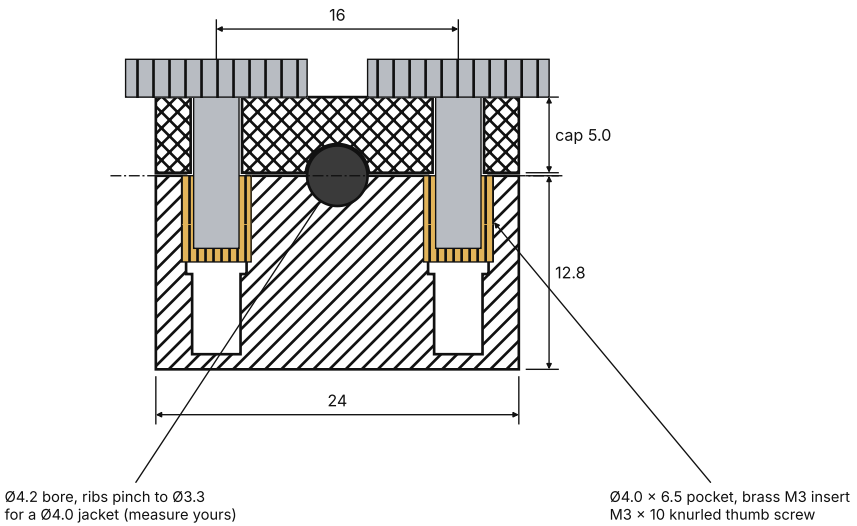

B-B is cut across the cable saddle, looking toward the device. Scale 2 : 1 — halve any measurement taken from these sections. Tables not to scale.

#	Part	File (STL / 3MF / STEP)	Qty	Print orientation
1	Shell, option S	shell_selftap	1	floor down, no supports
1	Shell, option I	shell_insert	(1)	floor down, no supports
2	Cover	cover	1	lid down (clips up)
3	Clamp cap	clamp_cap	1	flat face down

Print ONE shell: option S or option I.

Hardware	Option S	Option I
Screw	2 × M3 (ST3) × 12 self-tapping, pan head	2 × M3 × 10 knurled thumb screw
	(Ø2.5 pilot in shell)	DIN 653 / DIN 464, stainless
Insert	—	2 × M3 brass heat-set, OD ≈4.6, L 5.7
Cap hole	Ø3.4 clearance	Ø3.4 clearance
Tools	Phillips #1	soldering iron ~230 °C (PETG) for inserts

CARD CHECK

A bank / ID card (85.60 × 53.98 mm)
must cover this box exactly.
If not, the print is not 1 : 1.

PRODUCT

BLASTERPROOF II — Cable clamp + parts

PART / ASSEMBLY	REV	SHEET
USB-Blaster II strain-relief enclosure	**2.2**	2 / 2
UNITS mm TOLERANCE ±0.3 printed MATERIAL PETG (see PPD) DRAWN 2026-10-17 SOURCE cradle_cq.py v2.2	SCALE **2 : 1**	SIZE **A4**