
Determine the overall unit thermal resistance(the R-value) and the overall heat transfer coefficient(the U-factor) of a wall frame wall that is built around 38-mm 90-mm wood studs with a center-to-center distance of 400mm. The 90-mm-wide cavity between the studs is filled with urethane rigif foam. The inside is filled with 13-mm gypsum wallboard and outside with 13-mm plywood and 13-mm 200-mm wood bevel lapped siding. The insulated cavity constitutes 75% heat transmission area while the studs, plates, and sills constitutes 21%. The headers constitutes 4% of the area, and they can be treated as studs.

Also determine the rate of heat loss through the walls of a house whose perimeter is 50m and wall height is 2.5m in Las Vegas, Nevada, whose winter design temperature is -2°C. Take the indoor design temperature to be 22°C and assume 20% of the wall area is occupied by glazing.

	Wood	Insulation
Outside air	0.03	0.03
Wood bevel(13mm-200mm)	0.14	0.14
Plywood(13mm)	0.11	0.11
Urethane rigif foam insulation(90mm)	×	$0.98 \times \frac{90}{25} = 3.528$
Wood studs(90mm)	0.63	×
Gypsum board(13mm)	0.079	0.079
Inside surface	0.12	0.12

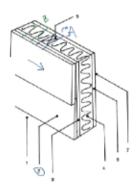

$$R'_{total\,wood} = 0.03 + 0.14 + 0.11 + 0.63 + 0.079 + 0.12 = 1.109m^2 \cdot {^{\circ}C/w}$$

$$R'_{total.ins} = 0.03 + 0.14 + 0.11 + 3.528 + 0.079 + 0.12 = 4.007m^2 \cdot {^{\circ}C/w}$$

$$\frac{1}{R_{total}} = \frac{1}{R_{wood}} + \frac{1}{R_{ins}}, R' = R \times A \quad \rightarrow \quad R = \frac{R'}{A}, \frac{1}{\frac{R'_{tot}}{A_{tot}}} = \frac{1}{\frac{R'_{wood}}{A_{wood}}} + \frac{1}{\frac{R'_{ins}}{A_{ins}}} \quad \rightarrow \quad \frac{A_{tot}}{R'_{tot}} = \frac{A_{wood}}{R'_{wood}} + \frac{A_{ins}}{R'_{ins}} \quad \rightarrow \quad U = \frac{1}{R'}$$

$$\begin{split} &U_{tot} \times A_{tot} = U_{wood} \times A_{wood} + U_{ins} \times A_{ins} \quad \rightarrow \quad U_{tot} = U_{wood} \times \frac{A_{wood}}{A_{tot}} + U_{ins} \times \frac{A_{ins}}{A_{tot}} \\ &= 0.25 \times \frac{1}{1.109} + 0.75 \times \frac{1}{4.007} \approx \frac{0.4126W}{m^2} \cdot ^{\circ}\text{C} \end{split}$$

$$R_{value} = \frac{1}{U_{tot}} \approx \frac{1}{0.4126} \approx 2.4237 m^2 \cdot {^{\circ}\text{C}}/w$$

$$\dot{Q}_{tot} = U_{tot} \times A_{tot} \times \Delta T = 0.4126 \times 50 \times 2.5 \times (1 - 20\%) \times [22 - (-2)] = 990.24W$$

# Summary about radiation and radiative heat transfer

This lesson introduces the content of radiation, which refers to the phenomenon of relying on the outer surface of an object to emit heat rays to transmit energy (electromagnetic waves capable of producing significant thermal effects).

Here is my thought about radiation and radiative heat transfer:

#### 1. Electromagnetic wave - definition

Electromagnetic waves are oscillating particle waves that are generated by the electric field and magnetic field in the same phase and perpendicular to each other. They are electromagnetic fields that propagate in the form of waves.

The process of relying on electromagnetic wave radiation to achieve heat transfer between hot and cold objects is a non-contact heat transfer that can also be carried out in a vacuum. The electromagnetic waves emitted by the object are theoretically distributed over the entire spectrum, but in the temperature range encountered in the industry, the practical significance is the thermal radiation with a wavelength between 0.38 and  $1000 \, \mu m$ , and most of them are located in the infrared (again It is called the heat ray) in the range of 0.76 to  $20 \, \mu m$ . The so-called infrared heating is to use the thermal radiation of this section.

## 2. Electromagnetic wave - formula

$$\lambda = \frac{c}{v}$$
  $c = \frac{c_0}{n}$   $e = h \times v = \frac{h \times c}{v}$ 

 $c_0$ : speed of light in a cacunm  $c_0 = 2.9979 \times 10^8 m/s$ 

n: index of refraction of the medium  $n=1(air \ and \ most \ gases)$  n=1.5(glass) n=1.33(water)

 $h = 6.626069 \times 10^{-34} J \cdot s$  is **Planck's constant** 

#### 3. thermal radiation

Radiation is a phenomenon in which energy is transmitted by electromagnetic waves. The process in which radiant energy is emitted due to heat is called thermal radiation.

While scattering the emitted radiant energy, the object will continuously absorb the radiant energy emitted by other surrounding objects and convert it into heat energy. The heat transfer process between the objects that emit radiant energy and absorb radiant energy is called radiative heat transfer. It's a basic way of heat transfer.

Any object emits radiant energy while absorbing the radiant energy from surrounding objects. The difference between the energy radiated by an object and the energy absorbed is the net energy it transmits. The radiation capacity of an object (that is, the energy radiated outward from a unit surface per unit time) increases rapidly with increasing temperature.

- ·If the energy of the heat radiation reaching the surface of the object is completely absorbed, the object is called an absolute black body, referred to as a black body;
- ·If the energy of the thermal radiation reaching the surface of the object is all reflected; when the reflection is regular, the object is called a mirror;
- ·If it is a chaotic reflection, it is called absolute white body.
- If the energy of the heat radiation reaching the surface of the object passes through the object, the object is called a

heat permeable body.

#### 4. Black body

The so-called absolute black body refers to an object that can absorb all the energy radiated to any wavelength on its surface at any temperature.

When the absorption rate of the object is  $\alpha=1$ , it means that the object can fully absorb the projected heat radiation of various wavelengths. Such an object is called an absolute black body, or simply a black body. Blackbody is an idealized object with the strongest absorption of thermal radiation. The actual object has no absolute blackbody. However, in the theoretical study, various absolute black bodies can be designed. For example, a hollow container is provided, the wall of which is made of opaque material, and a small hole is formed in the wall to form a black body. Because when the ray is injected into the small hole, it will be reflected multiple times in the cavity, and the inner surface of the reflector wall absorbs a part of the energy. If the aperture diameter is small, it is much smaller than the surface area of the container. In this way, the ray can be considered to be completely absorbed by the small holes. The small hole can be considered as an absolute black body. The absolute blackbody's emissivity is also 1.

#### 5. Stefan—Boltzmann's Law

$$E_b(T) = \delta \times T^4(W/m^2)$$
  
Stefan—Boltzman constant:  $\delta = 5.670 \times 10^{-8} W/m^2 \cdot K^4$ 

### 6. Plank's Law

$$E_{b\lambda}(\lambda, T) = \frac{C_1}{\lambda^5 \left[ \exp\left(\frac{C_2}{\lambda \times T}\right) - 1 \right]} (W/m^2 \cdot \mu m)$$

$$\begin{split} &C_1 = 2\pi h c_0^2 = 3.74177 \times 10^8 W \cdot \mu m^4/m^2 \\ &C_2 = h c_0/k = 1.43878 \times 10^4 \mu m \cdot K \\ &k = 1.38065 \times 10^{-23} J/K \longrightarrow \text{Boltzmann's constant} \end{split}$$