



Review


- The reverse polarity protection circuit is of no use and it will not be working as well as the GND scheme connected is incorrect and the B- is not connected to anything. The DW01 will not be working in this case.

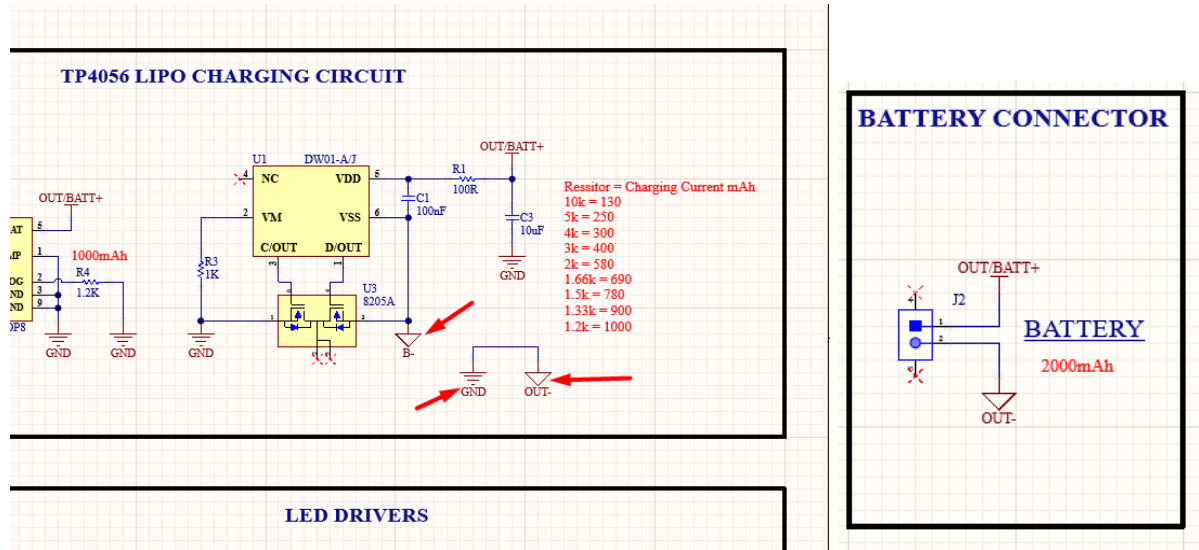


- The C6 is of 50V which is wrong over here as for the protection atleast 1KV capacitor should be used. R7 package should also be minimum 0603.

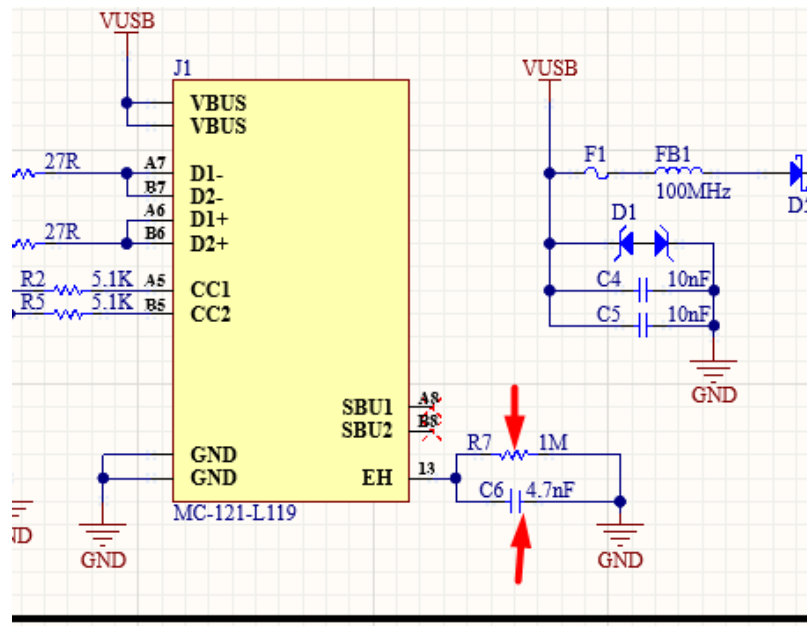


- The power ORing scheme over here is wrong. At 3.3V ORing with load the diode will easily drop about 0.4V atleast keeping ESP32 in brownout state. Plus the current capacity of these diodes are 200mA which is not sufficient.

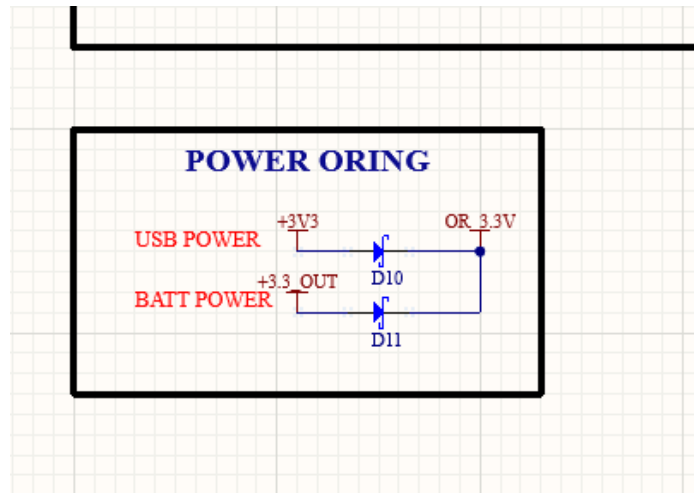


- LEDs current limiting resistors values are not correct. If the scheme is using MOSFETs then LEDs should be powered through 5V as blue color glow on 3V3 will be very less.

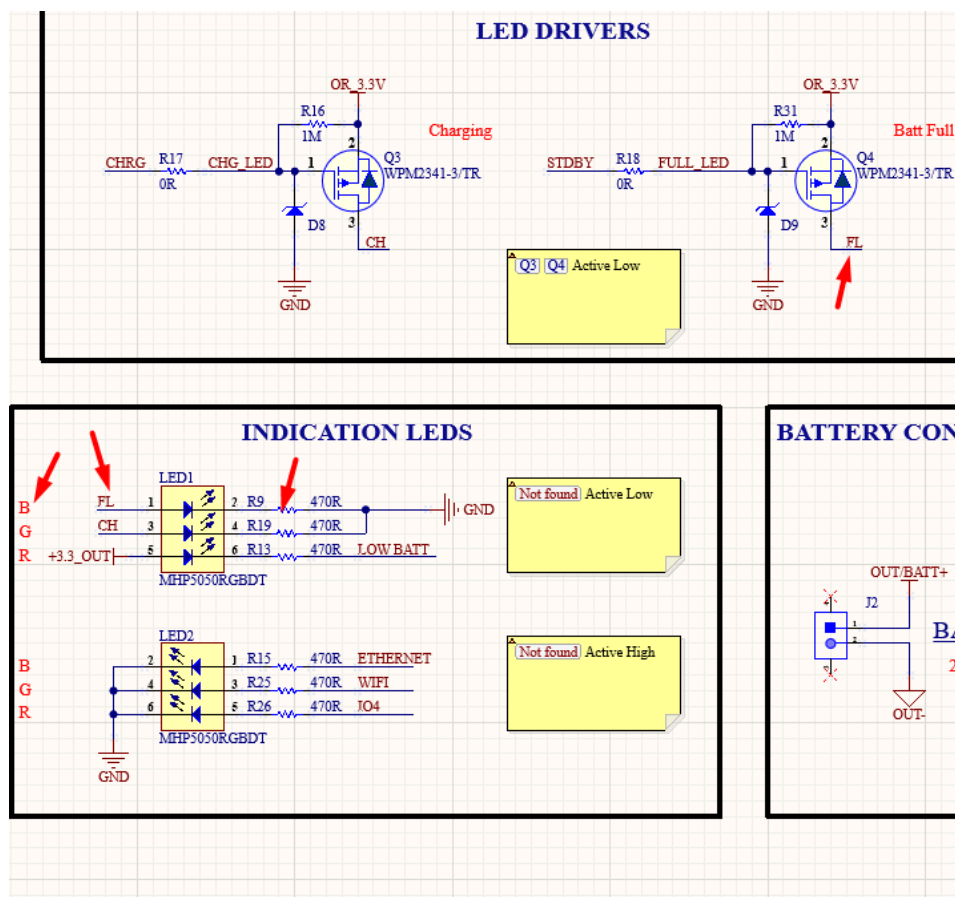


- Please confirm the battery connector pinout is correct as generally pin 1 is connected to GND.

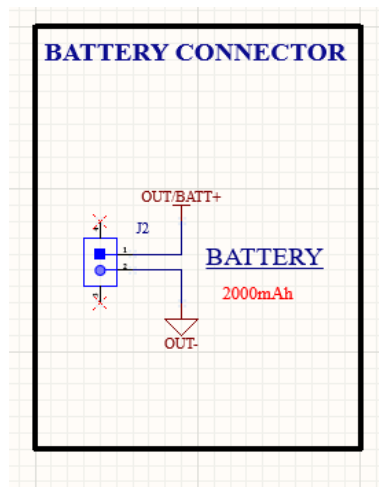

- Low battery cutoff might not be needed as we are using Fuel Gauge in this design. Even for the overdischarge protection, DW01 is already implemented.

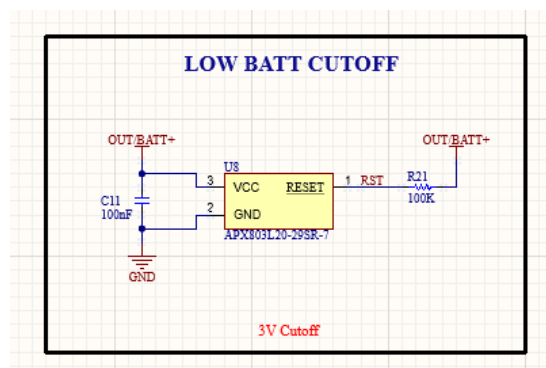

- C26 should not be used on IO0 as it will fail the USB auto download functionality.

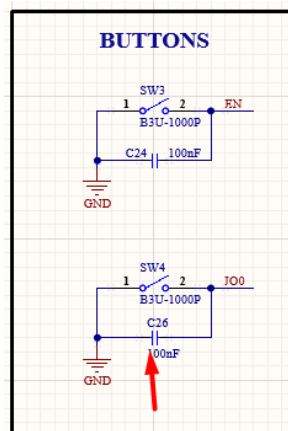

- C27 should be used here as it is a Boot pin and also used as a clock pin.

