### UART Communication Stress Test with NodeMCU ESP8266

Course Title: Internet of Things

Course Code: CSE 406

Section: 01

### Submitted by

Name: Zihad Khan

**ID:** 2022-2-60-107

**Date:** 13/07/2025

#### Submitted to

Dr. Raihan Ul Islam (DRUI)

Associate Professor, Department of Computer Science and Engineering

East West University

### Other Group Members

Name	ID	
Shairin Akter Hashi	2022-2-60-102	
Nushrat Jaben Aurnima	2022-2-60-146	
Shahrukh Hossain Shihab	2022-1-60-372	

# Table of Contents

Introduction	2
Methodology	2
Hardware Setup	2
Software Setup	3
Arduino IDE Configuration	3
CoolTerm Setup and Logging	4
Baud Rate Synchronization	4
Results	5
Data Collection	5
Observations	5
Analysis	6
Throughput	6
Transfer Speed	6
Error Rate	6
Best Configuration	6
Challenges	7
Conclusion	7
Refences	8

### Introduction

UART (Universal Asynchronus receiver transmitter) is a widely used communication protocol that allows the asynchronous serial data exchange between TX (transmitter) and RX (obtained) PIN use. It works without a clock signal and depends on the predetermined storage speed to sync data transfer and reception. In this laboratory, we targeted to evaluate the performance of UART communication between two **Nodemcu Esp8266 board**.

The purpose was to measure the **throughput** (the amount of data transferred in byte/seconds), **transfer rate** (message/second) and **error rate** (percentage of unsuccessful/contaminated messages). We performed a stress test using different parameters: **Baud speeds** (9600, 38400, 115200), **message size** (10, 50, 100 byte) and **transfer interval** (0ms, 10ms, 100ms). The boards were connected using expansion boards and a breadboard for wiring.

### Methodology

### **Hardware Setup**

For this lab, two NodeMCU ESP8266 boards were connected using jumper wires and a breadboard. The connections were made as follows:

- NodeMCU 1 D5 (TX) → NodeMCU 2 D6 (RX)
- NodeMCU 2 D5 (TX) → NodeMCU 1 D6 (RX)
- **GND pins** of both boards were connected through the shared ground on the breadboard.

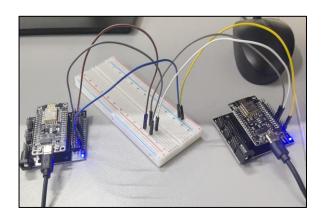


Figure 1: Hardware Setup

### **Software Setup**

Software configurations include **Nodemcu ESP8266** Board Both programming and establishment of serial communication monitoring using **Arduino IDE** and **CoolTerm**.

#### **Arduino IDE Configuration**

The Arduino IDE was used to program both NodeMCU 1 (Master) and NodeMCU 2 (Slave). To enable ESP8266 board support, we added the following URL to the "Additional Board Manager URLs" field in the Preferences window: <a href="http://arduino.esp8266.com/stable/package\_esp8266com\_index.json">http://arduino.esp8266.com/stable/package\_esp8266com\_index.json</a>

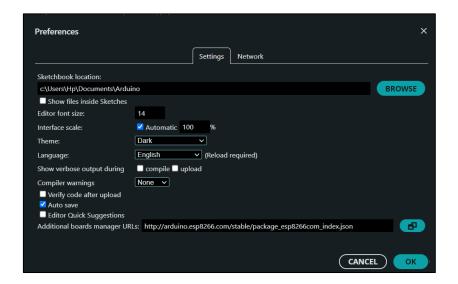


Figure 2: Additional Board Manager URLs

After that, we installed the **ESP8266 Board Package (version 3.1.2)** via the **Boards Manager**. Before running the main test, some basic demo sketches were uploaded and ran to verify that the board drivers, serial communication, and wiring were working correctly.

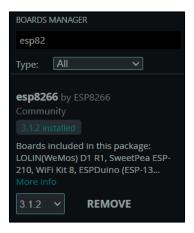


Figure 3: Installation

The **Arduino IDE** was used to upload separate sketches to each board:

- Master Final.ino was uploaded to NodeMCU 1 (Master) connected to COM7.
- Slave.ino was uploaded to NodeMCU 2 (Slave) connected to COM6.

#### **CoolTerm Setup and Logging**

To capture and log real-time communication output from each NodeMCU, **CoolTerm** was used which is a serial terminal that allows data capture to text files. Each board was connected to a separate CoolTerm session:

#### • NodeMCU 1 (Master) – COM7

- o CoolTerm was configured with:
  - **Baud rate:** 115200
  - Data bits: 8
  - Parity: None
  - Stop bits: 1
- Captured output was saved to: nodemcu1\_output.txt

#### • NodeMCU 2 (Slave) – COM6

- o CoolTerm was configured with the same settings.
- Captured output was saved to: nodemcu2\_output.txt

#### To start logging:

- 1. Navigate Connection > Capture to Text File > Start, then select the destination .txt file, and then click Connect (green plug icon).
- 2. Once testing is completed, click **Connection > Capture to Text File > Stop**, followed by **Disconnect**.

#### **Baud Rate Synchronization**

Both devices were programmed with the same se rate (BAUD: 115200). This mechanism helped maintain continuous communication settings and reduced the possibility of error passing or data corruption due to deviations with body rate.

### **Results**

#### **Data Collection**

The table below summarizes the UART communication performance between **NodeMCU 1** (Master) **and NodeMCU 2** (Slave), using different message sizes and intervals at **three** baud rates (9600, 38400, 115200). The metrics are calculated based on values parsed from the captured logs (nodemcu1\_output.txt and nodemcu2\_output.txt).

Baud	Message	Interval	Throughput	Message Rate	Error Rate
Rate	Size		(bytes/s)	(msg/s)	(%)
9600	10 bytes	0 ms	478.00	48.90	0.00%
9600	10 bytes	10 ms	304.00	31.50	0.63%
9600	10 bytes	100 ms	75.50	8.50	0.00%
9600	50 bytes	0 ms	484.10	9.90	0.00%
9600	50 bytes	10 ms	440.00	9.00	0.00%
9600	50 bytes	100 ms	244.00	5.00	0.00%
9600	100 bytes	0 ms	484.10	4.90	0.00%
9600	100 bytes	10 ms	464.30	4.70	0.00%
9600	100 bytes	100 ms	325.70	3.30	0.00%
38400	10 bytes	0 ms	17.00	2.00	100.00%
115200	10 bytes	0 ms	17.00	2.00	100.00%

### **Observations**

- Throughput increases with larger message sizes and shorter intervals.
- Message rate decreases with larger message sizes, as expected.
- Both 38400 and 115200 baud rates failed entirely, returning 100% error rates.

- **Timeout errors** were frequently seen at higher baud rates.
- No Mismatch error was seen at any baud rate or byte size.
- At 9600 baud, communication was stable with 0% errors across most tests.

### **Analysis**

### **Throughput**

The throughput was successful for large message size. For example, at 9600 baud rates, both 50 byte and 100 byte messages are more than 440 bytes/s. However, this advantage when the delay interval was extended to 100 ms. The limitation arises from SoftwareSerial's buffer size and the timing accuracy on ESP8266 when operating at higher data ratesIn 38400 and 115200 booths, the flow rapidly fell to 17 bytes/s due to transmission failure.

### **Transfer Speed**

Short intervals (0ms) enabled higher message rates, reaching nearly 49 msg/s with 10-byte messages. As message sizes grew, transmission took longer, lowering the rate to around 3.3 msg/s for 100-byte messages at 100ms intervals.

#### **Error Rate**

The error rate in 9600 bodies remained **0%** for all tests except one (**10 bytes**, **10 ms**) with a modest **0.63%** error. However, in **38400** and **115200** baud rates, communication failed with a continuous 100% error rate and frequent timeouts. This happened because the software, which was used for UART communication on GPIO Pins **D5** and **D6**, is considered incredibly above 9600 baud rates due to dependence on software timing rather than hardware control. ESP8266 has two UARTS: **UARTO** (TX and RX) and **UART1** (only TX). Since UART0 is usually used for USB debugging, the SoftwereSerial library was chosen to simulate each other UART. While ESP8266 hardware UARTs use **FIFO buffers** to efficiently manage data, the software bypasses in buffers and depends on the interruption transmission. This threatens time issues at **high** baud rates, explaining why only **9600** baud rate resulted in stable communication.

## **Best Configuration**

The most reliable performance was observed with:

**Baud Rate: 9600** 

Message Size: 50 bytes

**Interval:** 10 ms

This configuration yielded 440 bytes/s throughput, 9 msg/s, and 0% error offering a

balanced trade-off between speed and stability.

**Challenges** 

Finding specific and accurate documents for the UART capabilities of ESP8266; especially

software limitations were one of the major problems we encountered. The official technical

manual did not clearly explain the lack of bod rate, which made it difficult to determine whether

there was expected behavior of failures seen at high baud rate. Additionally, coordinating

between master and slave equipment requires necessary testing and manual verification, as

ESP8266 did not always work at the intended baud rate when using SoftwareSerial library.

Understanding the difference between hardware UART and imitating people was important to

explain and solve these issues.

**Conclusion** 

This experiment demonstrated that the UART on ESP8266 is stable in only 9600 baud using

communication SoftwareSerial library. At this speed, the message sizes of 50 and 100 bytes

performed the best with 484 bytes/s throughput and 0% error. However, in 38400 and 115200

baud rates, all tests failed with 100% error rates, highlighting the boundaries of software-based

serial communication on ESP8266. Although UART is generally a reliable method for data

transfer, the time sensitivity of the software and the lack of hardware buffering make it

unsuitable for high-speed communication. Therefore, to improve performance, future

implementation must use hardware UART, avoid software, or consider alternative

communication protocols such as SPI or I2C for high data rates.

7

# Refences

- https://forum.arduino.cc/t/serial-monitor-and-esp8266/480428/6
- https://www.espressif.com/sites/default/files/documentation/esp8266technical reference en.pdf