

Pipelined Control

- Control signals derived from instruction
 - As in single-cycle implementation



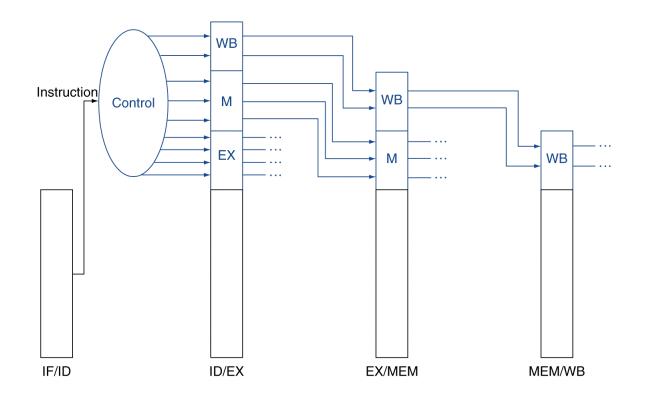

Pipelined Control

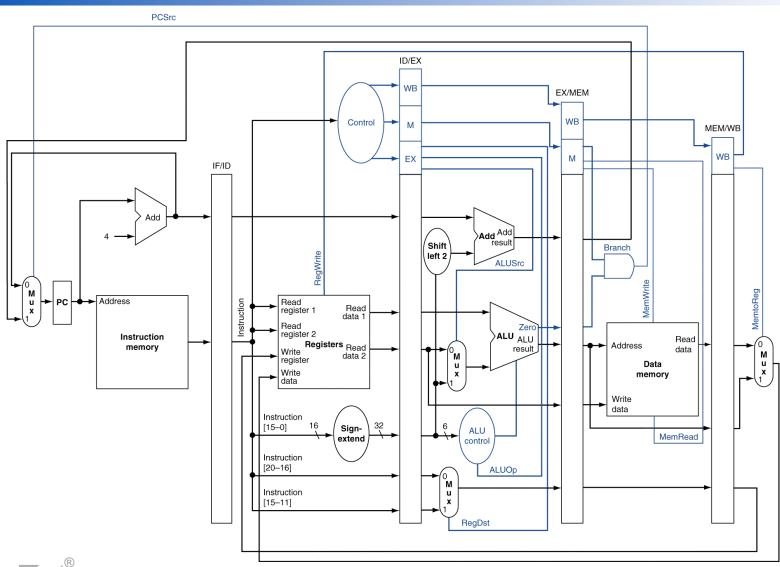



Data Hazards in ALU Instructions


Consider this sequence:

```
sub $2, $1,$3
and $12,$2,$5
or $13,$6,$2
add $14,$2,$2
sw $15,100($2)
```

- We can resolve hazards with forwarding
 - How do we detect when to forward?



Dependencies & Forwarding

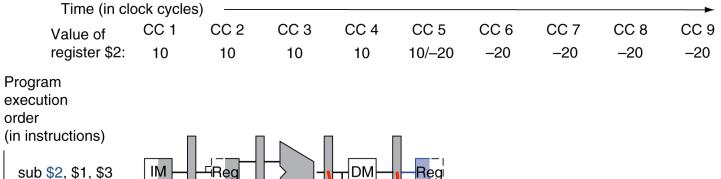


and \$12, \$2, \$5

or \$13, \$6, **\$2**

add \$14, \$2,\$2

sw \$15, 100(\$2)

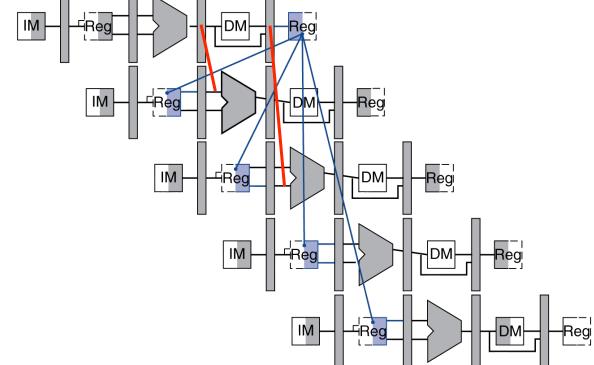



Detecting the Need to Forward

- Pass register numbers along pipeline
 - e.g., ID/EX.RegisterRs = register number for Rs sitting in ID/EX pipeline register
- ALU operand register numbers in EX stage are given by
 - ID/EX.RegisterRs, ID/EX.RegisterRt
- Data hazards when
 - 1a. EX/MEM.RegisterRd = ID/EX.RegisterRs
 - 1b. EX/MEM.RegisterRd = ID/EX.RegisterRt
 - 2a. MEM/WB.RegisterRd = ID/EX.RegisterRs
 - 2b. MEM/WB.RegisterRd = ID/EX.RegisterRt

Fwd from EX/MEM pipeline reg

Fwd from MEM/WB pipeline reg




Detecting the Need to Forward

- But only if forwarding instruction will write to a register!
 - EX/MEM.RegWrite, MEM/WB.RegWrite
- And only if Rd for that instruction is not \$zero
 - EX/MEM.RegisterRd ≠ 0,
 MEM/WB.RegisterRd ≠ 0



Forwarding Paths

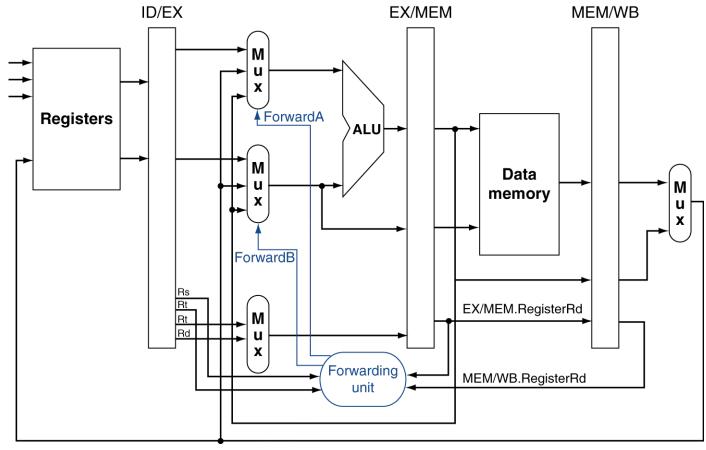

b. With forwarding



Forwarding Conditions

EX hazard

if (EX/MEM.RegWrite and (EX/MEM.RegisterRd ≠ 0) and (EX/MEM.RegisterRd = ID/EX.RegisterRs)) ForwardA = 10

• if (EX/MEM.RegWrite and (EX/MEM.RegisterRd ≠ 0) and (EX/MEM.RegisterRd = ID/EX.RegisterRt)) ForwardB = 10

MEM hazard

if (MEM/WB.RegWrite and (MEM/WB.RegisterRd ≠ 0) and (MEM/WB.RegisterRd = ID/EX.RegisterRs)) ForwardA = 01

if (MEM/WB.RegWrite and (MEM/WB.RegisterRd ≠ 0) and (MEM/WB.RegisterRd = ID/EX.RegisterRt)) ForwardB = 01



Double Data Hazard

Consider the sequence:

```
add $1,$1,$2
add $1,$1,$3
add $1,$1,$4
```

- Both hazards occur
 - Want to use the most recent
- Revise MEM hazard condition
 - Only fwd if EX hazard condition isn't true




Revised Forwarding Condition

- MEM hazard
 - if (MEM/WB.RegWrite and (MEM/WB.RegisterRd ≠ 0)

if (MEM/WB.RegWrite and (MEM/WB.RegisterRd ≠ 0)




Datapath with Forwarding

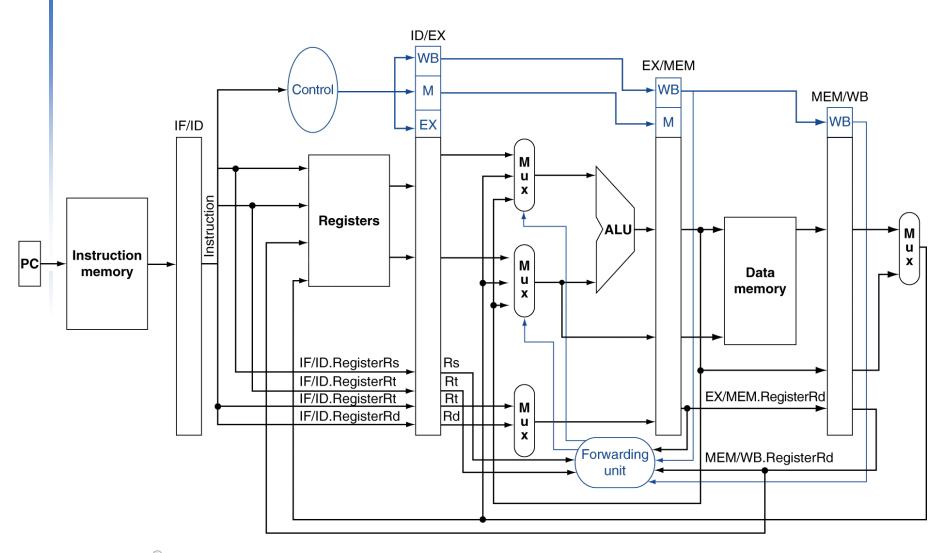



Load-Use Data Hazard

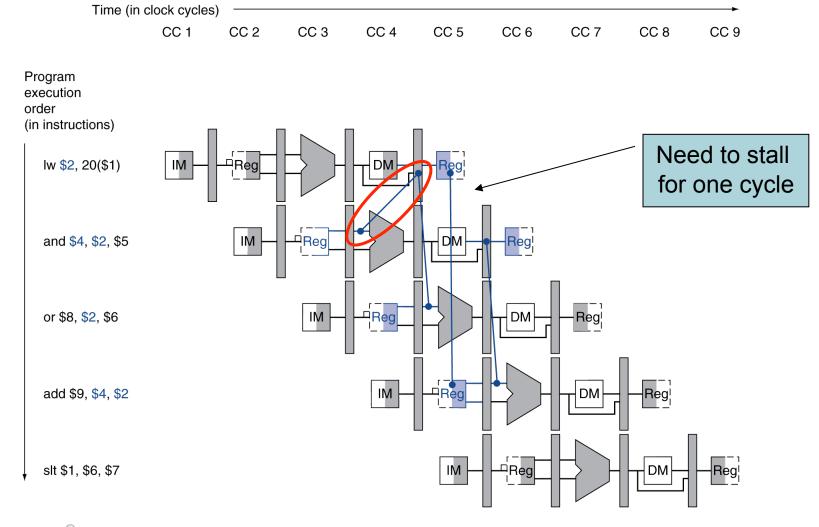



Load-Use Hazard Detection

- Check when using instruction is decoded in ID stage
- ALU operand register numbers in ID stage are given by
 - IF/ID.RegisterRs, IF/ID.RegisterRt
- Load-use hazard when
 - ID/EX.MemRead and ((ID/EX.RegisterRt = IF/ID.RegisterRs) or (ID/EX.RegisterRt = IF/ID.RegisterRt))
- If detected, stall and insert bubble

