
Electrobot - placement overview

Overview is scaled to fit. Use the later 1:1 tiles for physical positioning.

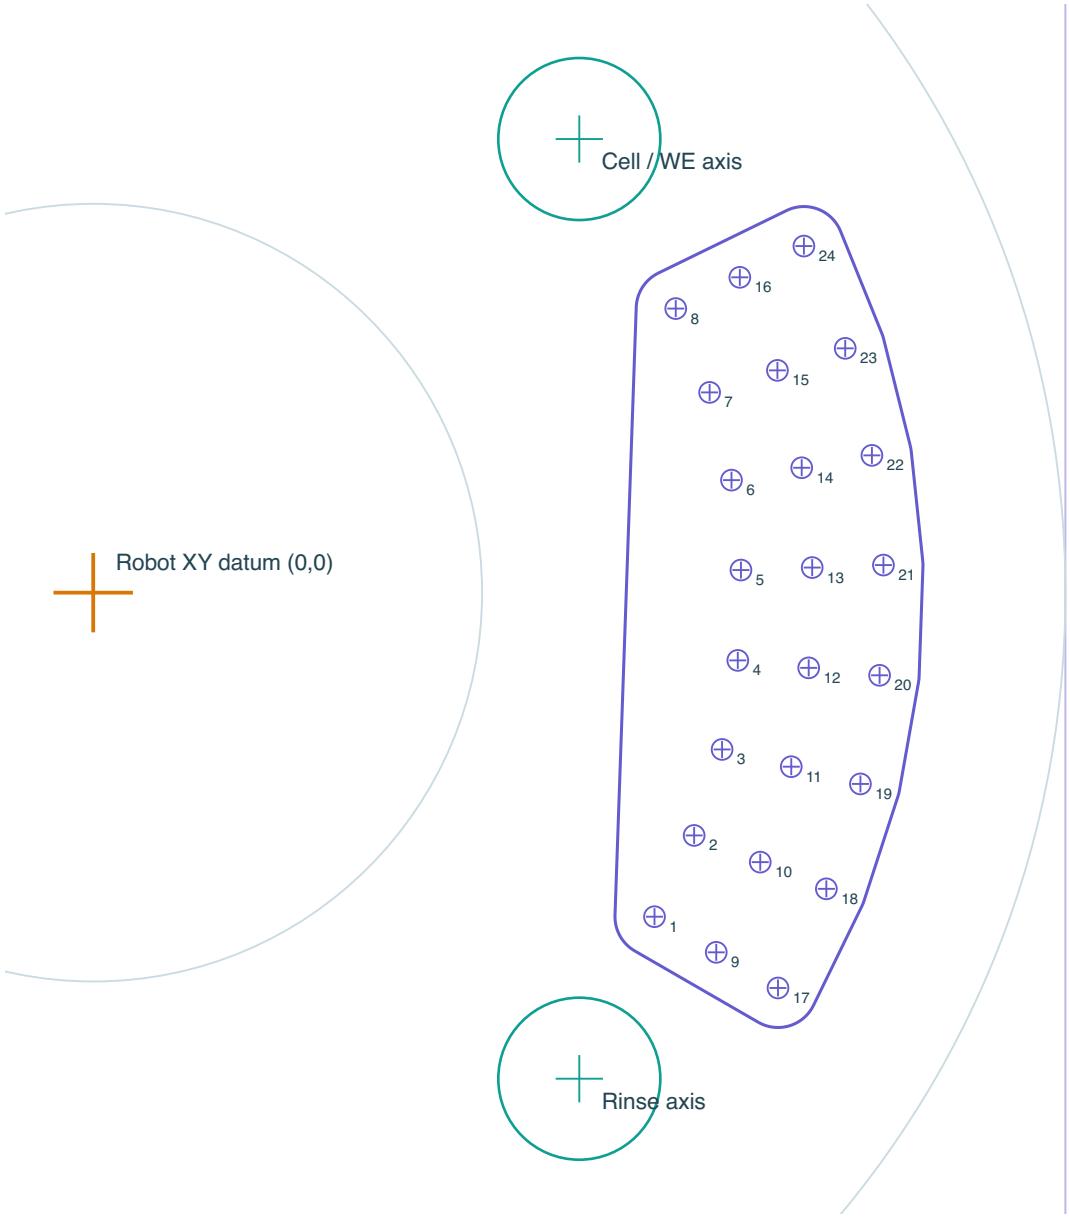

Coordinate convention

+X right; +Y up in top view.

Z values refer to robot tool pose.

Orange cross = XY origin datum.

Not a measured robot base footprint.

Align origin and axis directions

using taught robot references.

Beaker circles use entered diameters.

Cell center assumes central WE port.

Robot reach / collisions are not

certified by this placement sheet.

Travel Z: 80

Tool R: 0 deg

Rack grip Z: 15

Cell seat Z: 15

Rinse dip Z: 15

Rack printed height: 69

Check actual tool offset, gripper/cable clearance, rack seating and glassware before movement. Print tiles at 100%, not Fit.

Station coordinate checklist

* marks slots selected for this batch. Teach gripping Z after the physical rack is assembled.

Station	X	Y	Tool Z
Cell / WE axis	150.00	140.00	15.00
Rinse axis	150.00	-150.00	15.00
Rack slot 1 *	173.21	-100.00	15.00
Rack slot 2 *	185.44	-74.92	15.00
Rack slot 3 *	194.06	-48.38	15.00
Rack slot 4 *	198.90	-20.91	15.00
Rack slot 5 *	199.88	6.98	15.00
Rack slot 6 *	196.96	34.73	15.00
Rack slot 7 *	190.21	61.80	15.00
Rack slot 8 *	179.76	87.67	15.00
Rack slot 9 *	192.26	-111.00	15.00
Rack slot 10 *	205.83	-83.16	15.00
Rack slot 11 *	215.41	-53.71	15.00
Rack slot 12 *	220.78	-23.21	15.00
Rack slot 13 *	221.86	7.75	15.00
Rack slot 14 *	218.63	38.55	15.00
Rack slot 15 *	211.13	68.60	15.00
Rack slot 16 *	199.53	97.32	15.00
Rack slot 17 *	211.31	-122.00	15.00
Rack slot 18 *	226.23	-91.40	15.00
Rack slot 19 *	236.75	-59.03	15.00
Rack slot 20 *	242.66	-25.50	15.00
Rack slot 21 *	243.85	8.52	15.00
Rack slot 22 *	240.29	42.37	15.00


Station coordinate checklist

* marks slots selected for this batch. Teach gripping Z after the physical rack is assembled.

Station	X	Y	Tool Z
Rack slot 23 *	232.06	75.40	15.00
Rack slot 24 *	219.31	106.96	15.00

Actual-size tile 1/2, 1/3

100% / Actual size. Trim to frame; tile rows increase in +Y. Lower-left XY: (-20, -180).

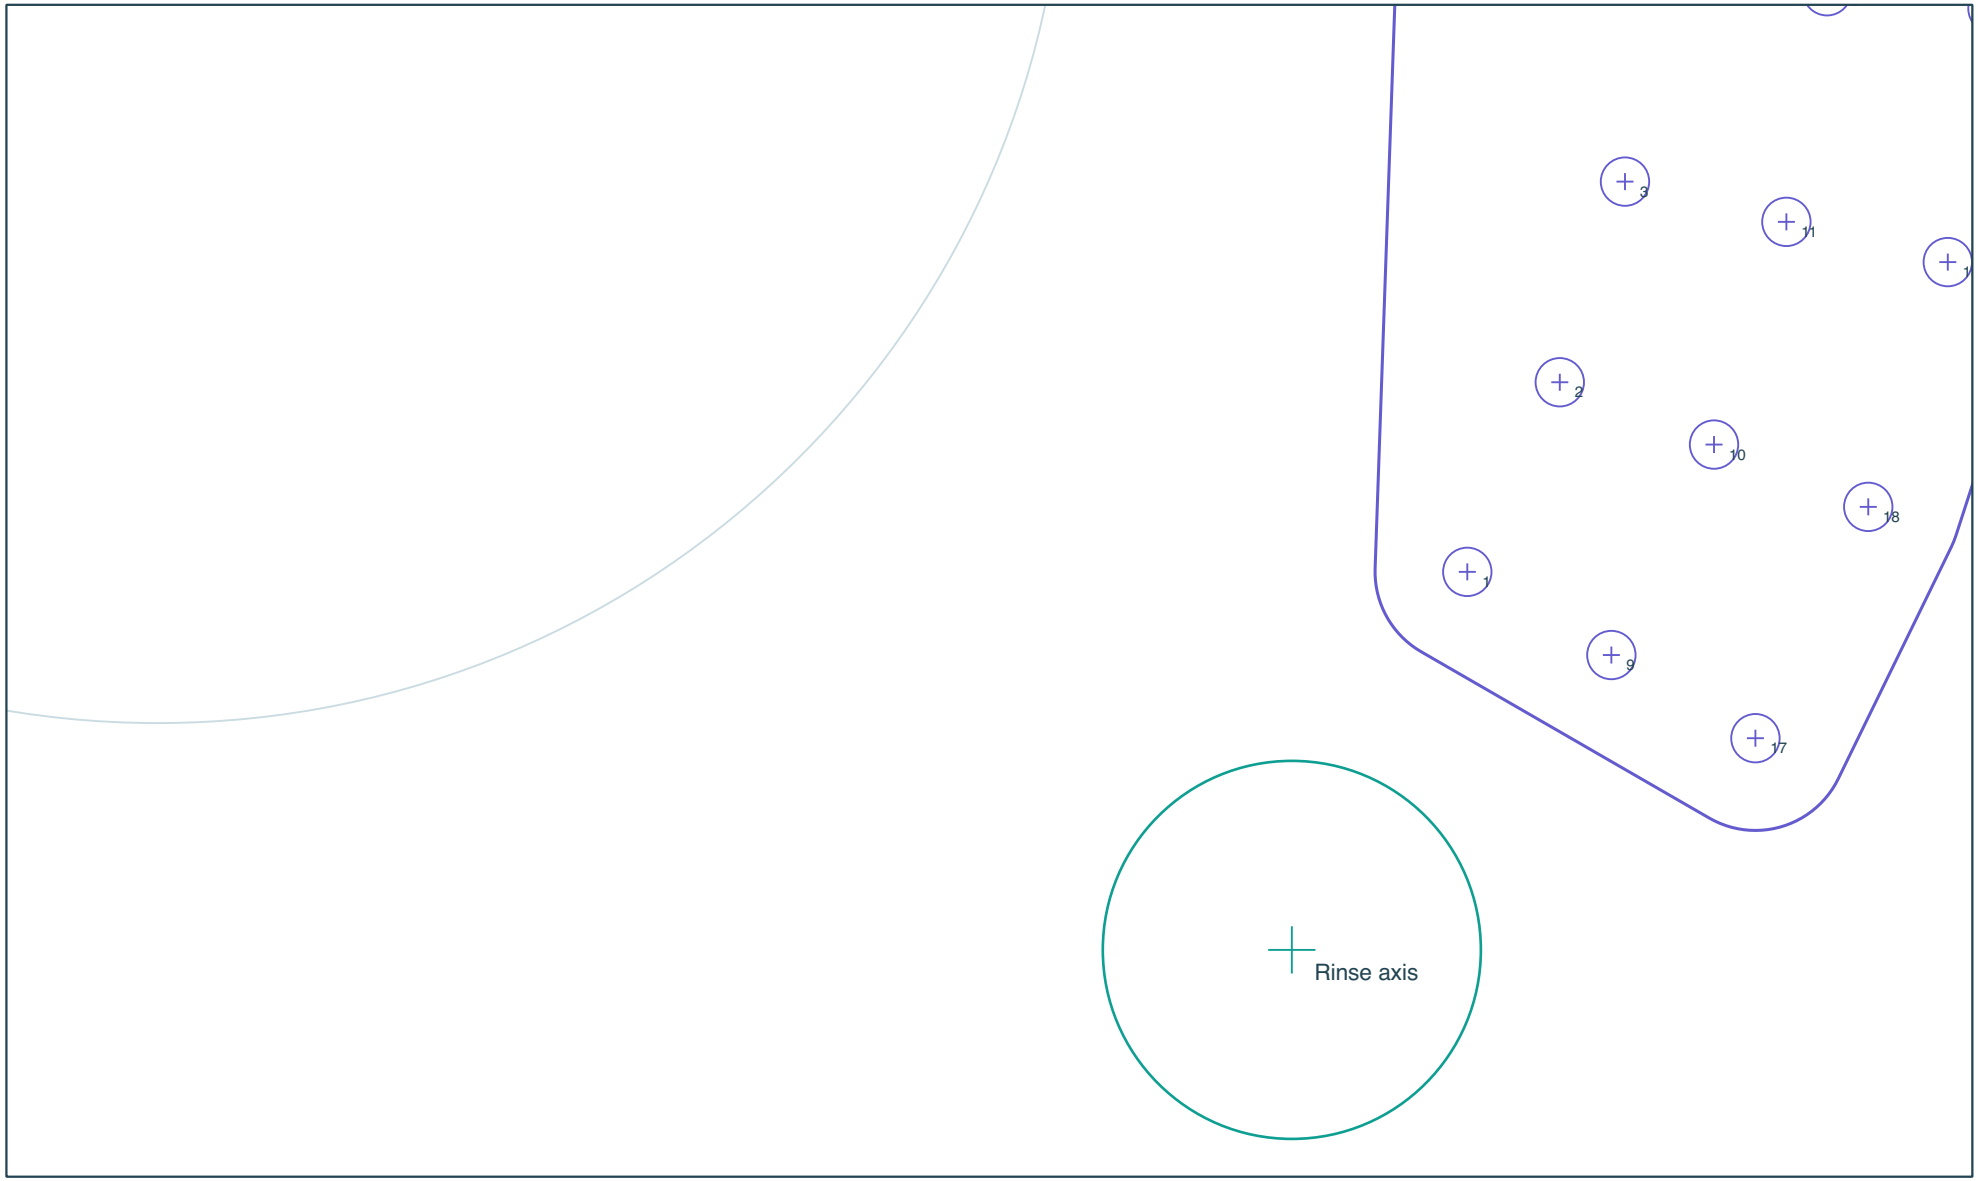

Verify this line measures exactly 50 mm:

Actual-size tile 2/2, 1/3

100% / Actual size. Trim to frame; tile rows increase in +Y. Lower-left XY: (240, -180).



Verify this line measures exactly 50 mm:

Actual-size tile 1/2, 2/3

100% / Actual size. Trim to frame; tile rows increase in +Y. Lower-left XY: (-20, -25).



Verify this line measures exactly 50 mm:

Actual-size tile 2/2, 2/3


100% / Actual size. Trim to frame; tile rows increase in +Y. Lower-left XY: (240, -25).



Verify this line measures exactly 50 mm:

Actual-size tile 1/2, 3/3


100% / Actual size. Trim to frame; tile rows increase in +Y. Lower-left XY: (-20, 130).

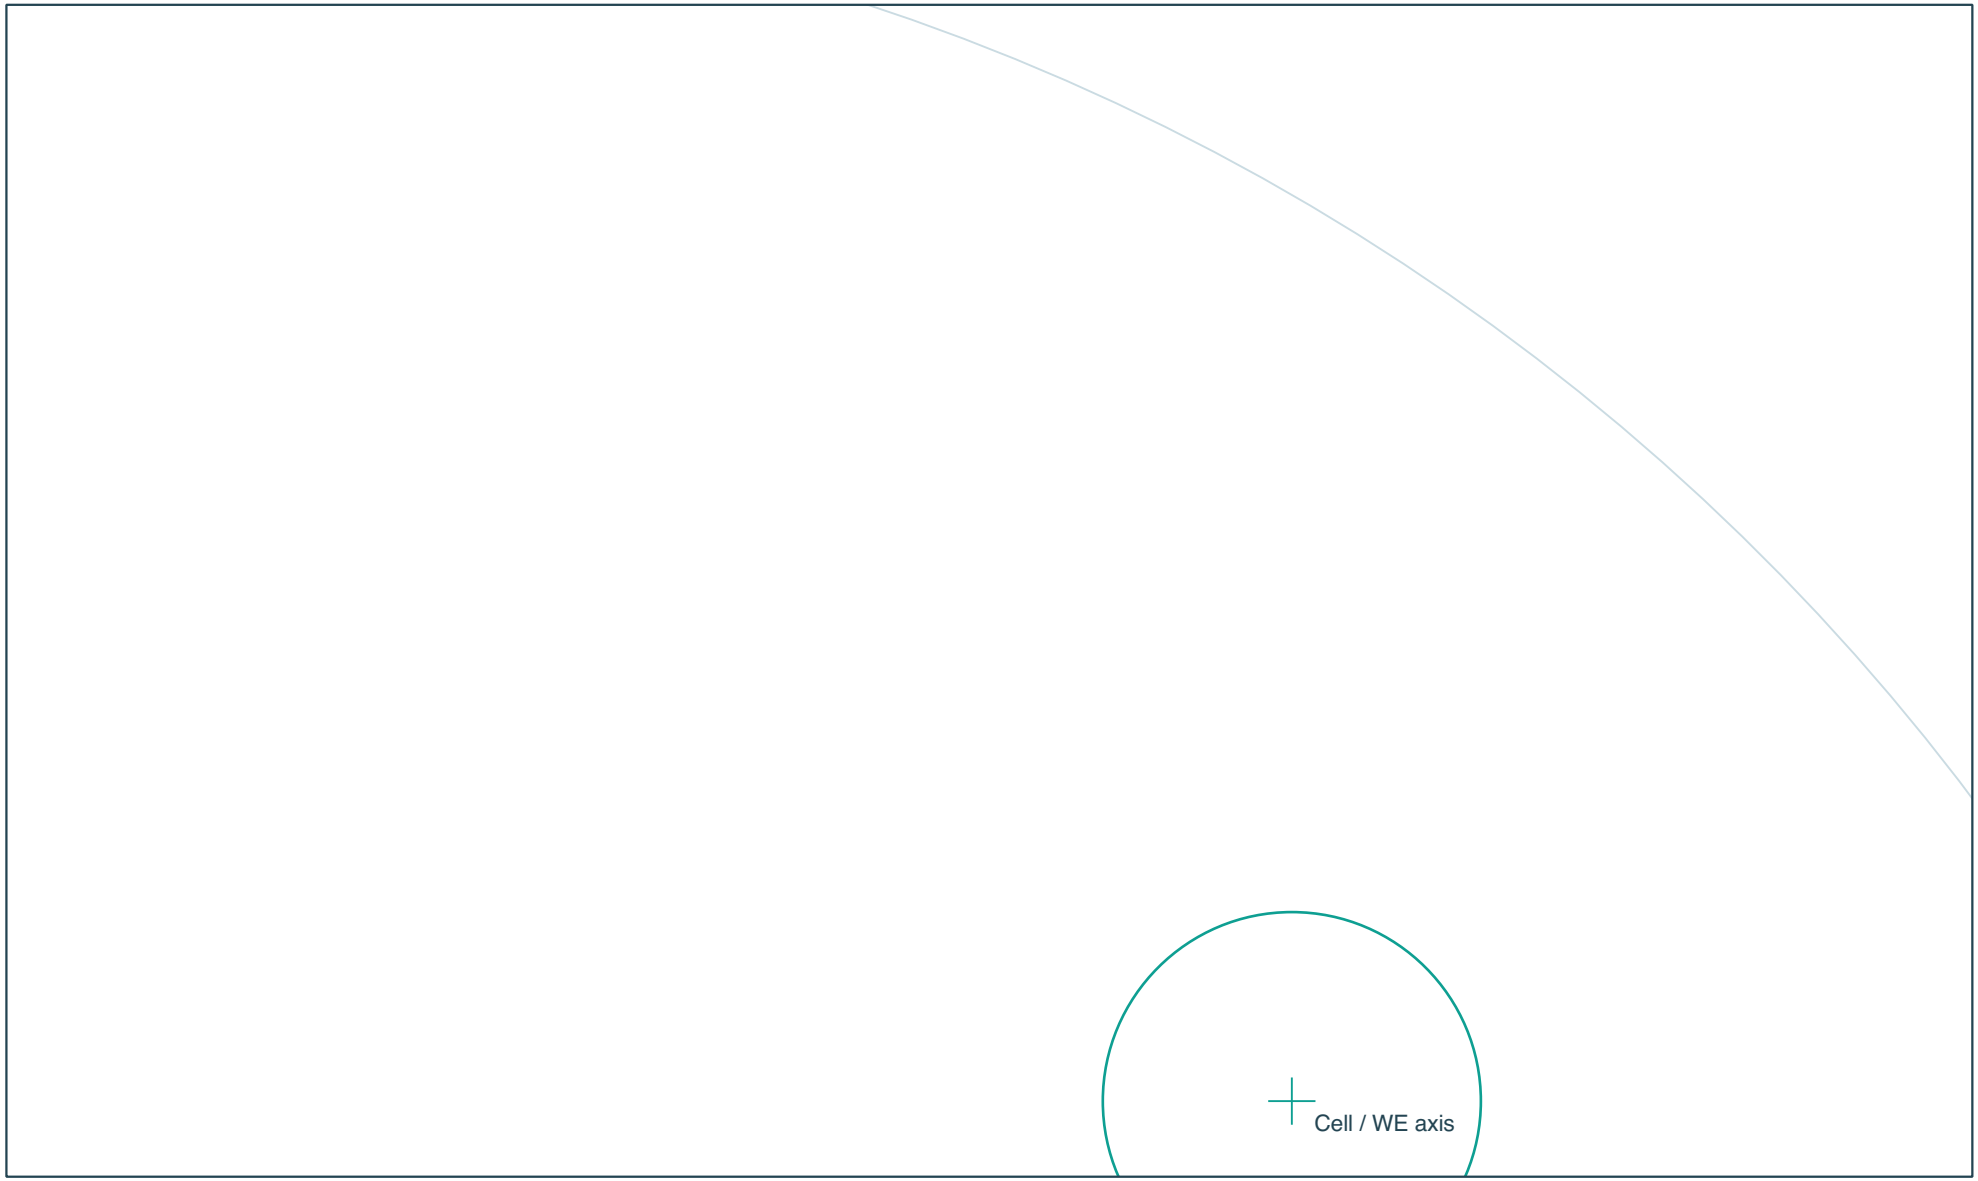

Verify this line measures exactly 50 mm:

Actual-size tile 2/2, 3/3

100% / Actual size. Trim to frame; tile rows increase in +Y. Lower-left XY: (240, 130).



Verify this line measures exactly 50 mm: