


Remora 2 Production Test

Revision 0.0

April 2026

Pad identification

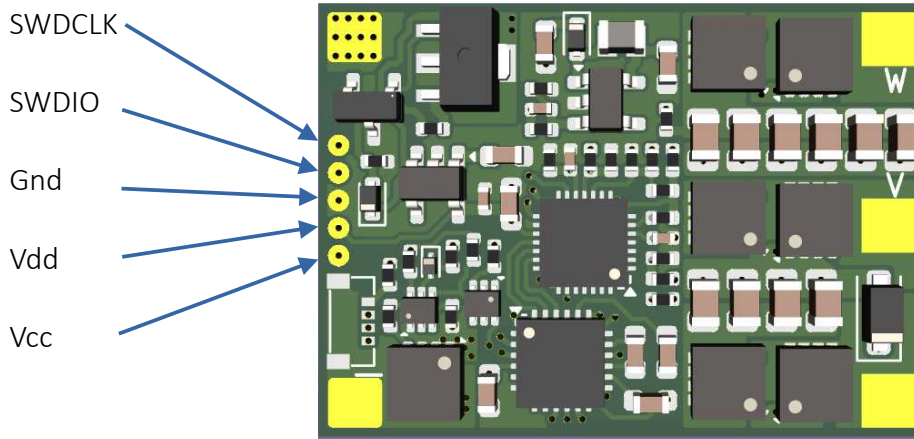

Procedure

setup / action	measure	expected result
visual inspection	check for no missing or misplaced parts, no bad joints or solder bridges	all OK
Low Voltage initial power-up		
set power supply to 1.5V, but output off		
connect power supply to + &- terminals		
turn power supply output on	power supply current	≈48mA
	VCC to GND	≈12.4V
	VDD to GND	3.234V to 3.366V
High Voltage Test		
increase power supply voltage to 13.5V	power supply current	≈6mA
	VCC to GND	≈12.4V
Memory Programming		
programme the flash memory		
reduce power supply voltage to zero & turn off		
Operation With Motor Connected		
connect motor, make sure its mechanically secure		
turn power supply on		

slowly increase power supply voltage from 0V to 13.5V	check motor rotation	motor should start at $\leq 1.2V$ & run smoothly
reduce power supply voltage to zero & turn off		
Reverse Polarity Test		
reverse connections to + & - terminals		
turn power supply on, increase power supply voltage to 13.5V	power supply current	<1.7mA
reduce power supply voltage to zero & turn off		
restore normal connections to + & - terminals		
turn power supply on, increase power supply voltage to 13.5V	check for motor rotation	normal rotation
End of Tests		
reduce power supply voltage to zero & turn off		
end		

Revision History

revision	date	changes
0.0	23 April 2026	initial draft