MQ303B Alcohol Sensor

Character

- * High sensitivity
- * Fast response and resume
- * Long life and low cost
- * Mini Size

Application

MQ303B is semiconductor sensor for Alcohol detection. It has good sensitivity and fast response to alcohol, suitable for portable alcohol detector.


Technical Data


Model No.			MQ303B
Sensor Type			Semiconductor
Standard Encapsulation			Metal
Detection Gas			Alcohol
Concentration			20-1000ppm Alcohol
Standard Circuit Conditions	Heater Voltage	V _H	0.9V ± 0.1V AC or DC
	Loop Voltage	$V_{\rm c}$	≤6V DC
	Load	R _L	
	Resistance		Adjustable
	Heater	Rн	$4.5\Omega \pm 0.5$ Ω (Room Tem.)
	Resistance		
	Heater Current	Ι _Η	120±20mA
	Heater Power	P _H	≤ 140 mW
Character	Sensor	Ps	≤10 mW
	Consumption		
	Sensing	$R_{\rm s}$	4KΩ-400KΩ(in air)
	Resistance		
	Consitivity	S	Rs(in air)/Rs(125ppm
	Sensitivity		Alcohol)≥3
	Slope	α	$0.50 \pm 0.15 (R_{300ppm}/R_{100ppm} Alcohol)$
Condition	Tem. Humidity		20℃±2℃; 65%±5%RH
	Standard test circuit		Vc:3.0 V±0.1 V DC ;
			V _H : 0.9 V±0.1 V DC
	Preheat time		Over 48 hours


element is installed in




Configuration

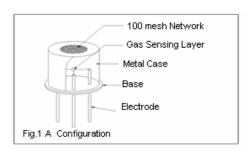

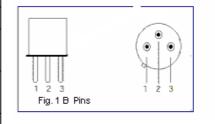



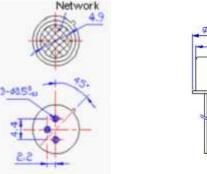

Sensing element of the

semiconductor sensor is a micro-ball, heater and metal electrode are inside, and the sensing

anti-explosion double 100 mesh metal case (see the above)

Tel: 86-371-67169097 Fax: 86-371-60932988 Email: sales@winsensor.com

Sensitivity Characteristics

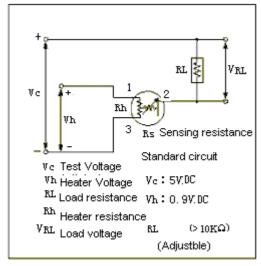


Fig 2 Standard Test Circuit

Fig.2 is the test circuit. You could get resistance change from voltage change on fixed or adjustable load resistance. Normally, it will take several minutes preheating for sensor enter into stable working after electrified; or you could give 2.2±0.2V high voltage for 5-10secs before test, which make sensor easily stable.

Influence of Temperature/Humidity

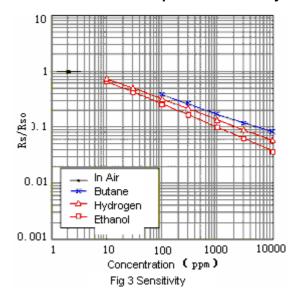


Fig 3 is sensitivy of MQ303B, it reflects relations between resistance and gas concentration, resistance of the sensor reduce when gas concentration increases

Notification

1 Following conditions must be prohibited

1.1 Exposed to organic silicon steam

Organic silicon steam cause sensors invalid, sensors must be avoid exposing to silicon bond, fixature, silicon latex, putty or plastic contain silicon environment

1.2 High Corrosive gas

If the sensors exposed to high concentration corrosive gas (such as H_2Sz , SO_X , CI_2 , HCI etc), it will not only result in corrosion of sensors structure, also it cause sincere sensitivity attenuation.

1.3 Alkali, Alkali metals salt, halogen pollution

The sensors performance will be changed badly if sensors be sprayed polluted by alkali metals salt especially brine, or be exposed to halogen such as fluorin.

1.4 Touch water

Sensitivity of the sensors will be reduced when spattered or dipped in water.

1.5 Freezing


Do avoid icing on sensor'surface, otherwise sensor would lose sensitivity.

1.6 Applied voltage higher

Applied voltage on sensor should not be higher than stipulated value, otherwise it cause down-line or heater damaged, and bring on sensors' sensitivity characteristic changed badly.

1.7 Voltage on wrong pins

For 6 pins sensor, if apply voltage on 1、3 pins or 4、6 pins, it will make lead broken, and without signal when apply on 2、4 pins



2 Following conditions must be avoided

2.1 Water Condensation

Tel: 86-371-67169097 Fax: 86-371-60932988

Indoor conditions, slight water condensation will effect sensors performance lightly. However, if water condensation on sensors surface and keep a certain period, sensor' sensitivity will be decreased.

2.2 Used in high gas concentration

No matter the sensor is electrified or not, if long time placed in high gas concentration, if will affect sensors characteristic.

2.3 Long time storage

The sensors resistance produce reversible drift if it's stored for long time without electrify, this drift is related with storage conditions. Sensors should be stored in airproof without silicon gel bag with clean air. For the sensors with long time storage but no electrify, they need long aging time for stbility before using.

2.4 Long time exposed to adverse environment

No matter the sensors electrified or not, if exposed to adverse environment for long time, such as high humidity, high temperature, or high pollution etc, it will effect the sensors performance badly.

2.5 Vibration

Continual vibration will result in sensors down-lead response then repture. In transportation or assembling line, pneumatic screwdriver/ultrasonic welding machine can lead this vibration.

2.6 Concussion

If sensors meet strong concussion, it may lead its lead wire disconnected.

2.7 Usage

For sensor, handmade welding is optimal way. If use wave crest welding should meet the following conditions:

- 2.7.1 Soldering flux: Rosin soldering flux contains least chlorine
- 2.7.2 Speed: 1-2 Meter/ Minute
- 2.7.3 Warm-up temperature: 100±20°C
- 2.7.4 Welding temperature: 250±10°C
- 2.7.5 1 time pass wave crest welding machine

If disobey the above using terms, sensors sensitivity will be reduced.

Tel: 86-371-67169097 Fax: 86-371-60932988 Email: sales@winsensor.com