

DrawDiff Comparison Report

Part number: P-001 | Job: 0d0fa489-3b7a-4e8c-8ceb-01810602e58c | Generated: 2026-05-05T01:02:48+00:00

Summary

1 Critical	7 Significant	2 Minor	0 Uncertain	6 Views compared
---------------	------------------	------------	----------------	---------------------

Title Block

Field	Original	Revised
part_number		
revision	TS	
material		
tolerance		
drawn_by		
date		

Revision Block

Added in revised

No revision entries on revised drawing.

Removed from original


No revision entries on original drawing.

Annotated Drawings


Severity: ■ Critical ■ Significant ■ Minor ■ Uncertain

Sheet 1 — boxes mark views with detected changes.

Original

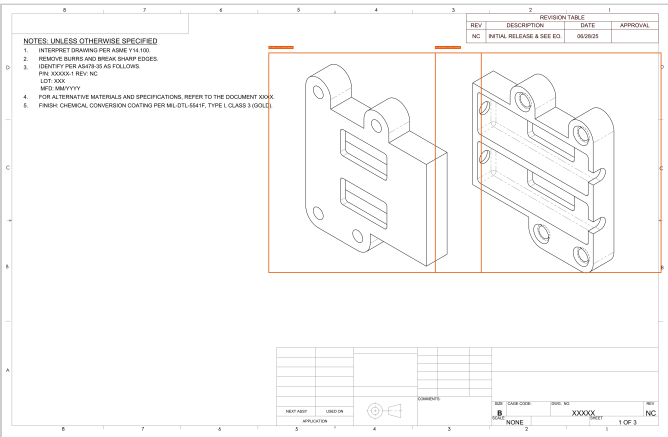


Revised

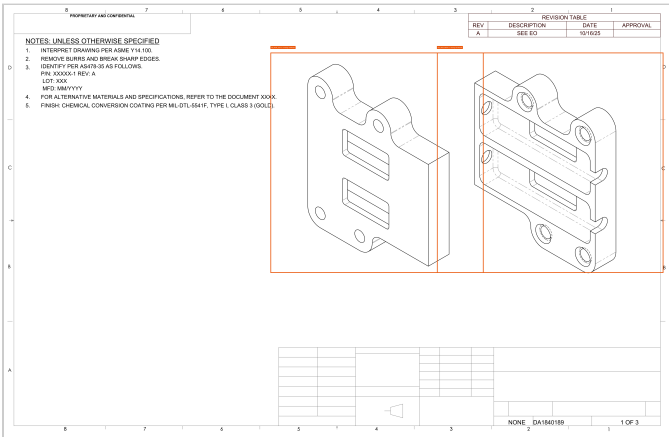


Sheet 2 — boxes mark views with detected changes.

Original

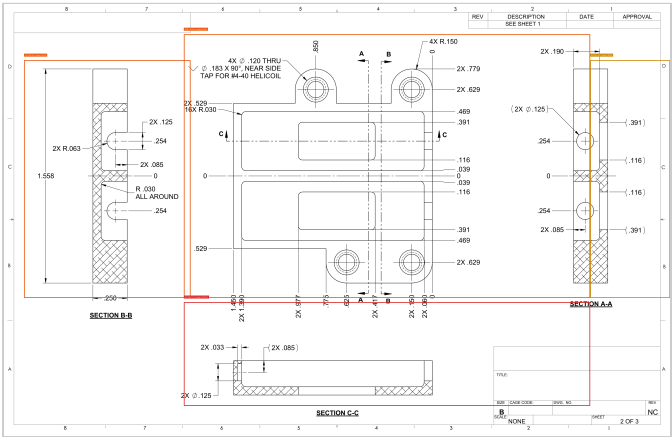

Revised

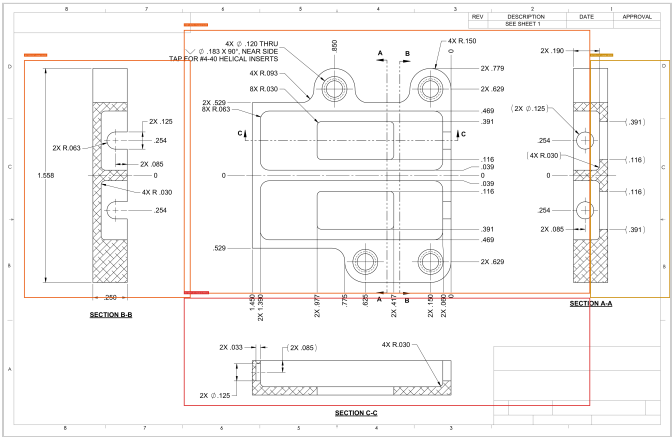

View-by-view Changes


title_block [TITLE_BLOCK]

Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	revision	Title Block	TS	—	1.00	title_block.revision changed from 'TS' to None

revision_block [REVISION_BLOCK]


No textual changes recorded for this view.

ISO_VIEW_LEFT [MATCHED]

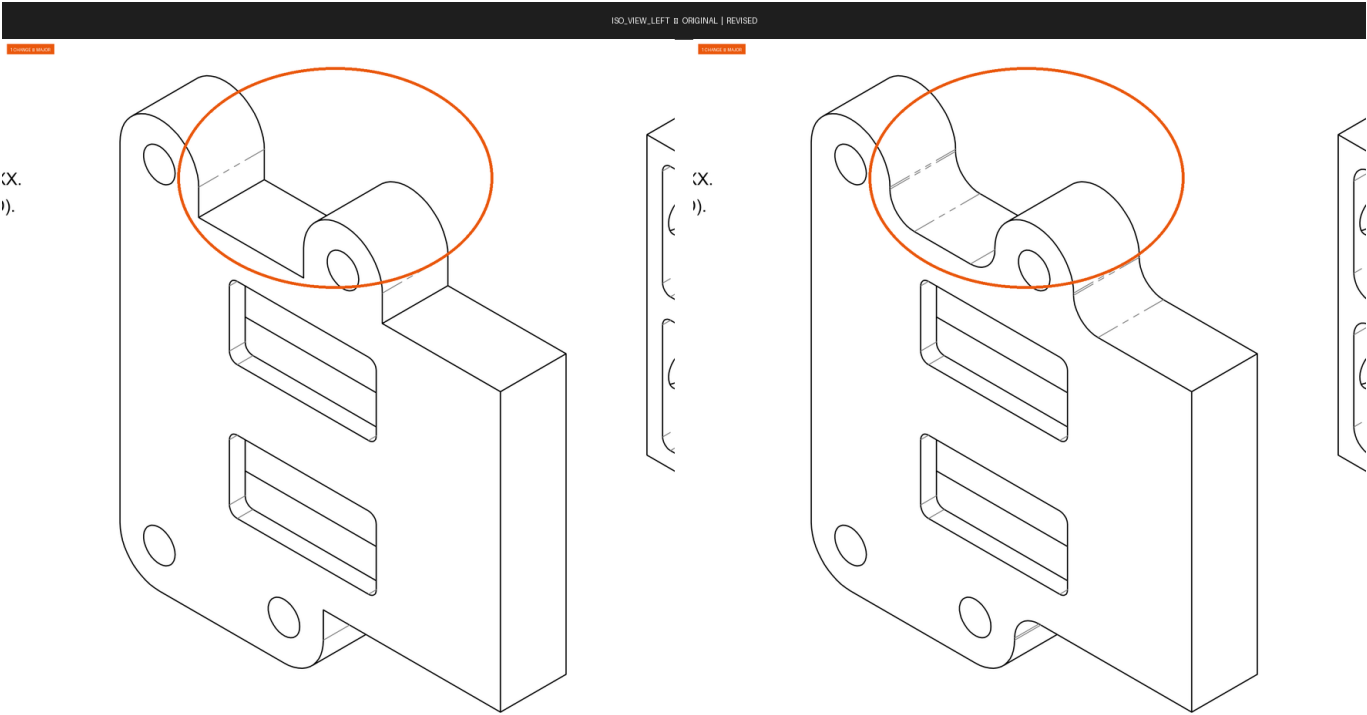


Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	A4	Flat/stepped top surface on upper hinge block with sharp rectangular cross-section transition	Curved/filleted top surface on upper hinge block with continuous rounded profile blending into main body	0.82	The upper hinge/clevis block geometry has changed from a flat-topped stepped profile to a continuously curved rounded profile, indicating a significant shape change to that feature that would affect manufacturing and potentially structural behavior.

ISO_VIEW_RIGHT [MATCHED]

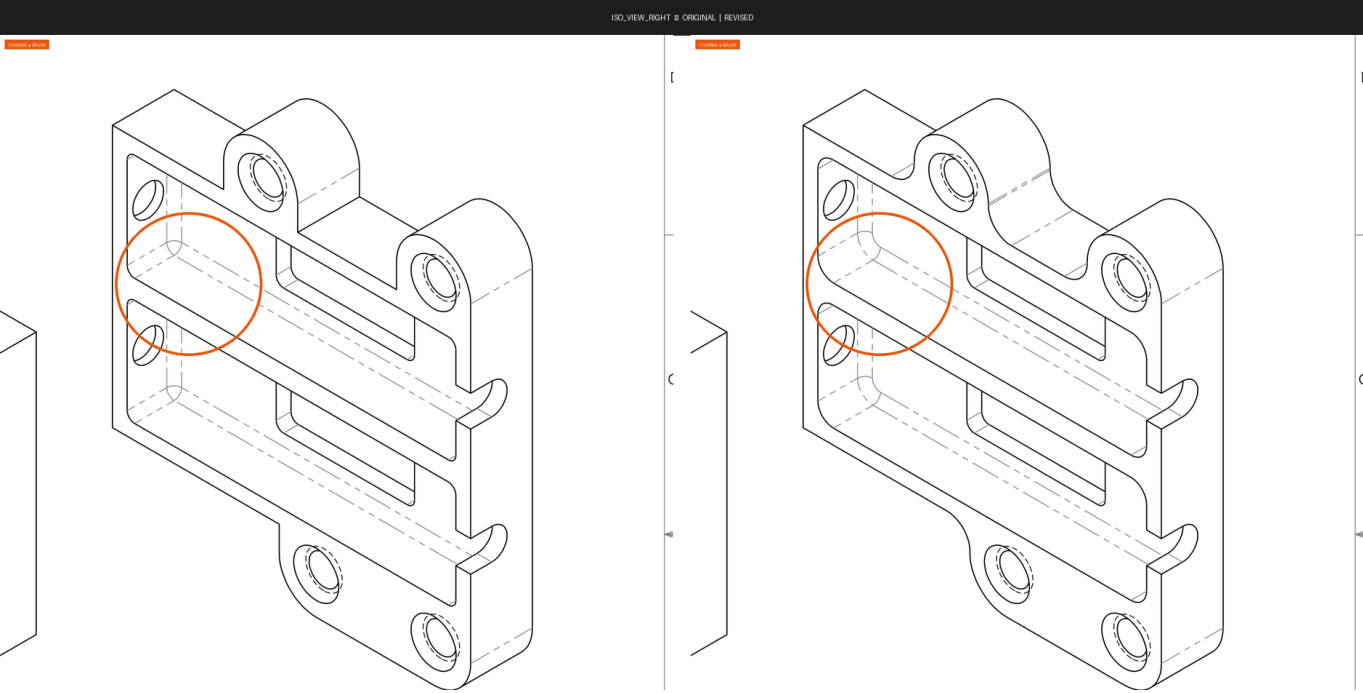



Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	B3	Sharp/stepped inner corner at top-left pocket transition (upper slot region shows a distinct step or sharp corner profile)	Radiused/filleted inner corner at top-left pocket transition (corner is now blended with a visible fillet)	0.72	The interior corner geometry at the upper-left pocket wall appears to transition from a sharp or stepped corner in the original to a filleted radius in the revised view, which affects stress concentration and manufacturing process.

SECTION B-B [MATCHED]

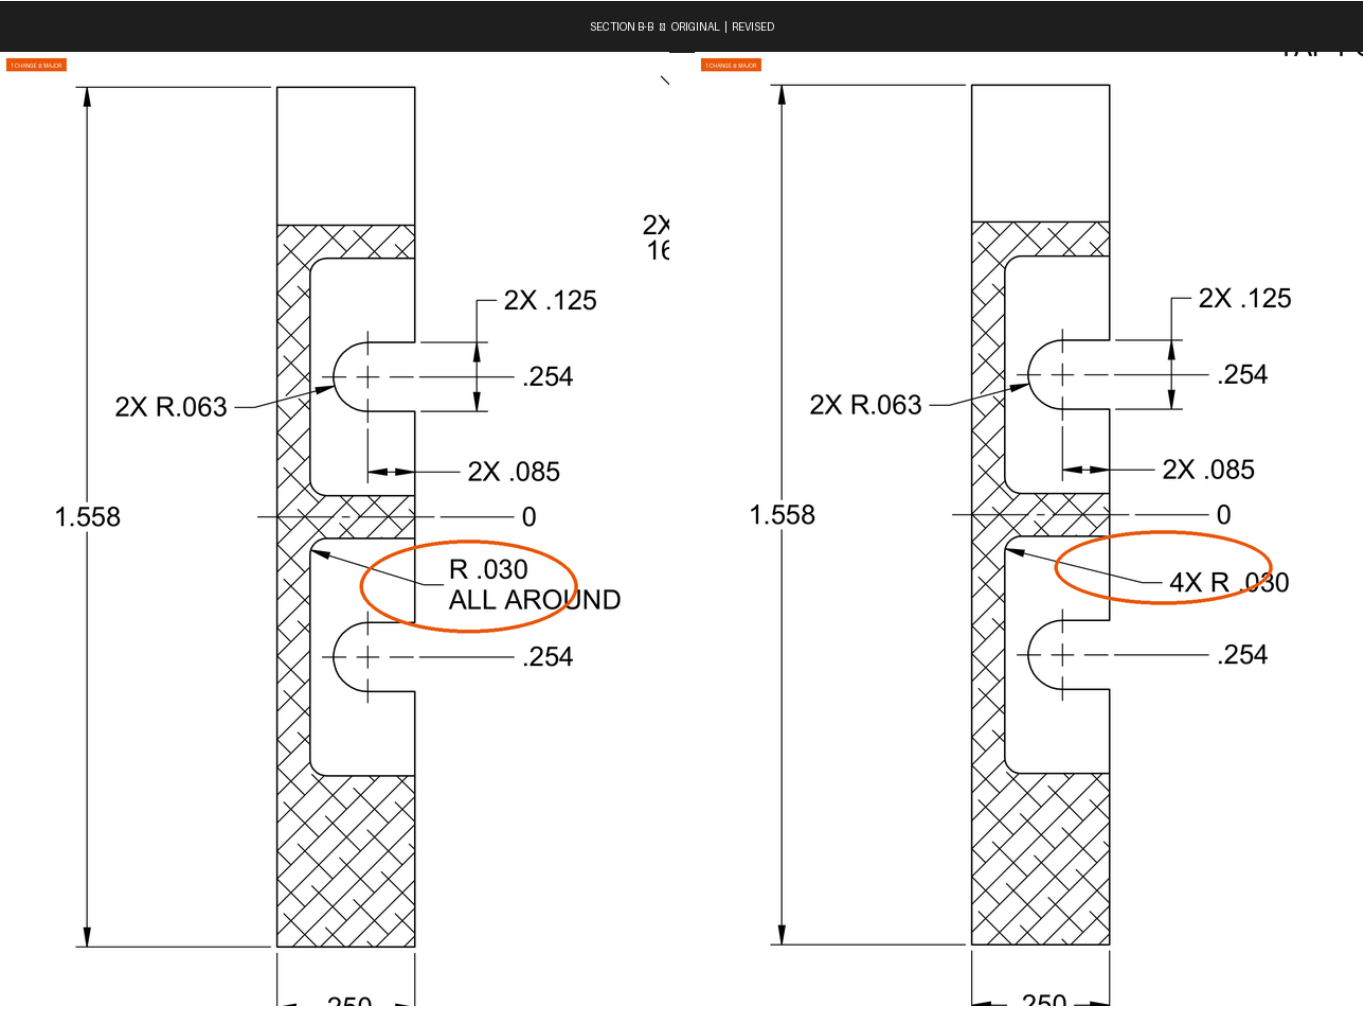


Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	callout	B7	R .030 ALL AROUND	4X R .030	0.92	The radius callout changed from 'R .030 ALL AROUND' to '4X R .030', replacing the all-around modifier with an explicit count of 4 instances, which changes how the radius specification is interpreted and applied to the feature.

FRONT_VIEW [MATCHED]

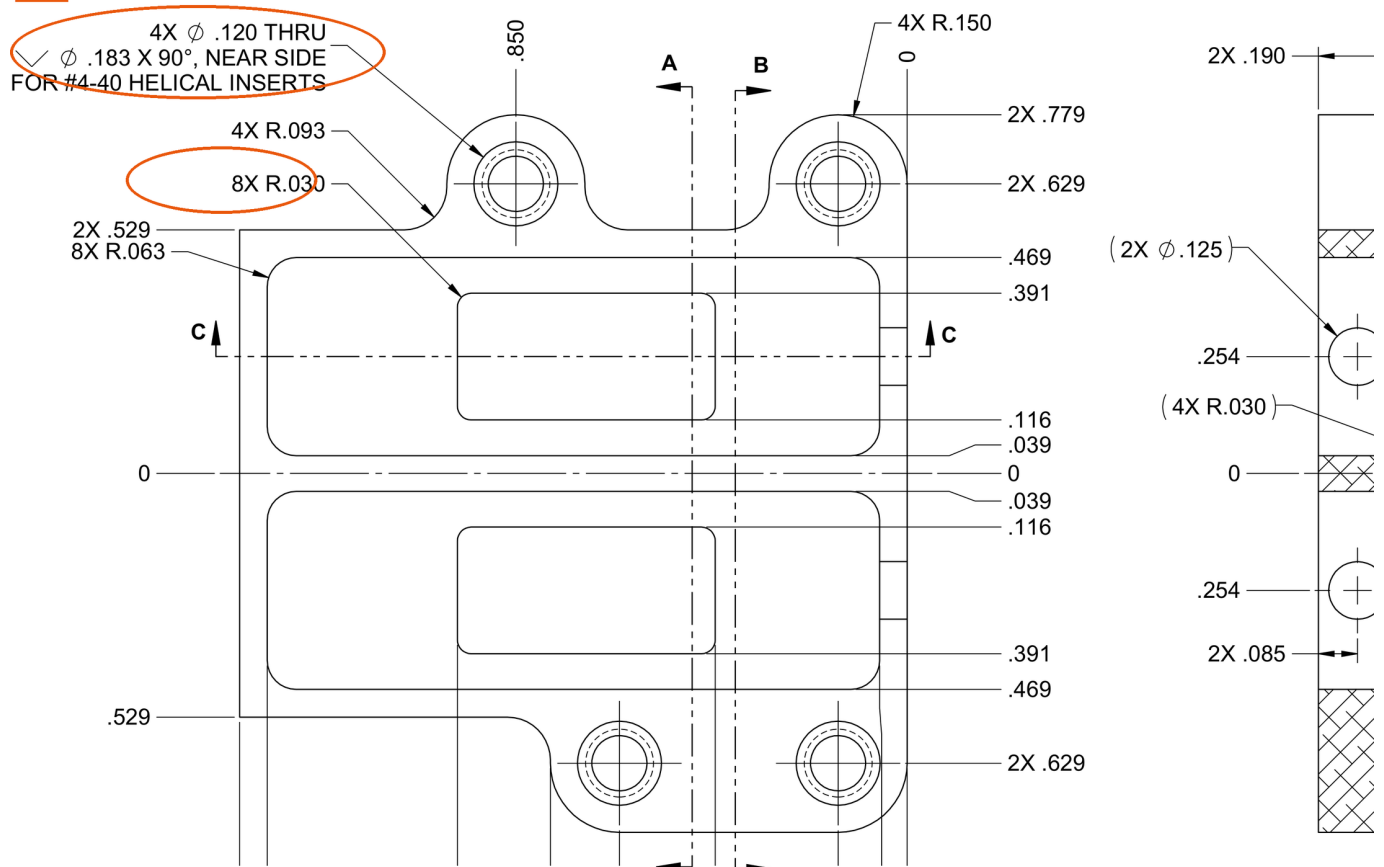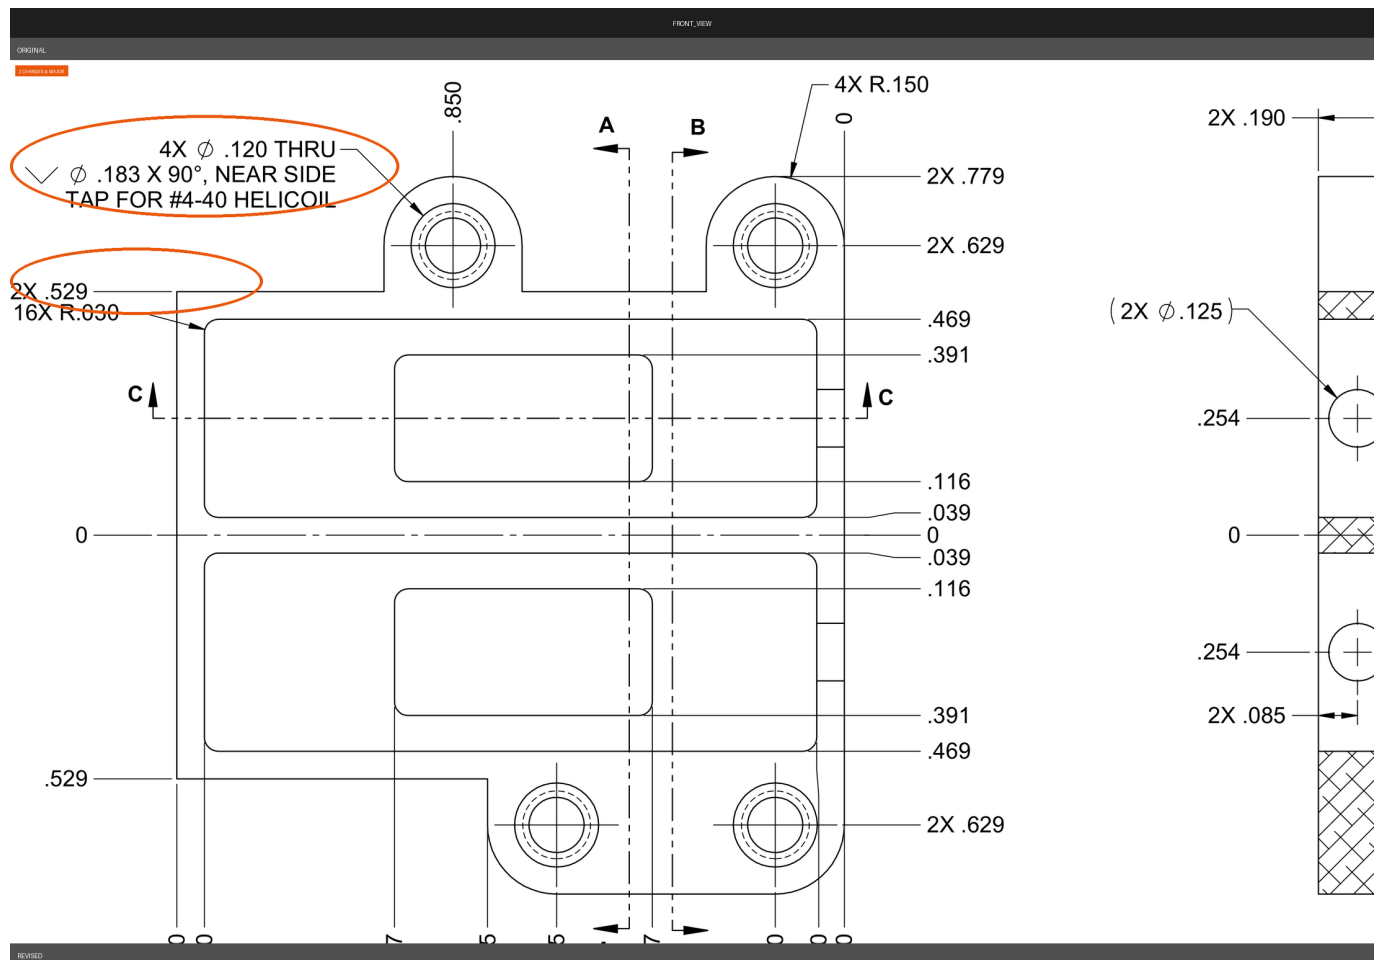


Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	note	A6	TAP FOR #4-40 HELICOIL	FOR #4-40 HELICAL INSERTS	0.95	The tap specification note was changed from 'TAP FOR #4-40 HELICOIL' to 'FOR #4-40 HELICAL INSERTS', indicating a change in insert type/brand specification which affects procurement and manufacturing.
SIGNIFICANT	annotation	A6	16X R.030	8X R.030	0.92	The quantity of R.030 radii in the upper area was changed from 16X to 8X, indicating fewer instances of this corner radius feature on the part.

SECTION A-A [MATCHED]

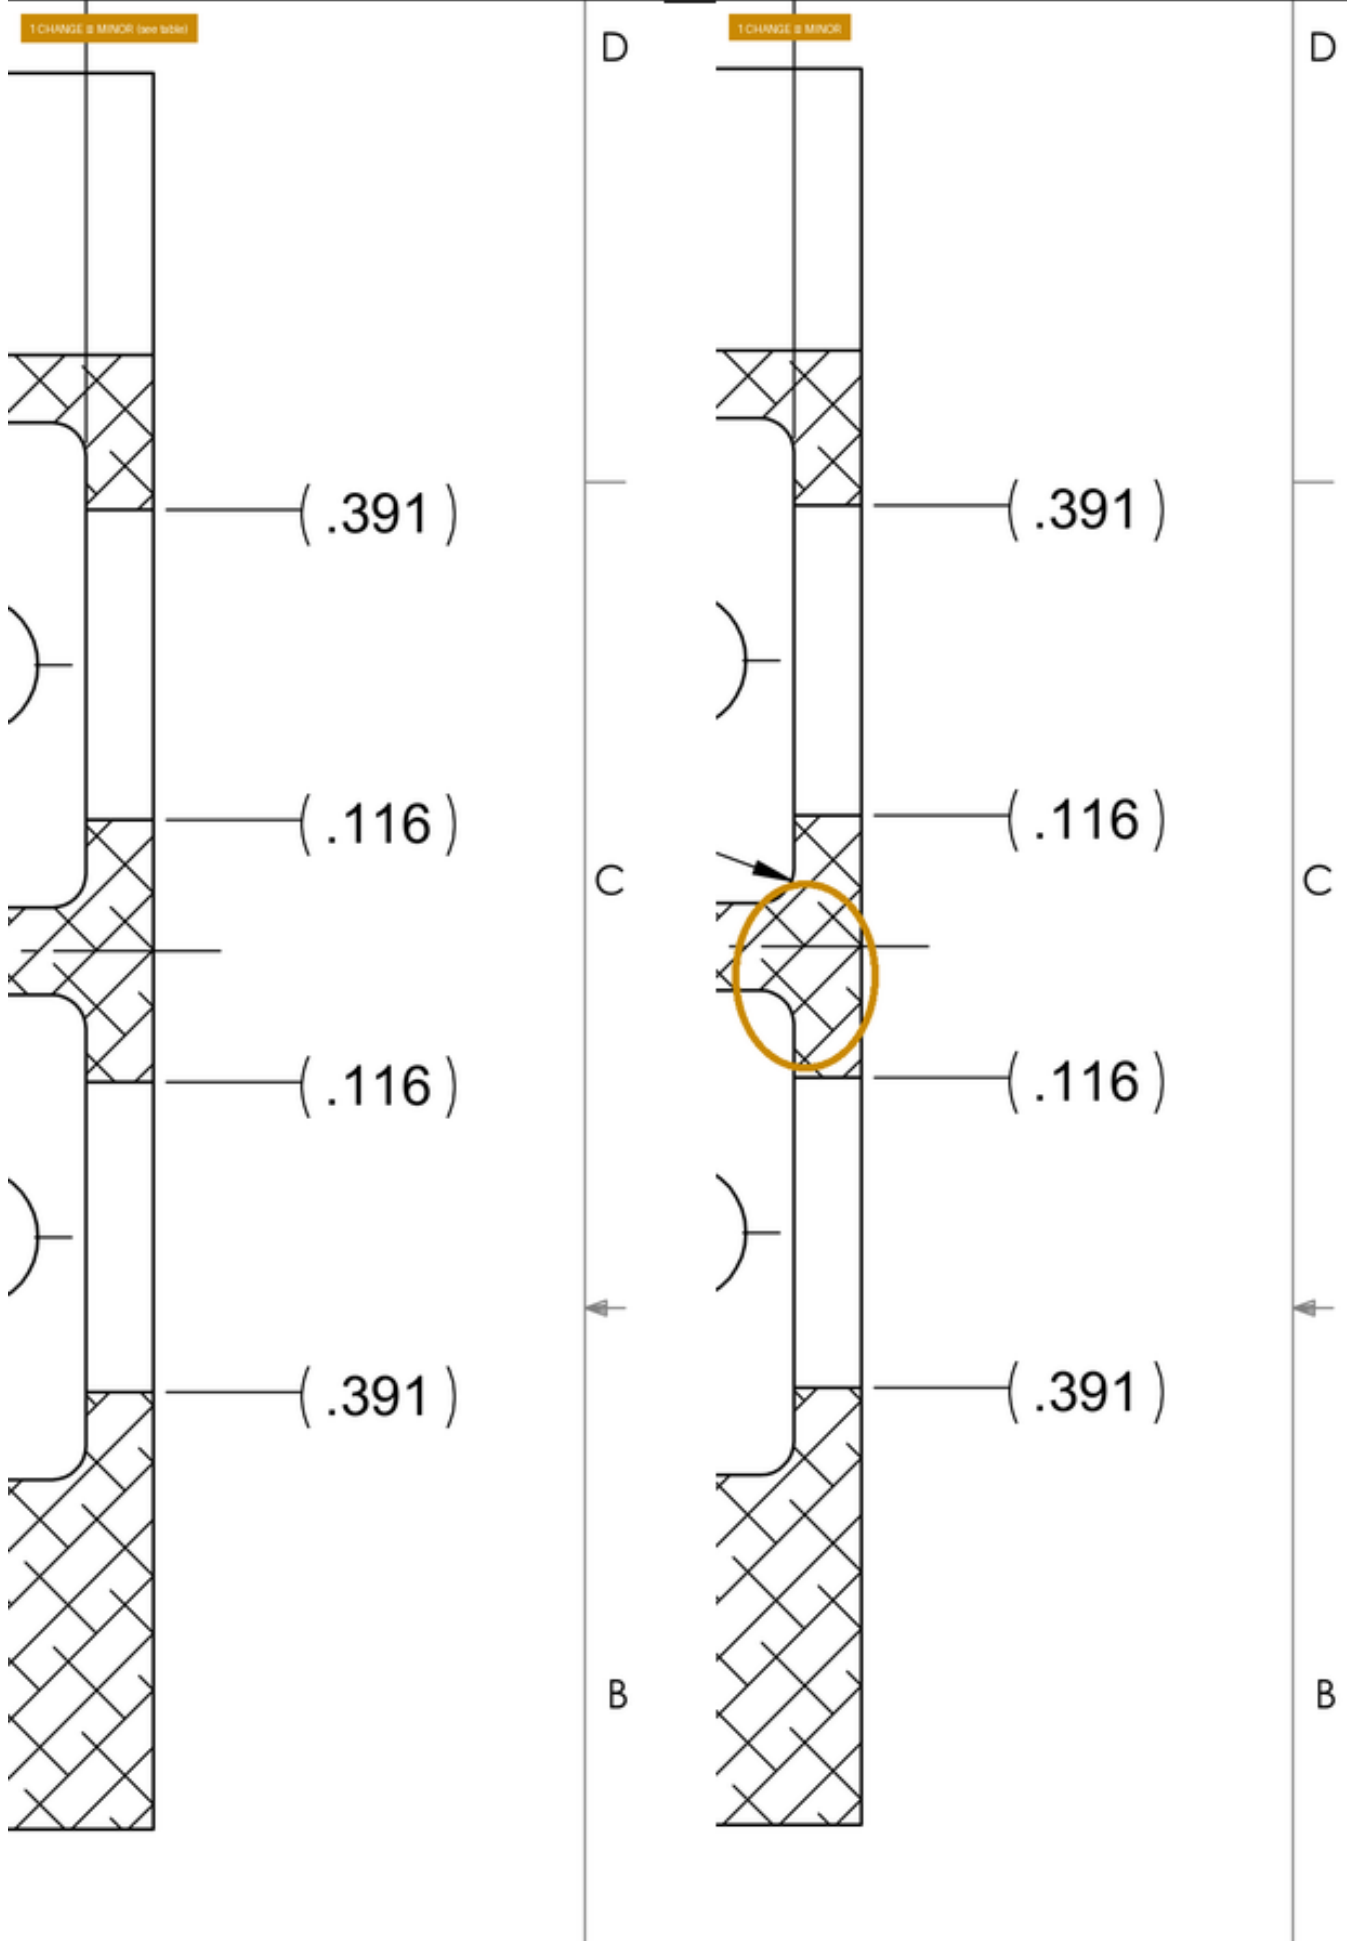

Severity	Field	Zone	Original	Revised	Conf.	Rationale
MINOR	annotation	B1	—	arrow/leader pointing to groove/ undercut feature	0.72	A small filled arrow or leader annotation appears in the revised view near the mid-section groove area (left side, around the .116 dimension zone) that is not present in the original, possibly indicating a new callout or pointer to a specific feature.

SECTION C-C [MATCHED]

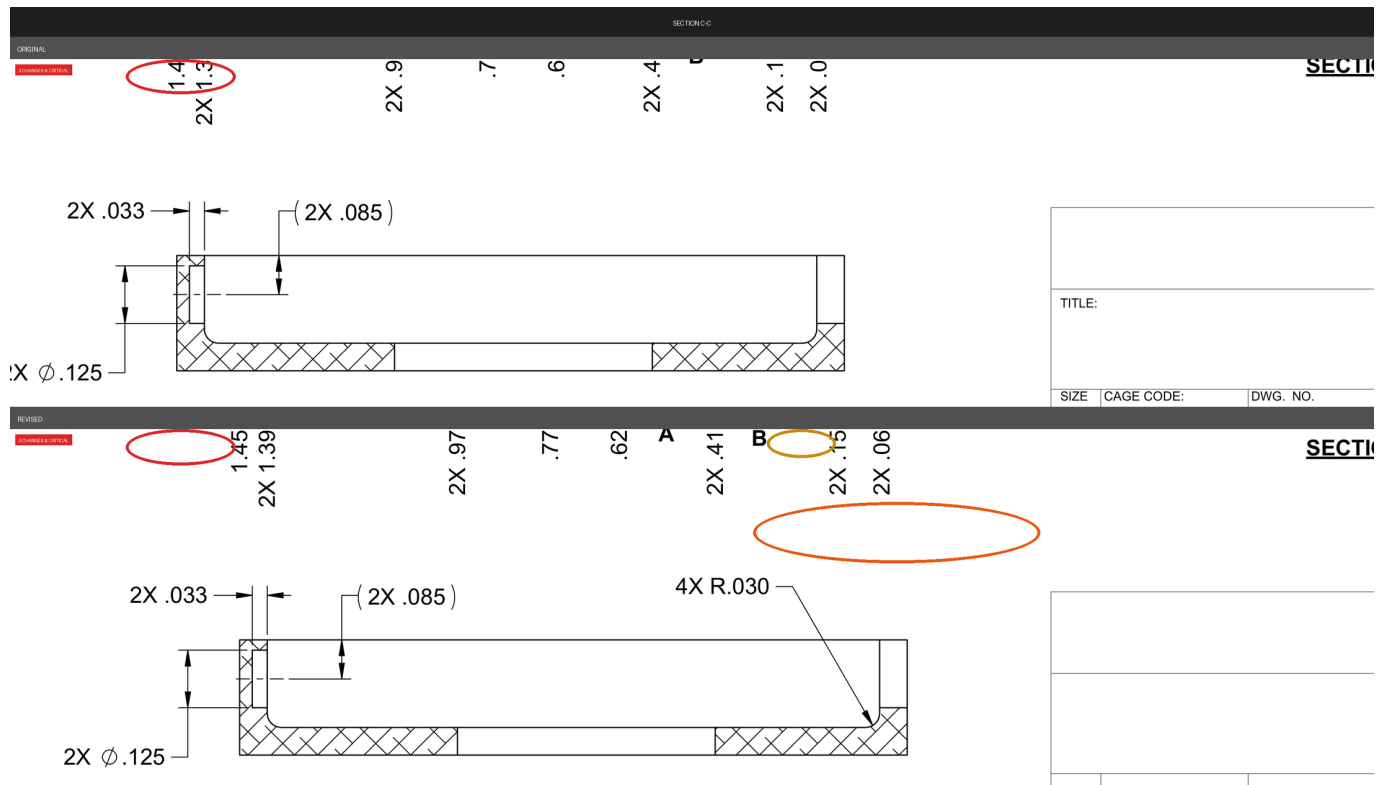

Severity	Field	Zone	Original	Revised	Conf.	Rationale
CRITICAL	dimension	C6	1.4	1.45	0.82	Overall length dimension changed from 1.4 to 1.45, a functional change affecting part fit and envelope.
SIGNIFICANT	callout	D3	—	4X R.030	0.90	A new radius callout '4X R.030' has been added in the revised drawing, specifying corner radii on four locations not previously called out.
MINOR	annotation	C4	—	A	0.75	A new section/datum label 'A' appears in the revised drawing at the top dimension row, not present in the original.

Legend

- **CRITICAL** — Affects structural integrity, safety, interchangeability, or regulatory compliance.
- **SIGNIFICANT** — Affects manufacturing scope, cost, or lead time. No safety risk but requires re-planning.
- **MINOR** — Clarity, formatting, or documentation change. No manufacturing impact.
- **UNCERTAIN** — Confidence below 0.65. Requires human review.

⚠ AI-generated — requires human verification before release to manufacturing.