

DrawDiff Comparison Report

Part number: P-001 | Job: 2fd37037-1fc4-4967-b49b-15e52ceb8631 | Generated: 2026-05-05T01:34:54+00:00

Summary

0 Critical	10 Significant	0 Minor	0 Uncertain	6 Views compared
---------------	-------------------	------------	----------------	---------------------

Title Block

Field	Original	Revised
part_number		
revision	TS	
material		
tolerance		
drawn_by		
date		

Revision Block

Added in revised

No revision entries on revised drawing.

Removed from original


No revision entries on original drawing.

Annotated Drawings


Severity: Critical Significant Minor Uncertain

Sheet 1 — boxes mark views with detected changes.

Original

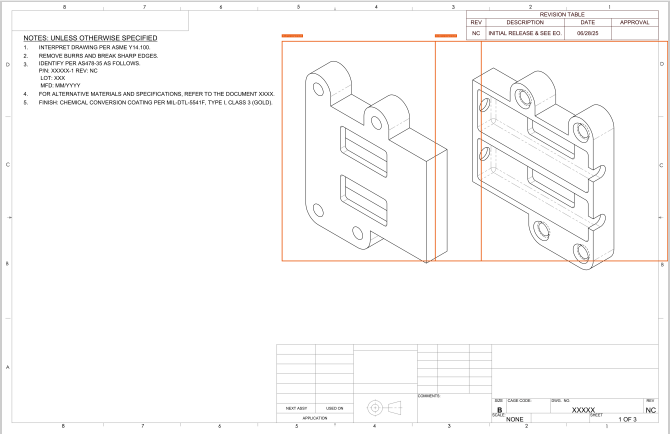


Revised

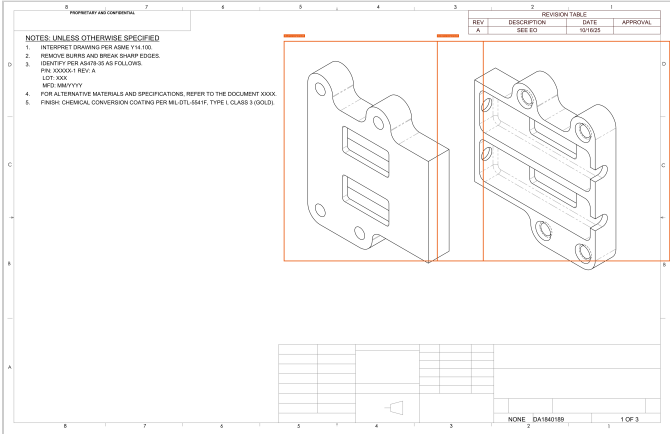


Sheet 2 — boxes mark views with detected changes.

Original

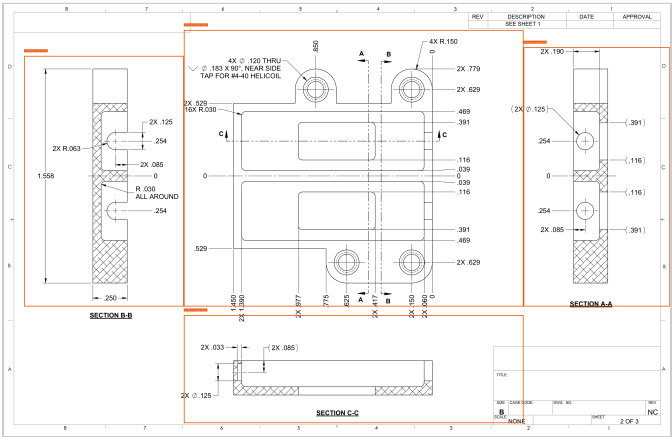

Revised

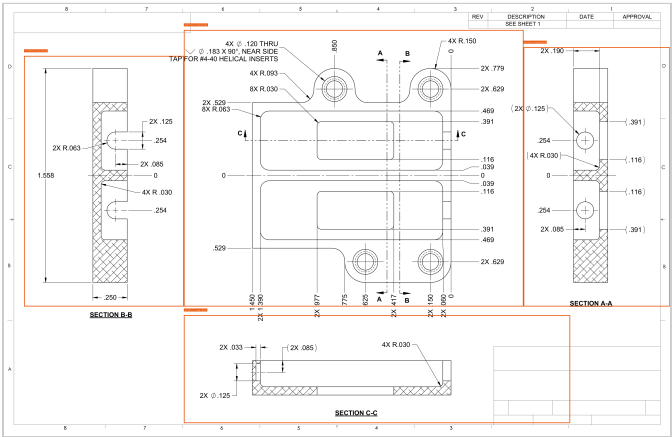

View-by-view Changes



title_block [TITLE_BLOCK]

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	revision	TS	—	1.00	title_block.revision changed from 'TS' to None

revision_block [REVISION_BLOCK]

No textual changes recorded for this view.


ISO_LEFT [MATCHED]

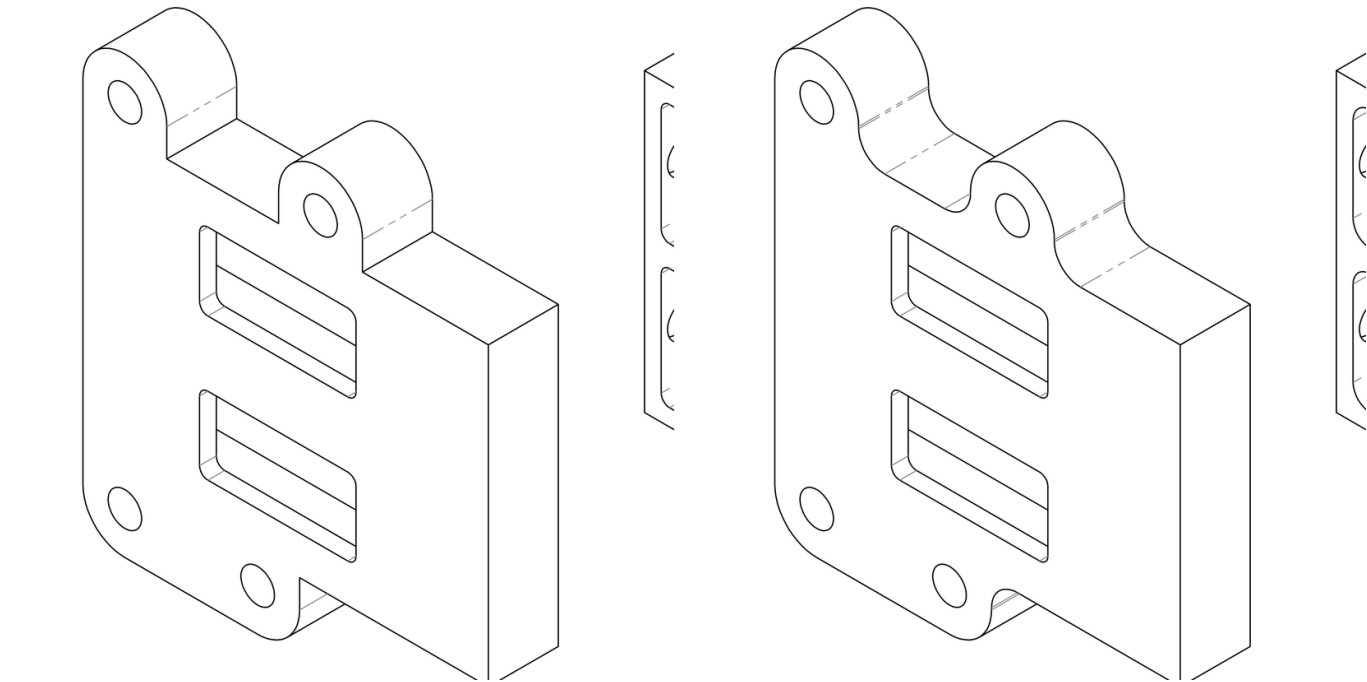


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry			0.72	

Severity	Field	Original	Revised	Conf.	Rationale
		Hinge knuckle/barrel area shows sharp or minimal fillet transitions between the barrel and the flat plate mounting surface	Hinge knuckle/barrel area shows larger, more pronounced fillet/radius transitions between the barrel and the flat plate mounting surface		The revised view shows noticeably larger blend radii where the hinge barrel meets the mounting plate, which would affect stress concentration, material volume, and potentially fit with mating components.

ISO_RIGHT [MATCHED]

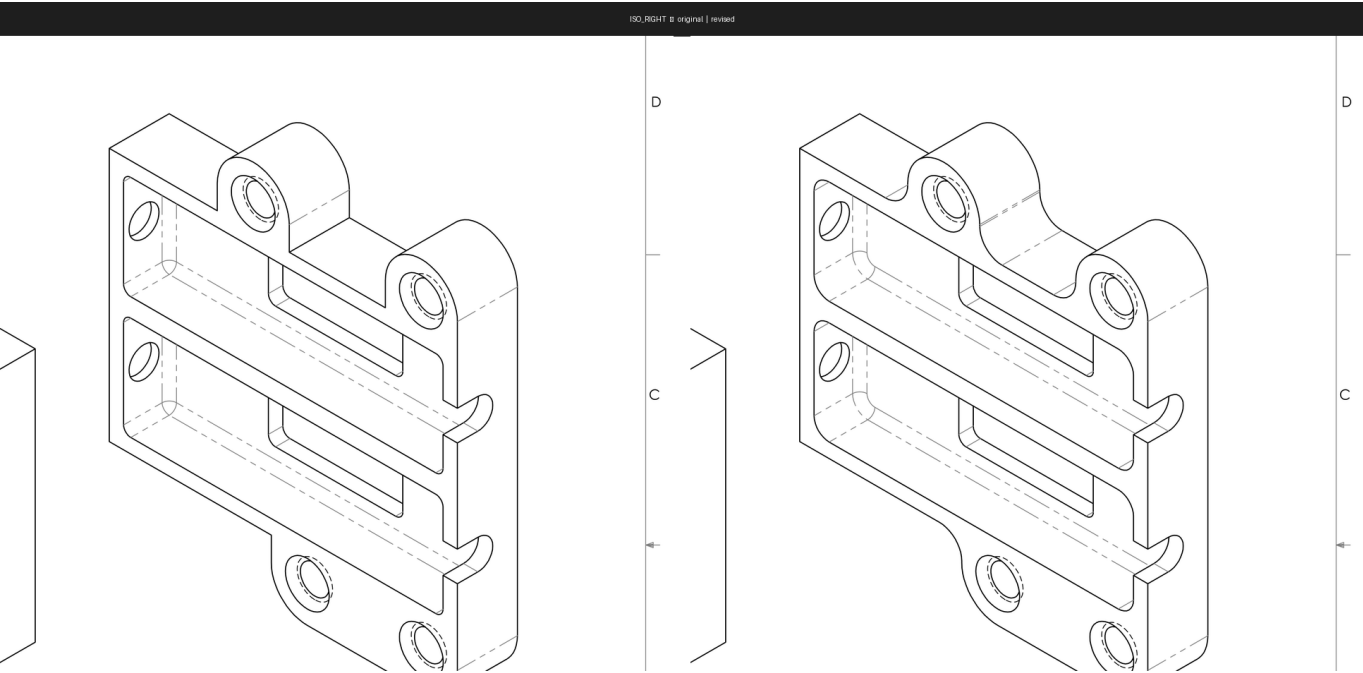


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	Sharp/angled internal corners visible on the front-left pocket walls of both upper and lower channel sections	Rounded/filleted internal corners on the front-left pocket walls of both upper and lower channel sections	0.72	The internal corner geometry of the recessed channel pockets has changed from sharp corners to radiused fillets, which affects stress concentration, machinability requirements, and potentially fit with mating components.

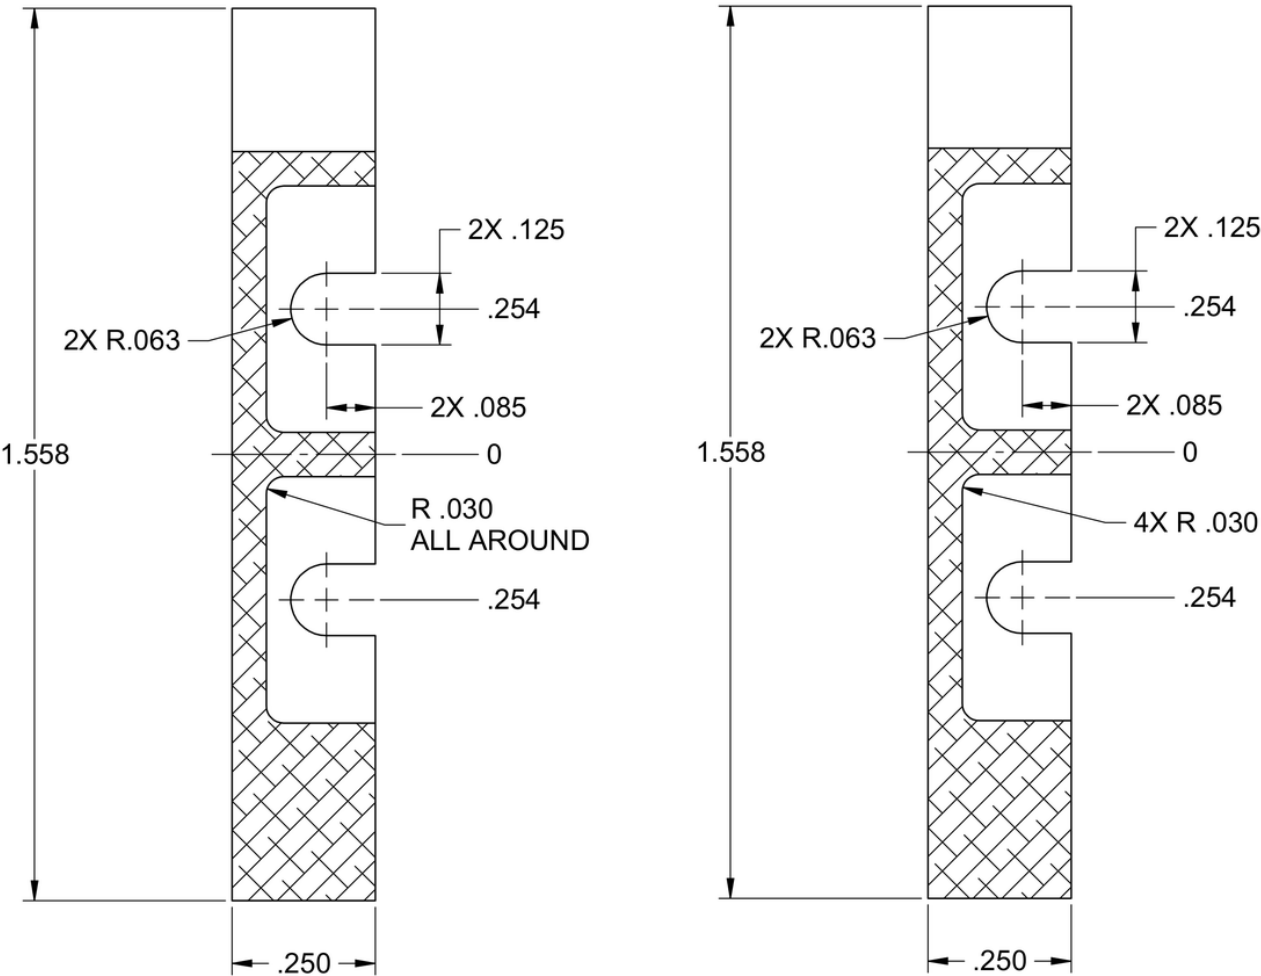


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	annotation	—	TAP	0.95	A new 'TAP' label was added to the revised view in the upper right corner, indicating a tapping operation requirement that was not present in the original drawing.
SIGNIFICANT	callout	R .030 ALL AROUND	4X R .030	0.92	The radius callout scope changed from 'ALL AROUND' (implying continuous all-around application) to '4X R .030' (explicitly specifying four discrete instances), which alters the manufacturing interpretation of where the R.030 radii are applied.

FRONT_VIEW [MATCHED]

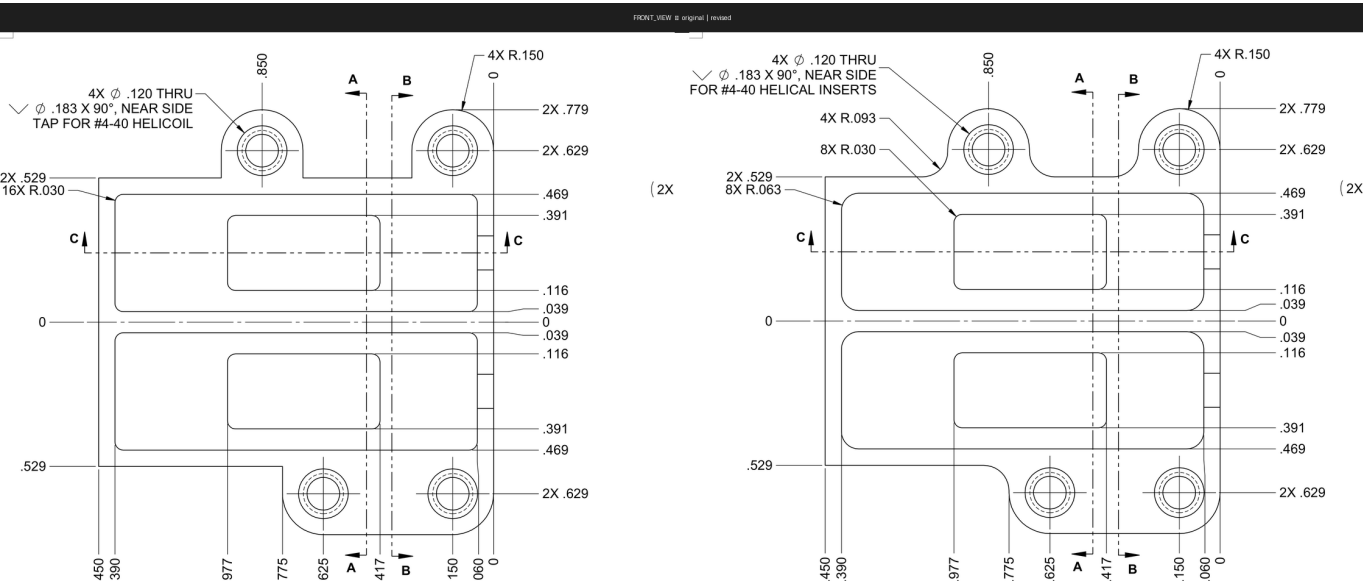


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	note	TAP FOR #4-40 HELICOIL	FOR #4-40 HELICAL INSERTS	0.92	The thread insert specification wording changed from 'HELICOIL' (brand name) to 'HELICAL INSERTS' (generic), which may affect procurement and manufacturing interpretation of the required insert type.
SIGNIFICANT	annotation	16X R.030	8X R.030	0.90	The count of R.030 radii was reduced from 16 to 8, indicating a significant change in the number of fillet/radius features on the part geometry.
SIGNIFICANT	geometry	Lower half of part shows mirrored pocket and boss features identical to upper half	Lower half of part appears simplified with different pocket/boss geometry compared to upper half	0.75	The lower portion of the part in the revised view appears to have altered pocket and boss geometry relative to the original, suggesting a functional shape change in the lower half of the component.

SECTION A-A [MATCHED]

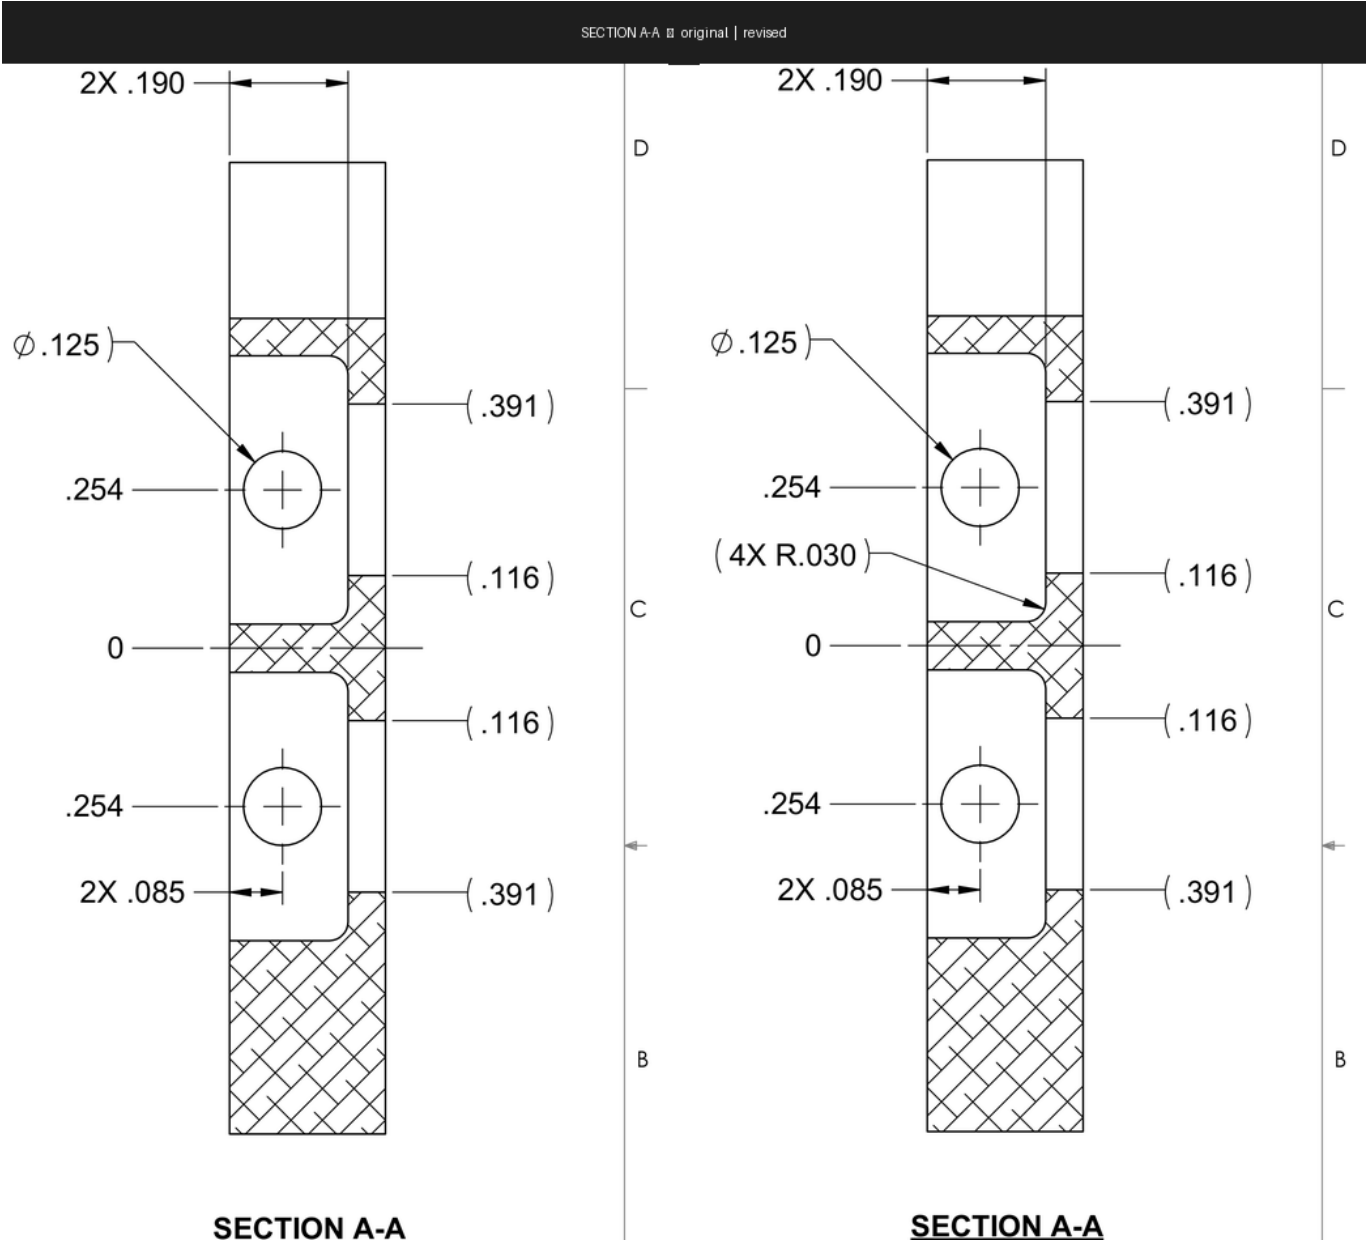

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	annotation	—	(4X R.030)	0.92	A new reference callout specifying four corner radii of R.030 has been added to the revised drawing, which defines a previously unspecified geometric feature on the slot/pocket corners and will affect machining requirements.

SECTION C-C [MATCHED]

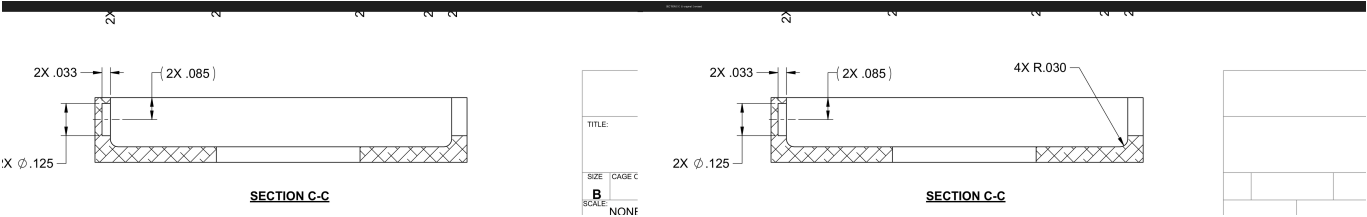

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	annotation	—	4X R.030	0.92	A new radius callout '4X R.030' has been added in the revised view, specifying corner radii that were not previously called out, which affects machining and part geometry.

Legend

- **CRITICAL** — Affects structural integrity, safety, interchangeability, or regulatory compliance.
 - **SIGNIFICANT** — Affects manufacturing scope, cost, or lead time. No safety risk but requires re-planning.
 - **MINOR** — Clarity, formatting, or documentation change. No manufacturing impact.
 - **UNCERTAIN** — Confidence below 0.65. Requires human review.
- ⚠ **AI-generated — requires human verification before release to manufacturing.**