

DrawDiff Comparison Report

Part number: P-001 | Job: 6cfcbeba-bc19-4ad3-a7cd-31ff4b6b13ed | Generated: 2026-05-05T04:10:31+00:00

Summary

0 Critical	7 Significant	1 Minor	0 Uncertain	6 Views compared
---------------	------------------	------------	----------------	---------------------

Title Block

Field	Original	Revised
part_number		
revision	TS	
material		
tolerance		
drawn_by		
date		

Revision Block

Added in revised

No revision entries on revised drawing.

Removed from original


No revision entries on original drawing.

Annotated Drawings


Severity: Critical Significant Minor Uncertain

Sheet 1 — boxes mark views with detected changes.

Original


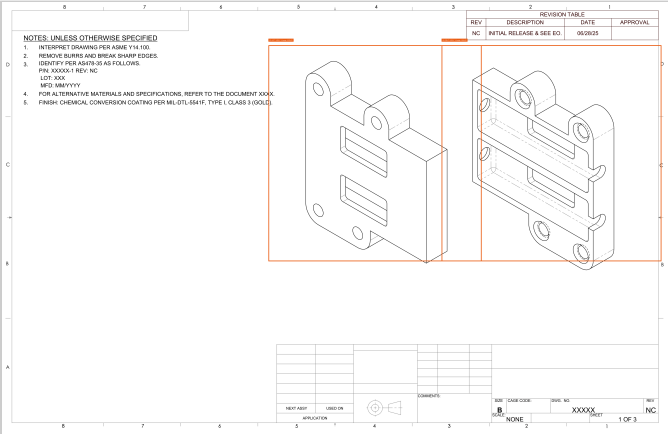


Revised

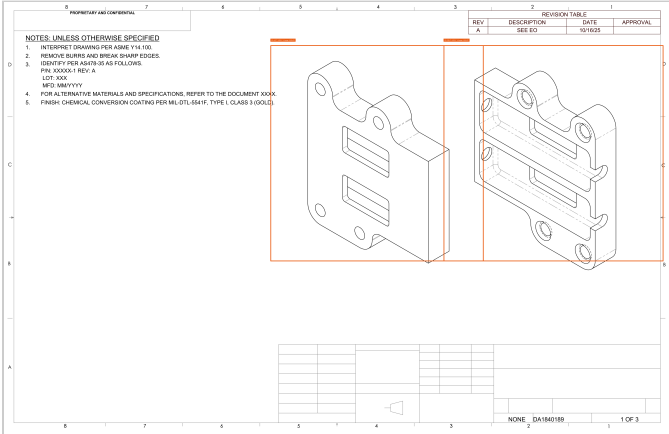

Original

Revised

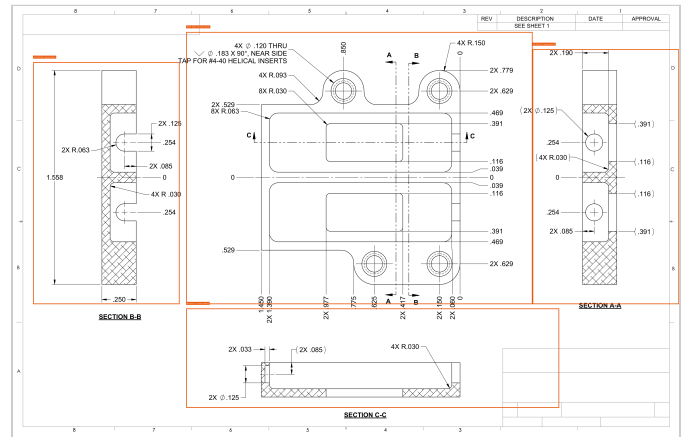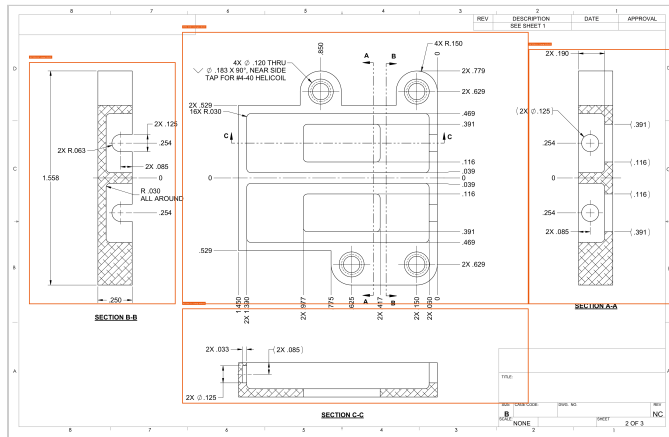

View-by-view Changes


title_block [TITLE_BLOCK]

Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	revision	Title Block	TS	—	1.00	title_block.revision changed from 'TS' to None

revision_block [REVISION_BLOCK]


No textual changes recorded for this view.

ISO_LEFT_VIEW [MATCHED]

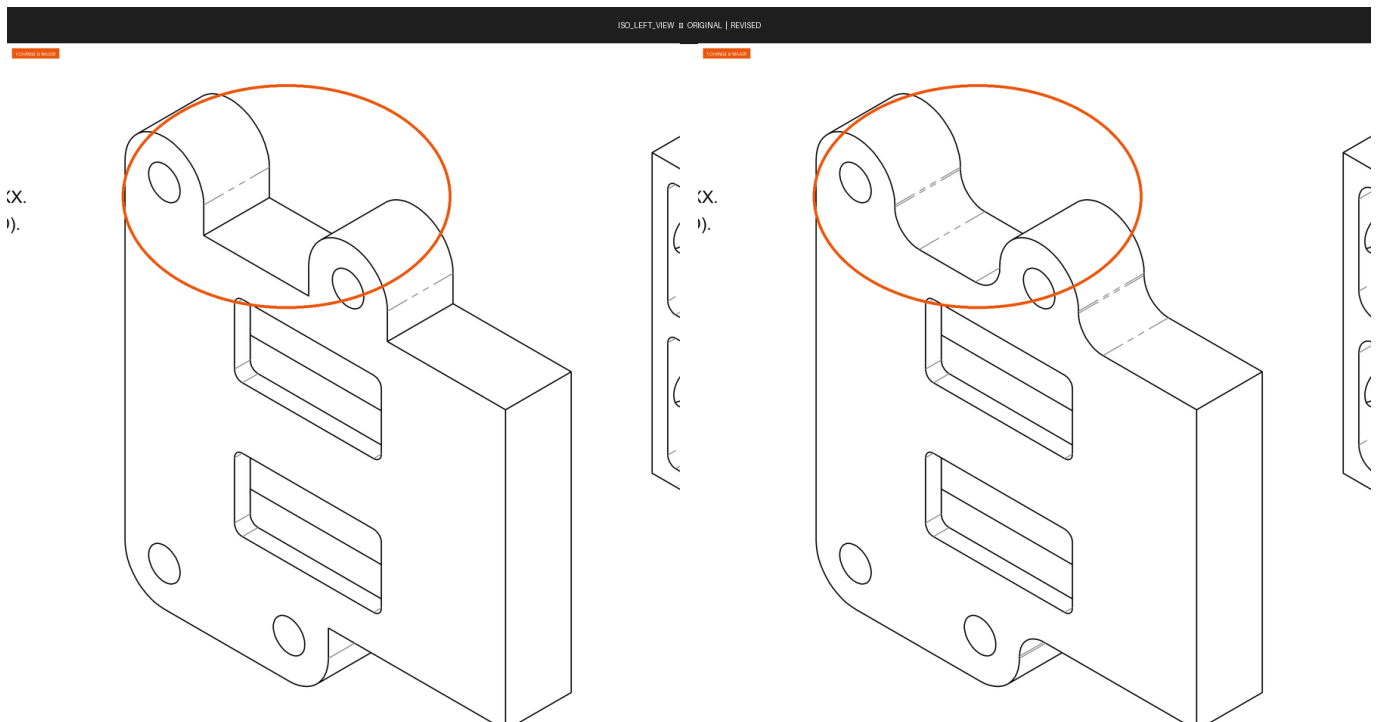


Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	A4	Hinge knuckle/ barrel shown as cylindrical tube with flat top face and sharp shoulder transition	Hinge knuckle/ barrel shown with full rounded/ filleted profile and smooth curved transition along top — no flat top face or sharp shoulder	0.82	The top hinge barrel profile changed from a flat-topped cylindrical knuckle with a distinct shoulder step to a fully rounded knuckle with a smooth continuous fillet transition, indicating a geometric/feature change that affects the physical shape of the hinge barrel and its interface with mating parts.

ISO_RIGHT_VIEW [MATCHED]

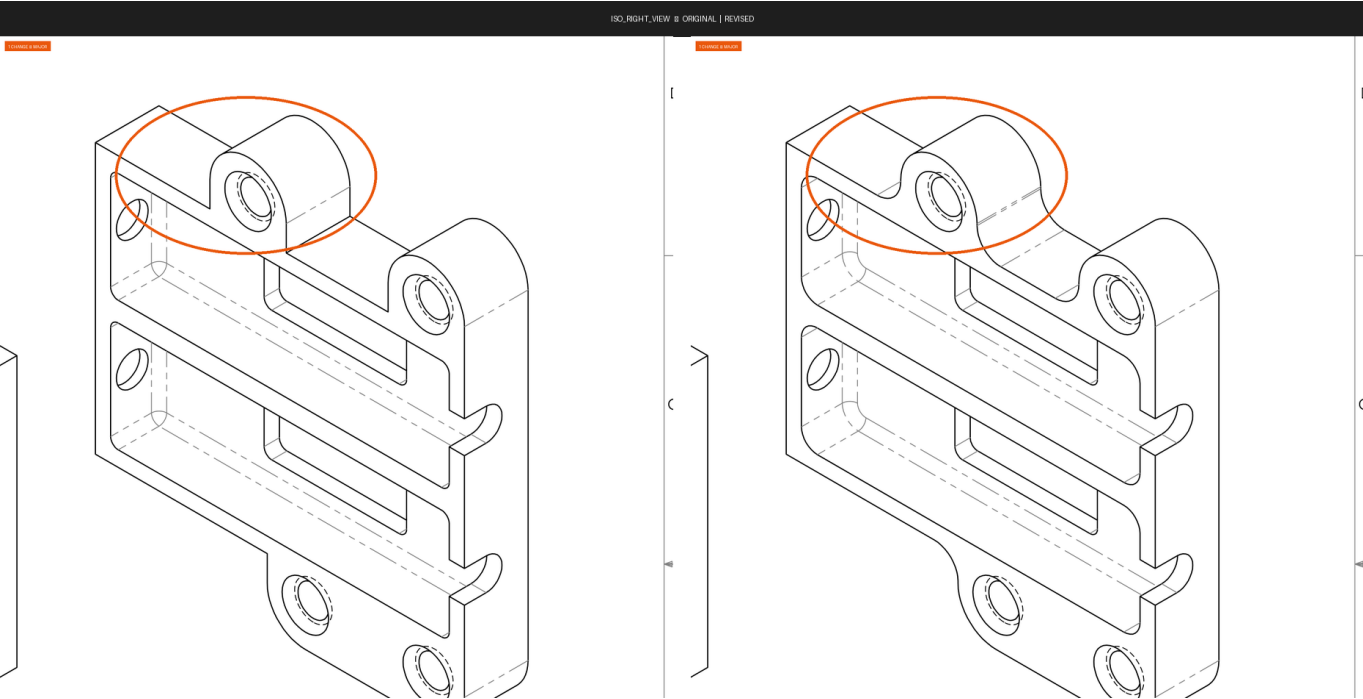


Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	A2	Top front edge of upper block has a flat/ square profile with a visible step or ledge at the top-left corner of the upper boss area	Top front edge of upper block shows a chamfer or fillet blending the top-left corner of the upper boss area into the main body — the sharp step/ ledge is replaced by a curved/ angled transition	0.72	The upper-left region of the top block shows a geometric profile change between revisions: the original has a more prominent flat ledge/step at the top front corner near the cylindrical boss, while the revised version shows a smoother chamfered or filleted blend, indicating a functional geometry modification that affects the part envelope and potentially its mating or structural behavior.

SECTION B-B [MATCHED]

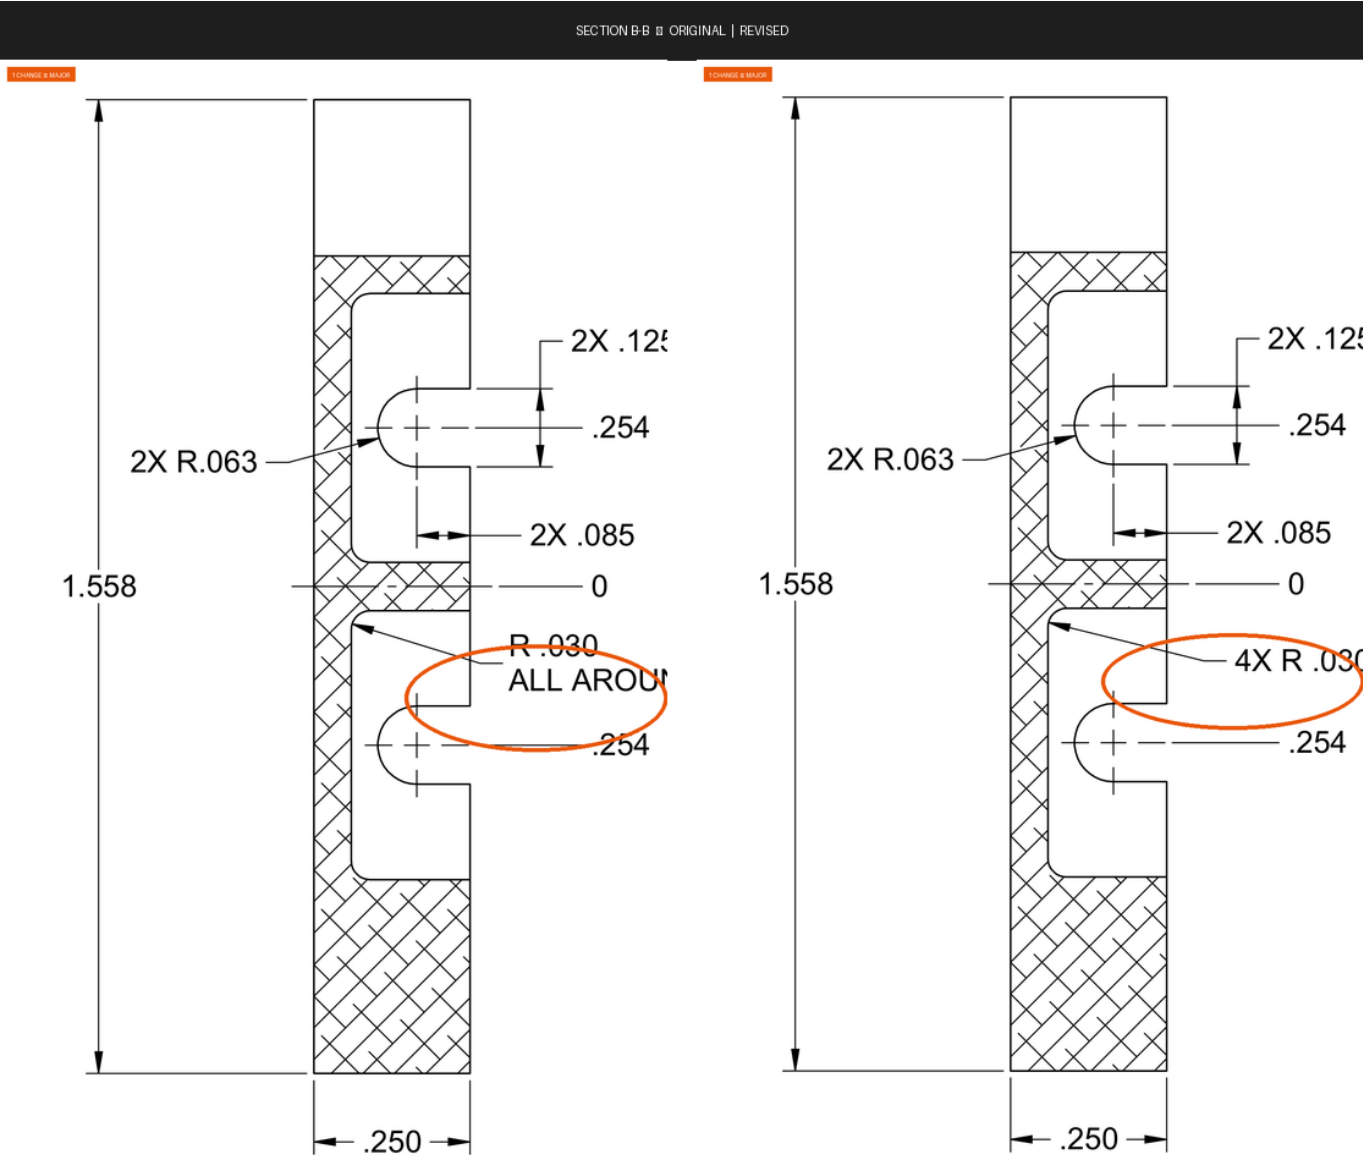


Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	callout	B7	R .030 ALL AROUND	4X R .030	0.92	The radius callout changed from 'R .030 ALL AROUND' to '4X R .030', replacing the all-around specification with an explicit count of 4 instances, which changes the scope and intent of where the radius applies.

FRONT_VIEW [MATCHED]

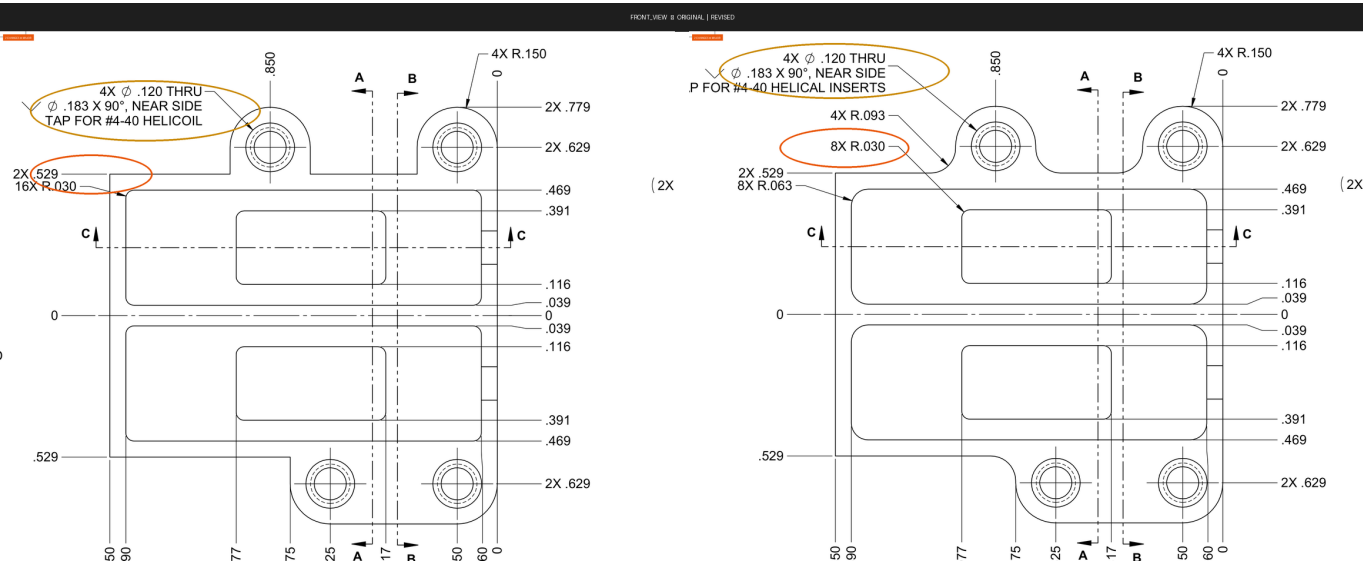


Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	dimension	A5	16X R.030	8X R.030	0.90	The quantity of R.030 radius features on the main body was reduced from 16 to 8, indicating a change in the number of corner radii of this size applied to the part.
MINOR	note	A6	TAP FOR #4-40 HELICOIL	TAP FOR #4-40 HELICAL INSERTS	0.92	The thread insert brand name 'HELICOIL' was replaced with the generic term 'HELICAL INSERTS', which is a documentation/terminology change but does not alter the functional specification.

SECTION A-A [MATCHED]

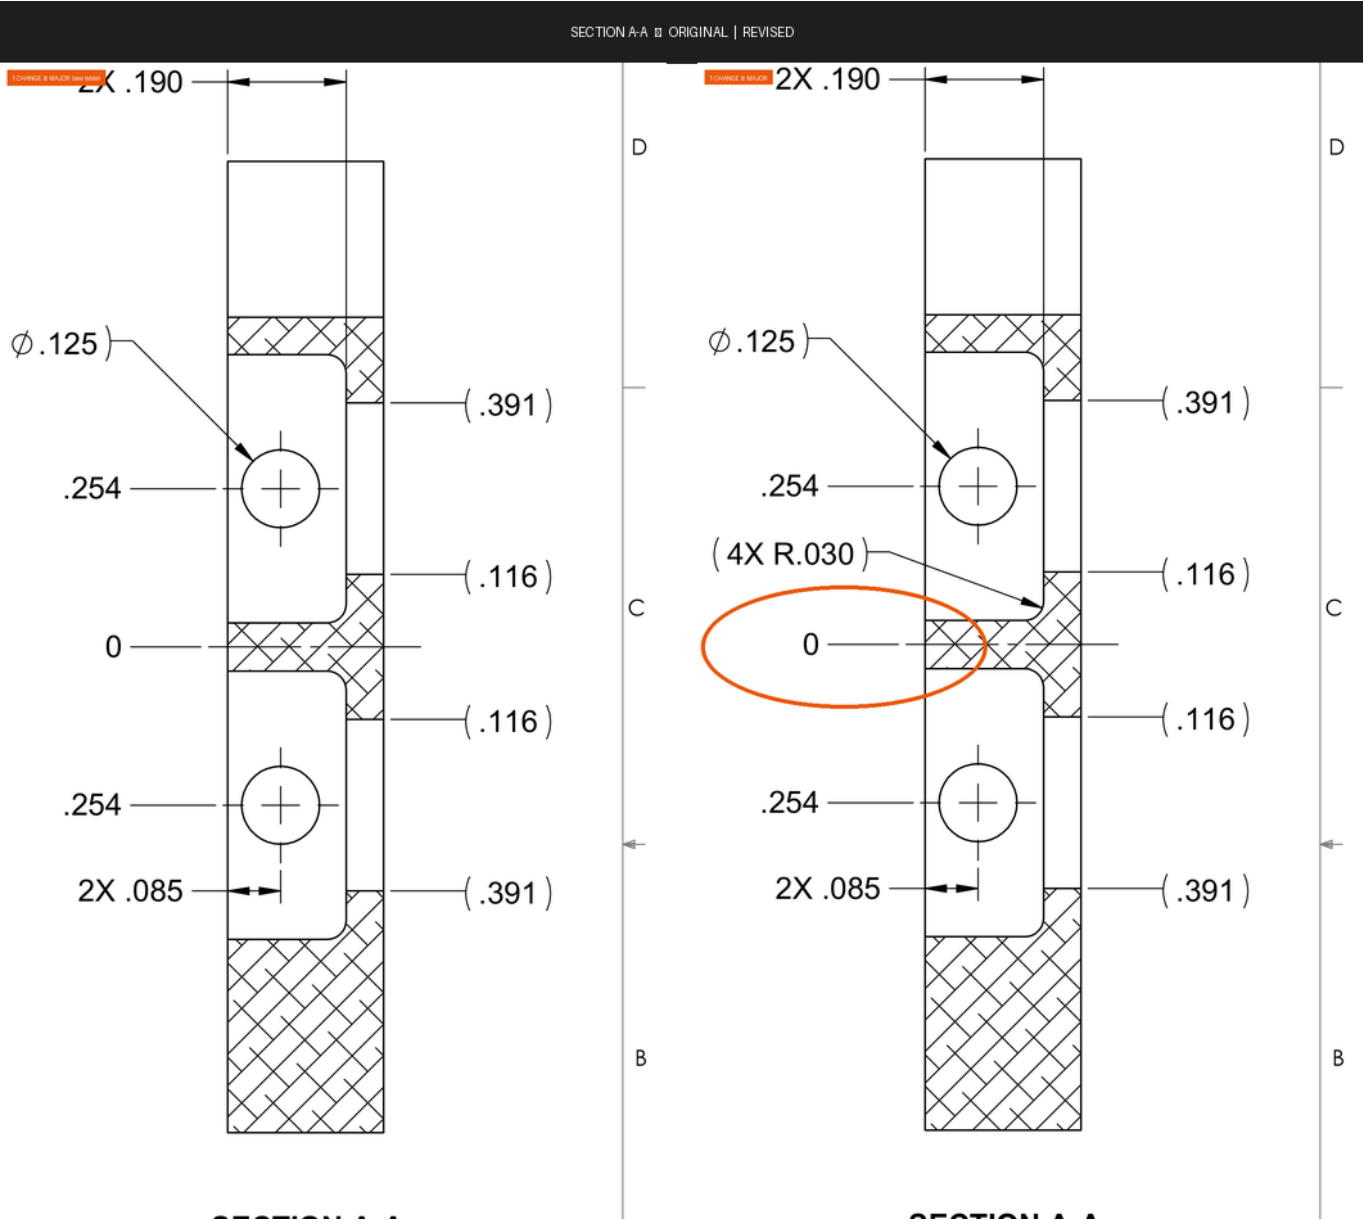

Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	annotation	B2	—	(4X R.030)	0.92	A new reference callout '(4X R.030)' has been added in the revised drawing, indicating four corner radii of 0.030 on the slot/pocket feature, which is a new manufacturing requirement not present in the original.

SECTION C-C [MATCHED]

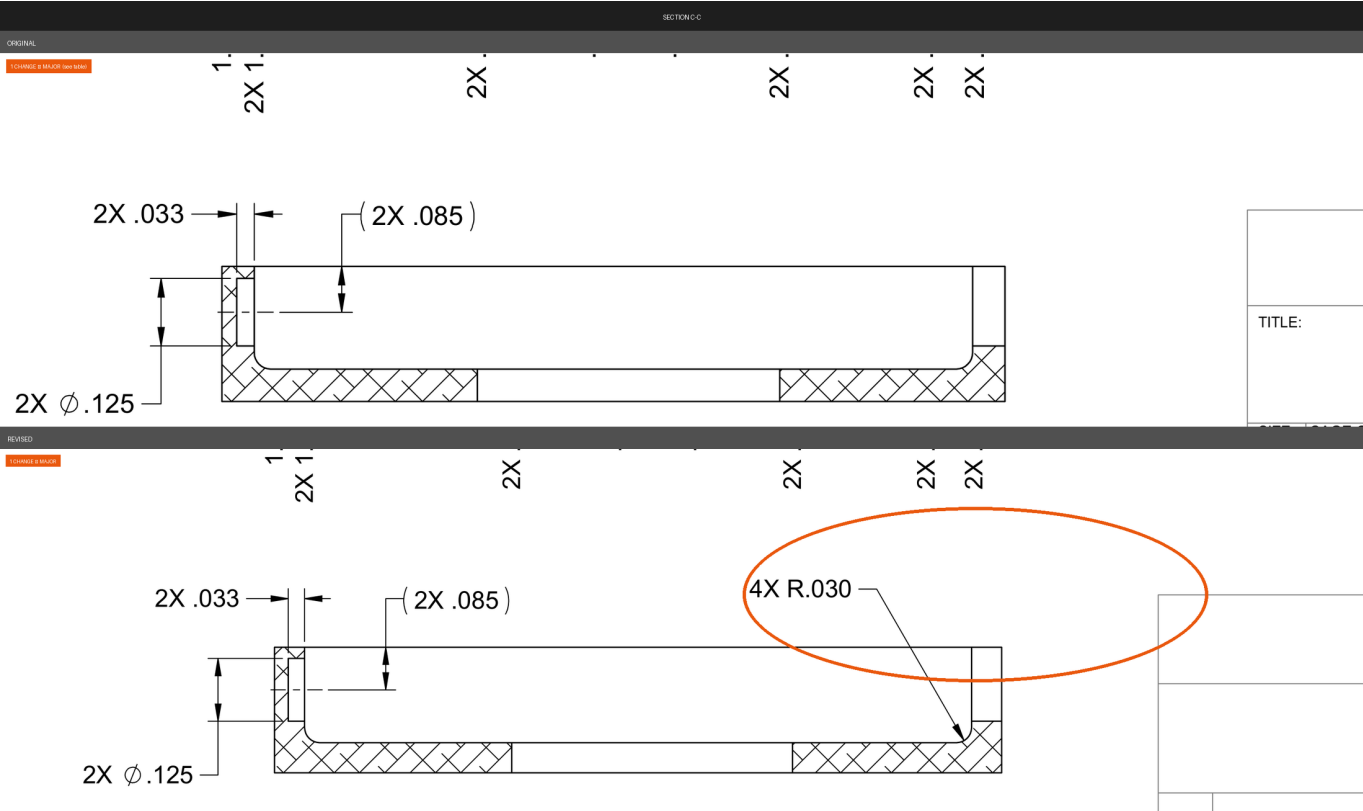

Severity	Field	Zone	Original	Revised	Conf.	Rationale
SIGNIFICANT	callout	D3	—	4X R.030	0.92	A new radius callout '4X R.030' with leader pointing to the inner corner of the channel has been added in the revised drawing, specifying four corner radii that were not previously called out, which affects machining and fit requirements.

Legend

- **CRITICAL** — Affects structural integrity, safety, interchangeability, or regulatory compliance.
 - **SIGNIFICANT** — Affects manufacturing scope, cost, or lead time. No safety risk but requires re-planning.
 - **MINOR** — Clarity, formatting, or documentation change. No manufacturing impact.
 - **UNCERTAIN** — Confidence below 0.65. Requires human review.
- ⚠ **AI-generated** — requires human verification before release to manufacturing.