

DrawDiff Comparison Report

Part number: P-001 | Job: ab7f5e43-e2c9-4333-97f0-7f3a16fe3feb | Generated: 2026-05-04T23:39:07+00:00

Summary

0 Critical	9 Significant	0 Minor	0 Uncertain	6 Views compared
---------------	------------------	------------	----------------	---------------------

Title Block

Field	Original	Revised
part_number		
revision	TS	
material		
tolerance		
drawn_by		
date		

Revision Block

Added in revised

No revision entries on revised drawing.

Removed from original


No revision entries on original drawing.

Annotated Drawings


Severity: ■ Critical ■ Significant ■ Minor ■ Uncertain

Sheet 1 — boxes mark views with detected changes.


Original

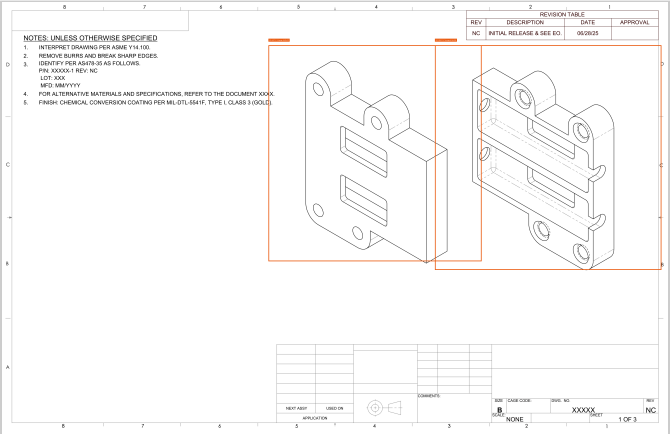


Revised

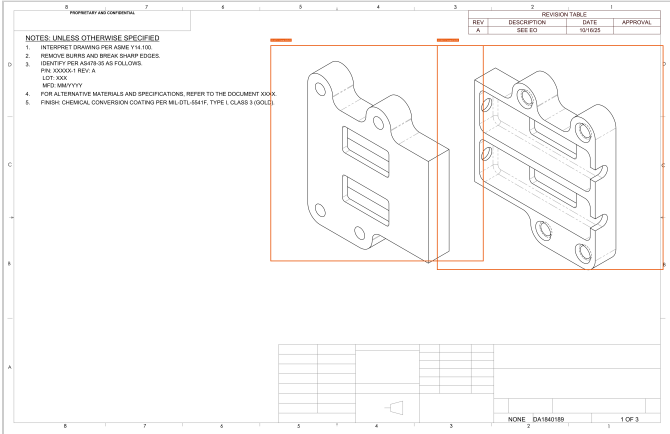

Original

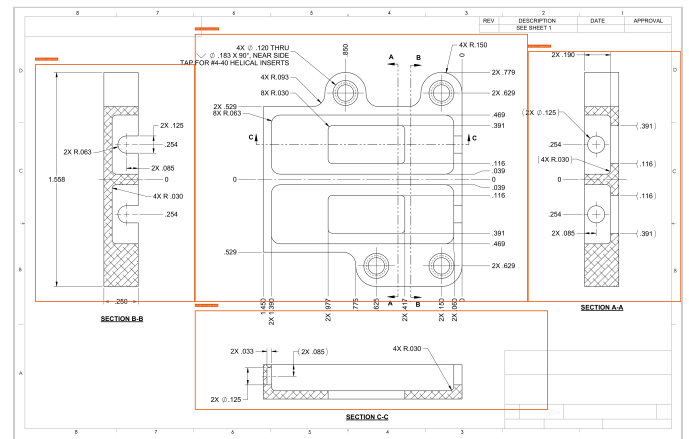[illegible]**title_block** [TITLE_BLOCK]**revision_block** [REVISION_BLOCK]


ISO_LEFT [MATCHED]

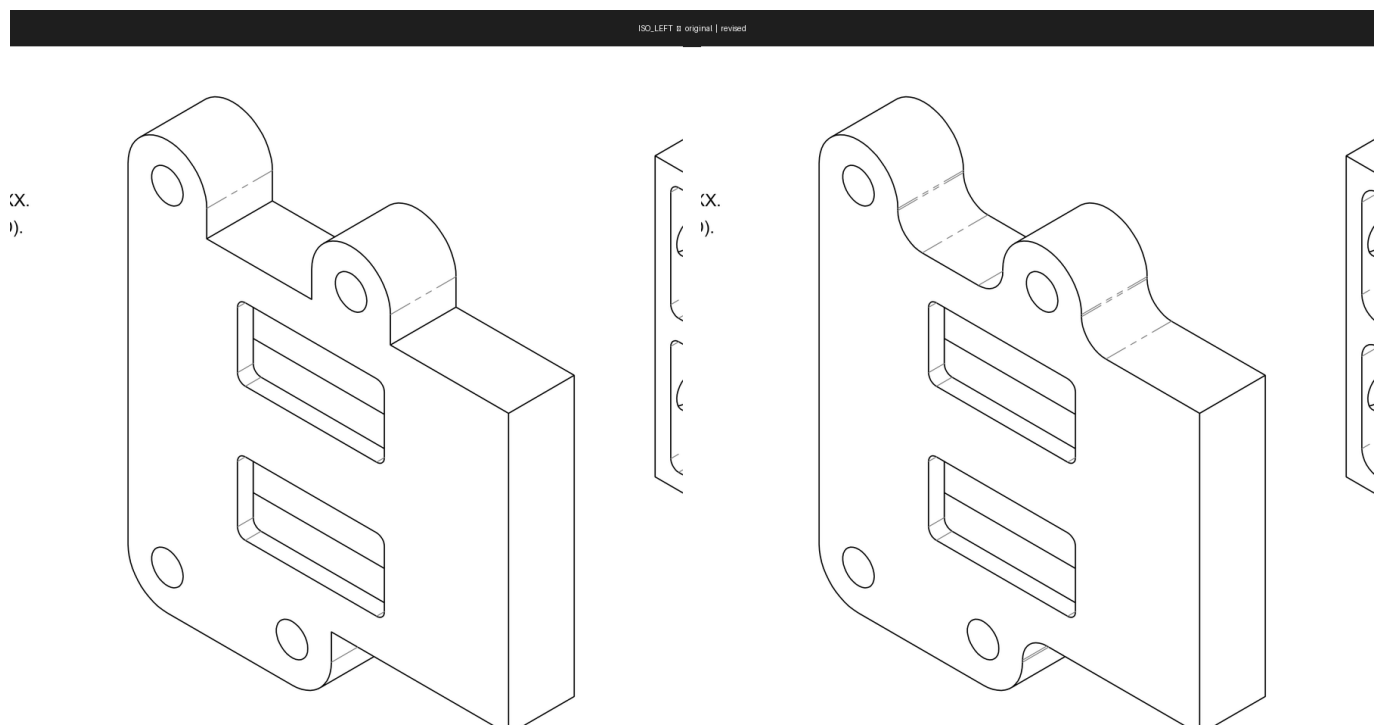

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	Upper hinge/pivot bracket has flat-topped cylindrical	Upper hinge/pivot bracket has continuous curved/filletted profile	0.82	The upper pivot boss area changed from a stepped/ square-shouldered profile to a


Severity	Field	Original	Revised	Conf.	Rationale
		boss with sharp square shoulder transition to body	transitioning smoothly from the round boss down to the body without a square shoulder step		fully blended curved fillet, which alters the stress concentration geometry and potentially the fit of mating hinge components.

ISO_RIGHT [MATCHED]

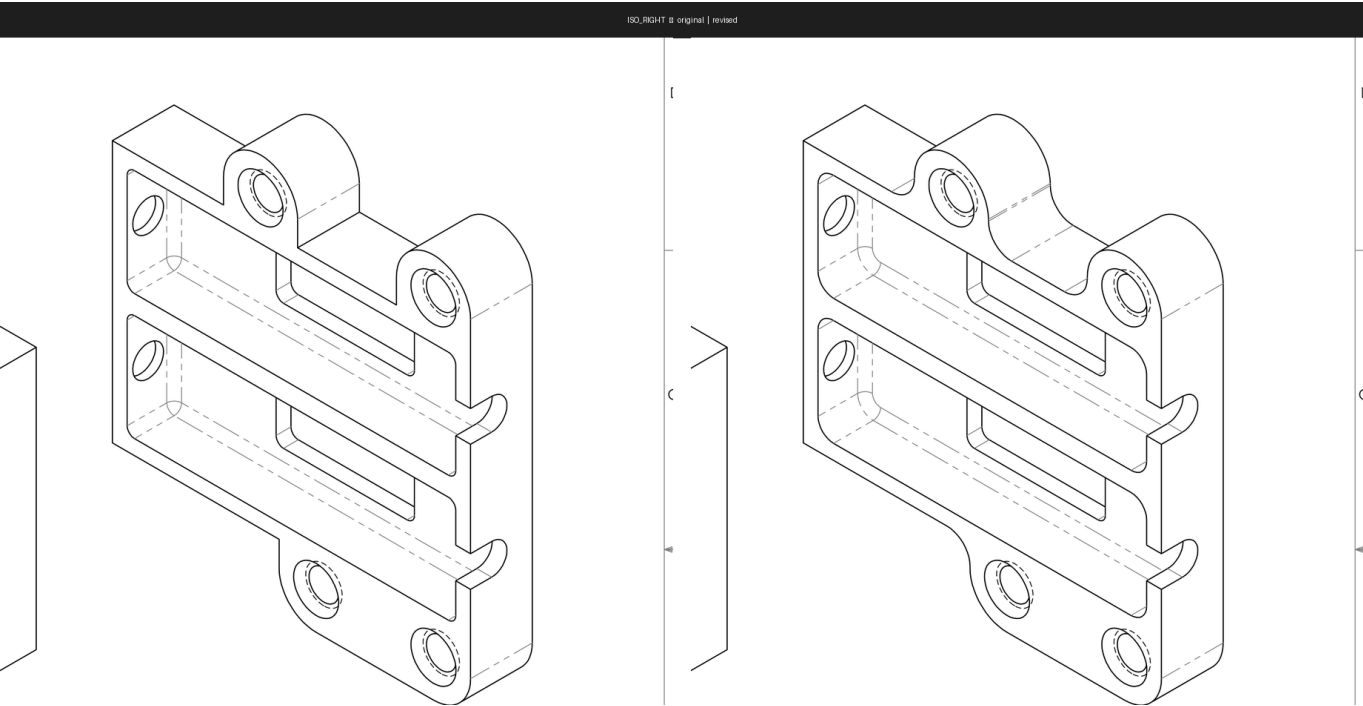


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	Sharp/square corner at upper-left front edge of top flange (no fillet visible)	Fillet/radius added at upper-left front edge of top flange	0.75	The revised view shows a visible fillet radius on the upper-left corner of the top flange area where the original had a sharp corner, indicating a geometry change that affects stress concentration and potentially fit with mating parts.

SECTION B-B [MATCHED]

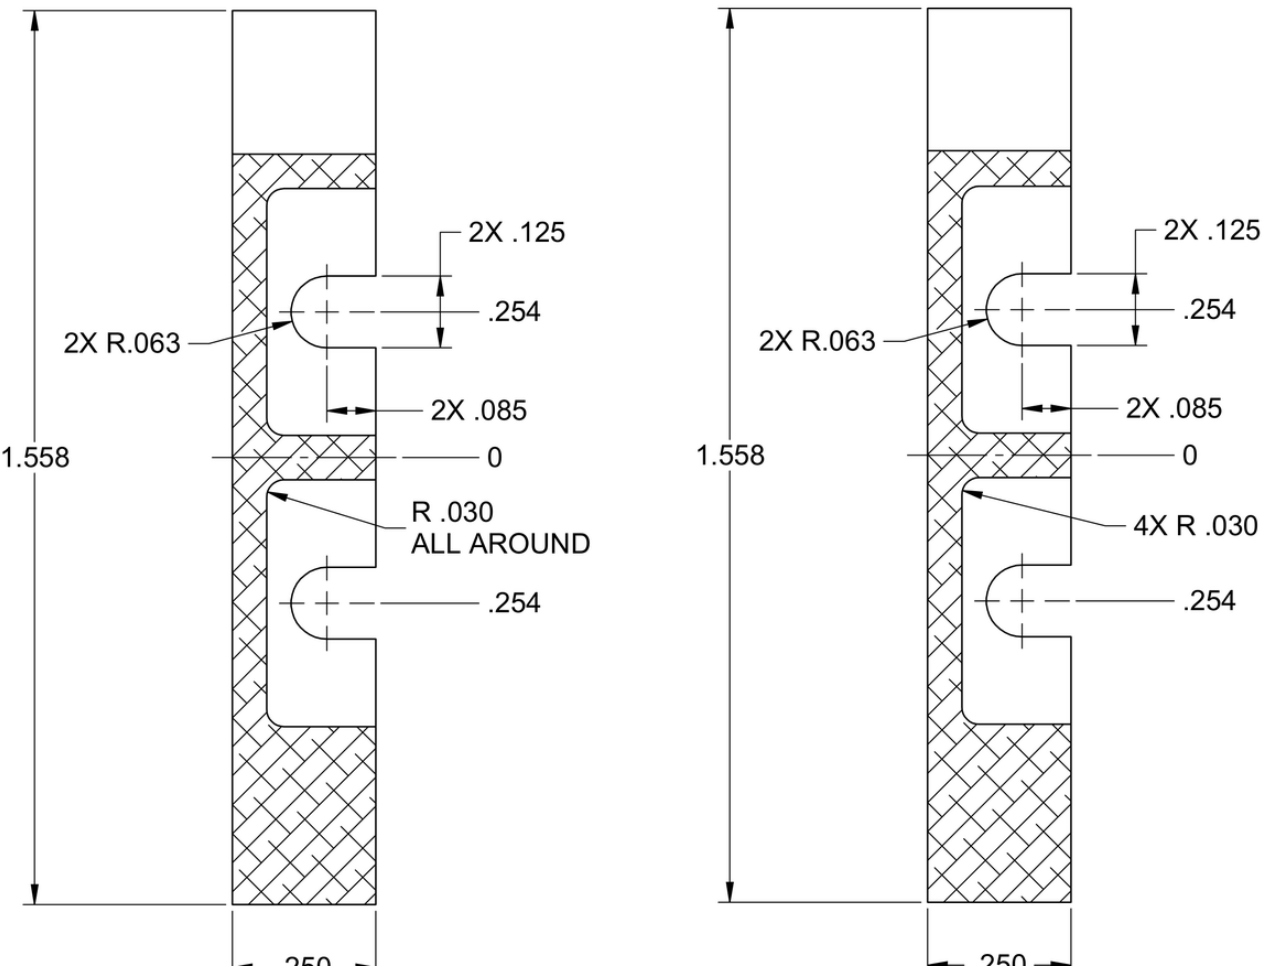


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	callout	R .030 ALL AROUND	4X R .030	0.92	The radius callout changed from 'ALL AROUND' (implying continuous application around the full profile) to '4X' (explicitly counting 4 discrete instances), which alters the manufacturing scope and inspection criteria for this fillet/radius feature.

FRONT_VIEW [MATCHED]

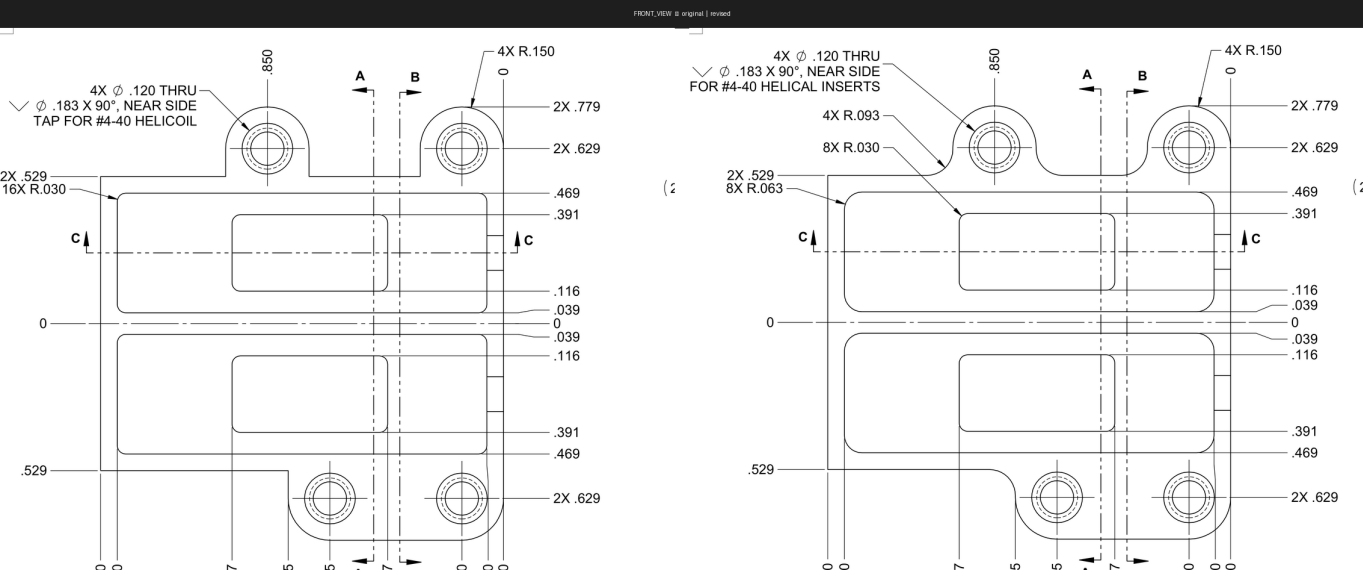


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	note	TAP FOR #4-40 HELICOIL	FOR #4-40 HELICAL INSERTS	0.92	The insert specification note was changed from 'TAP FOR #4-40 HELICOIL' to 'FOR #4-40 HELICAL INSERTS', which alters the manufacturing callout for the threaded insert installation process and brand/ type designation.
SIGNIFICANT	annotation	16X R.030	8X R.030	0.90	The quantity multiplier for the R.030 radius callout was reduced from 16X to 8X, indicating fewer instances of this radius feature are now specified on the part.
SIGNIFICANT	geometry	Upper pocket with sharp/small corner radii consistent with 16X R.030 only	Upper pocket geometry updated with additional R.093 and R.063 radii features	0.80	The pocket corner geometry in the upper half of the part appears to have changed shape, consistent with the addition of the R.093 and R.063 radius callouts replacing or supplementing some of the previously specified R.030 corners.

SECTION A-A [MATCHED]

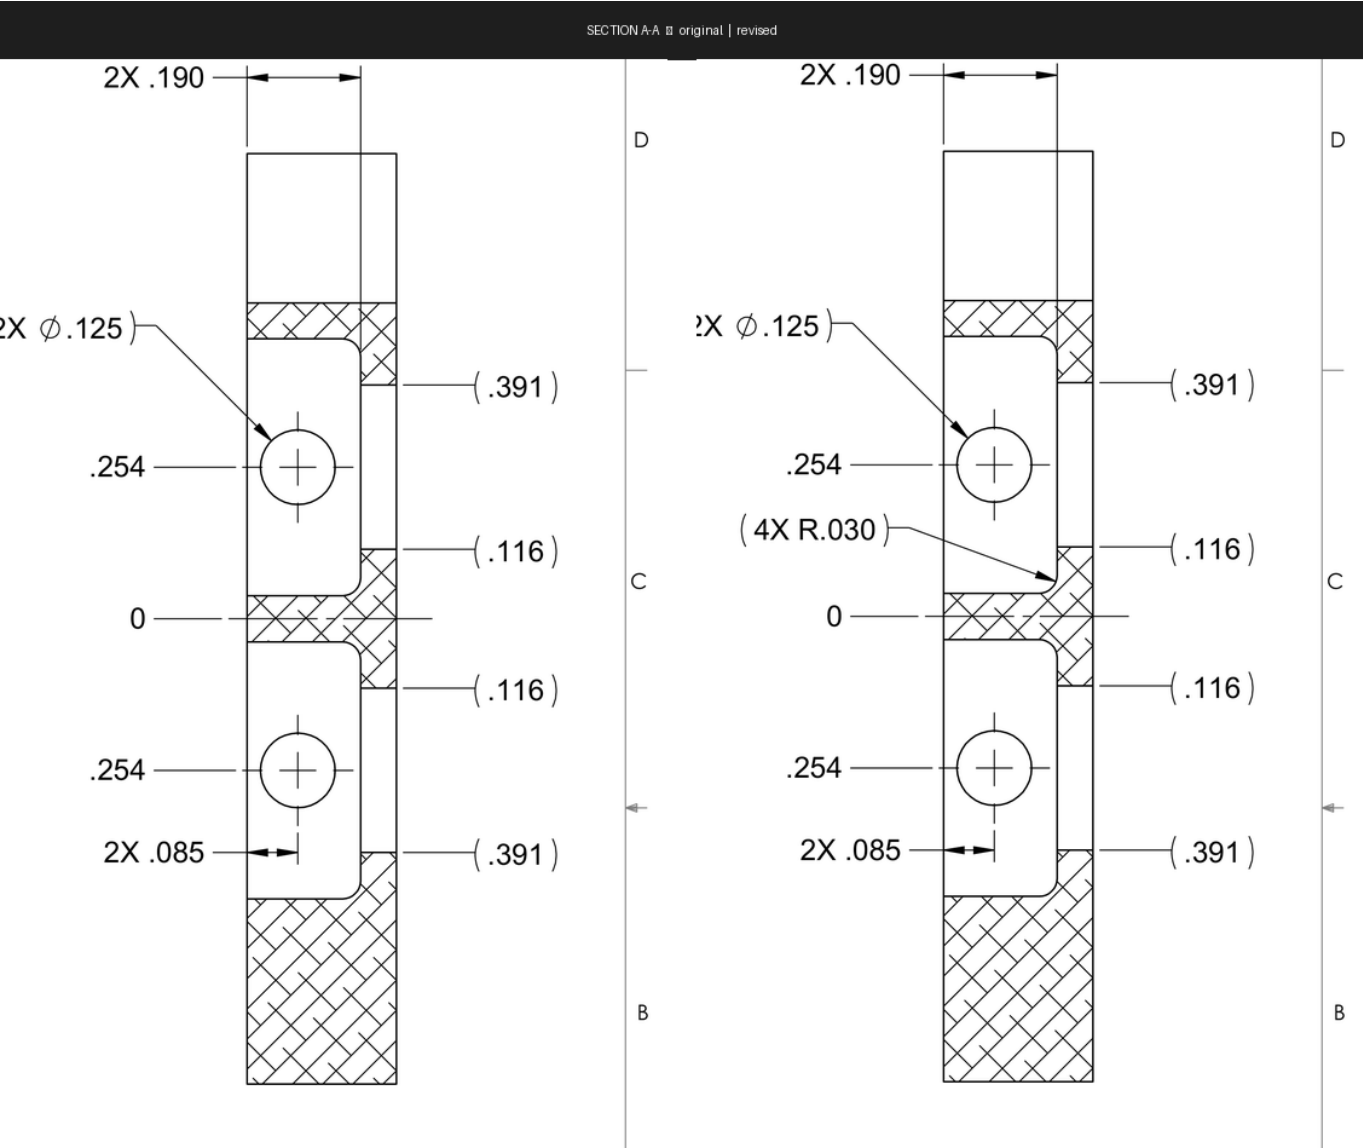

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	annotation	—	(4X R.030)	0.92	A new reference callout for 4 corner radii of R.030 has been added in the revised drawing, specifying fillet/ corner radii at the slot transitions that were not previously called out, which affects machining requirements.

SECTION C-C [MATCHED]

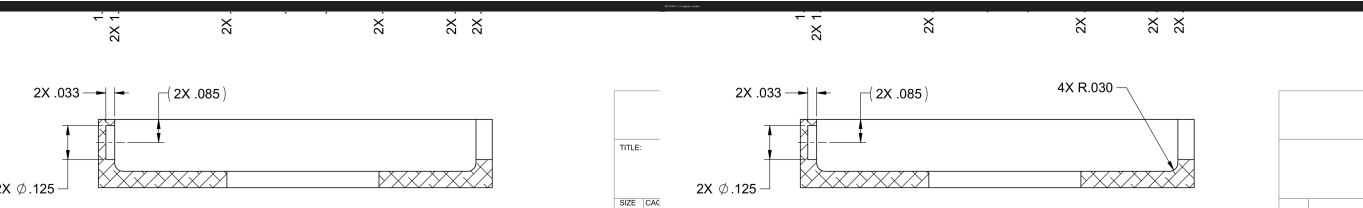

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	callout	—	4X R.030	0.92	A new radius callout '4X R.030' has been added in the revised drawing, specifying four corner radii that were not

Severity	Field	Original	Revised	Conf.	Rationale
					previously called out, which affects part geometry and manufacturing requirements.

Legend

- **CRITICAL** — Affects structural integrity, safety, interchangeability, or regulatory compliance.
 - **SIGNIFICANT** — Affects manufacturing scope, cost, or lead time. No safety risk but requires re-planning.
 - **MINOR** — Clarity, formatting, or documentation change. No manufacturing impact.
 - **UNCERTAIN** — Confidence below 0.65. Requires human review.
- ⚠ **AI-generated — requires human verification before release to manufacturing.**