

DrawDiff Comparison Report

Part number: DA1840189 | Job: 49c6f03e-9d80-4ed0-86c2-1a41475a6533 | Generated: 2026-04-30T02:39:16+00:00

verify4: bbox-overlap matching

Summary

1 Critical	18 Significant	1 Minor	0 Uncertain	6 Views compared
---------------	-------------------	------------	----------------	---------------------

Executive Summary

The most critical change to DA1840189 is the apparent removal or significant reduction of a raised rectangular boss/step feature on the upper front face of the bracket, which directly affects part geometry, fit to mating assemblies, and structural function. Supporting this scope of revision, the drawing has been substantially restructured: the SIDE view and VIEW_8 have been removed and replaced with new Section A-A and Section B-B cut views, providing improved internal detail disclosure. Several geometry changes accompany the view restructuring, including the addition of fillets at previously sharp interior pocket corners on the rear face, a modified S-curve transition at the left mounting lug, and a reduction in the count of R.030 radii callouts from 16X to 8X — all of which carry manufacturing and stress-concentration implications. Document control changes are also significant: the drawing number was formalized from placeholder 'XXXXX' to DA1840189, the revision level incremented from NC to A, and the title block revision field was cleared, requiring reconciliation before release.

Title Block

Field	Original	Revised
part_number		
revision	TS	
material		
tolerance		
drawn_by		
date		

Revision Block

Added in revised

No revision entries on revised drawing.


Removed from original

No revision entries on original drawing.


Annotated Drawings

Severity: Critical Significant Minor Uncertain


Original

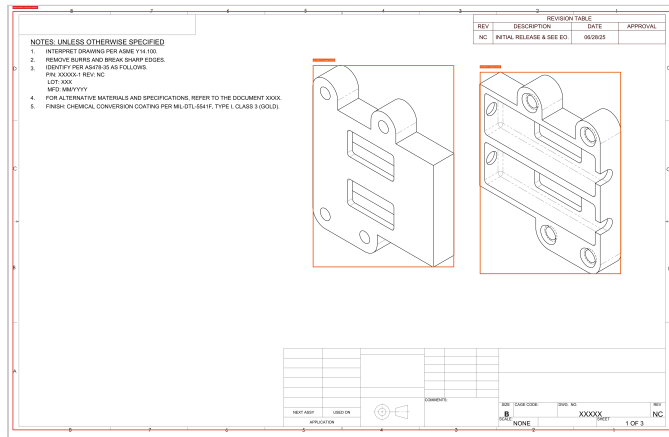


Revised

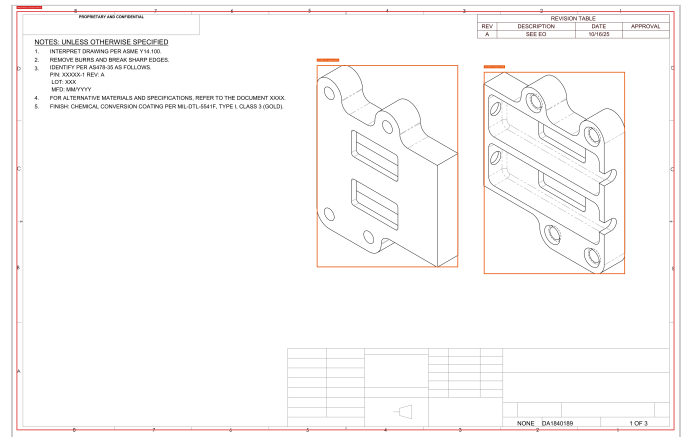

Original

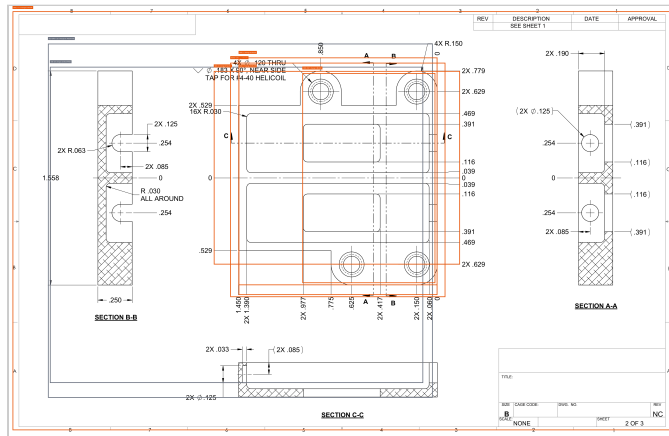

Revised

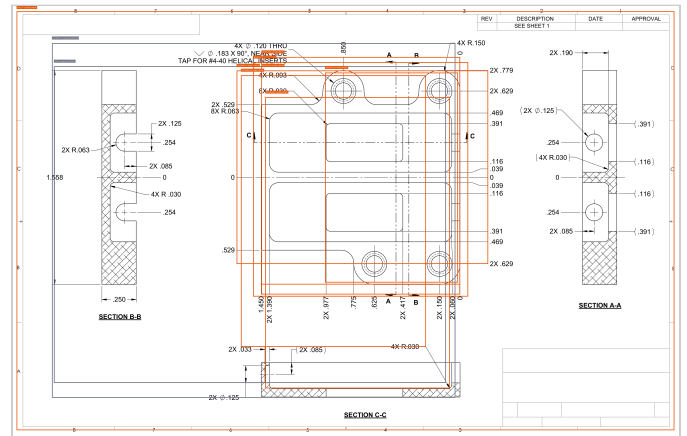

View-by-view Changes


title_block [TITLE_BLOCK]

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	revision	TS	—	1.00	title_block.revision changed from 'TS' to None Impact: Revision field in the title block has been cleared (was 'TS'); document control must confirm the correct revision state before this drawing is released or used for fabrication.

revision_block [REVISION_BLOCK]

No textual changes recorded for this view.


ANNOTATION [MATCHED]

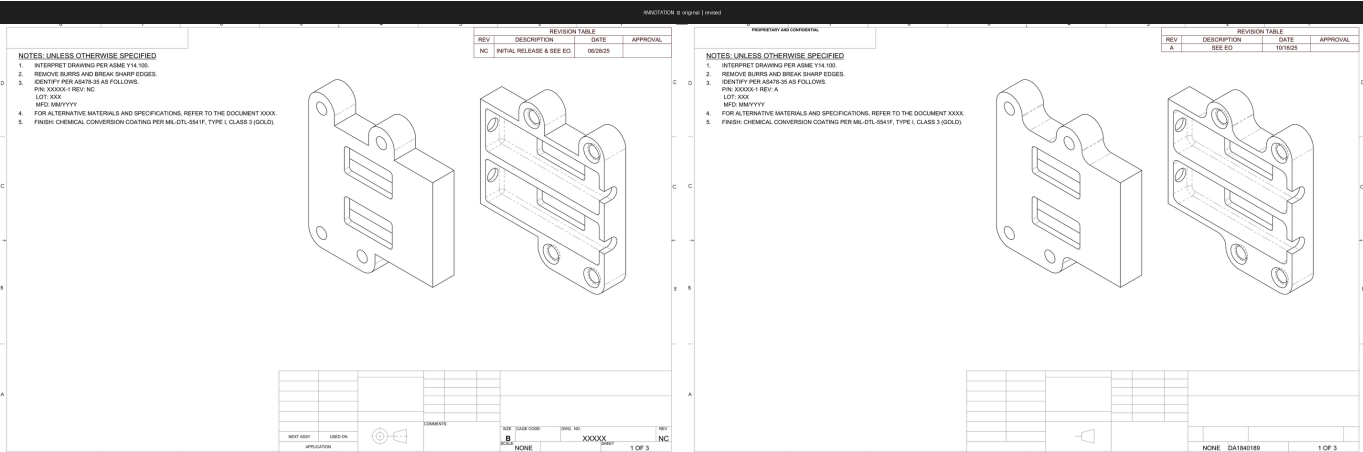

Severity	Field	Original	Revised	Conf.	Rationale
CRITICAL	geometry	Top-left isometric view shows a raised rectangular boss/step feature on the upper portion of the front face of the bracket	Same view shows the raised boss/step feature appears removed or significantly reduced, leaving a more uniform top surface	0.72	The front isometric view appears to show a geometric change on the upper bracket face where a protruding stepped feature visible in the original is not clearly present in the revised view, which could affect fit and function. Impact: Potential removal of a structural boss on the upper front face would alter fit to any mating part that locates against or around that feature — reviewer must verify against assembly interface requirements.
SIGNIFICANT	annotation	REV: NC	REV: A	0.95	The drawing revision level in Note 3 (P/N identification block) changed from NC to A, indicating a formal revision increment that affects part traceability. Impact: Formal revision increment from NC to A affects part traceability and configuration management; all associated BOMs and procurement records must be updated to reference Rev A.
SIGNIFICANT	other	DWG. NO.: XXXXX, SIZE B, SCALE NONE, SHEET 1 OF 3, with NEXT ASSY / USED ON /	DWG. NO.: DA1840189, SCALE NONE, SHEET 1 OF 3; title block reformatted with fewer	0.85	The drawing number changed from placeholder 'XXXXX' to an actual part number 'DA1840189', and the title block layout was

Severity	Field	Original	Revised	Conf.	Rationale
		APPLICATION blocks and projection symbol visible	visible fields and no NEXT ASSY/USED ON/APPLICATION labels		updated, which is significant for document control and part identification. Impact: Placeholder drawing number replaced with actual part number DA1840189; removal of NEXT ASSY/USED ON fields reduces traceability visibility in the title block and should be confirmed as intentional per document control policy.


ISO_FRONT [MATCHED]

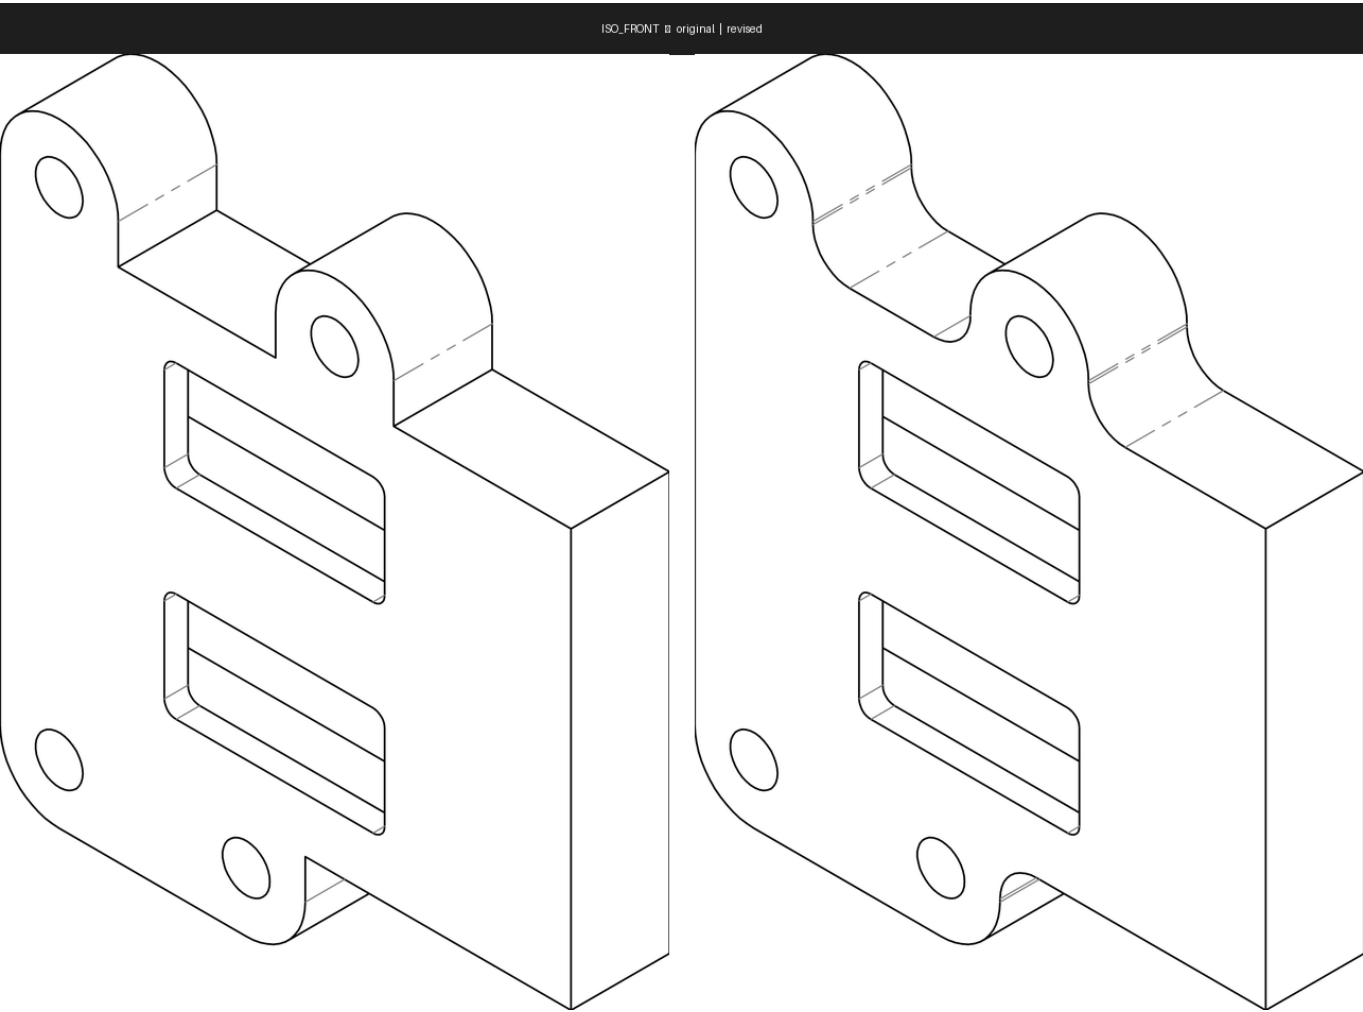

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	Left mounting boss/tab has a straight/angular transition from the rolled cylindrical lug to the flat face	Left mounting boss/tab has a larger, more pronounced curved (S-shaped) transition from the rolled cylindrical lug to the flat face	0.78	The left lug/boss area shows a changed fillet or curved transition geometry between the rolled cylindrical feature and the main body, which affects the structural form and potentially the stress distribution of the bracket.

Severity	Field	Original	Revised	Conf.	Rationale
					Impact: Changed lug-to-body transition geometry affects stress distribution at the mounting boss and may require updated FEA or stress review; toolpath programming for this feature will also need revision.

ISO_REAR [MATCHED]

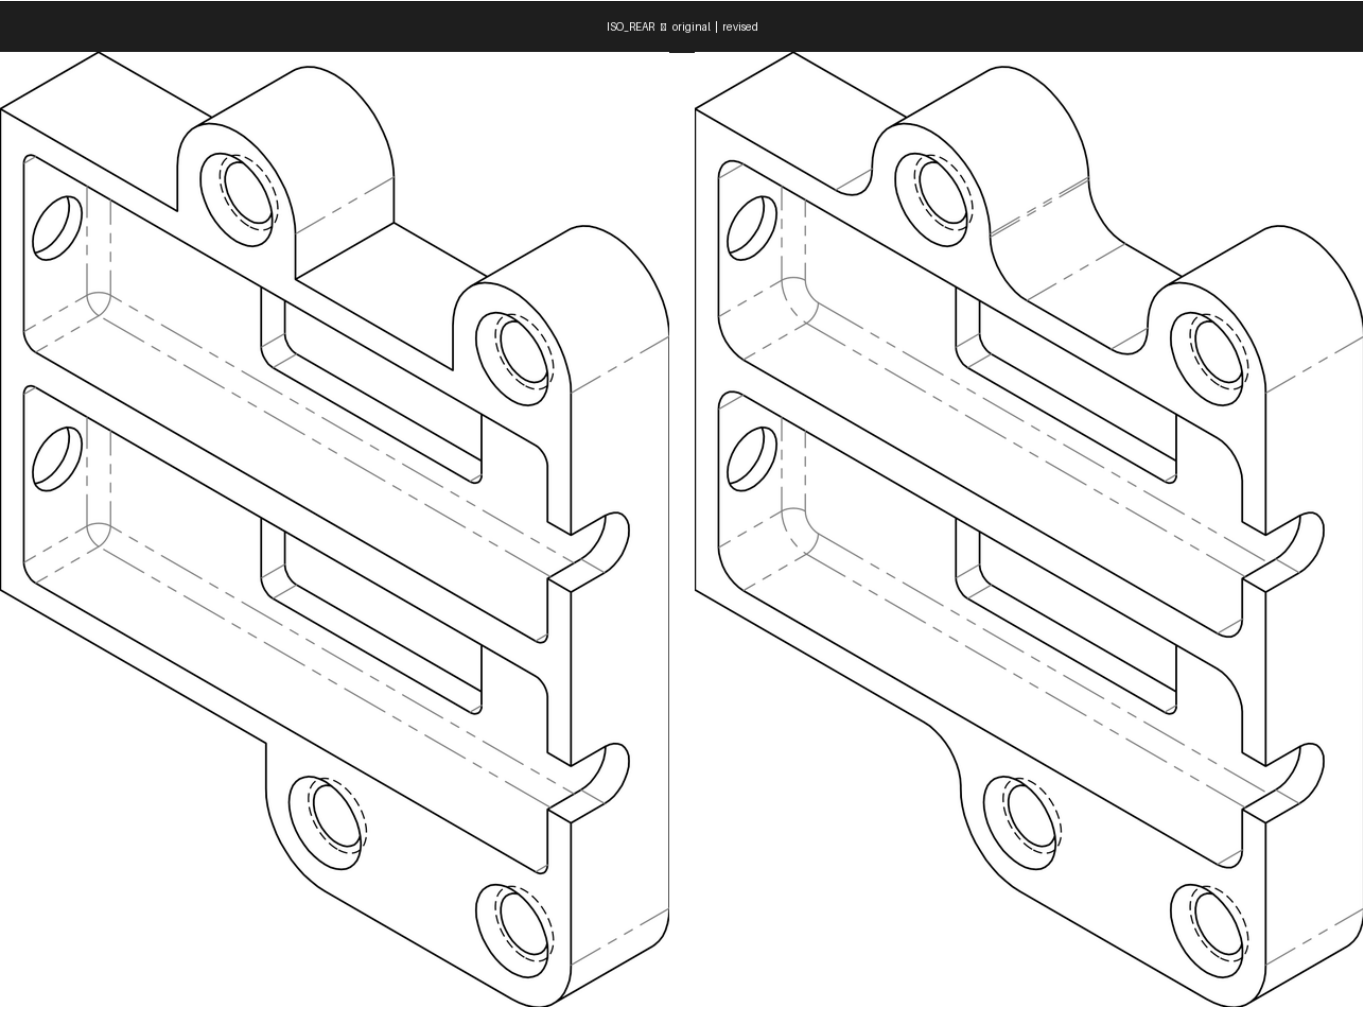


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	Sharp interior corners at left-side vertical edges of upper and lower slot/pocket openings (left face)	Filleted/radiused interior corners at left-side vertical edges of upper and lower slot/pocket openings (left face)	0.75	The revised view shows rounded/filleted transitions at the interior corners of the left-face pocket openings where the original shows sharp corners, indicating a geometry change that affects stress concentration and potentially machining requirements. Impact: Addition of fillets at previously sharp interior pocket corners reduces stress concentration and improves fatigue life, but requires updated machining operations (e.g., radius end mill pass) and inspection criteria.

[illegible]


DrawDiff — AI-generated. Requires human verification. | Page 6 of 15

SIDE [MATCHED]

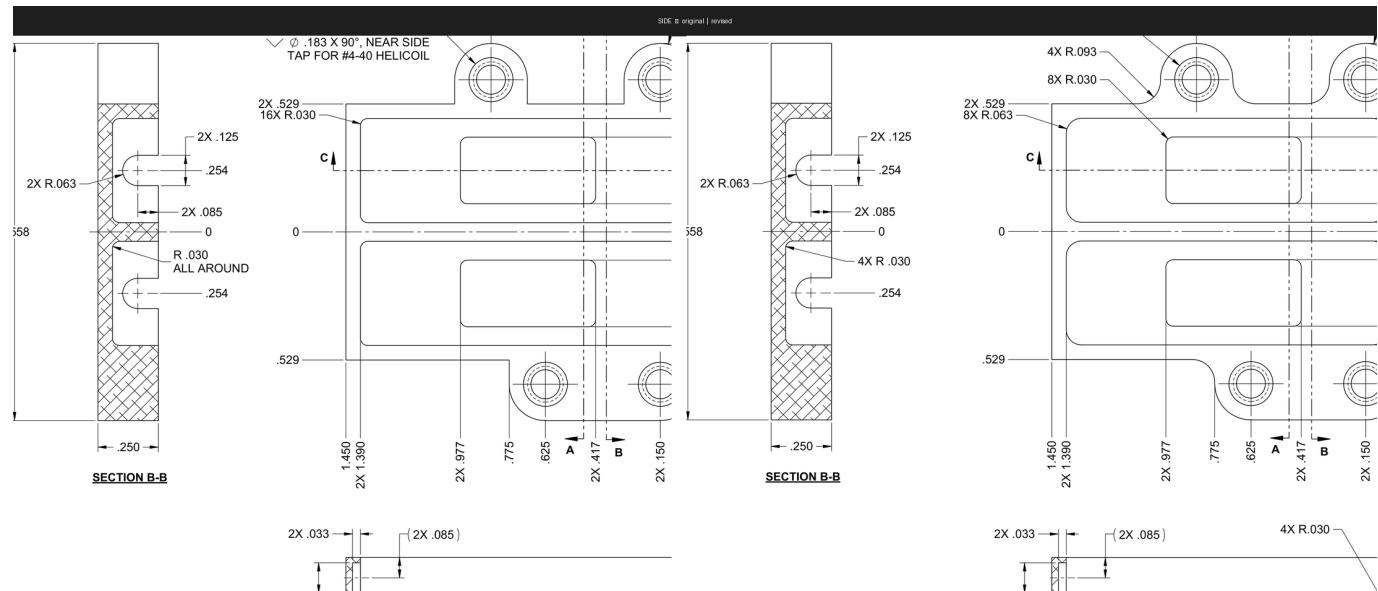


No textual changes recorded for this view.

SIDE [REMOVED]

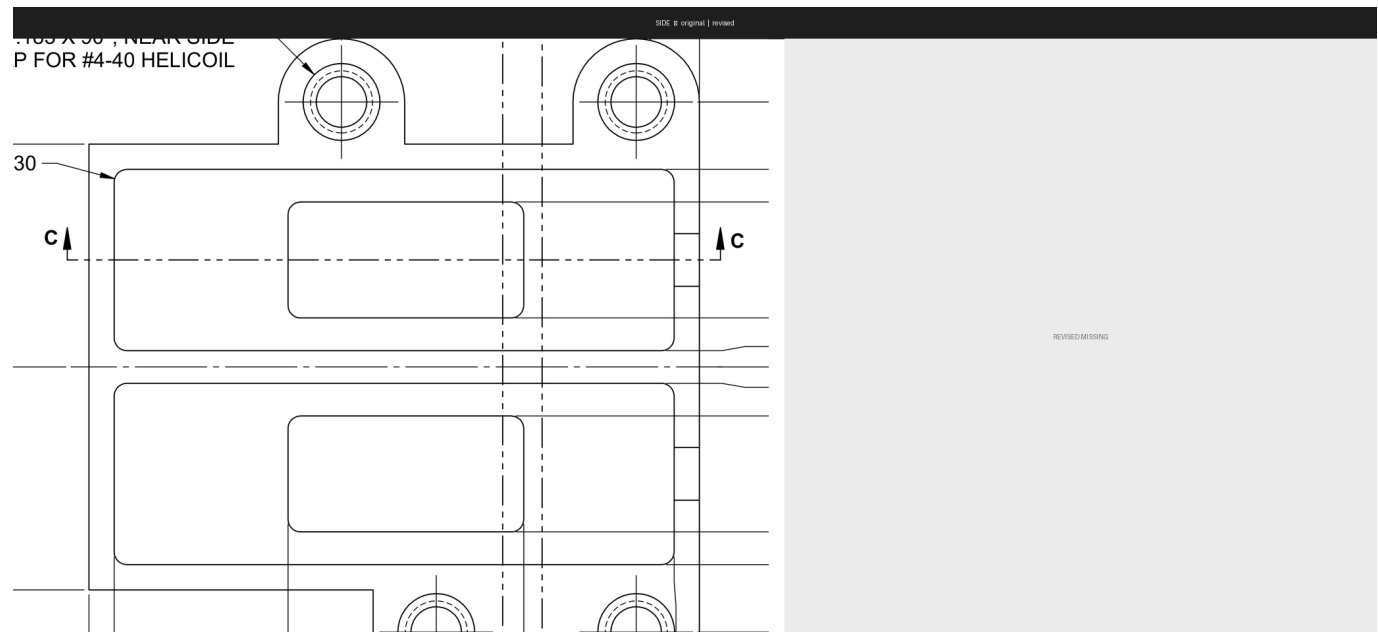


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	SIDE	—	1.00	View 'SIDE' was present in the original but not the revised drawing. Impact: Removal of the SIDE view reduces orthographic coverage; reviewer should confirm that the new section views (A-A, B-B) fully replace the dimensional and geometric information previously conveyed by this view.

SIDE [REMOVED]

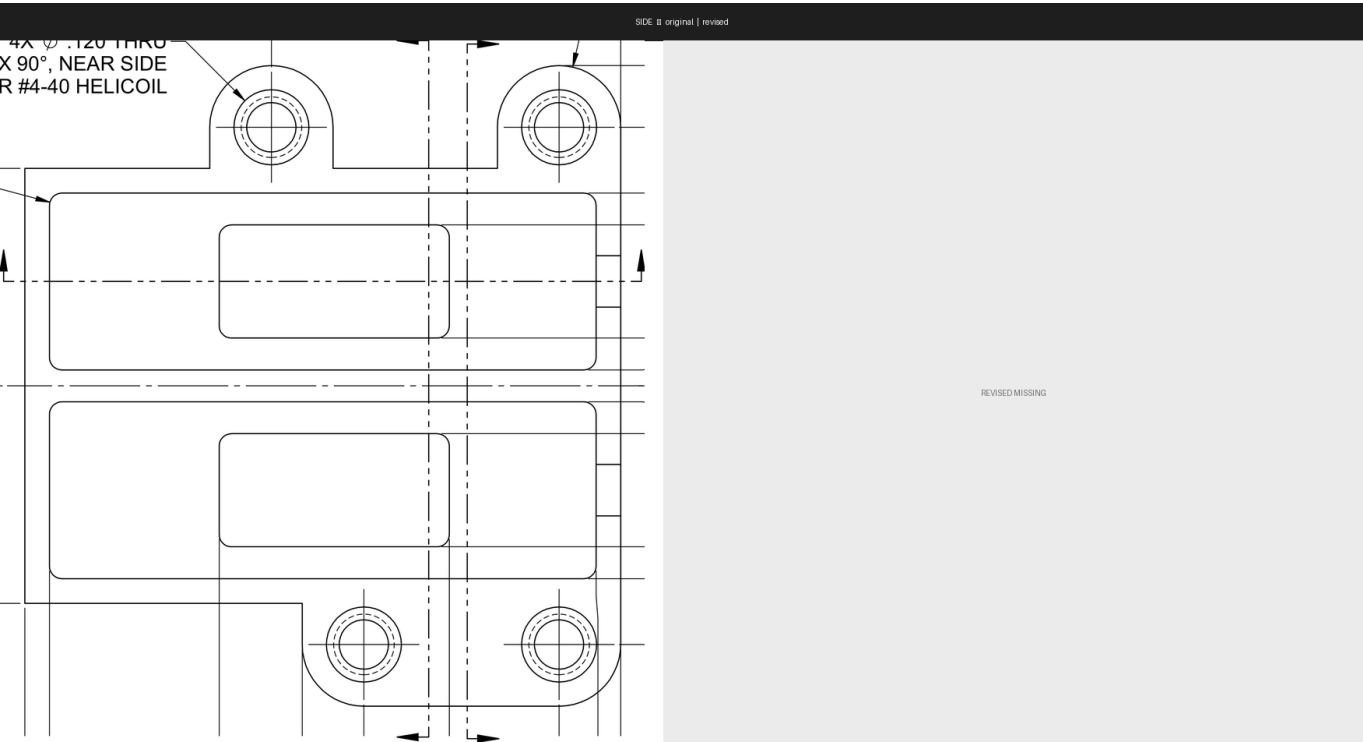


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	SIDE	—	1.00	View 'SIDE' was present in the original but not the revised drawing. Impact: Removal of the SIDE view reduces orthographic coverage; reviewer should confirm that the new section views (A-A, B-B) fully replace the dimensional and geometric information previously conveyed by this view.

SIDE [REMOVED]

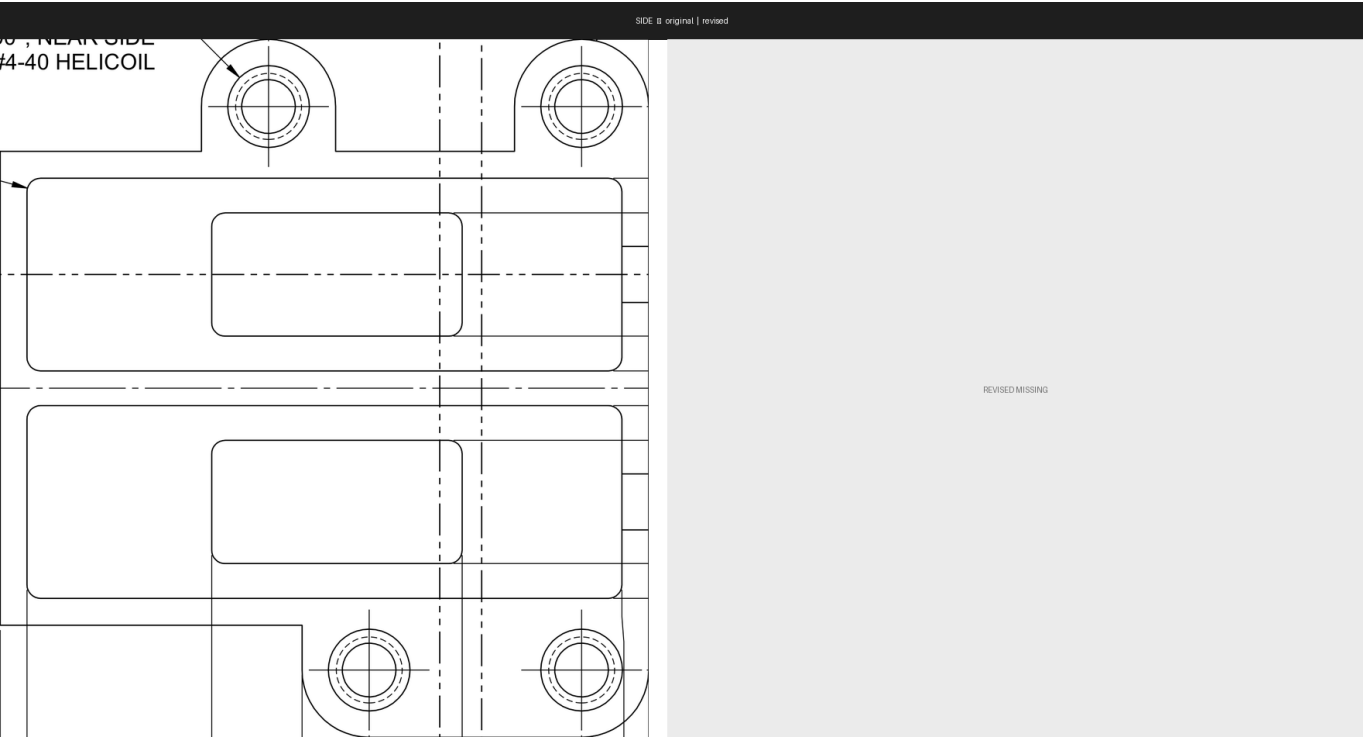


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	SIDE	—	1.00	View 'SIDE' was present in the original but not the revised drawing. Impact: Removal of the SIDE view reduces orthographic coverage; reviewer should confirm that the new section views (A-A, B-B) fully replace the dimensional and geometric information previously conveyed by this view.

SIDE [REMOVED]

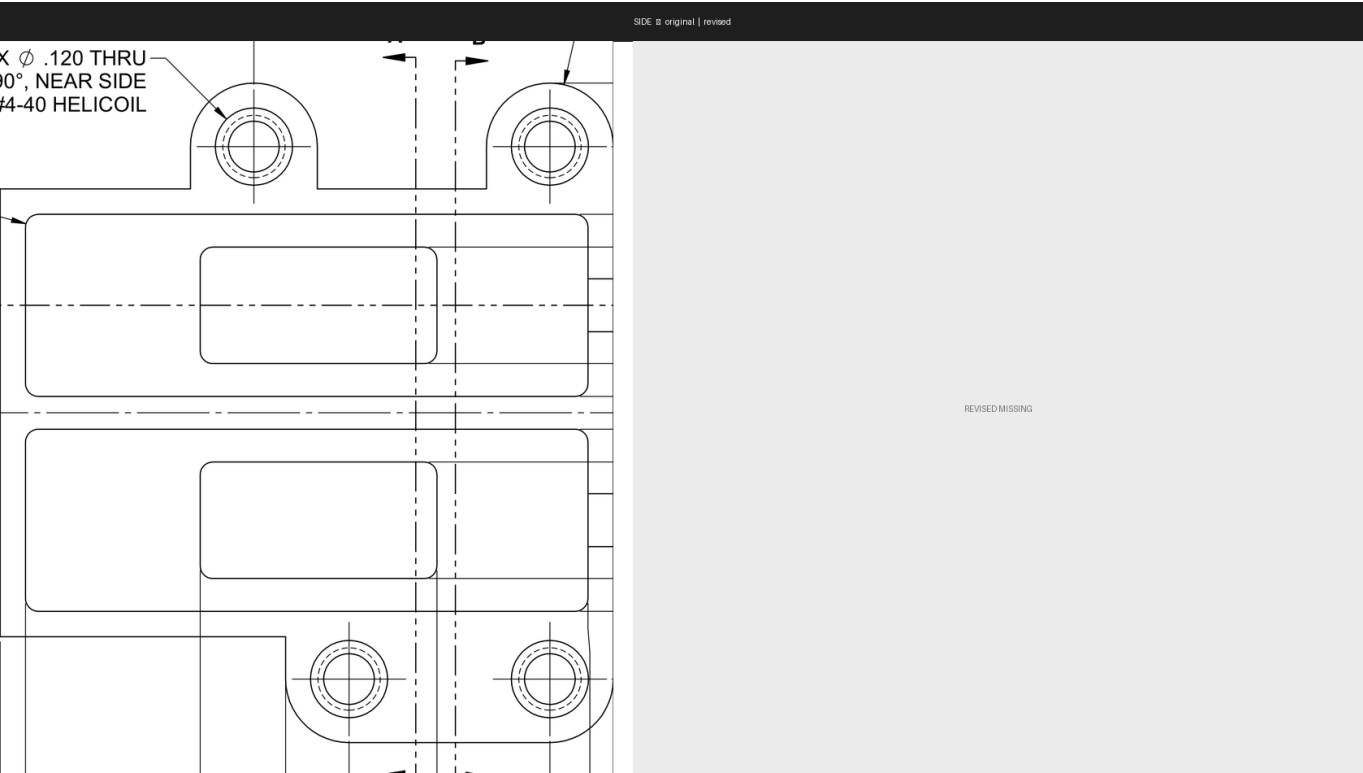


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	SIDE	—	1.00	View 'SIDE' was present in the original but not the revised drawing. Impact: Removal of the SIDE view reduces orthographic coverage; reviewer should confirm that the new section views (A-A, B-B) fully replace the dimensional and geometric information previously conveyed by this view.

VIEW_8 [REMOVED]

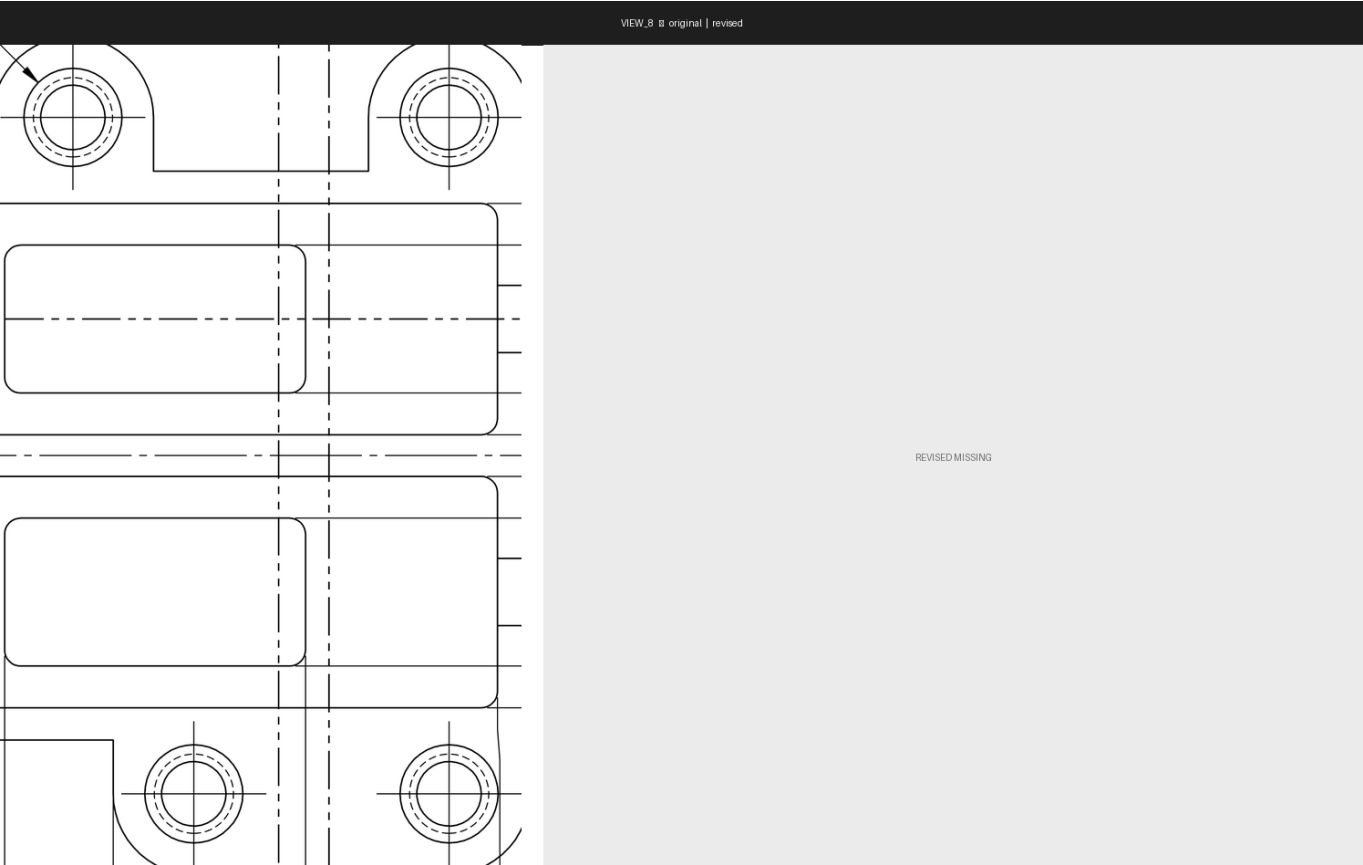


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	VIEW_8	—	1.00	View 'VIEW_8' was present in the original but not the revised drawing. Impact: VIEW_8 has been removed from the revised drawing; any dimensions or callouts unique to that view must be verified as captured elsewhere in the revised drawing set.

SECTION A-A [ADDED]

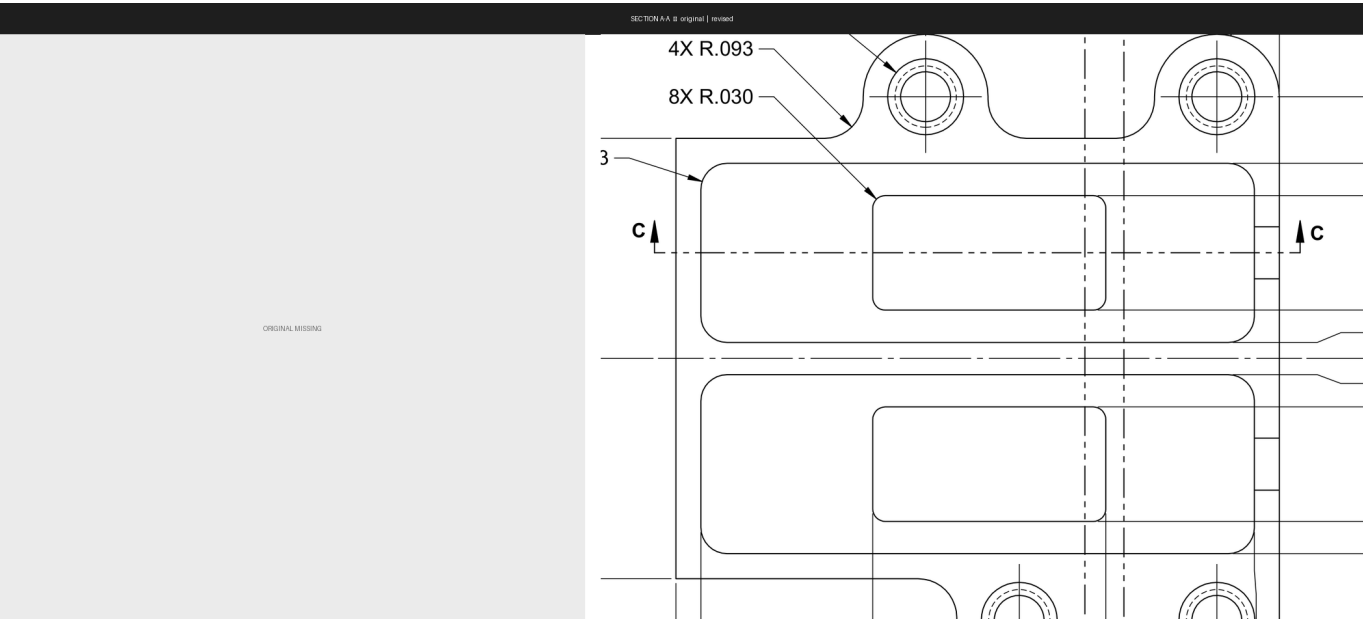


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	—	SECTION A-A	1.00	View 'SECTION A-A' appears only in the revised drawing. Impact: New Section A-A added to the revised drawing, providing cross-sectional detail not previously shown; manufacturing and inspection must incorporate this view's dimensions and tolerances into their processes.

SECTION A-A [ADDED]

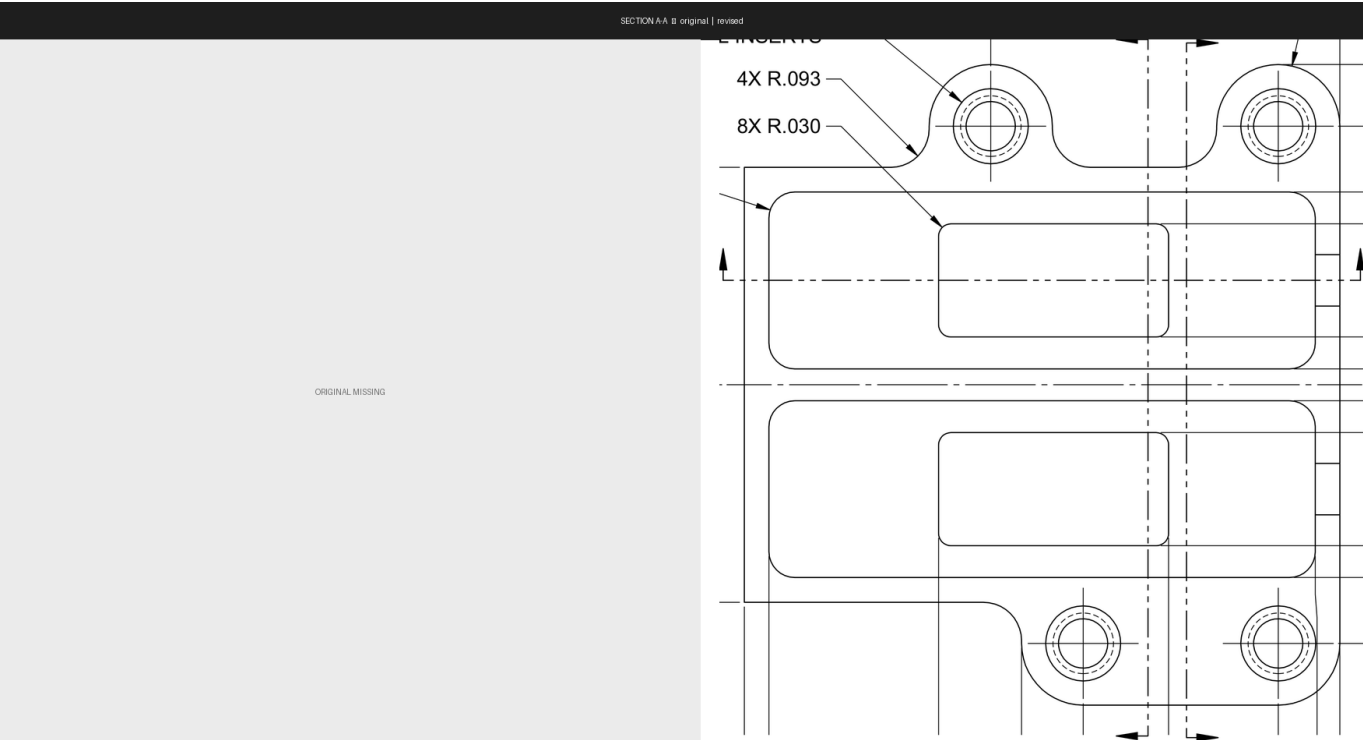


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	—	SECTION A-A	1.00	View 'SECTION A-A' appears only in the revised drawing. Impact: New Section A-A added to the revised drawing, providing cross-sectional detail not previously shown; manufacturing and inspection must incorporate this view's dimensions and tolerances into their processes.

SECTION A-A [ADDED]

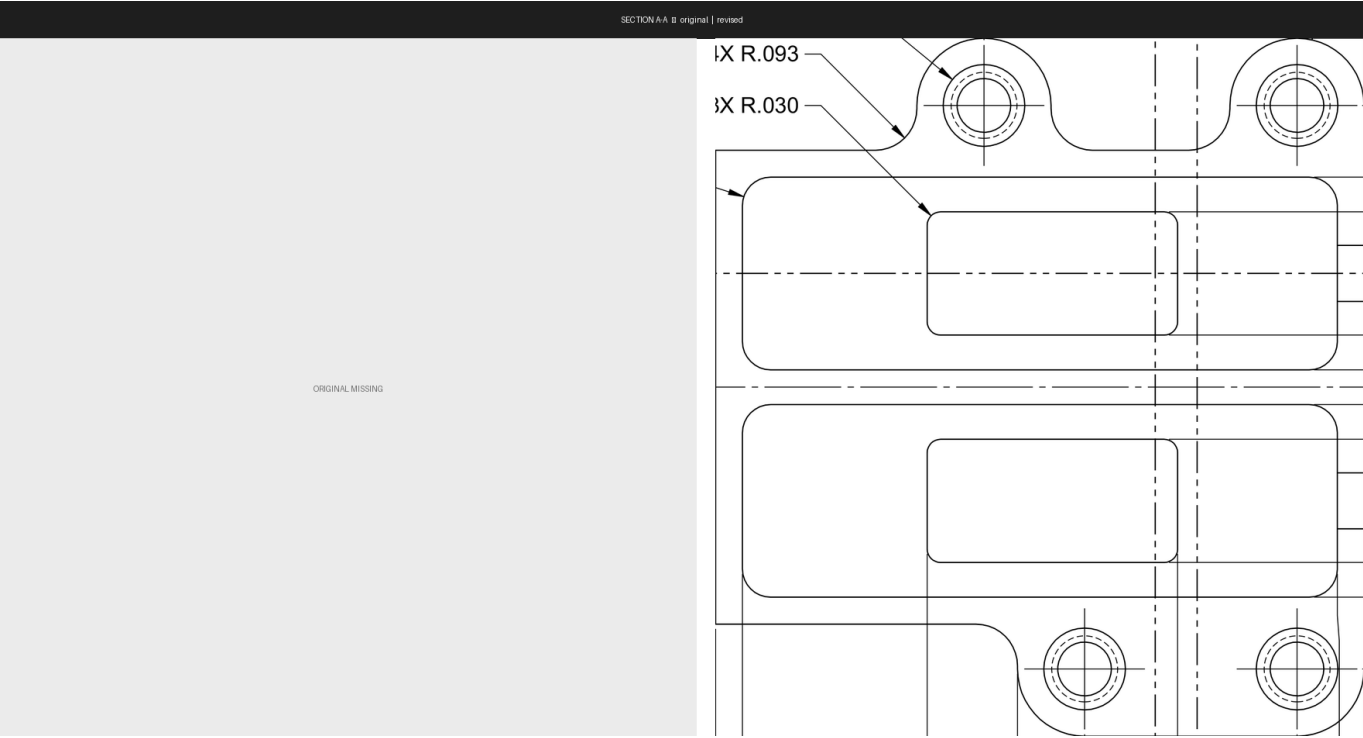


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	—	SECTION A-A	1.00	View 'SECTION A-A' appears only in the revised drawing. Impact: New Section A-A added to the revised drawing, providing cross-sectional detail not previously shown; manufacturing and inspection must incorporate this view's dimensions and tolerances into their processes.

SECTION A-A [ADDED]

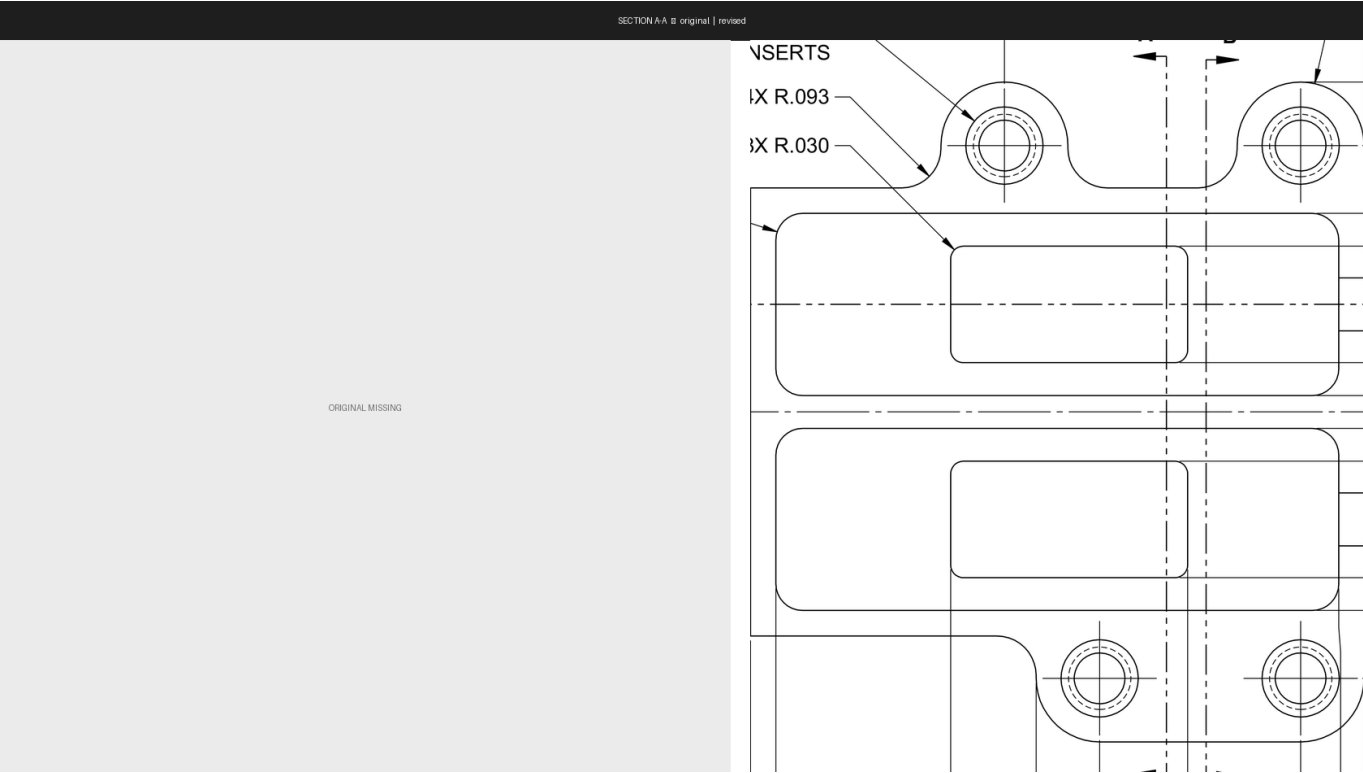


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	—	SECTION A-A	1.00	View 'SECTION A-A' appears only in the revised drawing. Impact: New Section A-A added to the revised drawing, providing cross-sectional detail not previously shown; manufacturing and inspection must incorporate this view's dimensions and tolerances into their processes.

SECTION A-A [ADDED]

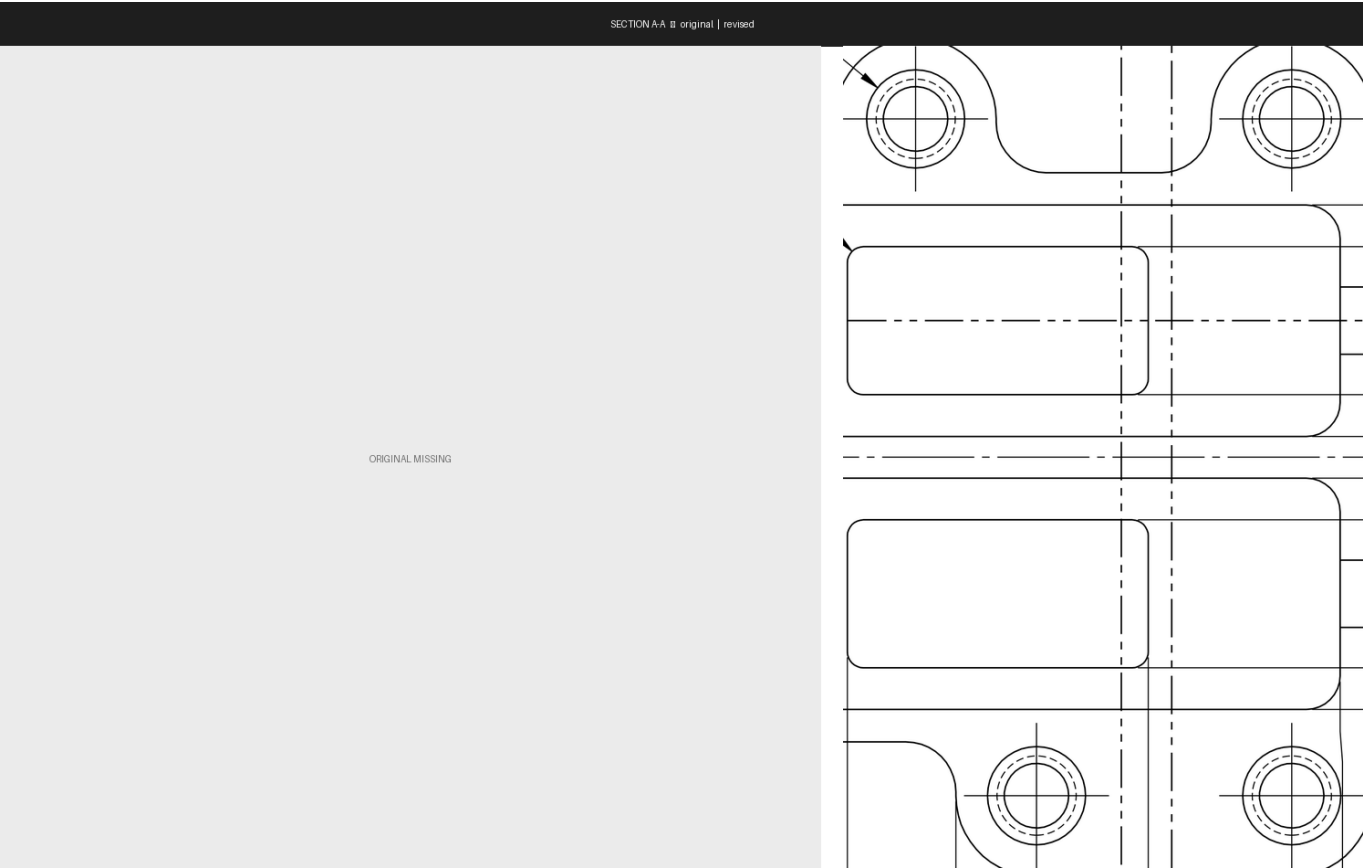


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	—	SECTION A-A	1.00	View 'SECTION A-A' appears only in the revised drawing. Impact: New Section A-A added to the revised drawing, providing cross-sectional detail not previously shown; manufacturing and inspection must incorporate this view's dimensions and tolerances into their processes.

SECTION B-B [ADDED]

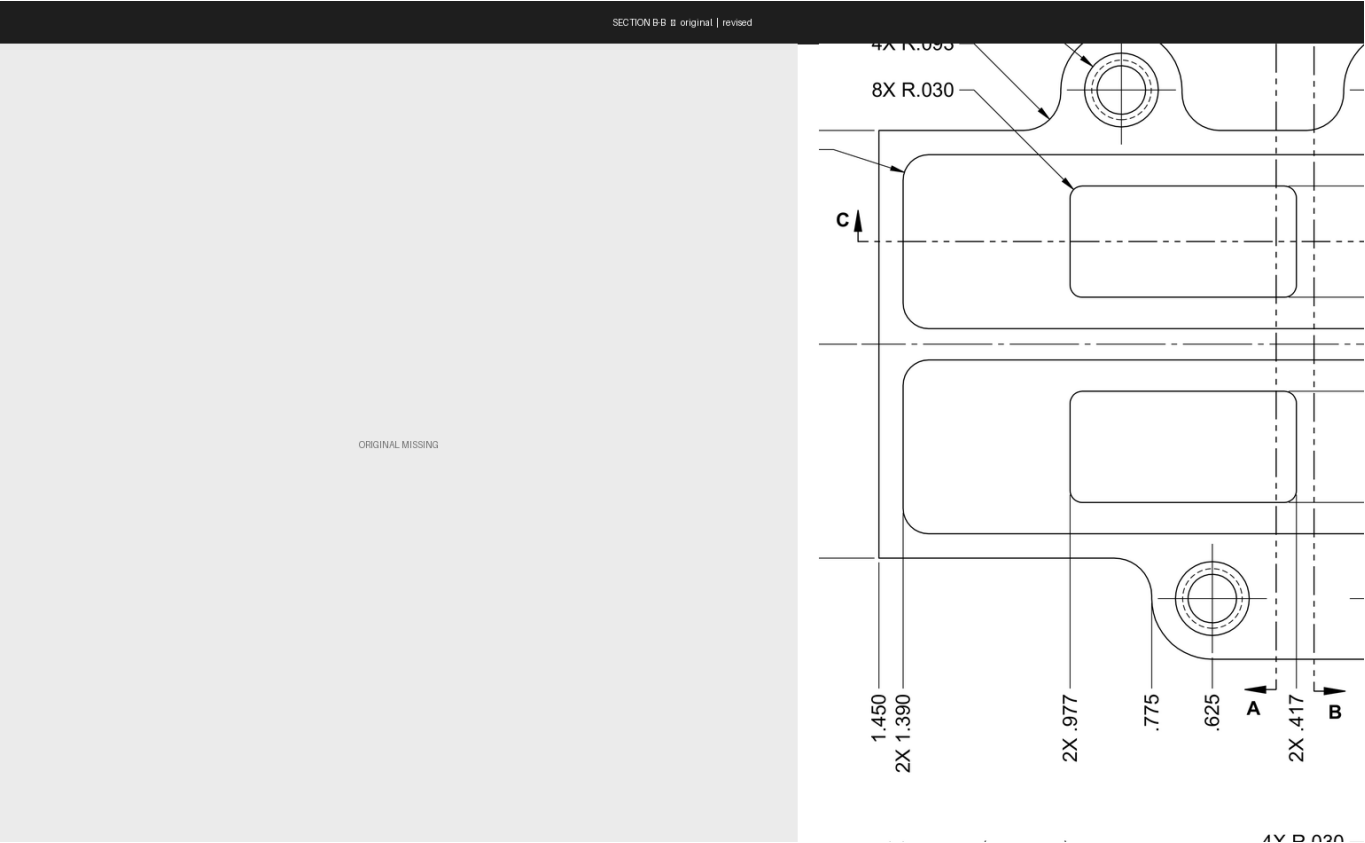

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	—	SECTION B-B	1.00	View 'SECTION B-B' appears only in the revised drawing. Impact: New Section B-B added to the revised drawing; as with Section A-A, all dimensions and tolerances shown must be incorporated into manufacturing planning and first-article inspection.

SECTION B-B [ADDED]

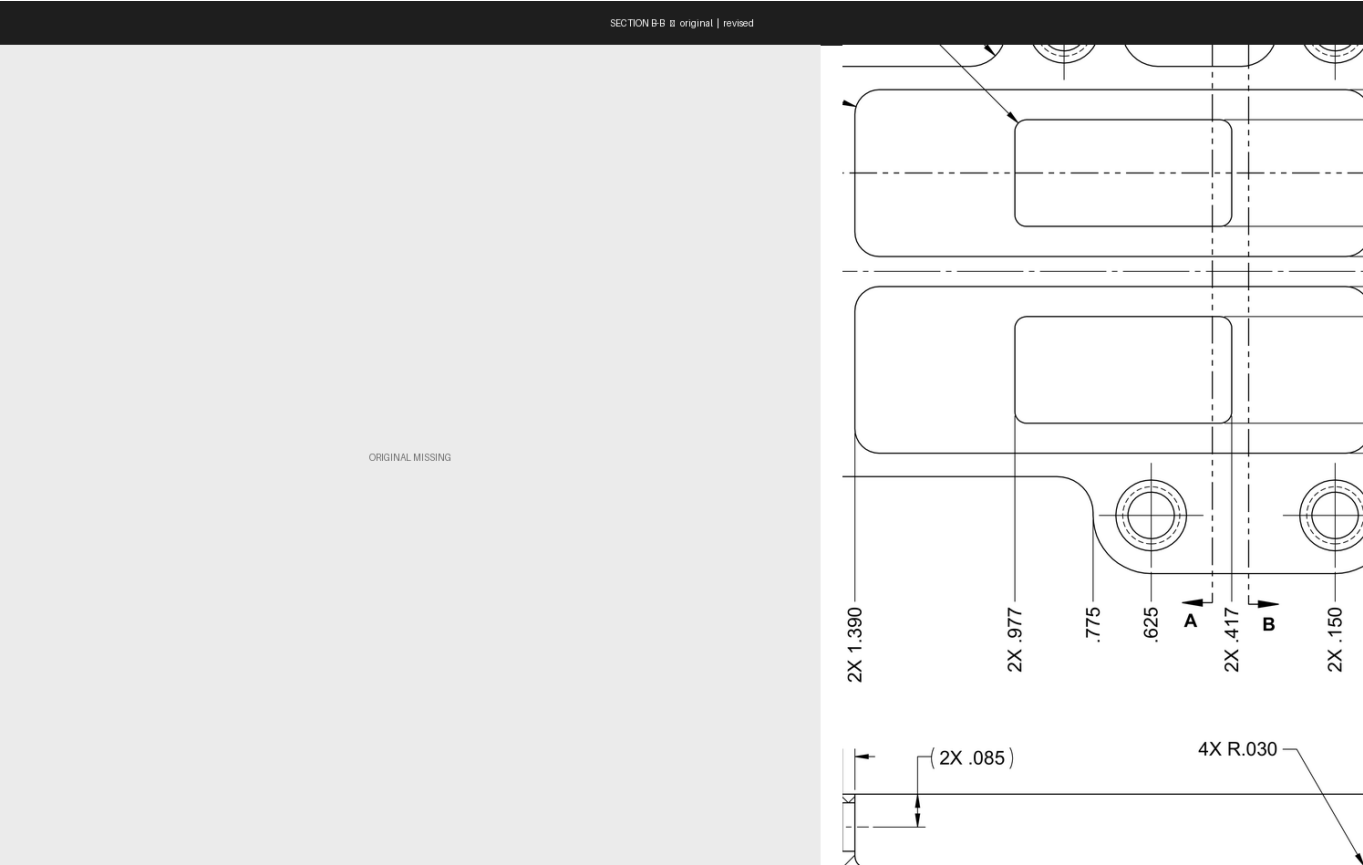

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	—	SECTION B-B	1.00	View 'SECTION B-B' appears only in the revised drawing. Impact: New Section B-B added to the revised drawing; as with Section A-A, all dimensions and tolerances shown must be incorporated into manufacturing planning and first-article inspection.

Legend

- **CRITICAL** — Affects structural integrity, safety, interchangeability, or regulatory compliance.
 - **SIGNIFICANT** — Affects manufacturing scope, cost, or lead time. No safety risk but requires re-planning.
 - **MINOR** — Clarity, formatting, or documentation change. No manufacturing impact.
 - **UNCERTAIN** — Confidence below 0.65. Requires human review.
- ⚠ **AI-generated — requires human verification before release to manufacturing.**