

DrawDiff Comparison Report

Part number: DA1840189 | Job: 0740fbeb-6c2c-404e-b13b-9dfeb40ea7b0 | Generated: 2026-04-30T02:44:02+00:00

verify5: intra-side dedup

Summary

1 Critical	16 Significant	2 Minor	0 Uncertain	9 Views compared
---------------	-------------------	------------	----------------	---------------------

Title Block

Field	Original	Revised
part_number		
revision	TS	
material		
tolerance		
drawn_by		
date		

Revision Block

Added in revised

No revision entries on revised drawing.

Removed from original



No revision entries on original drawing.

Annotated Drawings

Severity: Critical Significant Minor Uncertain

Sheet 1 — boxes mark views with detected changes.



Original Revised

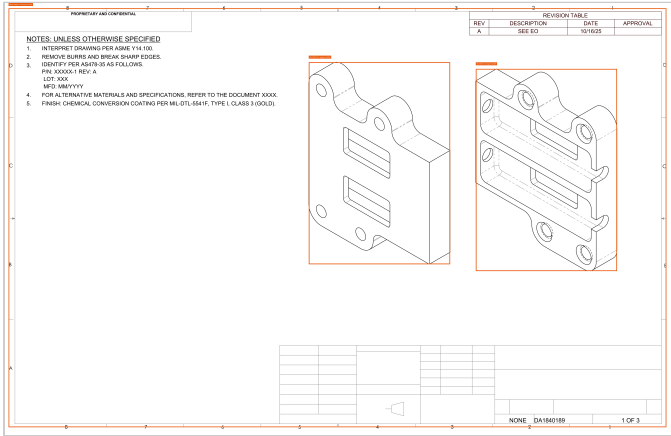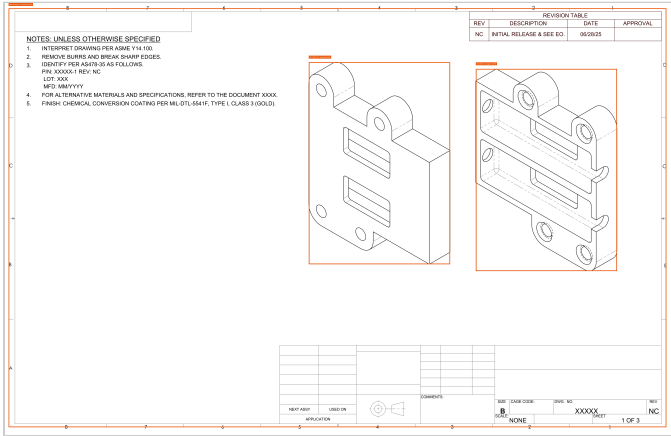

Sheet 2 — boxes mark views with detected changes.

Original

Revised

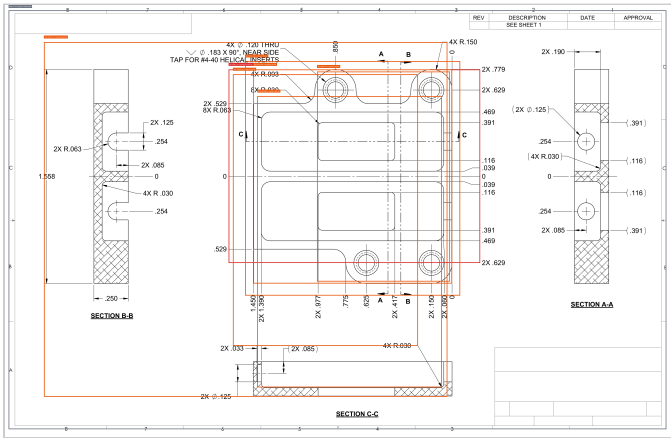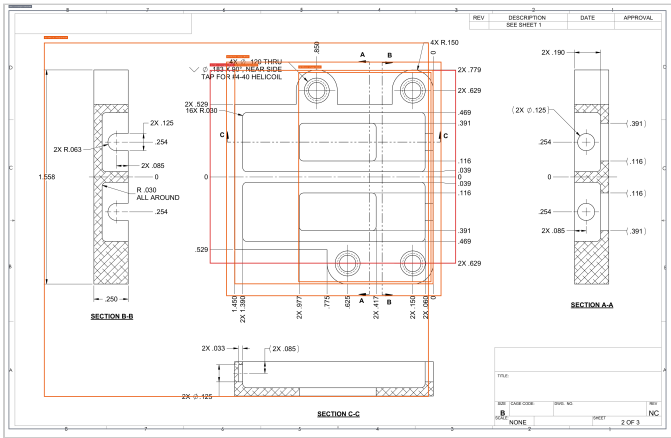

View-by-view Changes


title_block [TITLE_BLOCK]

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	revision	TS	—	1.00	title_block.revision changed from 'TS' to None

revision_block [REVISION_BLOCK]


No textual changes recorded for this view.

SECTION C-C [MATCHED]

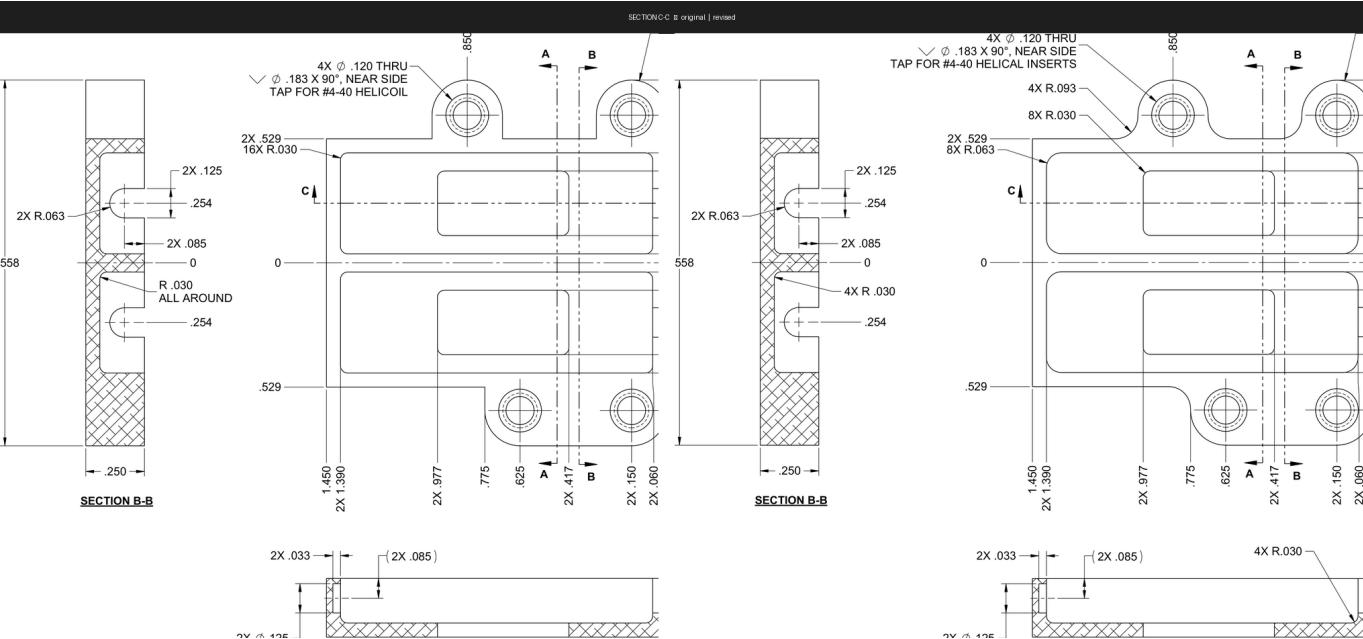

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	annotation	16X R.030	8X R.030	0.92	[deduped across views] The count of R.030 radii on the rectangular pockets changed from 16X to 8X, indicating a reduction in the number of corners or locations where this radius applies, which affects machining requirements.
MINOR	note	TAP FOR #4-40 HELICOIL	TAP FOR #4-40 HELICAL INSERTS	0.95	[deduped across views] The thread insert callout wording changed from 'HELICOIL' (brand name) to 'HELICAL INSERTS' (generic term); functionally equivalent but affects procurement/specification language.


ANNOTATION [MATCHED]

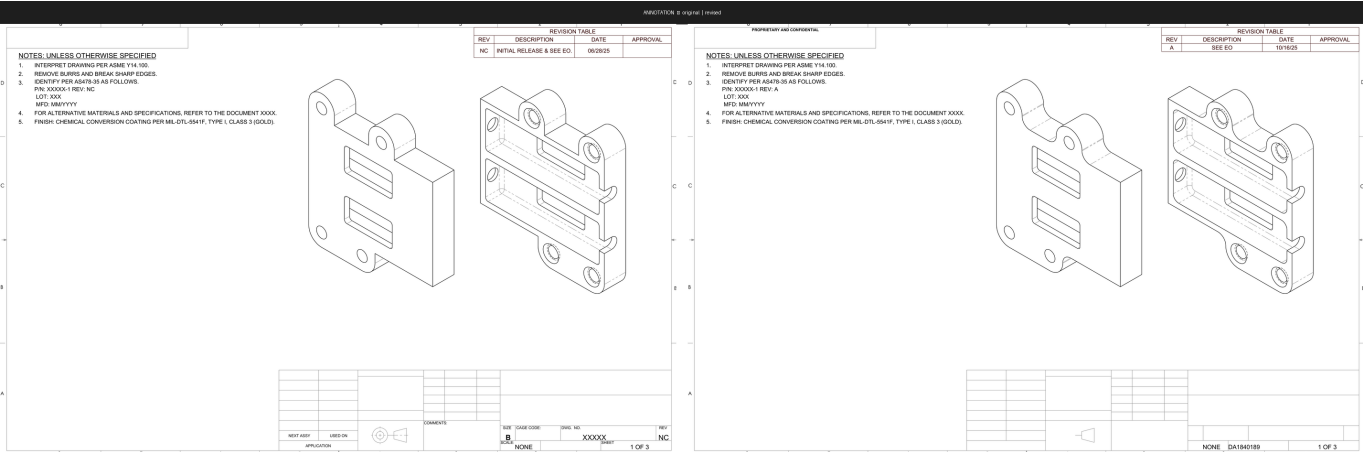

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	other	REV: NC INITIAL RELEASE &	REV: A SEE EO 10/16/25	0.97	The revision table has been updated from NC (Initial Release) to Rev A with a new date of 10/16/25, indicating a


Severity	Field	Original	Revised	Conf.	Rationale
		SEE EO. I 06/28/25			formal revision cycle has been initiated.
SIGNIFICANT	note	P/N: XXXXX-1 REV: NC	P/N: XXXXX-1 REV: A	0.97	Note 3 part number identification has been updated from REV: NC to REV: A to match the new revision level in the title block.
SIGNIFICANT	geometry	Front isometric view shows a solid top boss/lug with no visible gap or cutout at the top center of the bracket	Front isometric view shows a gap or cutout visible at the top center of the bracket between the two upper lugs	0.72	The front isometric view of the part appears to show a geometric change at the top of the bracket — the revised view shows what appears to be a cutout or separation between the upper mounting lugs that was not present in the original.
MINOR	annotation	—	PROPRIETARY AND CONFIDENTIAL	0.95	A 'PROPRIETARY AND CONFIDENTIAL' header has been added to the revised drawing that was not present in the original.

ISO_FRONT [MATCHED]

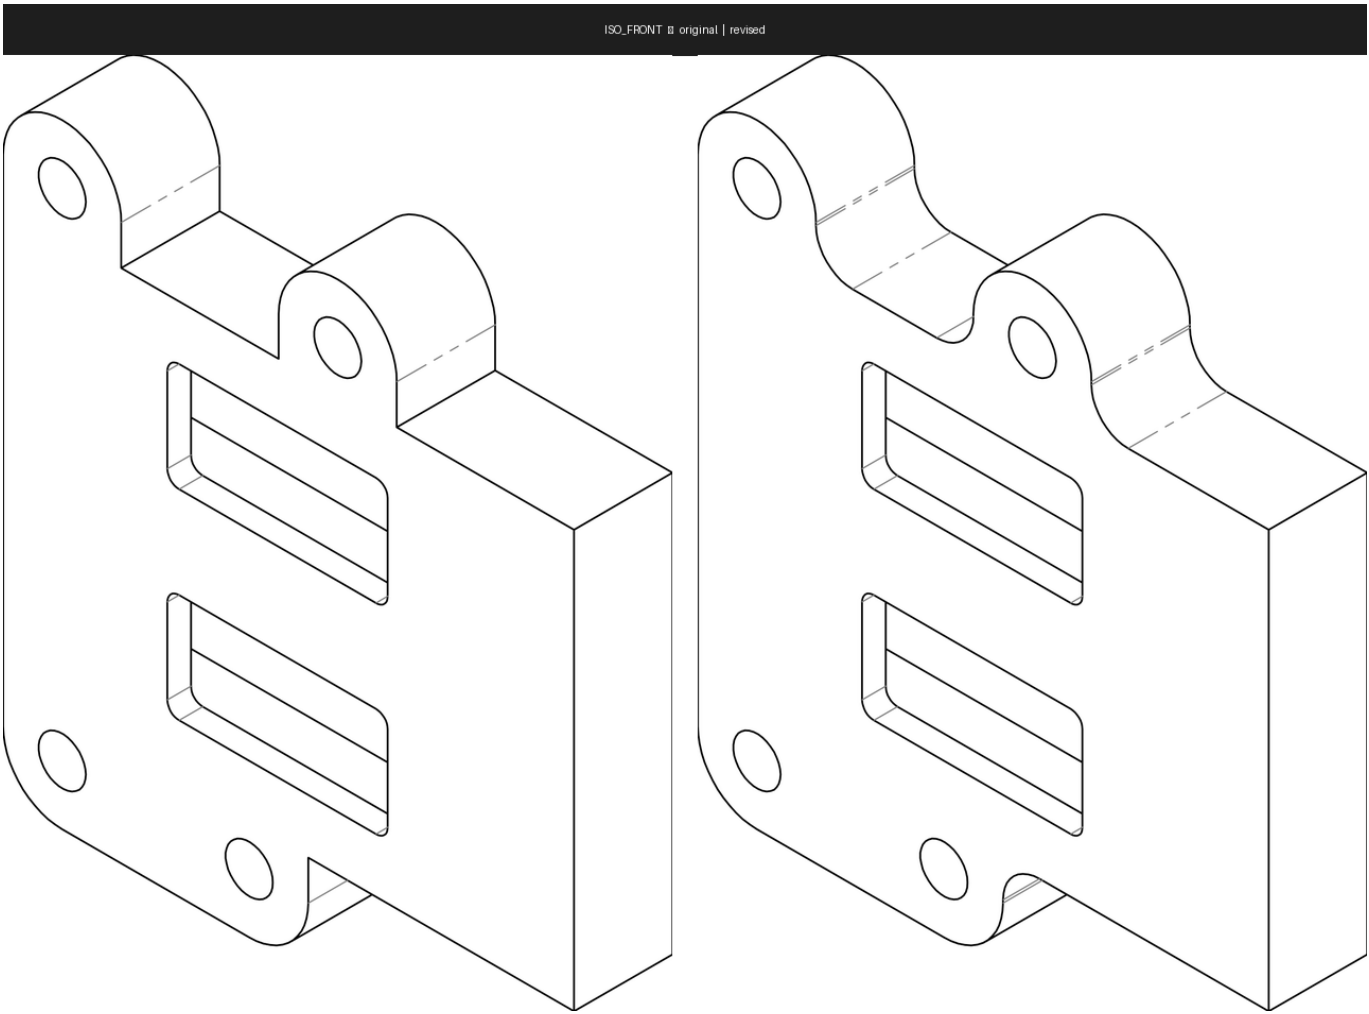


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	Upper flange/tab is a single flat horizontal shelf with a simple curved top edge and no undercut or relief on the underside	Upper flange/tab shows a concave undercut or relief profile on the underside, creating a thinner web between the curved boss and the flat shelf	0.75	The revised view shows a visible concave relief or undercut machined into the underside of the upper mounting flange that is absent in the original, which would affect the structural cross-section and manufacturing operations for that feature.

ISO_REAR [MATCHED]

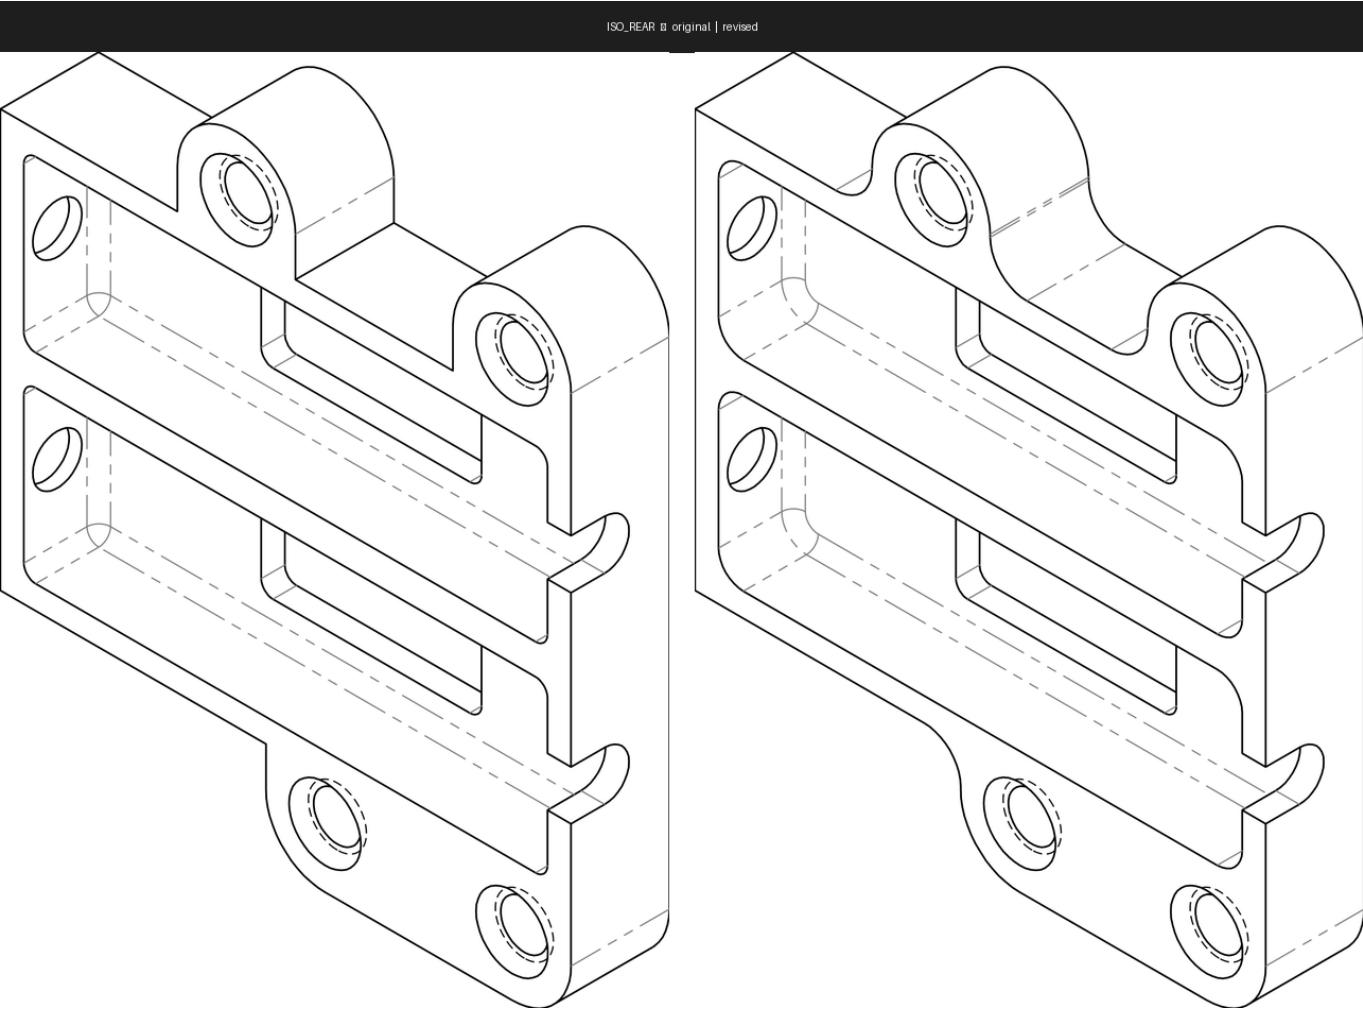


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	Sharp or minimally radiused internal corners at the left-side vertical edges of the upper and lower rectangular pockets/slots (front-left region)	Visibly radiused/ filleted internal corners at the left-side vertical edges of the upper and lower rectangular pockets/slots (front-left region)	0.72	The revised view shows clearly rounded fillets at the internal left-side corners of the two large slot/ pocket features on the front face, whereas the original shows sharp or near-sharp corners, indicating a geometry change that affects stress concentration and potentially manufacturing method.

VIEW_1 [MATCHED]

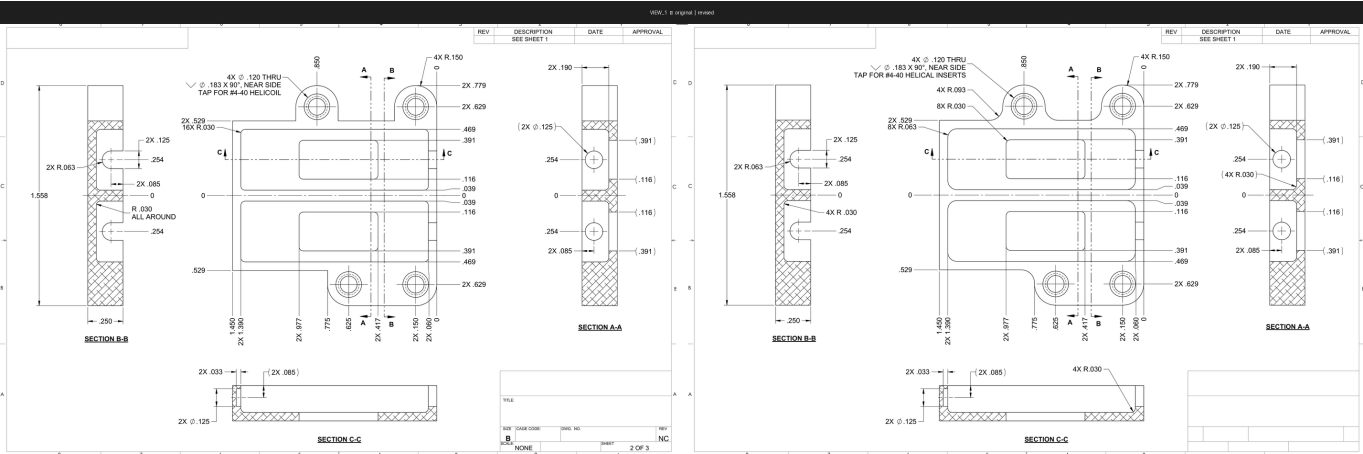


No textual changes recorded for this view.

SECTION A-A [MATCHED]

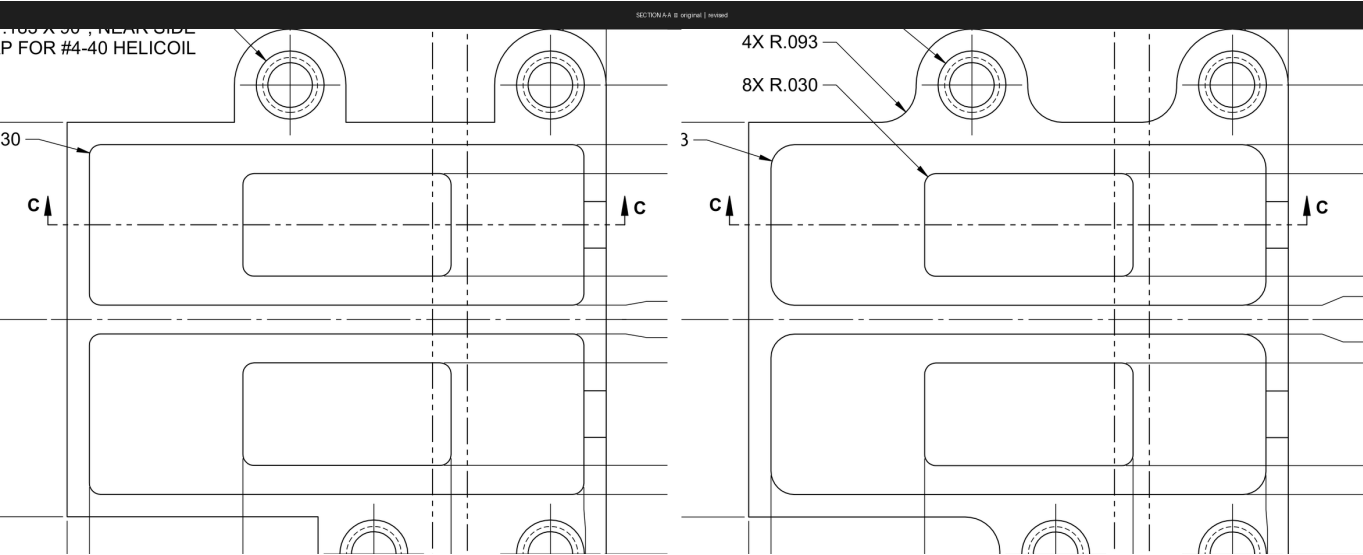


Severity	Field	Original	Revised	Conf.	Rationale
CRITICAL	note	.165 X 90°; NEAR SIDE P FOR #4-40 HELICOIL	—	0.75	The countersink and helicoil preparation note visible in the original ('.165 X 90°; NEAR SIDE / P FOR #4-40 HELICOIL') appears to have been removed from this view in the revision, which would affect thread insert installation requirements.
SIGNIFICANT	annotation	—	4X R.093	0.92	[deduped across views] A new radius callout '4X R.093' has been added in the revised view, specifying four corner radii on the mounting boss features that were not previously annotated.
SIGNIFICANT	dimension	30	—	0.65	A dimension value '30' with a leader arrow visible in the original view appears to be absent or cropped out in the revised view, suggesting a dimension annotation was removed or relocated.

SECTION A-A [MATCHED]

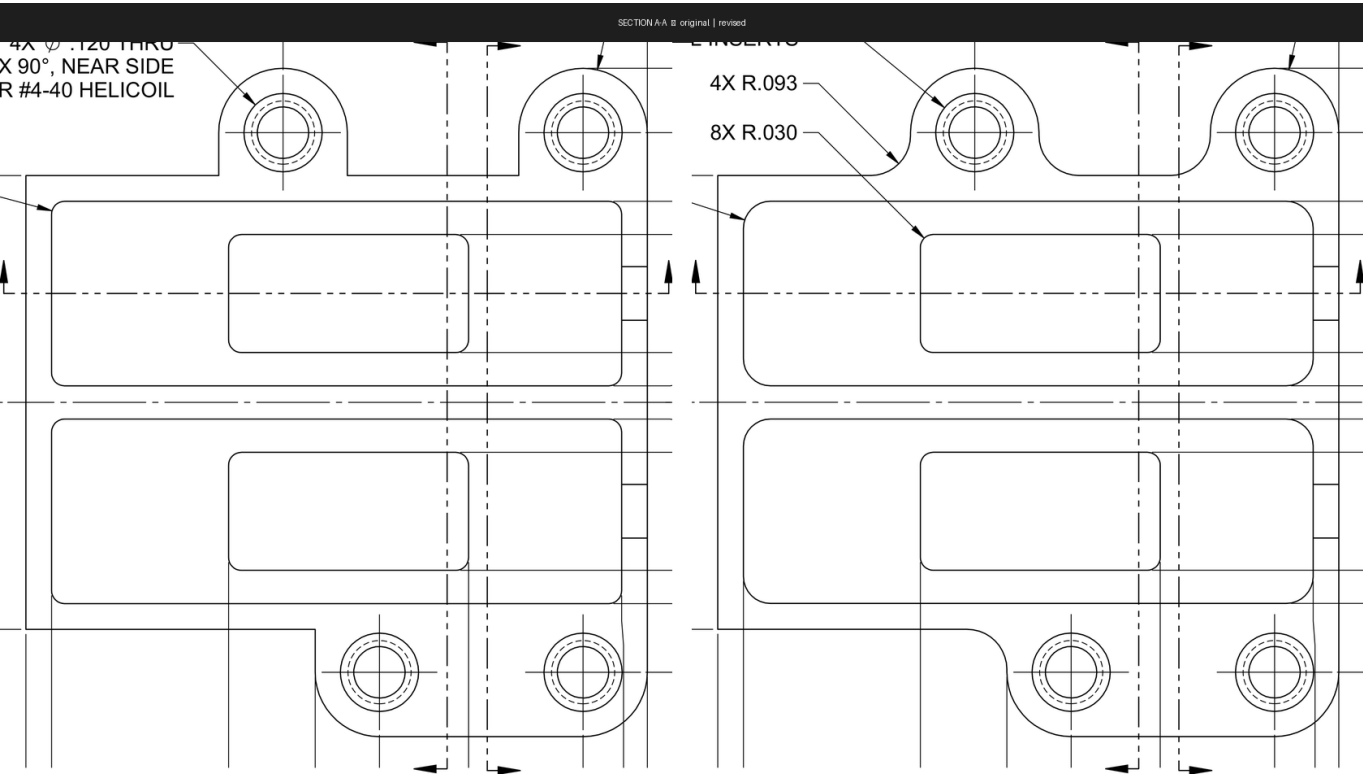


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	note	4X Ø .120 THRU X 90°, NEAR SIDE R #4-40 HELICOIL	E INSERTS (partial, truncated at top)	0.72	The hole/helicoil callout text visible in the original ('4X Ø .120 THRU ... #4-40 HELICOIL') appears to have been revised or partially replaced; the revised view shows only a truncated remnant '...E INSERTS', suggesting the note wording has changed, though the full revised text is cut off at the image edge.

SECTION A-A [MATCHED]

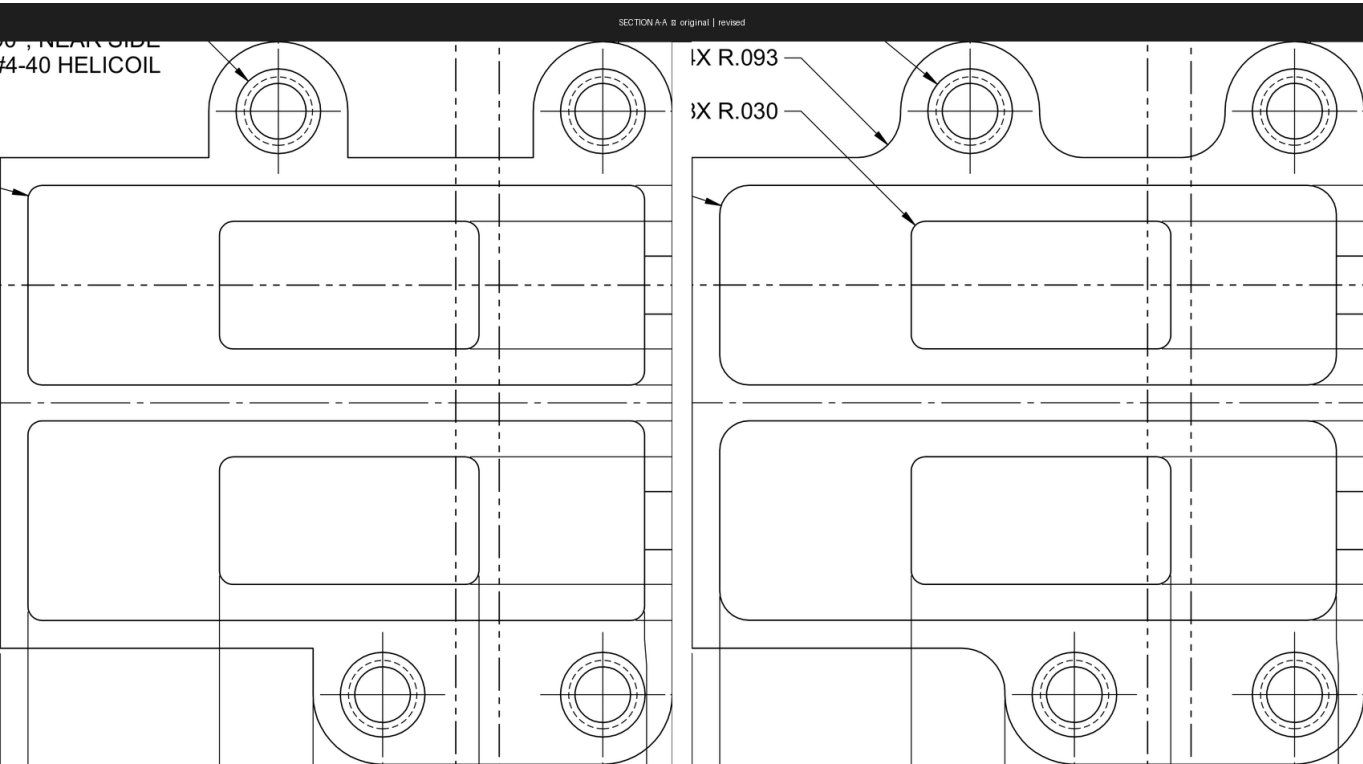


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	annotation	—	4X R.093 (with leader to boss fillet radius)	0.88	A new radius callout '4X R.093' with a leader arrow pointing to the mounting boss fillet has been added in the revised view, explicitly specifying a previously uncalled-out radius.
SIGNIFICANT	note	(partial text visible) '...0°, NEAR SIDE' note present in upper left	—	0.72	The partial note visible in the upper-left corner of the original (referencing 'NEAR SIDE' and an angle) has been removed in the revised view, potentially removing a manufacturing instruction.
SIGNIFICANT	geometry	Boss-to-body transition shown as tangent blend (smooth continuous curve)	Boss-to-body transition shown with a more pronounced fillet/step geometry visible between bosses	0.70	The profile of the mounting boss base transitions appears geometrically different in the revised view, showing a more defined step or fillet between the two top bosses, which may reflect an actual geometry change or improved drafting clarity.

SECTION A-A [MATCHED]

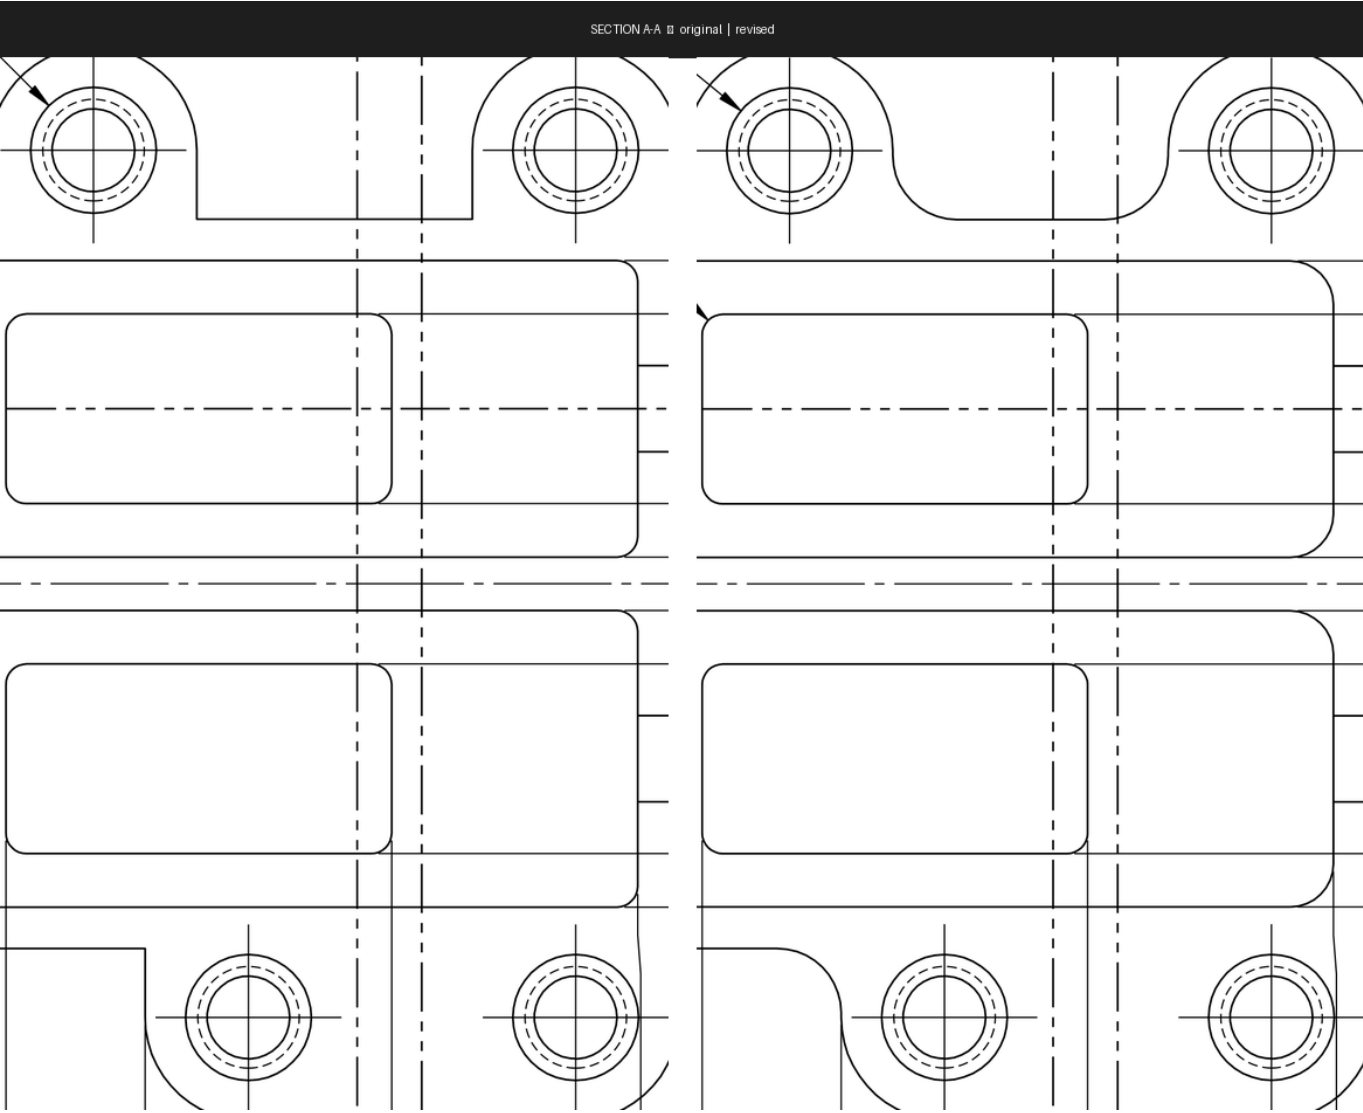


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	Sharp/chamfered corners on central notch between upper mounting bosses	Large radii (fillet) corners on central notch between upper mounting bosses	0.92	The top central cutout/notch transitions from sharp square corners to large rounded fillet corners, significantly changing the geometry and stress distribution at those transitions.

SECTION B-B [ADDED]

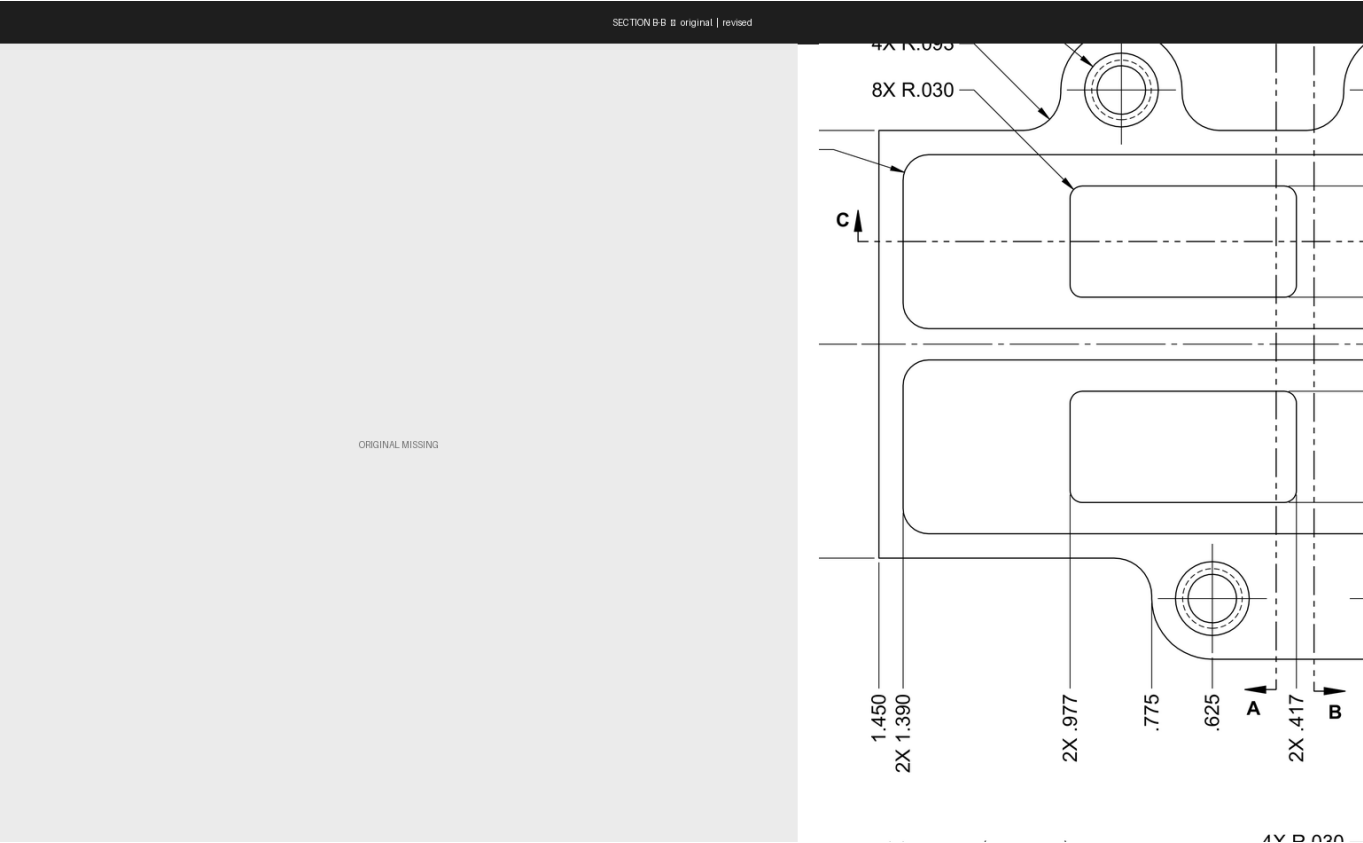

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	—	SECTION B-B	1.00	View 'SECTION B-B' appears only in the revised drawing.

SECTION B-B [ADDED]

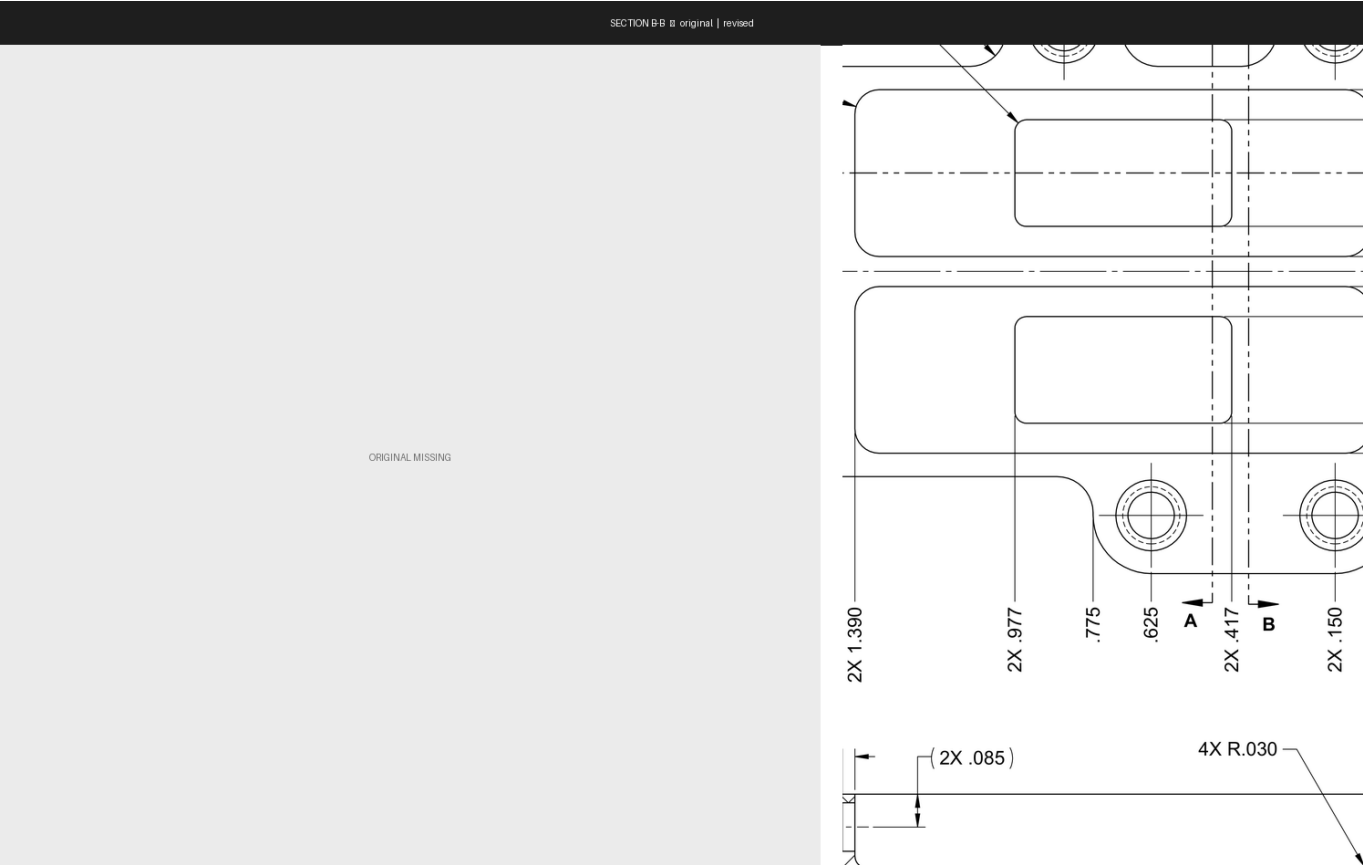

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	view	—	SECTION B-B	1.00	View 'SECTION B-B' appears only in the revised drawing.

Legend

- **CRITICAL** — Affects structural integrity, safety, interchangeability, or regulatory compliance.
- **SIGNIFICANT** — Affects manufacturing scope, cost, or lead time. No safety risk but requires re-planning.
- **MINOR** — Clarity, formatting, or documentation change. No manufacturing impact.
- **UNCERTAIN** — Confidence below 0.65. Requires human review.

⚠ **AI-generated** — requires human verification before release to manufacturing.