

**KIRLOSKAR CHILLERS PRIVATE LIMITED**

A Kirloskar Group Company

Enriching Lives

ENGINEERING SPECIFICATIONS

Document Name: KWKI_XXX_1X Modbus list		
Document No: ESP-17-18-113	Revision: R02	Date: 19/03/2018
Prepared By: HPK	Approved By: SSN	Sheet: 1 of 2

KWKI_XXX_1X MODEL				
Descriptions	UOM	Type	Read/Write	Modbus Add
Evaporator Water In Temperature	°C	ANALOG	Read	40002 (Holding Register)
Evaporator Water Out Temperature	°C	ANALOG	Read	40003 (Holding Register)
Oil Temperature	°C	ANALOG	Read	40004 (Holding Register)
Discharge Temperature	°C	ANALOG	Read	40005 (Holding Register)
Suction Temperature	°C	ANALOG	Read	40006 (Holding Register)
Liquid Line Temperature	°C	ANALOG	Read	40007 (Holding Register)
Condenser IN Temperature	°C	ANALOG	Read	40008 (Holding Register)
Condenser Out Temperature	°C	ANALOG	Read	40009 (Holding Register)
Suction Pressure	Bar	ANALOG	Read	40010 (Holding Register)
Discharge Pressure	Bar	ANALOG	Read	40011 (Holding Register)
Oil Pressure	Bar	ANALOG	Read	40012 (Holding Register)
Motor Current	Amp	ANALOG	Read	40013 (Holding Register)
Suction Superheat	°C	ANALOG	Read	40014 (Holding Register)
Suction Saturation Temperature	°C	ANALOG	Read	40015 (Holding Register)
Percentage RLA	%	ANALOG	Read	40021 (Holding Register)
Evaporator Approach	-	ANALOG	Read	40022 (Holding Register)
Condenser Approach	-	ANALOG	Read	40023 (Holding Register)
LWT Setpoint	°C	ANALOG	Read/Write	40051 (Holding Register)
Run Hours- High*	Hrs.	INTEGER	Read	45035 (Holding Register)
Run Hours- Low*	Hrs.	INTEGER	Read	45029 (Holding Register)

***Note:** Total run hours will be combination of two registers
Total Run hours = Run Hours High x 1000 + Run Hours Low




KIRLOSKAR CHILLERS PRIVATE LIMITED

A Kirloskar Group Company

Enriching Lives

Protocol Details	
Parity	None
Baud rate	19200
Protocol	Modbus/Modbus Extended
Start bit	1
Stop bit	1
No of bit	8
Communication Interface	RS-485
Interface Connection	2 Wire

The connection with the RS485 network is carried out by means of the plug-in terminal connector on the card. Pin-wiring of the connector is stamped on the card. If the card is placed in the last position of the supervision serial line, pins 2 and 3, you must connect a 120 Ω - 1/4 W end line resistor, as shown.

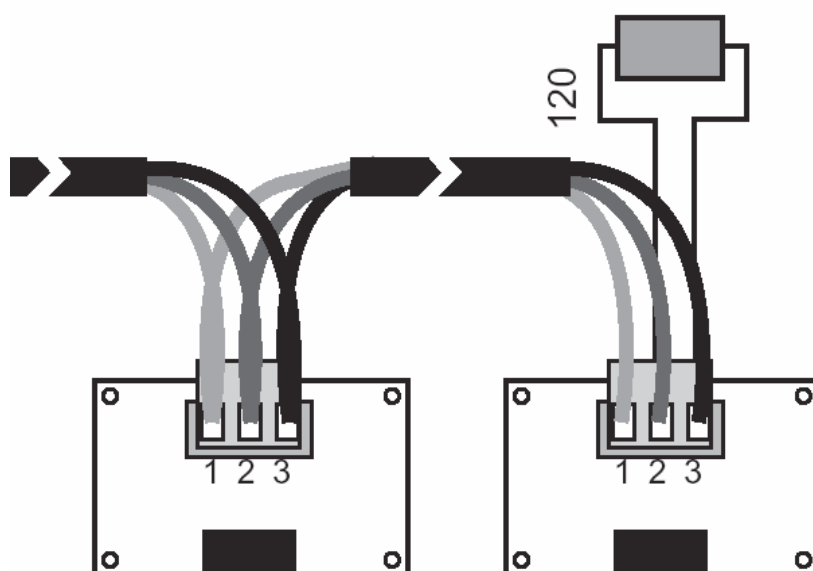

pin	significato <i>meaning</i>
1	GND
2	RX+/TX+
3	RX-/TX-