

ENGINEERING SPECIFICATIONS

Document Name: Modscan Check Procedure		
Document No: ESP-21-22-004	Revision: R00	Date: 14/09/2021
Prepared By: CGH	Approved By: RDT	Sheet: 1

Modscan Check Procedure

ENGINEERING SPECIFICATIONS

Document Name: Modscan Check Procedure		
Document No: ESP-21-22-004	Revision: R00	Date: 14/09/2021
Prepared By: CGH	Approved By: RDT	Sheet: 2

Refer below procedure for checking Modscan,
Engineer should carry below cables & converter with him to check Modscan.

1. Carel RS 485 Converter
2. Printer USB Cable.
3. 3 Core Cable.




ENGINEERING SPECIFICATIONS


Document Name: Modscan Check Procedure		
Document No: ESP-21-22-004	Revision: R00	Date: 14/09/2021
Prepared By: CGH	Approved By: RDT	Sheet: 3

To test Modscan connectivity refers below procedure.

 **Step – 1:** Without extract open Modbus Modscan (Master) folder.

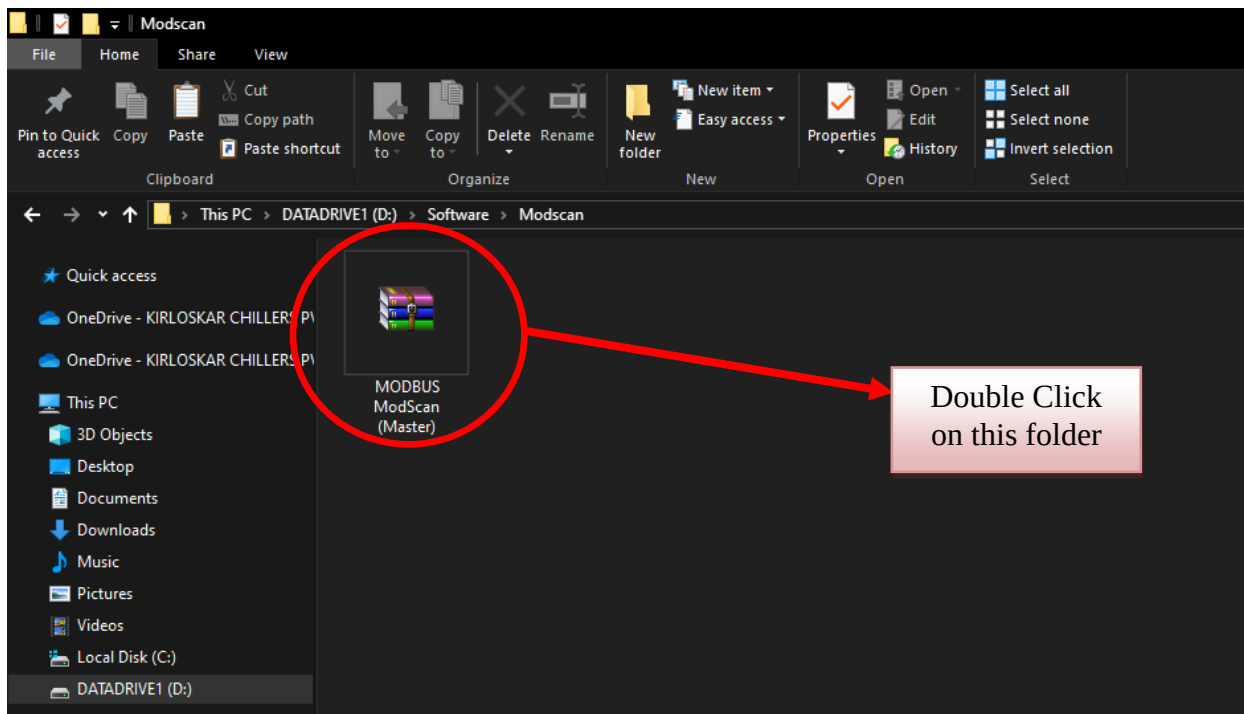


After opening Zip folder we will see like this

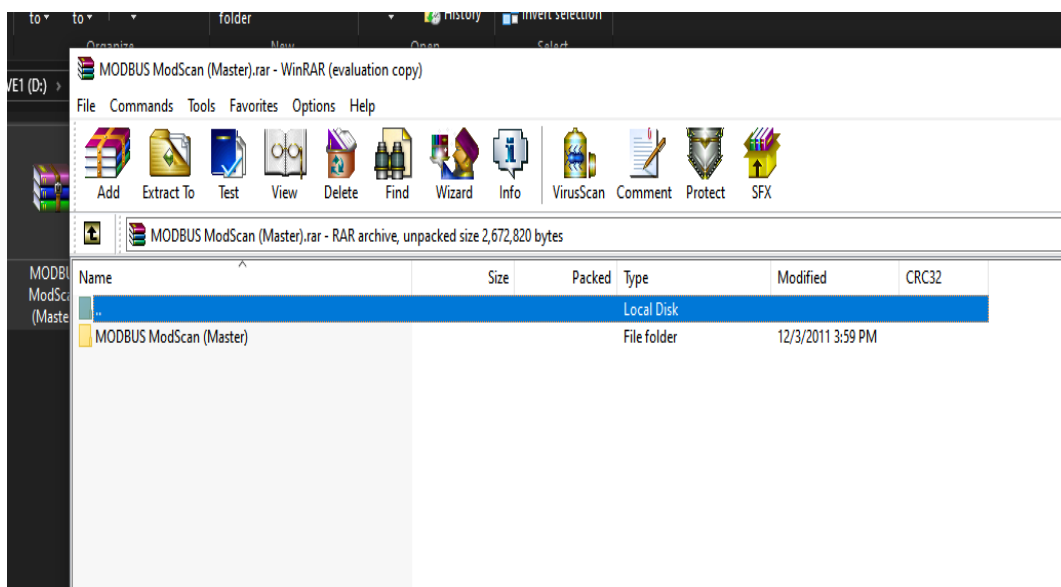

ENGINEERING SPECIFICATIONS

Document Name: Modscan Check Procedure		
Document No: ESP-21-22-004	Revision: R00	Date: 14/09/2021
Prepared By: CGH	Approved By: RDT	Sheet: 4


- ✚ **Step – 2:** Then open Modbus Modscan (Master) & click on Modscan32.exe as per shown in below images, then you will get another popup just click on ok.

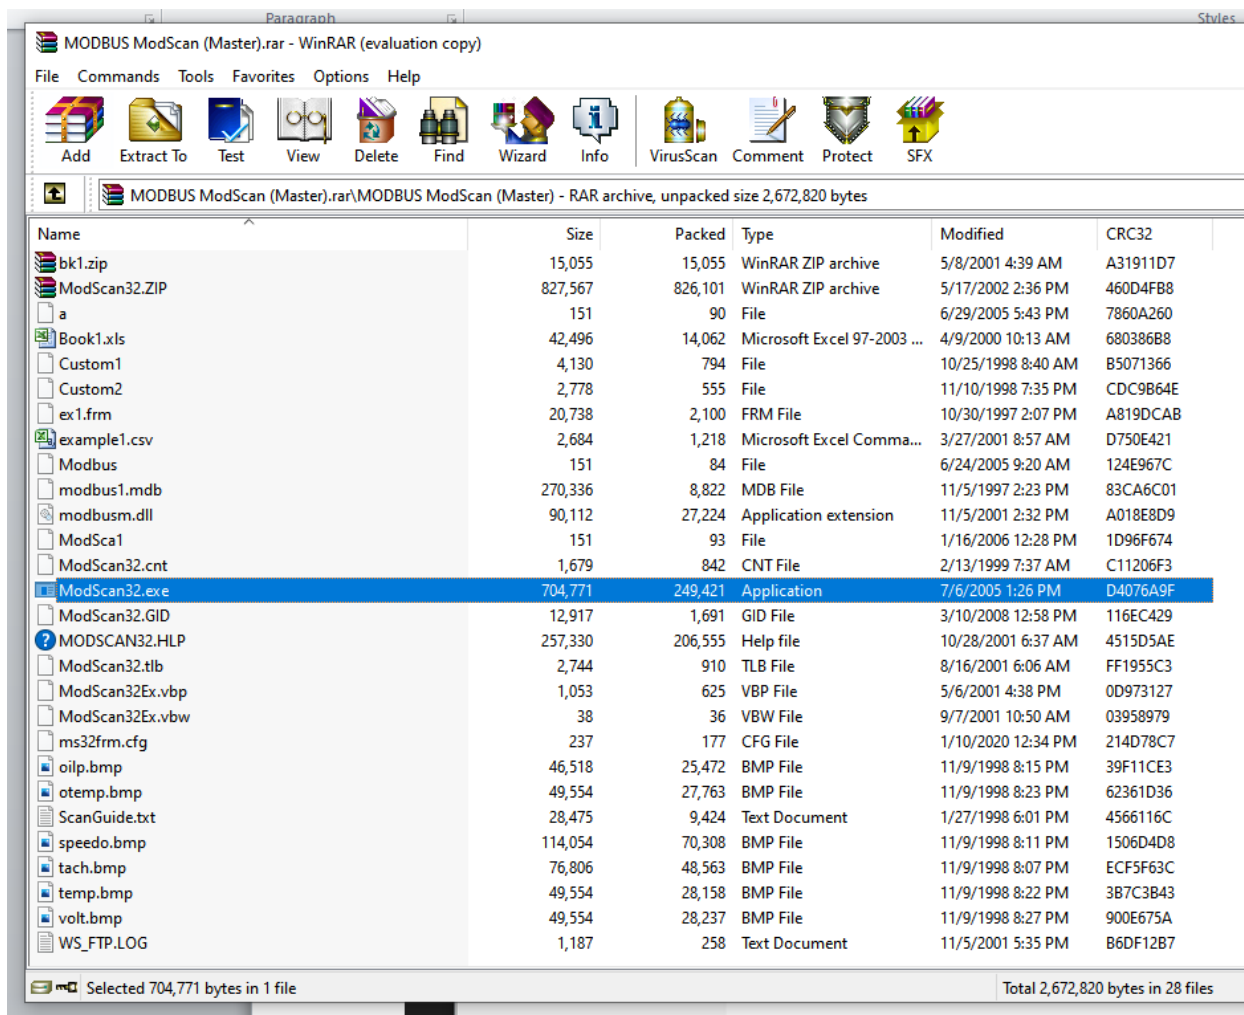


After doing all this you get modscan view like this.

ENGINEERING SPECIFICATIONS

Document Name: Modscan Check Procedure		
Document No: ESP-21-22-004	Revision: R00	Date: 14/09/2021
Prepared By: CGH	Approved By: RDT	Sheet: 5

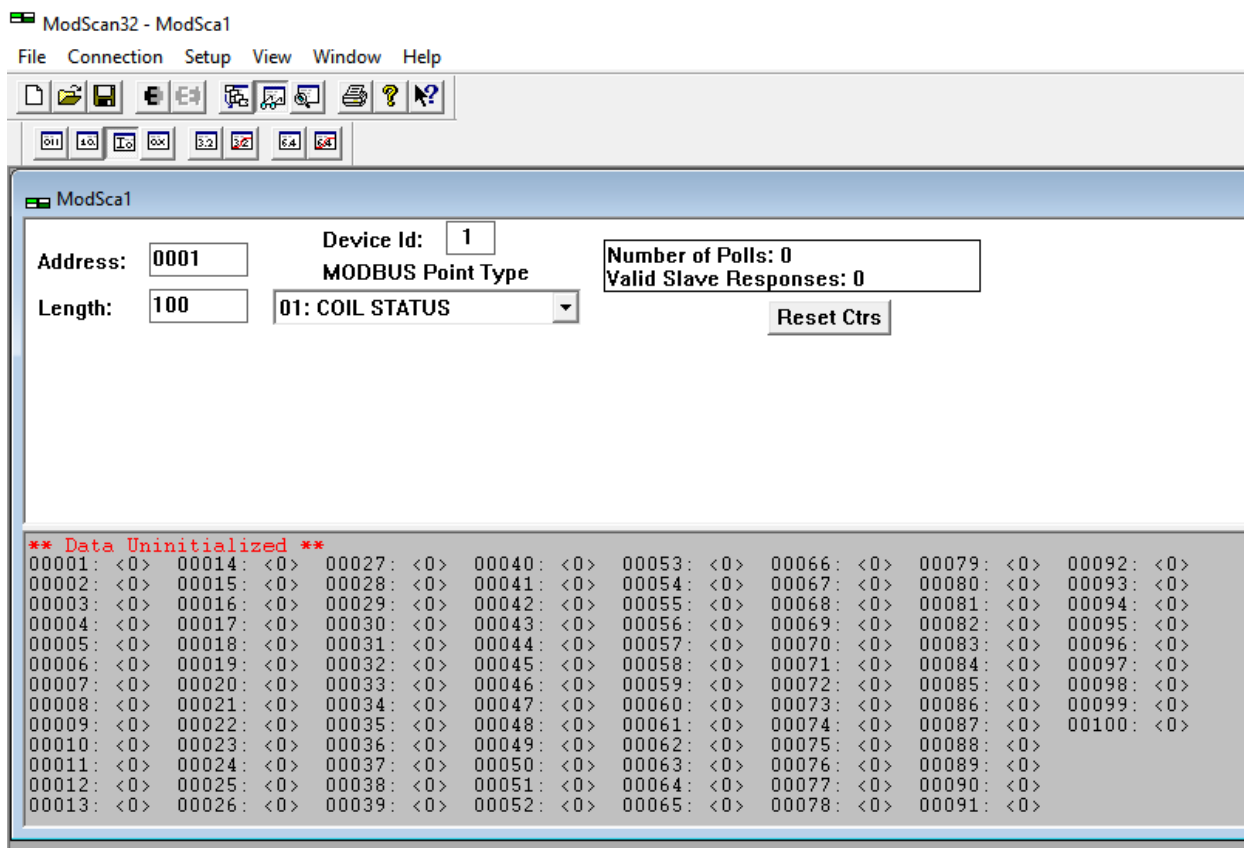

- ✚ **Step – 3:** After this connect USB cable from controller (J25 BMS 2 Or BMS Card) to laptop USB port. As per shown below.

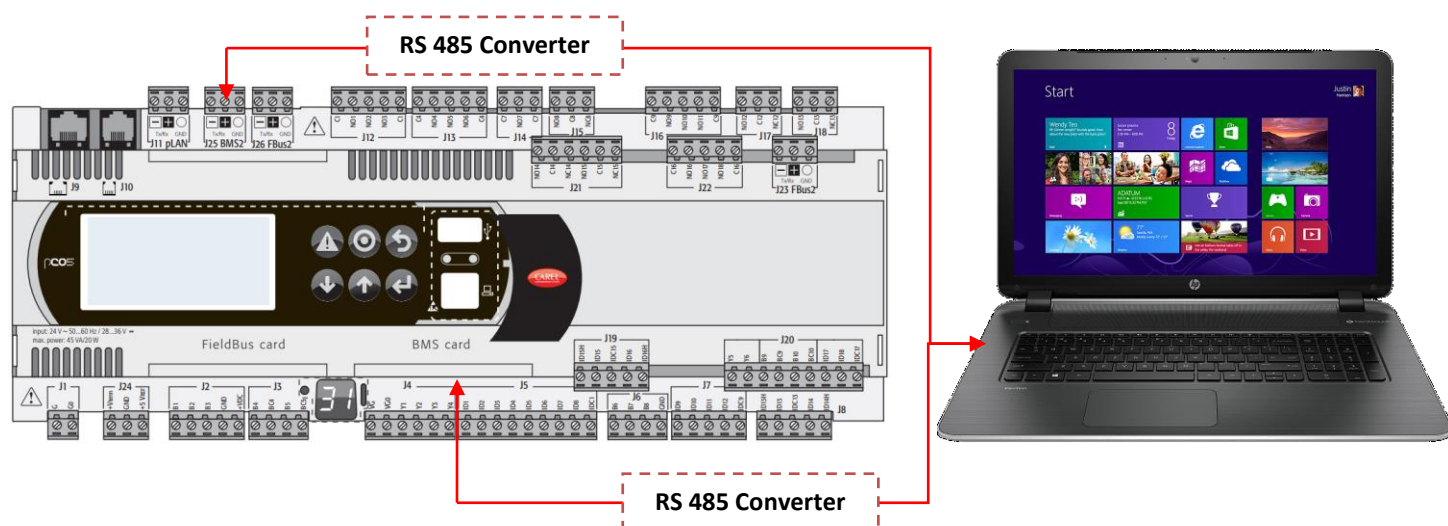


You can connect any port as per availability on controller.


- ✚ **Step – 4:** After this check which com port consumed by laptop, To check this search device manager in start window and open device manager tab.

ENGINEERING SPECIFICATIONS

Document Name: Modscan Check Procedure		
Document No: ESP-21-22-004	Revision: R00	Date: 14/09/2021
Prepared By: CGH	Approved By: RDT	Sheet: 6

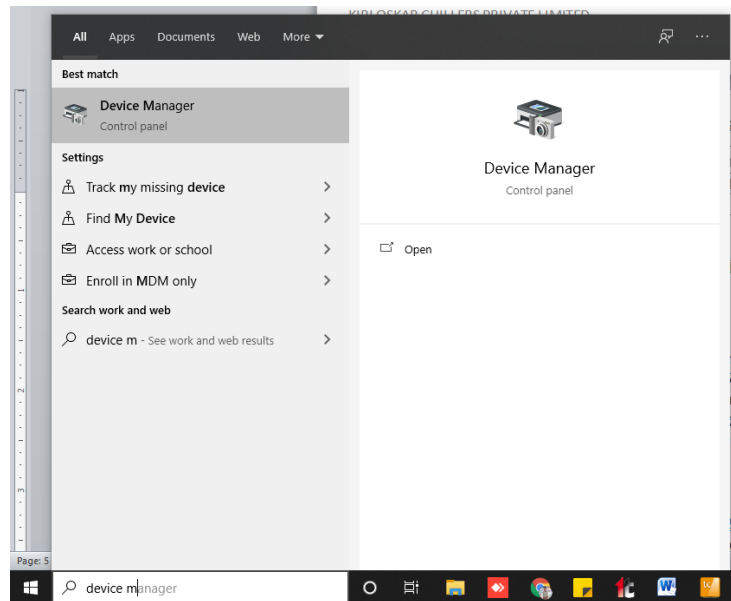

In device manager click on Port & check which port used for USB cable.

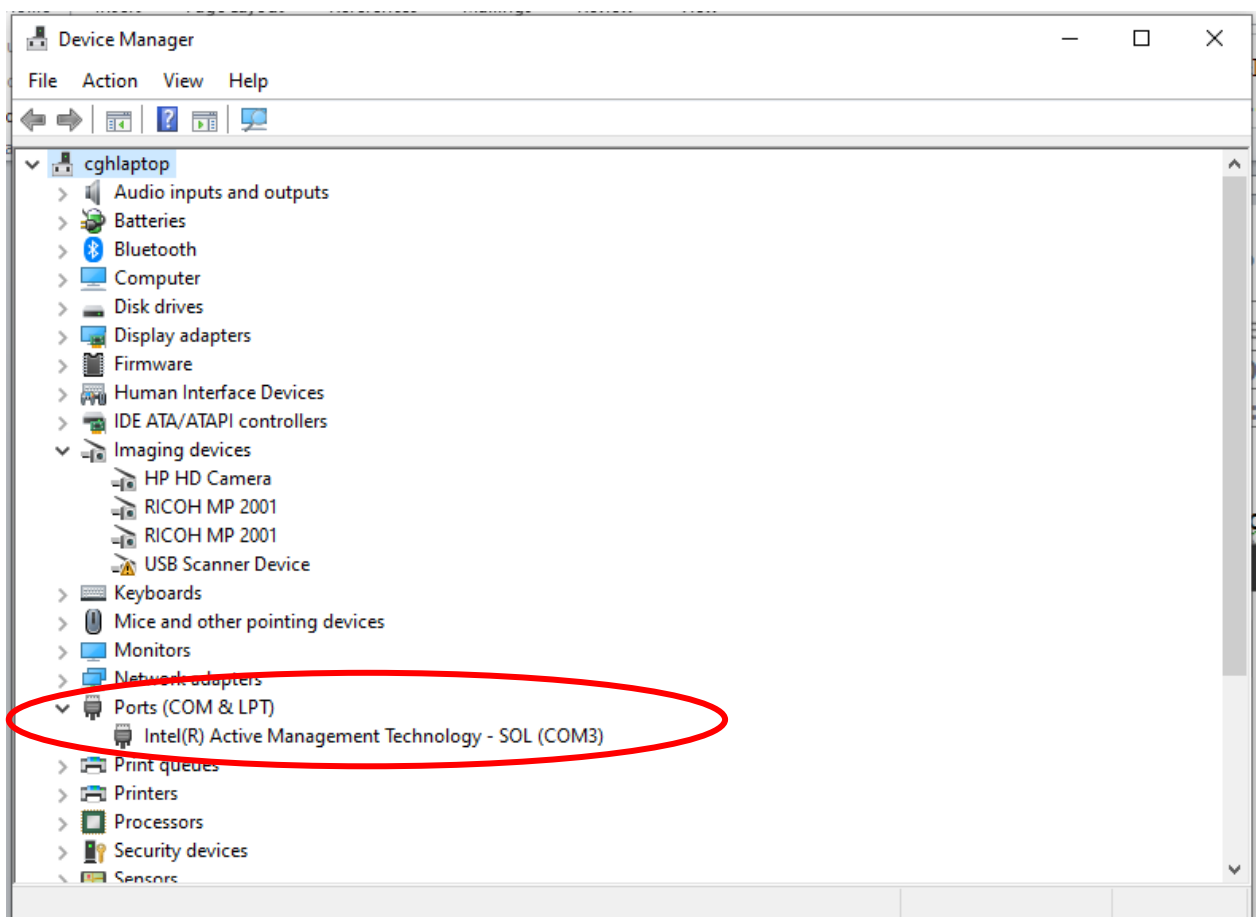


ENGINEERING SPECIFICATIONS

Document Name: Modscan Check Procedure		
Document No: ESP-21-22-004	Revision: R00	Date: 14/09/2021
Prepared By: CGH	Approved By: RDT	Sheet: 7

 **Step – 4:** After checking com port open Modscan again & click on connection 1st & then enter all data.

To open connection window click

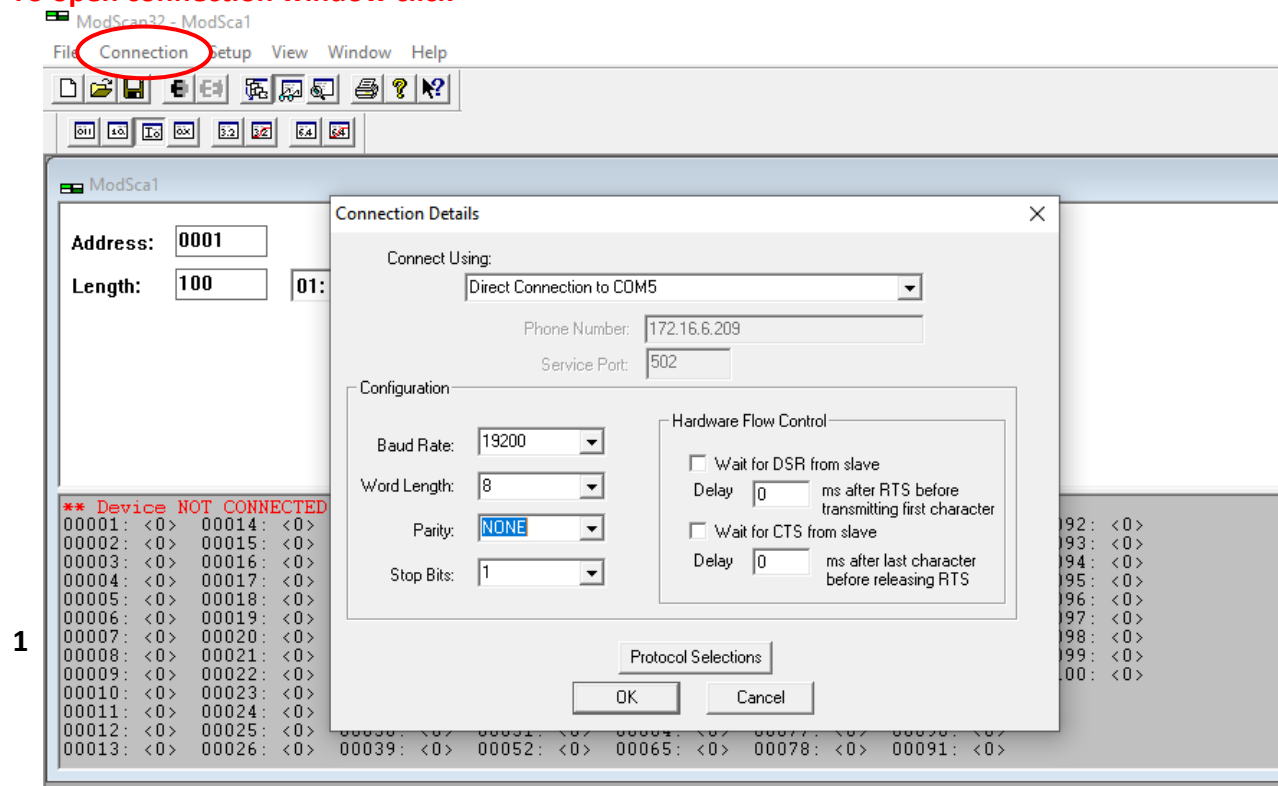

- Select COM port refer Page No 06
- Select Baud Rate same as set on controller BMS settings
- Word Length 8 as it is
- Parity None as it is
- Stop bit 1 as it is


Then press OK and set device ID same as set on BMS setting.

Ex... If BMS 1(BMS Card) Address – 2 Then device ID for Modscan is 2

If BMS 2(J25 BMS Port) Address – 3 Then device ID for Modscan is 3

ENGINEERING SPECIFICATIONS

Document Name: Modscan Check Procedure		
Document No: ESP-21-22-004	Revision: R00	Date: 14/09/2021
Prepared By: CGH	Approved By: RDT	Sheet: 8

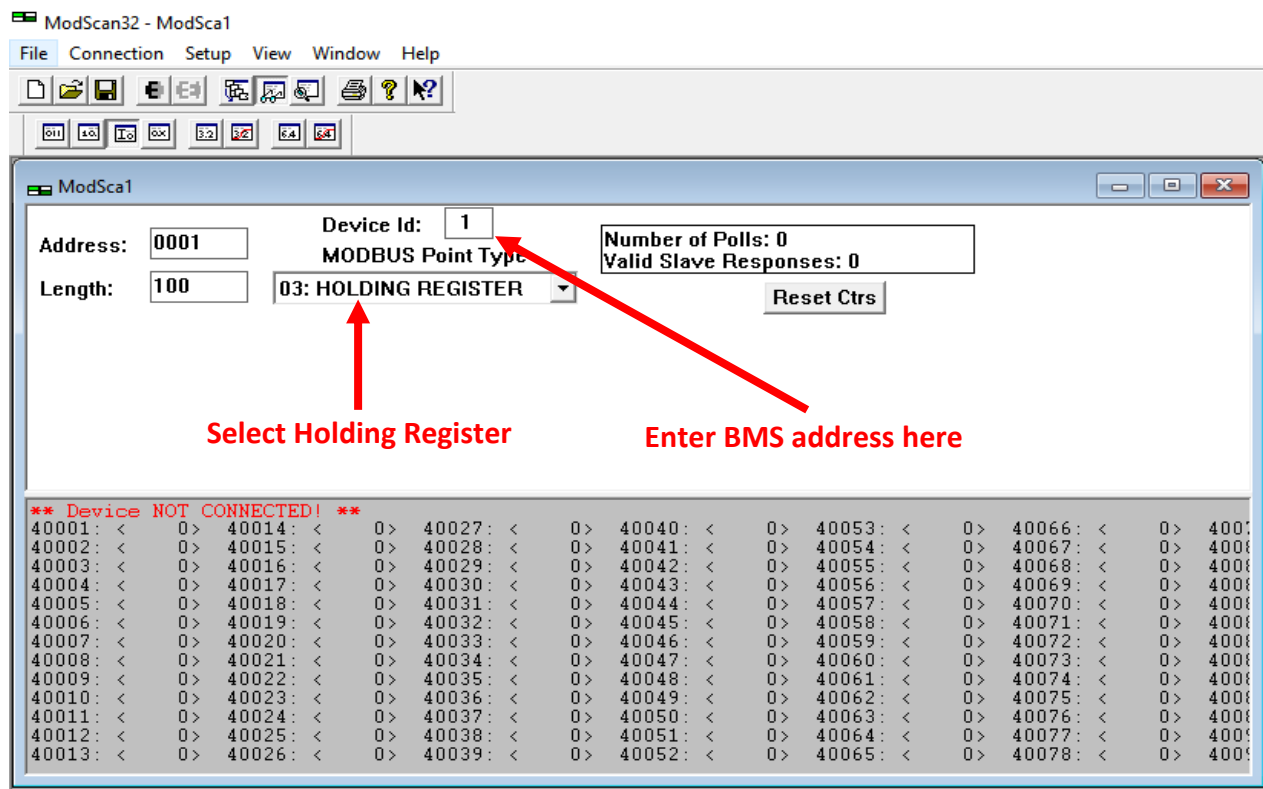

After doing this all you see view like this

