

ENGINEERING SPECIFICATIONS

Document Name: KSC Single Circuit Modbus List		
Document No: ESP-24-25-005	Revision: R03	Date:16-07-2024
Prepared By: PJP	Checked By: AS	Approved By: NMR


KSC Single Circuit				
Descriptions	UOM	Type	Read/Write	Modbus Add(Holding Register)
Suction Pressure	Bar	ANALOG	Read	40002
Discharge Pressure	Bar	ANALOG	Read	40003
Oil Feed Pressure	Bar	ANALOG	Read	40004
Evaporator Water In Temperature	°C	ANALOG	Read	40005
Evaporator Water Out Temperature	°C	ANALOG	Read	40006
Compressor Current	Amp	ANALOG	Read	40007
Oil Vent Pressure	Bar	ANALOG	Read	40008
Discharge Temperature	°C	ANALOG	Read	40009
Oil Feed Temperature	°C	ANALOG	Read	40010
Oil Sump Temperature	°C	ANALOG	Read	40011
Suction Temperature	°C	ANALOG	Read	40012
Liquid Temperature	°C	ANALOG	Read	40013
Condenser Water in Temperature	°C	ANALOG	Read	40014
Condenser Water out Temperature	°C	ANALOG	Read	40015
Suction Saturation Temperature	°C	ANALOG	Read	40016
Suction Superheat	°C	ANALOG	Read	40017
Percentage RLA	%	ANALOG	Read	40031
Evaporator Approach	-	ANALOG	Read	40024
Condenser Approach	-	ANALOG	Read	40027
LWT Setpoint	°C	ANALOG	Read/Write	40051
Run Hours- High*	Hrs.	INTEGER	Read	45017
Run Hours- Low*	Hrs.	INTEGER	Read	45019
Number Of Starts H*	-	INTEGER	Read	45008
Number Of Starts L*	-	INTEGER	Read	45020

Protocol Details	
Parity	None
Baud rate	19200
Protocol	Modbus/Modbus Extended
Start bit	1
Stop bit	1
No of bit	8
Communication Interface	RS-485
Interface Connection	2 Wire

ENGINEERING SPECIFICATIONS

Document Name: KSC Single Circuit Modbus List		
Document No: ESP-24-25-005	Revision: R03	Date:16-07-2024
Prepared By: PJP	Checked By: AS	Approved By: NMR

The connection with the RS485 network is carried out using the plug-in terminal connector on the card. Pin-wiring of the connector is stamped on the card. If the card is placed in the last position of the supervision serial line, pins 2 and 3, you must connect a 120 Ω - 1/4 W end line resistor, as shown.

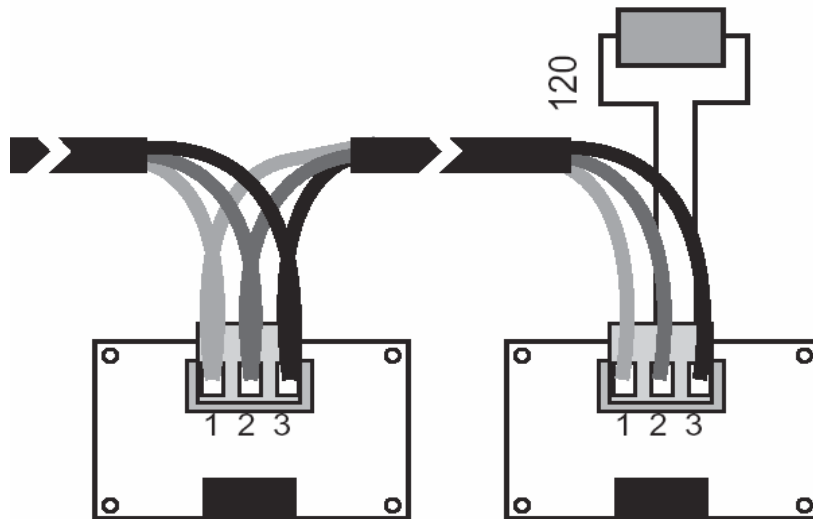

pin	significato <i>meaning</i>
1	GND
2	RX+/TX+
3	RX-/TX-

*Total Run hours/No of starts will be calculated as below *Total run hrs = Run hour H (45023) x 1000 + Run hour L (45024) *Total no of starts = Number of starts H (45019) x 1000 + Number of starts L (45020)