# Robbi V0.1 Wiring Diagram - ACE Builder

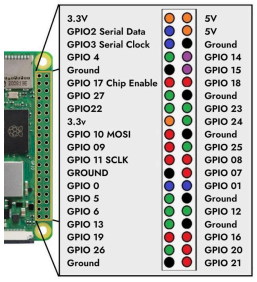


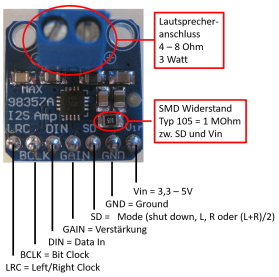


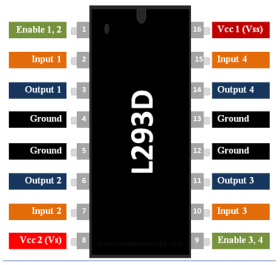


USB Mic connected via USB.

| Pin | Signal | Connected to | Pin | Signal | Connected to |
|---|---|---|---|---|---|
| 1 | 3V3 | LCD VCC & Max98357A SD | 2 | 5V | L293D $VCC_1$ & $VCC_2$ (logic & motor power) |
| 3 | GPIO2 | NC | 4 | 5V | Max98357A VIN |
| 5 | GPIO3 | NC | 6 | GND | Common ground (all modules)<br>MAX98357A GAIN |
| 7 | GPIO4 | Motor 1 $IN_2$ (L293D) | 8 | GPIO14 | NC |
| 9 | GND | Common ground | 10 | GPIO15 | NC |
| 11 | GPIO17 | Motor 1 $IN_1$ (L293D) | 12 | GPIO18 | Max98357A BCLK ($I^2S$ bit-clock) |
| 13 | GPIO27 | NC | 14 | GND | Common ground |
| 15 | GPIO22 | Motor 2 $IN_1$ (L293D) | 16 | GPIO23 | Motor 2 $IN_2$ (L293D) |
| 17 | 3V3 | LCD BLK (backlight) | 18 | GPIO24 | LCD RES (reset) |
| 19 | GPIO10 | LCD SDA (SPI MOSI) | 20 | GND | Common ground |
| 21 | GPIO9 | NC | 22 | GPIO25 | LCD DC (data/command) |
| 23 | GPIO11 | LCD SCL (SPI SCLK) | 24 | GPIO8 | LCD CS (SPI CE0) |
| 25 | GND | Common ground | 26 | GPIO7 | NC |
| 27 | GPIO0 | NC | 28 | GPIO1 | NC |
| 29 | GPIO5 | NC | 30 | GND | Common ground |
| 31 | GPIO6 | NC | 32 | GPIO12 | Motor 1 ENABLE (L293D PWM) |
| 33 | GPIO13 | Motor 2 ENABLE (L293D PWM) | 34 | GND | Common ground |
| 35 | GPIO19 | Max98357A LRC ($I^2S$ LRCLK) | 36 | GPIO16 | NC |
| 37 | GPIO26 | NC | 38 | GPIO20 | NC |
| 39 | GND | Common ground | 40 | GPIO21 | Max98357A DIN ($I^2S$ data-out) |