DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE; THE FACILITY OWNER'S QUALIFIED PROCEDURES AND APPLICABLE CODES GOVERN.

WO-300-02 — Pull, clean and test the tube bundle of E-103

Area	A300 Exchangers and drum	**Task**	XB Exchanger bundle pull, clean and tube-side test
Priority	2 (integrity)	**Issued by**	Facility owner (demonstration)
Primary asset	E-103 — E-103 shell-and-tube exchanger 36" ID × 192" — E 87'-0" N 25'-0" EL 106'-6"		
Equipment	E-103	**Lines**	4"-P150-CWS-3005, 4"-P150-CWR-3006, 6"-P300-P-1011, 6"-P300-P-1012, 1"-P150-V-6027, 1"-P150-D-6028, 3/4"-P300-I-6029
Isometrics	ISO-4"-P150-CWS-3005, ISO-4"-P150-CWR-3006, ISO-6"-P300-P-1011, ISO-6"-P300-P-1012, ISO-1"-P150-V-6027, ISO-1"-P150-D-6028, ISO-3/4"-P300-I-6029 (generated); owner's drawings ISO-CWS-3005, ISO-CWR-3006, ISO-P-1011, ISO-P-1012, ISO-V-6027, ISO-D-6028, ISO-I-6029		
Permits	General work permit, Confined-space entry permit, Lifting plan		

Reason

Fouling: tube bundle to be pulled, cleaned and tested.

Scope of work

1. Isolate E-103 per the isolation list (tube and shell sides); drain and vent.
2. Remove the channel cover; pull the tube bundle to the cleaning bay.
3. Clean the tubes and shell side; inspect visually; thickness at the TMLs.
4. Reinstall the bundle with new gaskets; tube-side hydrostatic test at 210 psi (SW-TEST-1).
5. Remove blinds; restore the line-up.

Affected items: E-103

Rules: SW-ITP-1, SW-ITP-2, SW-ITP-3, SW-TEST-1, SW-WO-1, SW-WO-2, SW-WO-3, SW-WO-5, SW-WO-6, SW-WO-7

Owner's isometric drawings (SW-IMP-6)

Drawing	Line drawn	Work line	Sheets	Match to the plant model
ISO-CWS-3005	4"-P150-CWS-3005	4"-P150-CWS-3005	1	0 error(s), 1 warning(s) — see below
ISO-CWR-3006	4"-P150-CWR-3006	4"-P150-CWR-3006	2	0 error(s), 2 warning(s) — see below
ISO-P-1011	6"-P300-P-1011	6"-P300-P-1011	2	0 error(s), 3 warning(s) — see below
ISO-P-1012	6"-P300-P-1012	6"-P300-P-1012	2	0 error(s), 2 warning(s) — see below
ISO-V-6027	1"-P150-V-6027	1"-P150-V-6027	1	agrees with the model
ISO-D-6028	1"-P150-D-6028	1"-P150-D-6028	1	agrees with the model
ISO-I-6029	3/4"-P300-I-6029	3/4"-P300-I-6029	1	agrees with the model

ISO-CWS-3005 (PDF): ../isometrics-imported/ISO-CWS-3005.pdf · ISO-CWR-3006 (PDF): ../isometrics-imported/ISO-CWR-3006.pdf · ISO-P-1011 (PDF): ../isometrics-imported/ISO-P-1011.pdf · ISO-P-1012 (PDF): ../isometrics-imported/ISO-P-1012.pdf · ISO-V-6027 (PDF): ../isometrics-imported/ISO-V-6027.pdf · ISO-D-6028 (PDF): ../isometrics-imported/ISO-D-6028.pdf · ISO-I-6029 (PDF): ../isometrics-imported/ISO-I-6029.pdf — the generated isometrics follow the ITP.

Drawing	Sheet	Level	Finding
ISO-CWS-3005	1	warning	weld 4"-P150-CWS-3005/W1 (E 86'-0" N 0" EL 123'-6 11/16", sheet 1) has no label
ISO-CWR-3006	2	warning	weld 4"-P150-CWR-3006/W9 (E 84'-5 5/16" N 25'-0" EL 126'-6", sheet 2) has no label
ISO-CWR-3006	2	warning	weld 4"-P150-CWR-3006/W12 (E 85'-0" N 1'-6" EL 125'-11 5/16", sheet 2) has no label
ISO-P-1011	2	warning	W14 (6"-P300-P-1011/W14, sheet 2) is labelled again on sheet 1; it is 162.0 in from the nearest break
ISO-P-1011	2	warning	weld 6"-P300-P-1011/W20 (E 89'-0" N 25'-0" EL 110'-2 1/2", sheet 2) has no label
ISO-P-1011	1	warning	branch weld 3/4"-P300-I-7011/W1 (E 68'-11" N 6" EL 120'-0", sheet 1) has no label
ISO-P-1012	2	warning	W10 (6"-P300-P-1012/W10, sheet 2) is labelled again on sheet 1; it is 70.5 in from the nearest break
ISO-P-1012	1	warning	branch weld 3/4"-P300-I-7012/W1 (E 99'-6" N 21'-0" EL 113'-11", sheet 1) has no label

Assets in the plant model (SW-WO-7)

Tag	Kind	Description	Line	Location
E-103	equipment	E-103 shell-and-tube exchanger 36" ID × 192"		E 87'-0" N 25'-0" EL 106'-6"
4"-P150-CWS-3005/B2	item	VALVE, GATE, WEDGE, OS&Y 4" P150	4"-P150-CWS-3005	E 86'-0" N 25'-0" EL 109'-3-13/16"
E-103-N1	nozzle	Nozzle E-103-N1 (tube in, 4" P150) on E-103		E 86'-0" N 25'-0" EL 108'-8-1/16"
4"-P150-CWR-3006/A2	item	VALVE, GATE, WEDGE, OS&Y 4" P150	4"-P150-CWR-3006	E 86'-0" N 25'-0" EL 103'-8-3/16"
E-103-N2	nozzle	Nozzle E-103-N2 (tube out, 4" P150) on E-103		E 86'-0" N 25'-0" EL 104'-3-15/16"

Tag	Kind	Description	Line	Location
6"-P300-P-1011/B2	item	VALVE, GATE, WEDGE, OS&Y 6" P300	6"-P300-P-1011	E 89'-0" N 25'-0" EL 109'-3-7/16"
E-103-N3	nozzle	Nozzle E-103-N3 (shell in, 6" P300) on E-103		E 89'-0" N 25'-0" EL 108'-8-5/16"
6"-P300-P-1012/A2	item	VALVE, GATE, WEDGE, OS&Y 6" P300	6"-P300-P-1012	E 101'-0" N 25'-0" EL 103'-8-9/16"
E-103-N4	nozzle	Nozzle E-103-N4 (shell out, 6" P300) on E-103		E 101'-0" N 25'-0" EL 104'-3-3/4"
1"-P150-V-6027/2	item	VALVE, BALL, FLOATING 1" P150	1"-P150-V-6027	E 100'-0" N 25'-0" EL 109'-1/2"
E-103-N5	nozzle	Nozzle E-103-N5 (vent, 1" P150) on E-103		E 100'-0" N 25'-0" EL 108'-5-11/16"
1"-P150-D-6028/2	item	VALVE, BALL, FLOATING 1" P150	1"-P150-D-6028	E 89'-0" N 25'-0" EL 103'-11-1/2"
E-103-N6	nozzle	Nozzle E-103-N6 (drain, 1" P150) on E-103		E 89'-0" N 25'-0" EL 104'-6-3/8"
3/4"-P300-I-6029/2	item	VALVE, BALL, FLOATING 3/4" P300	3/4"-P300-I-6029	E 95'-0" N 27'-6-1/4" EL 106'-6"
E-103-N7	nozzle	Nozzle E-103-N7 (instrument, 0.75" P300) on E-103		E 95'-0" N 26'-11-9/16" EL 106'-6"

Isolation list (SW-WO-3)

#	Kind	Tag	Line	Action	Location	Fitted ✓	Removed ✓
1	valve	4"-P150-CWS-3005/B2	4"-P150-CWS-3005	Close and lock VALVE, GATE, WEDGE, OS&Y 4" P150 (4"-P150-CWS-3005/B2) on E-103-N1	E 86'-0" N 25'-0" EL 109'-3-13/16"		
2	blind	E-103-N1	4"-P150-CWS-3005	Fit a blind between 4"-P150-CWS-3005/B2 and the nozzle flange E-103-N1	E 86'-0" N 25'-0" EL 108'-8-1/16"		
3	valve	4"-P150-CWR-3006/A2	4"-P150-CWR-3006	Close and lock VALVE, GATE, WEDGE, OS&Y 4" P150 (4"-P150-CWR-3006/A2) on E-103-N2	E 86'-0" N 25'-0" EL 103'-8-3/16"		
4	blind	E-103-N2	4"-P150-CWR-3006	Fit a blind between 4"-P150-CWR-3006/A2 and the nozzle flange E-103-N2	E 86'-0" N 25'-0" EL 104'-3-15/16"		
5	valve	6"-P300-P-1011/B2	6"-P300-P-1011	Close and lock VALVE, GATE, WEDGE, OS&Y 6" P300 (6"-P300-P-1011/B2) on E-103-N3	E 89'-0" N 25'-0" EL 109'-3-7/16"		
6	blind	E-103-N3	6"-P300-P-1011	Fit a blind between 6"-P300-P-1011/B2 and the nozzle flange E-103-N3	E 89'-0" N 25'-0" EL 108'-8-5/16"		
7	valve	6"-P300-P-1012/A2	6"-P300-P-1012	Close and lock VALVE, GATE, WEDGE, OS&Y 6" P300 (6"-P300-P-1012/A2) on E-103-N4	E 101'-0" N 25'-0" EL 103'-8-9/16"		
8	blind	E-103-N4	6"-P300-P-1012	Fit a blind between 6"-P300-P-1012/A2 and the nozzle flange E-103-N4	E 101'-0" N 25'-0" EL 104'-3-3/4"		
9	valve	1"-P150-V-6027/2	1"-P150-V-6027	Close and lock VALVE, BALL, FLOATING 1" P150 (1"-P150-V-6027/2) on E-103-N5	E 100'-0" N 25'-0" EL 109'-1/2"		
10	blind	E-103-N5	1"-P150-V-6027	Fit a blind between 1"-P150-V-6027/2 and the nozzle flange E-103-N5	E 100'-0" N 25'-0" EL 108'-5-11/16"		
11	valve	1"-P150-D-6028/2	1"-P150-D-6028	Close and lock VALVE, BALL, FLOATING 1" P150 (1"-P150-D-6028/2) on E-103-N6	E 89'-0" N 25'-0" EL 103'-11-1/2"		
12	blind	E-103-N6	1"-P150-D-6028	Fit a blind between 1"-P150-D-6028/2 and the nozzle flange E-103-N6	E 89'-0" N 25'-0" EL 104'-6-3/8"		
13	valve	3/4"-P300-I-6029/2	3/4"-P300-I-6029	Close and lock VALVE, BALL, FLOATING 3/4" P300 (3/4"-P300-I-6029/2) on E-103-N7	E 95'-0" N 27'-6-1/4" EL 106'-6"		
14	blind	E-103-N7	3/4"-P300-I-6029	Fit a blind between 3/4"-P300-I-6029/2 and the nozzle flange E-103-N7	E 95'-0" N 26'-11-9/16" EL 106'-6"		

Inspections

Id	Inspection	Criteria	Basis
WO-300-02-I1	Internal visual examination of the shell, channel and tube bundle	Findings recorded against the owner's integrity criteria	SW-NDE-4
WO-300-02-I2	Ultrasonic thickness at the 12 TMLs listed	Each reading above the owner's minimum wall	SW-WO-6

Thickness monitoring locations (SW-WO-6)

TML	Item	Location	Position	Nominal wall	R1	R2	R3	R4
WO-300-02-TML01	E-103	Nozzle neck E-103-N1	E 86'-0" N 25'-0" EL 108'-8-1/16"		top: ____	side: ____	bottom: ____	side: ____
WO-300-02-TML02	E-103	Nozzle neck E-103-N2	E 86'-0" N 25'-0" EL 104'-3-15/16"		top: ____	side: ____	bottom: ____	side: ____
WO-300-02-TML03	E-103	Nozzle neck E-103-N3	E 89'-0" N 25'-0" EL 108'-8-5/16"		top: ____	side: ____	bottom: ____	side: ____
WO-300-02-TML04	E-103	Nozzle neck E-103-N4	E 101'-0" N 25'-0" EL 104'-3-3/4"		top: ____	side: ____	bottom: ____	side: ____
WO-300-02-TML05	E-103	Nozzle neck E-103-N5	E 100'-0" N 25'-0" EL 108'-5-11/16"		top: ____	side: ____	bottom: ____	side: ____

TML	Item	Location	Position	Nominal wall	R1	R2	R3	R4
WO-300-02-TML06	E-103	Nozzle neck E-103-N6	E 89'-0" N 25'-0" EL 104'-6-3/8"		top: ____	side: ____	bottom: ____	side: ____
WO-300-02-TML07	E-103	Nozzle neck E-103-N7	E 95'-0" N 26'-11-9/16" EL 106'-6"		top: ____	side: ____	bottom: ____	side: ____
WO-300-02-TML08	E-103	Left head centre	E 86'-2-3/4" N 25'-0" EL 106'-6"		centre: ____			
WO-300-02-TML09	E-103	Right head centre	E 103'-9-1/4" N 25'-0" EL 106'-6"		centre: ____			
WO-300-02-TML10	E-103	Shell at 0.000" from the left tangent	E 87'-0" N 25'-0" EL 106'-6"		0°: ____	90°: ____	180°: ____	270°: ____
WO-300-02-TML11	E-103	Shell at 6'-0" from the left tangent	E 93'-0" N 25'-0" EL 106'-6"		0°: ____	90°: ____	180°: ____	270°: ____
WO-300-02-TML12	E-103	Shell at 12'-0" from the left tangent	E 99'-0" N 25'-0" EL 106'-6"		0°: ____	90°: ____	180°: ____	270°: ____

Test — Hydrostatic test (tube side)


Description	Tube side of the reinstalled bundle
Pressure	210 psi
Hold	30 minutes, no leak, no pressure drop
Basis	SW-TEST-1

Inspection and test plan (SW-ITP-1..3)

H hold · W witness · R review · S surveillance. Status: accepted / rejected / not applicable.

#	Activity	Reference	Acceptance	Record	Contr.	Owner	3rd party	Status	Signed (contr. / owner / 3rd)	Date	Remark
1	Work permit issued; isolation list (valves locked, blinds fitted) verified at zero pressure and drained	SW-WO-3, isolation list	Every isolation in place and tagged; zero pressure at the vent	Signed isolation certificate	H	H	—				
2	Equipment vented, purged and gas-tested for entry; confined-space entry permit issued	Owner entry procedure	Atmosphere safe for entry per owner limits	Gas test record, entry permit	H	H	—				
3	Channel cover removed; bundle pulled and cleaned	Owner procedure	Surfaces clean enough to inspect	Daily report	S	S	—				
4	Internal visual examination	SW-NDE-4	Findings recorded	Inspection report with photographs	W	H	W				
5	Ultrasonic thickness at 12 TMLs	SW-WO-6	Above the owner's minimum wall	Thickness record per TML	S	R	R				
6	Owner's decision on findings (repair, monitor or accept)	Owner integrity procedure	Decision recorded	Signed disposition	R	H	R				
7	Closed with new gaskets on every opened joint; studs to preload	SW-WO-5	Preload as stated	Bolt-up record	W	W	—				
8	Tube-side hydrostatic test at 210 psi, 30 minutes	SW-TEST-1	No leak, no pressure drop	Test record	H	H	H				
9	Blinds removed, isolations returned to normal line-up per the isolation list	SW-WO-3	Every blind removed and accounted for	Isolation certificate closed	H	H	—				
10	Records complete; work order handed back to operations	SW-ITP-3	All ITP activities accepted or not applicable	Signed ITP and completion record	H	H	R				

ISOMETRIC — 4"-P150-CWS-3005 — Pull, clean and test the tube bundle of E-103

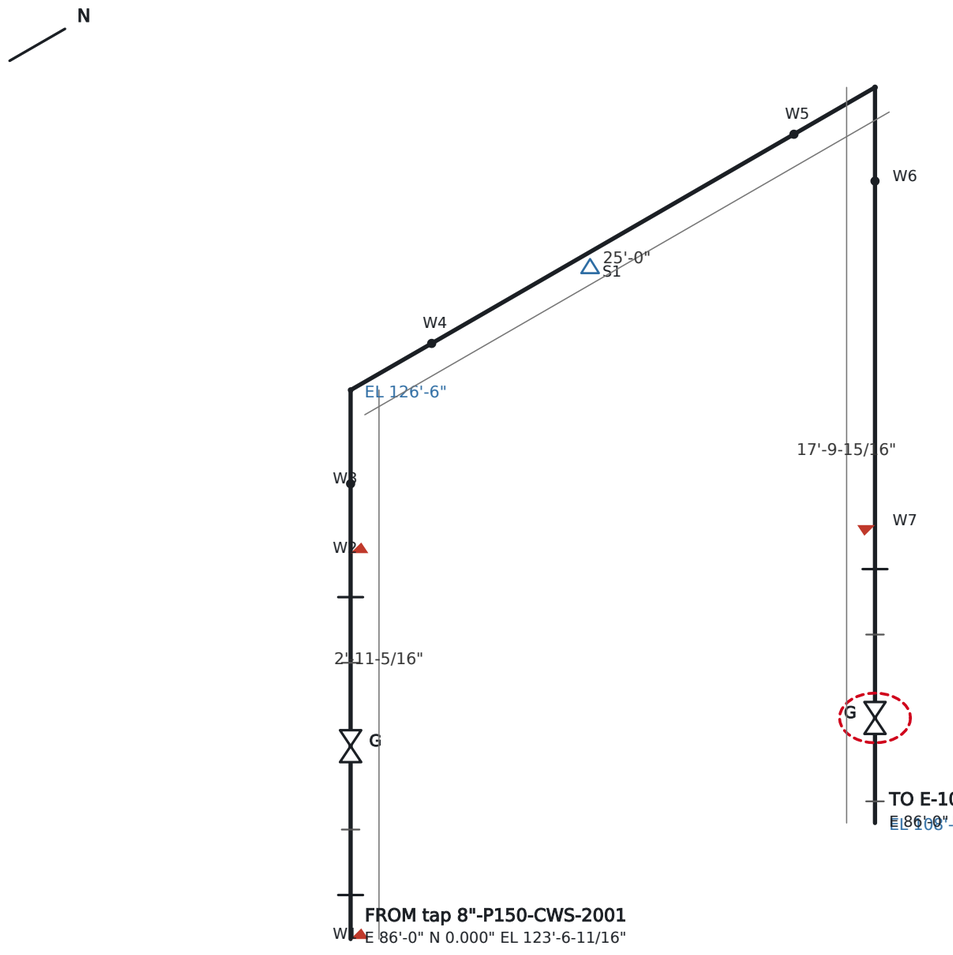

BILL OF MATERIALS

1	FLANGE WELD-NECK 4" P150 RAISED FACE	3
2	GASKET 4" P150 COMPRESSED SHEET	4
3	VALVE, GATE, WEDGE, OS&Y 4" P150	2
4	STUD SET 4 × 1" × 6-1/4" WITH 2 NUTS, FOR 4" P150	4
5	PIPE 4" P150 BEVELLED ENDS	39'-7-5/16"
6	ELBOW 90° R = 5/3 OD 4" P150	2

WELDS 7 (3 FIELD) · SUPPORTS 1 · SPOOLS 4

W1F W2F W3 W4 W5 W6 W7F

4"-P150-CWS-3005


CLASS W150 — Water (cooling and process)
SERVICE CWS · 4" · P150 · DESIGN 150 psi
tap 8"-P150-CWS-2001 → E-103-N1
PIPE 39'-7-5/16" · WEIGHT 693 lb

DWG ISO-4"-P150-CWS-3005 REV 0 WO-300-02

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 4"-P150-CWR-3006 — Pull, clean and test the tube bundle of E-103

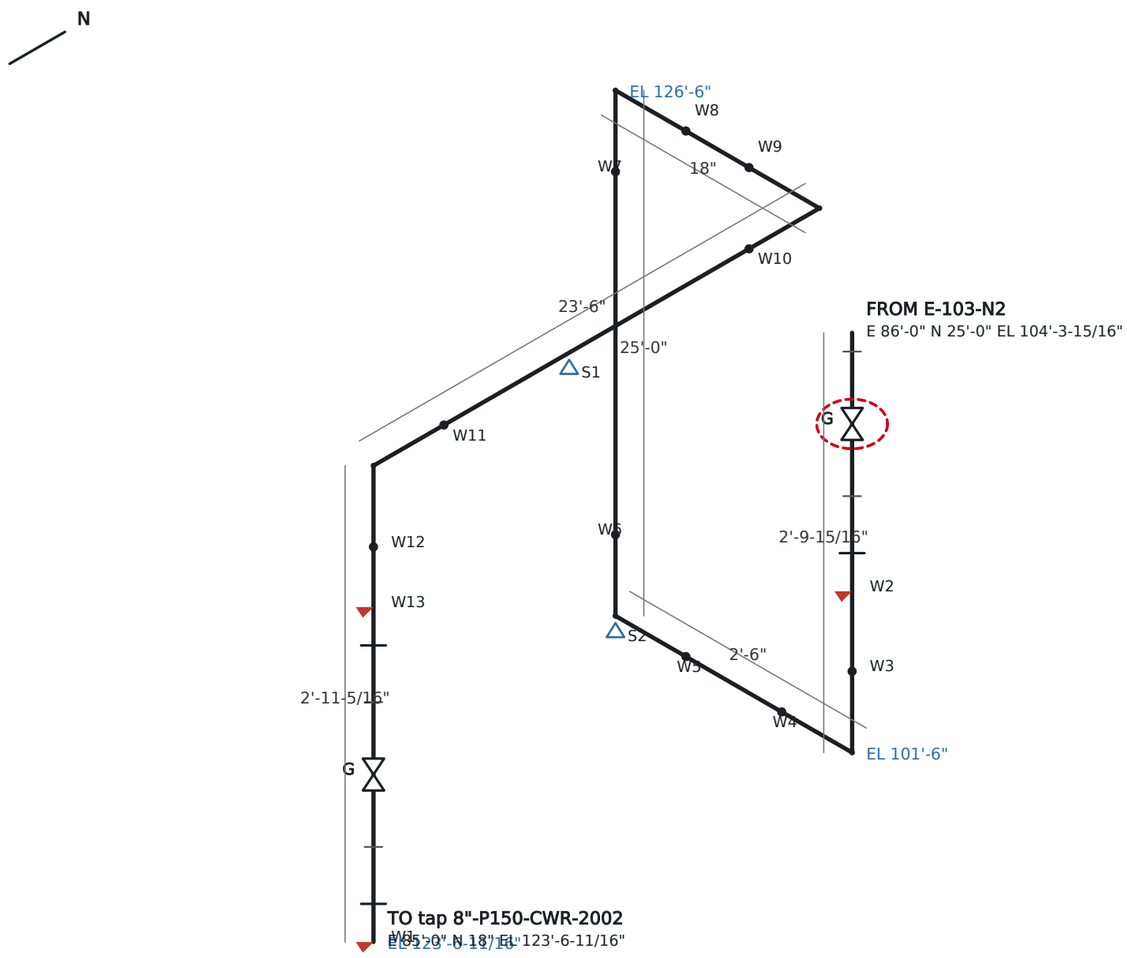

BILL OF MATERIALS

1	GASKET 4" P150 COMPRESSED SHEET	4
2	VALVE, GATE, WEDGE, OS&Y 4" P150	2
3	STUD SET 4 × 1" × 6-1/4" WITH 2 NUTS, FOR 4" P150	4
4	FLANGE WELD-NECK 4" P150 RAISED FACE	3
5	PIPE 4" P150 BEVELLED ENDS	48'-9-5/16"
6	ELBOW 90° R = 5/3 OD 4" P150	5

WELDS 13 (3 FIELD) · SUPPORTS 2 · SPOOLS 4

W1F W2F W3 W4 W5 W6 W7 W8 W9 W10
W11 W12 W13F

4"-P150-CWR-3006


CLASS W150 — Water (cooling and process)
SERVICE CWR · 4" · P150 · DESIGN 150 psi
E-103-N2 → tap 8"-P150-CWR-2002
PIPE 48'-9-5/16" · WEIGHT 783 lb

DWG ISO-4"-P150-CWR-3006 REV 0 WO-300-02

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 6"-P300-P-1011 — Pull, clean and test the tube bundle of E-103

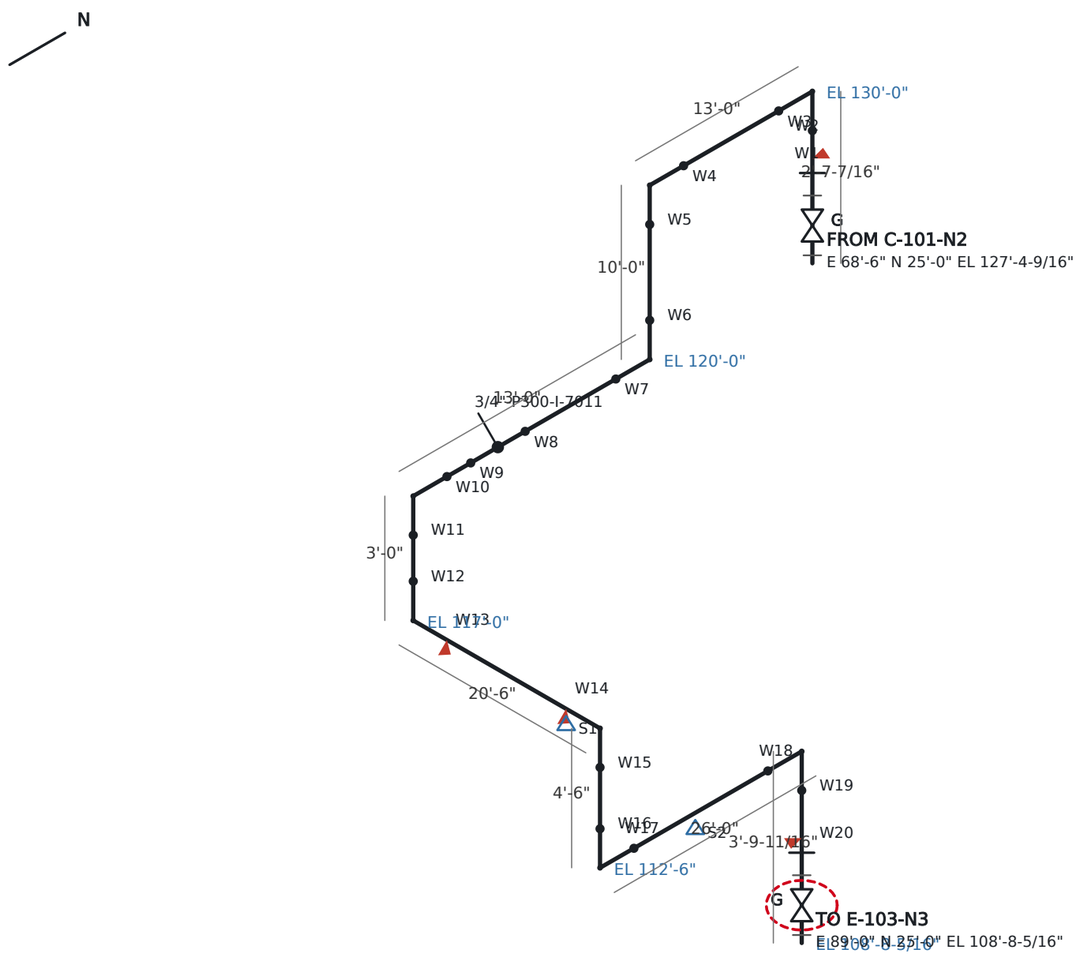

BILL OF MATERIALS

1	GASKET 6" P300 COMPRESSED SHEET	4
2	VALVE, GATE, WEDGE, OS&Y 6" P300	2
3	STUD SET 8 × 0.625" × 4" WITH 2 NUTS, FOR 6" P300	4
4	FLANGE WELD-NECK 6" P300 RAISED FACE	2
5	PIPE 6" P300 BEVELLED ENDS	79'-2-13/16"
6	ELBOW 90° R = 5/3 OD 6" P300	8
7	TEE REDUCING 6" × 3/4" P300	1

WELDS 20 (4 FIELD) · SUPPORTS 2 · SPOOLS 5

W1F W2 W3 W4 W5 W6 W7 W8 W9 W10
W11 W12 W13F W14F W15 W16 W17 W18 W19 W20F

6"-P300-P-1011


CLASS H300 — Hydrocarbon process
SERVICE P · 6" · P300 · DESIGN 300 psi
C-101-N2 → E-103-N3
PIPE 79'-2-13/16" · WEIGHT 1677 lb

DWG ISO-6"-P300-P-1011 REV 0 WO-300-02

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 6"-P300-P-1012 — Pull, clean and test the tube bundle of E-103

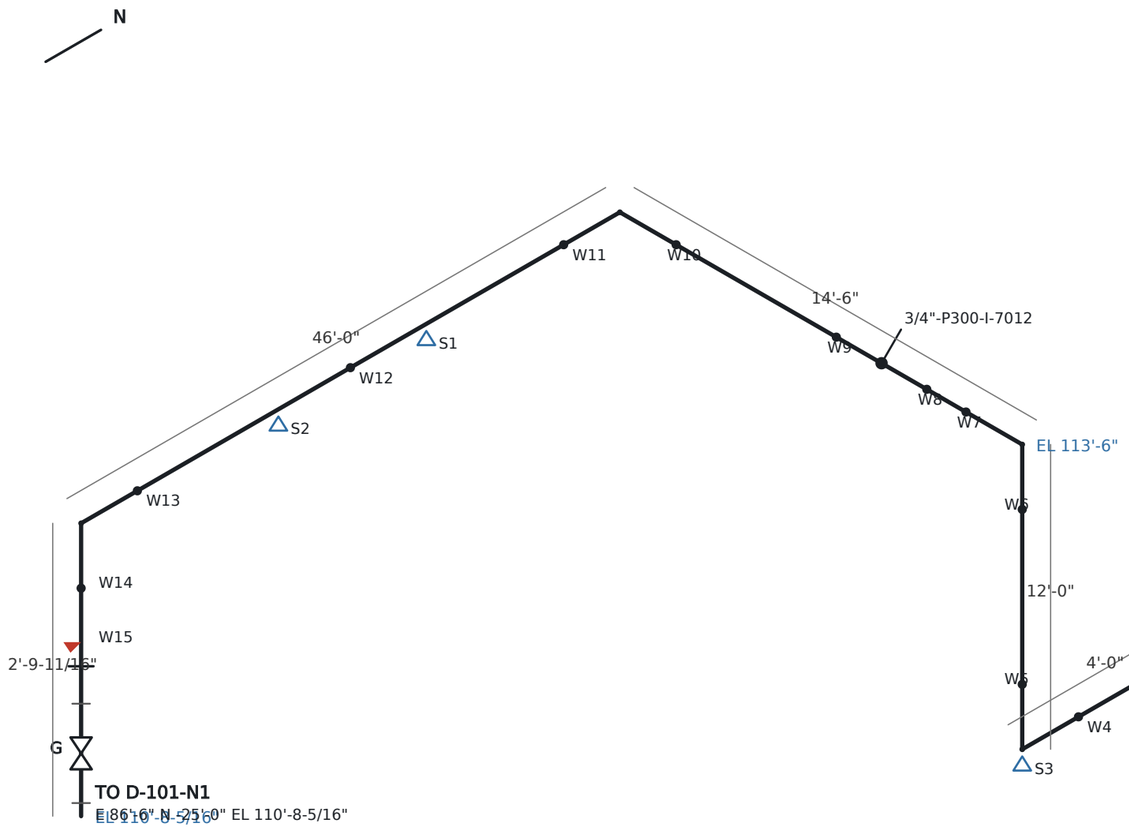

BILL OF MATERIALS

1	GASKET 6" P300 COMPRESSED SHEET	4
2	VALVE, GATE, WEDGE, OS&Y 6" P300	2
3	STUD SET 8 × 0.625" × 4" WITH 2 NUTS, FOR 6" P300	4
4	FLANGE WELD-NECK 6" P300 RAISED FACE	2
5	PIPE 6" P300 BEVELLED ENDS	69'-11-1/16"
6	ELBOW 90° R = 5/3 OD 6" P300	5
7	TEE REDUCING 6" × 3/4" P300	1

WELDS 15 (2 FIELD) · SUPPORTS 3 · SPOOLS 3

W1F W2 W3 W4 W5 W6 W7 W8 W9 W10
W11 W12 W13 W14 W15F

6"-P300-P-1012


CLASS H300 — Hydrocarbon process
SERVICE P · 6" · P300 · DESIGN 300 psi
E-103-N4 → D-101-N1
PIPE 69'-11-1/16" · WEIGHT 1498 lb

DWG ISO-6"-P300-P-1012 REV 0 WO-300-02

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 1"-P150-V-6027 — Pull, clean and test the tube bundle of E-103

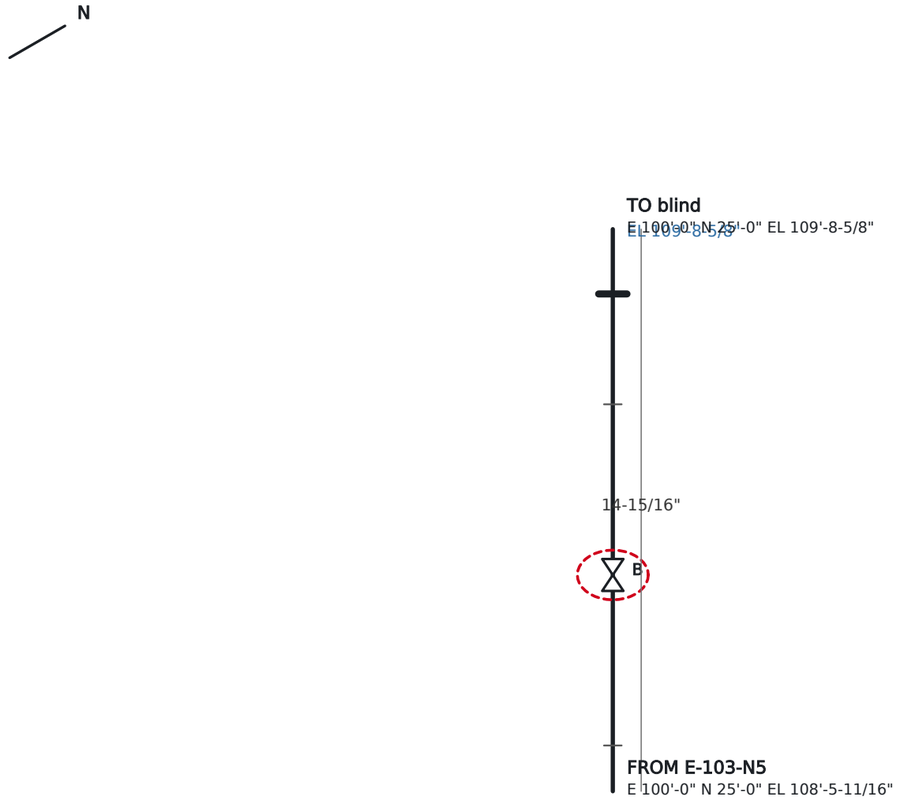

BILL OF MATERIALS

1	GASKET 1" P150 COMPRESSED SHEET	2
2	VALVE, BALL, FLOATING 1" P150	1
3	STUD SET 4 × 0.5" × 4" WITH 2 NUTS, FOR 1" P150	2
4	FLANGE BLIND 1" P150 RAISED FACE	1

WELDS 0 (0 FIELD) · SUPPORTS 0 · SPOOLS 0

1"-P150-V-6027


CLASS H150 — Hydrocarbon process
SERVICE V · 1" · P150 · DESIGN 150 psi
E-103-N5 → blind
PIPE 0.000" · WEIGHT 39 lb

DWG ISO-1"-P150-V-6027 REV 0 WO-300-02

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 1"-P150-D-6028 — Pull, clean and test the tube bundle of E-103

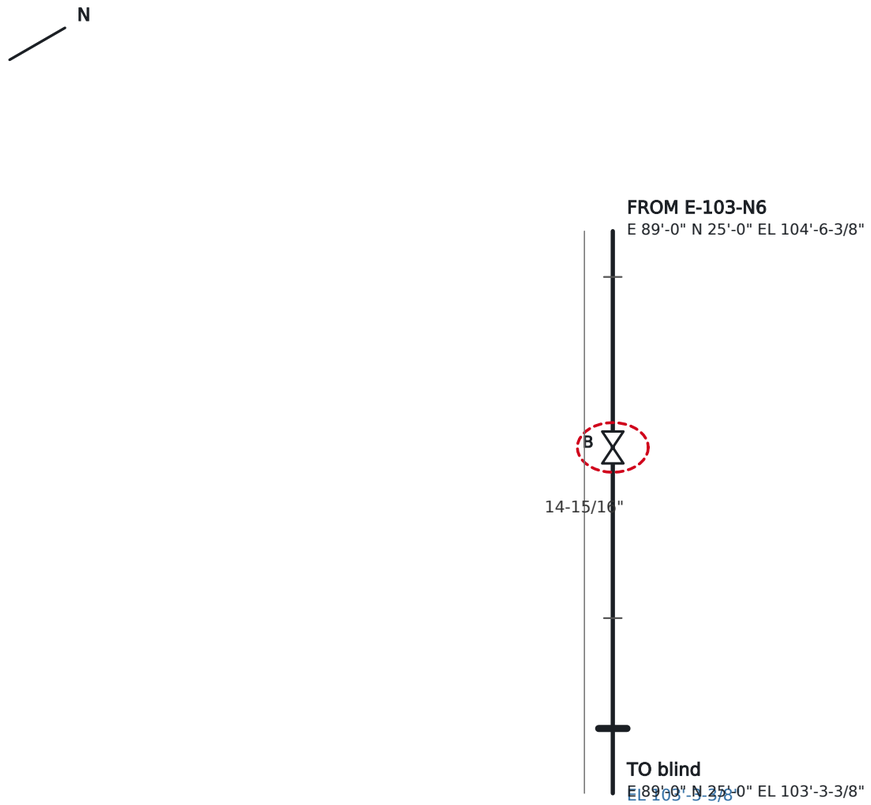

BILL OF MATERIALS

1	GASKET 1" P150 COMPRESSED SHEET	2
2	VALVE, BALL, FLOATING 1" P150	1
3	STUD SET 4 × 0.5" × 4" WITH 2 NUTS, FOR 1" P150	2
4	FLANGE BLIND 1" P150 RAISED FACE	1

WELDS 0 (0 FIELD) · SUPPORTS 0 · SPOOLS 0

1"-P150-D-6028


CLASS H150 — Hydrocarbon process
SERVICE D · 1" · P150 · DESIGN 150 psi
E-103-N6 → blind
PIPE 0.000" · WEIGHT 39 lb

DWG ISO-1"-P150-D-6028 REV 0 WO-300-02

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 3/4"-P300-I-6029 — Pull, clean and test the tube bundle of E-103

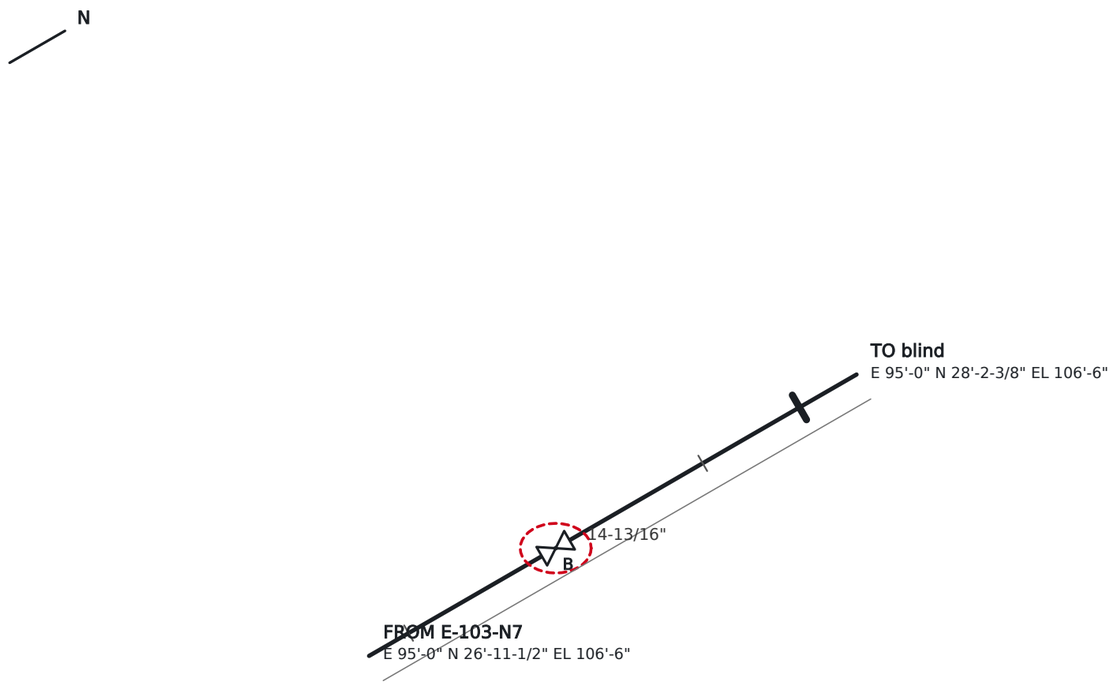

BILL OF MATERIALS

1	GASKET 3/4" P300 COMPRESSED SHEET	2
2	VALVE, BALL, FLOATING 3/4" P300	1
3	STUD SET 4 × 0.5" × 4-1/4" WITH 2 NUTS, FOR 3/4" P300	2
4	FLANGE BLIND 3/4" P300 RAISED FACE	1

WELDS 0 (0 FIELD) · SUPPORTS 0 · SPOOLS 0

3/4"-P300-I-6029

CLASS H300 — Hydrocarbon process
SERVICE I · 0.75" · P300 · DESIGN 300 psi
E-103-N7 → blind
PIPE 0.000" · WEIGHT 32 lb

DWG ISO-3/4"-P300-I-6029 REV 0 WO-300-02

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

Notices

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE; THE FACILITY OWNER'S QUALIFIED PROCEDURES AND APPLICABLE CODES GOVERN.

This document embeds a subset of the DejaVu Sans font (SW-LIC-3), renamed under its licence. DejaVu Sans (assets/fonts/DejaVuSans.ttf), from the DejaVu fonts 2.37 as packaged in the build environment.

Copyright (c) 2003 by Bitstream, Inc. All Rights Reserved. Bitstream Vera is a trademark of Bitstream, Inc.
DejaVu changes are in public domain.

Permission is hereby granted, free of charge, to any person obtaining a copy
of the fonts accompanying this license ("Fonts") and associated
documentation files (the "Font Software"), to reproduce and distribute the
Font Software, including without limitation the rights to use, copy, merge,
publish, distribute, and/or sell copies of the Font Software, and to permit
persons to whom the Font Software is furnished to do so, subject to the
following conditions:

The above copyright and trademark notices and this permission notice shall
be included in all copies of one or more of the Font Software typefaces.

The Font Software may be modified, altered, or added to, and in particular
the designs of glyphs or characters in the Fonts may be modified and
additional glyphs or characters may be added to the Fonts, only if the fonts
are renamed to names not containing either the words "Bitstream" or the word
"Vera".

This License becomes null and void to the extent applicable to Fonts or Font
Software that has been modified and is distributed under the "Bitstream
Vera" names.

The Font Software may be sold as part of a larger software package but no
copy of one or more of the Font Software typefaces may be sold by itself.

THE FONT SOFTWARE IS PROVIDED "AS IS", WITHOUT WARRANTY OF ANY KIND, EXPRESS
OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY WARRANTIES OF MERCHANTABILITY,
FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT OF COPYRIGHT, PATENT,
TRADEMARK, OR OTHER RIGHT. IN NO EVENT SHALL BITSTREAM OR THE GNOME
FOUNDATION BE LIABLE FOR ANY CLAIM, DAMAGES OR OTHER LIABILITY, INCLUDING
ANY GENERAL, SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES,
WHETHER IN AN ACTION OF CONTRACT, TORT OR OTHERWISE, ARISING FROM, OUT OF
THE USE OR INABILITY TO USE THE FONT SOFTWARE OR FROM OTHER DEALINGS IN THE
FONT SOFTWARE.

Except as contained in this notice, the names of Gnome, the Gnome
Foundation, and Bitstream Inc., shall not be used in advertising or
otherwise to promote the sale, use or other dealings in this Font Software
without prior written authorization from the Gnome Foundation or Bitstream
Inc., respectively. For further information, contact: fonts at gnome dot
org.