DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE; THE FACILITY OWNER'S QUALIFIED PROCEDURES AND APPLICABLE CODES GOVERN.

WO-300-03 — Internal inspection of horizontal drum D-101

Area	A300 Exchangers and drum	**Task**	VI Internal inspection
Priority	2 (integrity)	**Issued by**	Facility owner (demonstration)
Primary asset	D-101 — D-101 horizontal vessel 60" ID × 180" — E 84'-0" N -25'-0" EL 107'-6"		
Equipment	D-101	**Lines**	6"-P300-P-1012, 4"-P300-P-1013, 1"-P150-V-6016, 1"-P150-D-6017, 1"-P150-N-3014, 3/4"-P300-I-6018, 3/4"-P300-I-6019, 3/4"-P300-SP-6020
Isometrics	ISO-6"-P300-P-1012, ISO-4"-P300-P-1013, ISO-1"-P150-V-6016, ISO-1"-P150-D-6017, ISO-1"-P150-N-3014, ISO-3/4"-P300-I-6018, ISO-3/4"-P300-I-6019, ISO-3/4"-P300-SP-6020 (generated); owner's drawings ISO-P-1012, ISO-P-1013, ISO-V-6016, ISO-D-6017, ISO-N-3014, ISO-I-6018, ISO-I-6019, ISO-SP-6020		
Permits	General work permit, Confined-space entry permit		

Reason

Scheduled internal inspection of the drum.

Scope of work

1. Isolate D-101 per the isolation list; drain, vent, purge and gas-test for entry.
2. Open for entry; clean as needed for inspection.
3. Internal visual examination; ultrasonic thickness at the 14 TMLs.
4. Close with new gaskets on every opened joint; remove blinds; restore the line-up.

Affected items: D-101

Rules: SW-ITP-1, SW-ITP-2, SW-ITP-3, SW-TEST-2, SW-WO-1, SW-WO-2, SW-WO-3, SW-WO-5, SW-WO-6, SW-WO-7

Owner's isometric drawings (SW-IMP-6)

Drawing	Line drawn	Work line	Sheets	Match to the plant model
ISO-P-1012	6"-P300-P-1012	6"-P300-P-1012	2	0 error(s), 2 warning(s) — see below
ISO-P-1013	4"-P300-P-1013	4"-P300-P-1013	5	2 error(s), 7 warning(s) — see below
ISO-V-6016	1"-P150-V-6016	1"-P150-V-6016	1	agrees with the model
ISO-D-6017	1"-P150-D-6017	1"-P150-D-6017	1	agrees with the model
ISO-N-3014	1"-P150-N-3014	1"-P150-N-3014	1	agrees with the model
ISO-I-6018	3/4"-P300-I-6018	3/4"-P300-I-6018	1	agrees with the model
ISO-I-6019	3/4"-P300-I-6019	3/4"-P300-I-6019	1	agrees with the model
ISO-SP-6020	3/4"-P300-SP-6020	3/4"-P300-SP-6020	1	agrees with the model

ISO-P-1012 (PDF): ../isometrics-imported/ISO-P-1012.pdf · ISO-P-1013 (PDF): ../isometrics-imported/ISO-P-1013.pdf · ISO-V-6016 (PDF): ../isometrics-imported/ISO-V-6016.pdf · ISO-D-6017 (PDF): ../isometrics-imported/ISO-D-6017.pdf · ISO-N-3014 (PDF): ../isometrics-imported/ISO-N-3014.pdf · ISO-I-6018 (PDF): ../isometrics-imported/ISO-I-6018.pdf · ISO-I-6019 (PDF): ../isometrics-imported/ISO-I-6019.pdf · ISO-SP-6020 (PDF): ../isometrics-imported/ISO-SP-6020.pdf — the generated isometrics follow the ITP.

Drawing	Sheet	Level	Finding
ISO-P-1012	2	warning	W10 (6"-P300-P-1012/W10, sheet 2) is labelled again on sheet 1; it is 70.5 in from the nearest break
ISO-P-1012	1	warning	branch weld 3/4"-P300-I-7012/W1 (E 99'-6" N 21'-0" EL 113'-11", sheet 1) has no label
ISO-P-1013	4	error	sheet 4: CONT'D ON ISO-P-1013 SH 5 prints E 174'-0" N -10'-3 13/16" EL 102'-0" for E 174'-0" N -9'-8 3/16" EL 102'-0": the minus sign applies to the feet only; read as written the point is 7.62 in away (still on the centreline, at the wrong place along it)
ISO-P-1013	5	error	sheet 5: CONT'D FROM ISO-P-1013 SH 4 prints E 174'-0" N -10'-3 13/16" EL 102'-0" for E 174'-0" N -9'-8 3/16" EL 102'-0": the minus sign applies to the feet only; read as written the point is 7.62 in away (still on the centreline, at the wrong place along it)
ISO-P-1013	2	warning	weld 4"-P300-P-1013/W11 (E 98'-6 11/16" N 4'-0" EL 116'-6", sheet 2) has no label
ISO-P-1013	3	warning	weld 4"-P300-P-1013/W16 (E 172'-9 5/16" N 4'-0" EL 116'-6", sheet 3) has no label
ISO-P-1013	4	warning	W17 (4"-P300-P-1013/W17, sheet 4) is labelled again on sheet 3; it is 4.0 in from the nearest break
ISO-P-1013	4	warning	W18 (4"-P300-P-1013/W18, sheet 4) is labelled again on sheet 3; it is 17.4 in from the nearest break
ISO-P-1013	3	warning	branch weld 3/4"-P300-I-7034/W1 (E 171'-6" N 4'-0" EL 116'-9 5/16", sheet 3) has no label
ISO-P-1013	3	warning	branch weld 3/4"-P300-I-7013/W1 (E 172'-6" N 4'-0" EL 116'-9 5/16", sheet 3) has no label
ISO-P-1013	5	warning	TO label 'P-103A NOZ. S' is not on the drawing

Assets in the plant model (SW-WO-7)

Tag	Kind	Description	Line	Location
D-101	equipment	D-101 horizontal vessel 60" ID × 180"		E 84'-0" N -25'-0" EL 107'-6"
6"-P300-P-1012/B2	item	VALVE, GATE, WEDGE, OS&Y 6" P300	6"-P300-P-1012	E 86'-6" N -25'-0" EL 111'-3-7/16"

Tag	Kind	Description	Line	Location
D-101-N1	nozzle	Nozzle D-101-N1 (inlet, 6" P300) on D-101		E 86'-6" N -25'-0" EL 110'-8-5/16"
4"-P300-P-1013/A2	item	VALVE, GATE, WEDGE, OS&Y 4" P300	4"-P300-P-1013	E 98'-0" N -25'-0" EL 103'-8-3/16"
D-101-N2	nozzle	Nozzle D-101-N2 (outlet, 4" P300) on D-101		E 98'-0" N -25'-0" EL 104'-3-15/16"
3"-P300-RV-4001/2	item	VALVE, PRESSURE SAFETY VALVE 3" P300 INLET × 4" P150 OUTLET	3"-P300-RV-4001	E 94'-0" N -25'-0" EL 111'-6"
1"-P150-V-6016/2	item	VALVE, BALL, FLOATING 1" P150	1"-P150-V-6016	E 89'-0" N -25'-0" EL 111'-1/2"
D-101-N4	nozzle	Nozzle D-101-N4 (vent, 1" P150) on D-101		E 89'-0" N -25'-0" EL 110'-5-11/16"
1"-P150-D-6017/2	item	VALVE, BALL, FLOATING 1" P150	1"-P150-D-6017	E 85'-6" N -25'-0" EL 103'-11-1/2"
D-101-N5	nozzle	Nozzle D-101-N5 (drain, 1" P150) on D-101		E 85'-6" N -25'-0" EL 104'-6-3/8"
1"-P150-N-3014/B2	item	VALVE, BALL, FLOATING 1" P150	1"-P150-N-3014	E 91'-6" N -25'-0" EL 111'-1/2"
D-101-N6	nozzle	Nozzle D-101-N6 (nitrogen, 1" P150) on D-101		E 91'-6" N -25'-0" EL 110'-5-11/16"
3/4"-P300-I-6018/2	item	VALVE, BALL, FLOATING 3/4" P300	3/4"-P300-I-6018	E 91'-6" N -28'-6-1/4" EL 107'-6"
D-101-N7	nozzle	Nozzle D-101-N7 (instrument, 0.75" P300) on D-101		E 91'-6" N -27'-11-1/2" EL 107'-6"
3/4"-P300-I-6019/2	item	VALVE, BALL, FLOATING 3/4" P300	3/4"-P300-I-6019	E 95'-0" N -28'-6-1/4" EL 107'-6"
D-101-N8	nozzle	Nozzle D-101-N8 (instrument, 0.75" P300) on D-101		E 95'-0" N -27'-11-1/2" EL 107'-6"
3/4"-P300-SP-6020/2	item	VALVE, BALL, FLOATING 3/4" P300	3/4"-P300-SP-6020	E 93'-0" N -25'-0" EL 103'-11-3/4"
D-101-N9	nozzle	Nozzle D-101-N9 (sample, 0.75" P300) on D-101		E 93'-0" N -25'-0" EL 104'-6-1/2"

Isolation list (SW-WO-3)

#	Kind	Tag	Line	Action	Location	Fitted ✓	Removed ✓
1	valve	6"-P300-P-1012/B2	6"-P300-P-1012	Close and lock VALVE, GATE, WEDGE, OS&Y 6" P300 (6"-P300-P-1012/B2) on D-101-N1	E 86'-6" N -25'-0" EL 111'-3-7/16"		
2	blind	D-101-N1	6"-P300-P-1012	Fit a blind between 6"-P300-P-1012/B2 and the nozzle flange D-101-N1	E 86'-6" N -25'-0" EL 110'-8-5/16"		
3	valve	4"-P300-P-1013/A2	4"-P300-P-1013	Close and lock VALVE, GATE, WEDGE, OS&Y 4" P300 (4"-P300-P-1013/A2) on D-101-N2	E 98'-0" N -25'-0" EL 103'-8-3/16"		
4	blind	D-101-N2	4"-P300-P-1013	Fit a blind between 4"-P300-P-1013/A2 and the nozzle flange D-101-N2	E 98'-0" N -25'-0" EL 104'-3-15/16"		
5	removal	3"-P300-RV-4001/2	3"-P300-RV-4001	Remove the relief valve on D-101-N3 and blind the nozzle			
6	valve	1"-P150-V-6016/2	1"-P150-V-6016	Close and lock VALVE, BALL, FLOATING 1" P150 (1"-P150-V-6016/2) on D-101-N4	E 89'-0" N -25'-0" EL 111'-1/2"		
7	blind	D-101-N4	1"-P150-V-6016	Fit a blind between 1"-P150-V-6016/2 and the nozzle flange D-101-N4	E 89'-0" N -25'-0" EL 110'-5-11/16"		
8	valve	1"-P150-D-6017/2	1"-P150-D-6017	Close and lock VALVE, BALL, FLOATING 1" P150 (1"-P150-D-6017/2) on D-101-N5	E 85'-6" N -25'-0" EL 103'-11-1/2"		
9	blind	D-101-N5	1"-P150-D-6017	Fit a blind between 1"-P150-D-6017/2 and the nozzle flange D-101-N5	E 85'-6" N -25'-0" EL 104'-6-3/8"		
10	valve	1"-P150-N-3014/B2	1"-P150-N-3014	Close and lock VALVE, BALL, FLOATING 1" P150 (1"-P150-N-3014/B2) on D-101-N6	E 91'-6" N -25'-0" EL 111'-1/2"		
11	blind	D-101-N6	1"-P150-N-3014	Fit a blind between 1"-P150-N-3014/B2 and the nozzle flange D-101-N6	E 91'-6" N -25'-0" EL 110'-5-11/16"		
12	valve	3/4"-P300-I-6018/2	3/4"-P300-I-6018	Close and lock VALVE, BALL, FLOATING 3/4" P300 (3/4"-P300-I-6018/2) on D-101-N7	E 91'-6" N -28'-6-1/4" EL 107'-6"		
13	blind	D-101-N7	3/4"-P300-I-6018	Fit a blind between 3/4"-P300-I-6018/2 and the nozzle flange D-101-N7	E 91'-6" N -27'-11-1/2" EL 107'-6"		
14	valve	3/4"-P300-I-6019/2	3/4"-P300-I-6019	Close and lock VALVE, BALL, FLOATING 3/4" P300 (3/4"-P300-I-6019/2) on D-101-N8	E 95'-0" N -28'-6-1/4" EL 107'-6"		
15	blind	D-101-N8	3/4"-P300-I-6019	Fit a blind between 3/4"-P300-I-6019/2 and the nozzle flange D-101-N8	E 95'-0" N -27'-11-1/2" EL 107'-6"		
16	valve	3/4"-P300-SP-6020/2	3/4"-P300-SP-6020	Close and lock VALVE, BALL, FLOATING 3/4" P300 (3/4"-P300-SP-6020/2) on D-101-N9	E 93'-0" N -25'-0" EL 103'-11-3/4"		
17	blind	D-101-N9	3/4"-P300-SP-6020	Fit a blind between 3/4"-P300-SP-6020/2 and the nozzle flange D-101-N9	E 93'-0" N -25'-0" EL 104'-6-1/2"		

Inspections

Id	Inspection	Criteria	Basis
WO-300-03-I1	Internal visual examination of the shell, heads and nozzles	Findings recorded against the owner's integrity criteria	SW-NDE-4
WO-300-03-I2	Ultrasonic thickness at the 14 TMLs listed	Each reading above the owner's minimum wall	SW-WO-6

Thickness monitoring locations (SW-WO-6)

TML	Item	Location	Position	Nominal wall	R1	R2	R3	R4
WO-300-03-TML01	D-101	Nozzle neck D-101-N1	E 86'-6" N -25'-0" EL 110'-8-5/16"		top: ____	side: ____	bottom: ____	side: ____
WO-300-03-TML02	D-101	Nozzle neck D-101-N2	E 98'-0" N -25'-0" EL 104'-3-15/16"		top: ____	side: ____	bottom: ____	side: ____
WO-300-03-TML03	D-101	Nozzle neck D-101-N3	E 94'-0" N -25'-0" EL 110'-10-5/16"		top: ____	side: ____	bottom: ____	side: ____
WO-300-03-TML04	D-101	Nozzle neck D-101-N4	E 89'-0" N -25'-0" EL 110'-5-11/16"		top: ____	side: ____	bottom: ____	side: ____
WO-300-03-TML05	D-101	Nozzle neck D-101-N5	E 85'-6" N -25'-0" EL 104'-6-3/8"		top: ____	side: ____	bottom: ____	side: ____
WO-300-03-TML06	D-101	Nozzle neck D-101-N6	E 91'-6" N -25'-0" EL 110'-5-11/16"		top: ____	side: ____	bottom: ____	side: ____
WO-300-03-TML07	D-101	Nozzle neck D-101-N7	E 91'-6" N -27'-11-1/2" EL 107'-6"		top: ____	side: ____	bottom: ____	side: ____
WO-300-03-TML08	D-101	Nozzle neck D-101-N8	E 95'-0" N -27'-11-1/2" EL 107'-6"		top: ____	side: ____	bottom: ____	side: ____
WO-300-03-TML09	D-101	Nozzle neck D-101-N9	E 93'-0" N -25'-0" EL 104'-6-1/2"		top: ____	side: ____	bottom: ____	side: ____
WO-300-03-TML10	D-101	Left head centre	E 82'-8-3/4" N -25'-0" EL 107'-6"		centre: ____			
WO-300-03-TML11	D-101	Right head centre	E 100'-3-1/4" N -25'-0" EL 107'-6"		centre: ____			
WO-300-03-TML12	D-101	Shell at 0.000" from the left tangent	E 84'-0" N -25'-0" EL 107'-6"		0°: ____	90°: ____	180°: ____	270°: ____
WO-300-03-TML13	D-101	Shell at 6'-0" from the left tangent	E 90'-0" N -25'-0" EL 107'-6"		0°: ____	90°: ____	180°: ____	270°: ____
WO-300-03-TML14	D-101	Shell at 12'-0" from the left tangent	E 96'-0" N -25'-0" EL 107'-6"		0°: ____	90°: ____	180°: ____	270°: ____

Test — Service leak test


Description	Every opened joint checked at operating pressure on start-up
Basis	SW-TEST-2

Inspection and test plan (SW-ITP-1..3)

H hold · W witness · R review · S surveillance. Status: accepted / rejected / not applicable.

#	Activity	Reference	Acceptance	Record	Contr.	Owner	3rd party	Status	Signed (contr. / owner / 3rd)	Date	Remark
1	Work permit issued; isolation list (valves locked, blinds fitted) verified at zero pressure and drained	SW-WO-3, isolation list	Every isolation in place and tagged; zero pressure at the vent	Signed isolation certificate	H	H	—				
2	Equipment vented, purged and gas-tested for entry; confined-space entry permit issued	Owner entry procedure	Atmosphere safe for entry per owner limits	Gas test record, entry permit	H	H	—				
3	Opened for entry; cleaned for inspection	Owner procedure	Surfaces clean enough to inspect	Daily report	S	S	—				
4	Internal visual examination	SW-NDE-4	Findings recorded	Inspection report with photographs	W	H	W				
5	Ultrasonic thickness at 14 TMLs	SW-WO-6	Above the owner's minimum wall	Thickness record per TML	S	R	R				
6	Owner's decision on findings (repair, monitor or accept)	Owner integrity procedure	Decision recorded	Signed disposition	R	H	R				
7	Closed with new gaskets on every opened joint; studs to preload	SW-WO-5	Preload as stated	Bolt-up record	W	W	—				
8	Service leak test of opened joints on start-up	SW-TEST-2	No leak	Leak test record	W	W	—				
9	Blinds removed, isolations returned to normal line-up per the isolation list	SW-WO-3	Every blind removed and accounted for	Isolation certificate closed	H	H	—				
10	Records complete; work order handed back to operations	SW-ITP-3	All ITP activities accepted or not applicable	Signed ITP and completion record	H	H	R				

ISOMETRIC — 6"-P300-P-1012 — Internal inspection of horizontal drum D-101

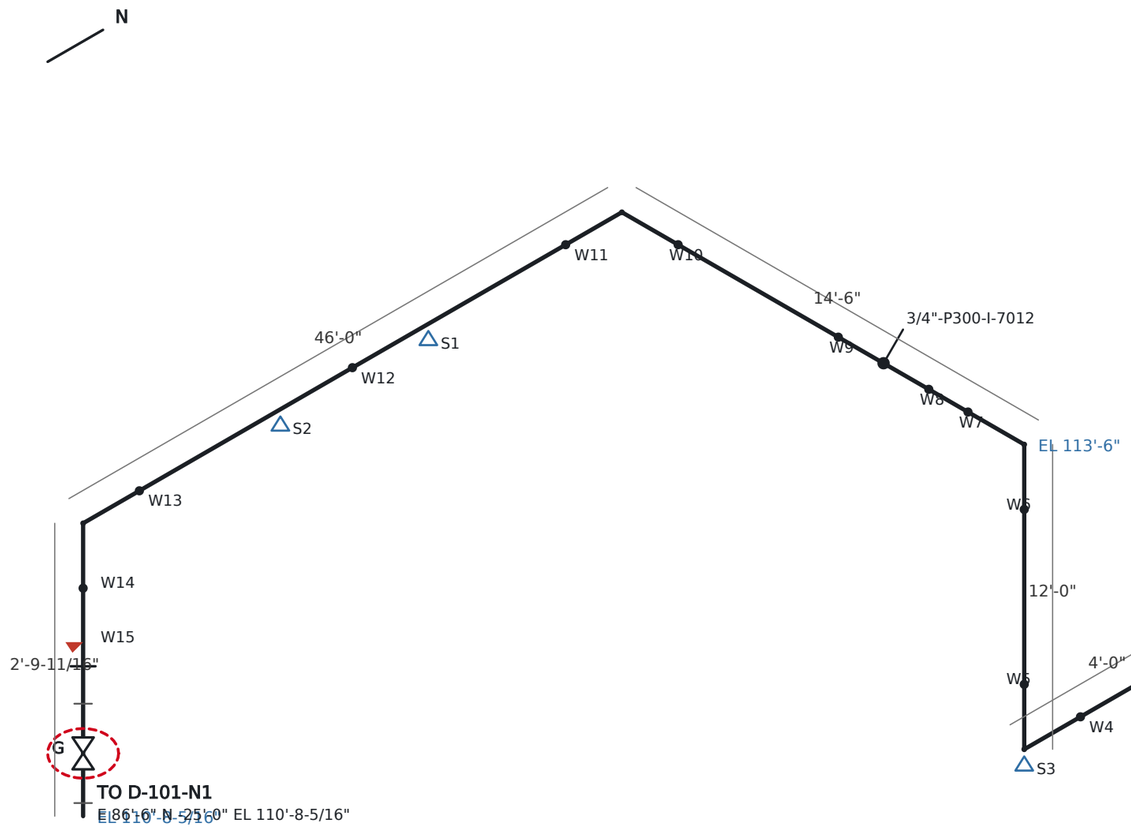

BILL OF MATERIALS

1	GASKET 6" P300 COMPRESSED SHEET	4
2	VALVE, GATE, WEDGE, OS&Y 6" P300	2
3	STUD SET 8 × 0.625" × 4" WITH 2 NUTS, FOR 6" P300	4
4	FLANGE WELD-NECK 6" P300 RAISED FACE	2
5	PIPE 6" P300 BEVELLED ENDS	69'-11-1/16"
6	ELBOW 90° R = 5/3 OD 6" P300	5
7	TEE REDUCING 6" × 3/4" P300	1

WELDS 15 (2 FIELD) · SUPPORTS 3 · SPOOLS 3

W1F W2 W3 W4 W5 W6 W7 W8 W9 W10
W11 W12 W13 W14 W15F

6"-P300-P-1012


CLASS H300 — Hydrocarbon process
SERVICE P · 6" · P300 · DESIGN 300 psi
E-103-N4 → D-101-N1
PIPE 69'-11-1/16" · WEIGHT 1498 lb

DWG ISO-6"-P300-P-1012 REV 0 WO-300-03

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 4"-P300-P-1013 — Internal inspection of horizontal drum D-101

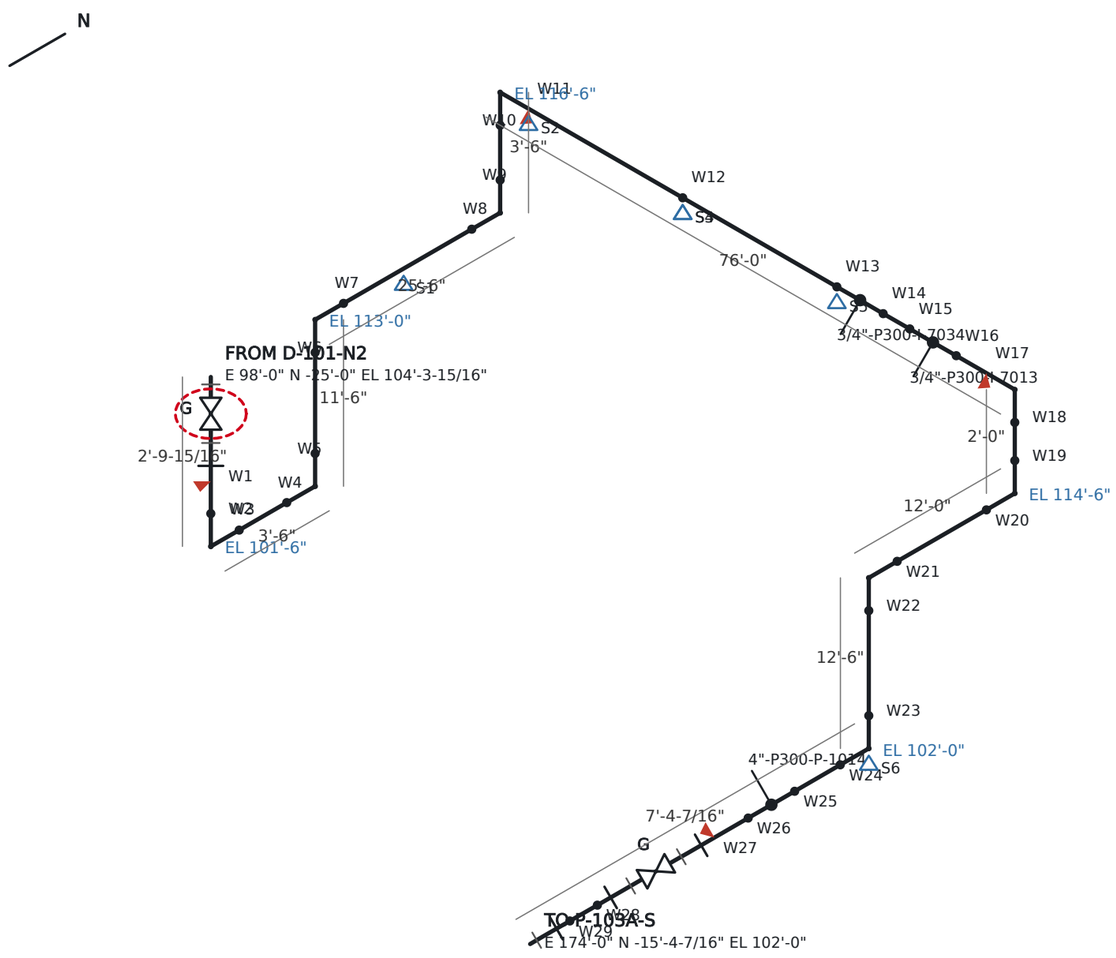

BILL OF MATERIALS

1	GASKET 4" P300 COMPRESSED SHEET	5
2	VALVE, GATE, WEDGE, OS&Y 4" P300	2
3	STUD SET 4 × 1" × 6-1/4" WITH 2 NUTS, FOR 4" P300	5
4	FLANGE WELD-NECK 4" P300 RAISED FACE	4
5	PIPE 4" P300 BEVELLED ENDS	140'-7-1/2"
6	ELBOW 90° R = 5/3 OD 4" P300	9
7	TEE REDUCING 4" × 3/4" P300	2
8	TEE EQUAL 4" P300	1

WELDS 29 (4 FIELD) · SUPPORTS 6 · SPOOLS 6

W1F W2 W3 W4 W5 W6 W7 W8 W9 W10
W11F W12 W13 W14 W15 W16 W17F W18 W19 W20
W21 W22 W23 W24 W25 W26 W27F W28 W29

4"-P300-P-1013


CLASS H300 — Hydrocarbon process
SERVICE P · 4" · P300 · DESIGN 300 psi
D-101-N2 → P-103A-S
PIPE 140'-7-1/2" · WEIGHT 1562 lb

DWG ISO-4"-P300-P-1013 REV 0 WO-300-03

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 1"-P150-V-6016 — Internal inspection of horizontal drum D-101

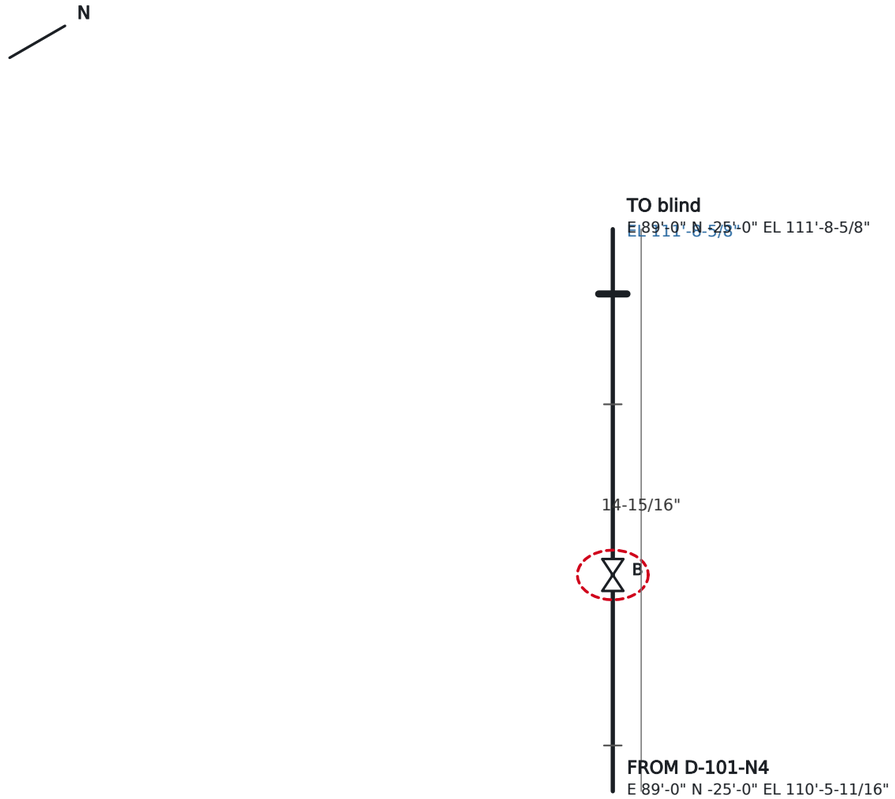

BILL OF MATERIALS

1	GASKET 1" P150 COMPRESSED SHEET	2
2	VALVE, BALL, FLOATING 1" P150	1
3	STUD SET 4 × 0.5" × 4" WITH 2 NUTS, FOR 1" P150	2
4	FLANGE BLIND 1" P150 RAISED FACE	1

WELDS 0 (0 FIELD) · SUPPORTS 0 · SPOOLS 0

1"-P150-V-6016


CLASS H150 — Hydrocarbon process
SERVICE V · 1" · P150 · DESIGN 150 psi
D-101-N4 → blind
PIPE 0.000" · WEIGHT 39 lb

DWG ISO-1"-P150-V-6016 REV 0 WO-300-03

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 1"-P150-D-6017 — Internal inspection of horizontal drum D-101

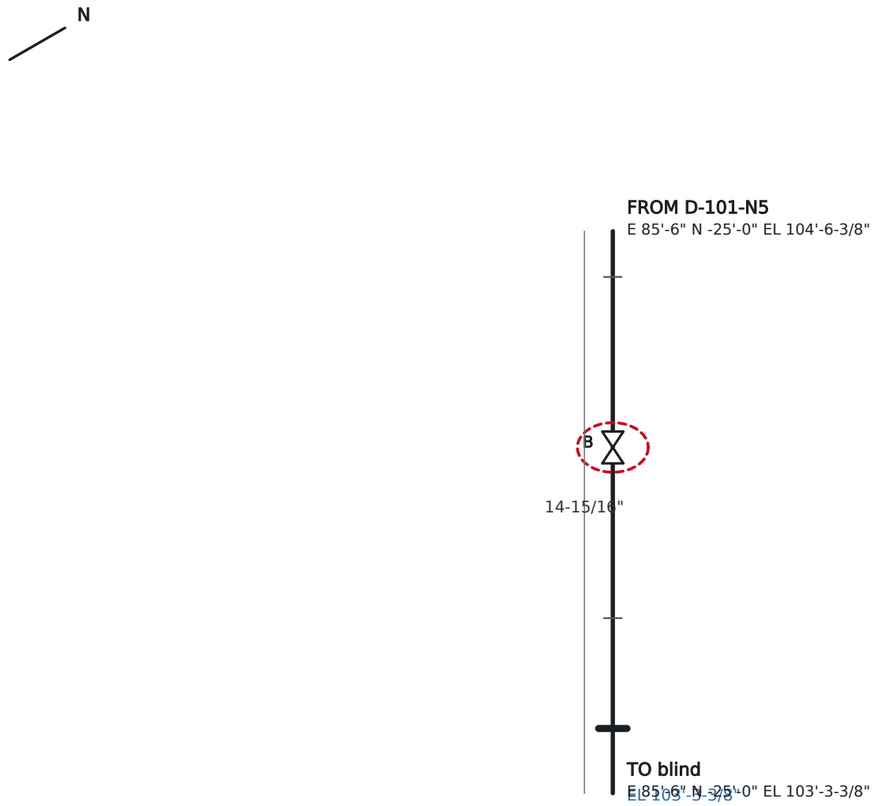

BILL OF MATERIALS

1	GASKET 1" P150 COMPRESSED SHEET	2
2	VALVE, BALL, FLOATING 1" P150	1
3	STUD SET 4 × 0.5" × 4" WITH 2 NUTS, FOR 1" P150	2
4	FLANGE BLIND 1" P150 RAISED FACE	1

WELDS 0 (0 FIELD) · SUPPORTS 0 · SPOOLS 0

1"-P150-D-6017


CLASS H150 — Hydrocarbon process
SERVICE D · 1" · P150 · DESIGN 150 psi
D-101-N5 → blind
PIPE 0.000" · WEIGHT 39 lb

DWG ISO-1"-P150-D-6017 REV 0 WO-300-03

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 1"-P150-N-3014 — Internal inspection of horizontal drum D-101

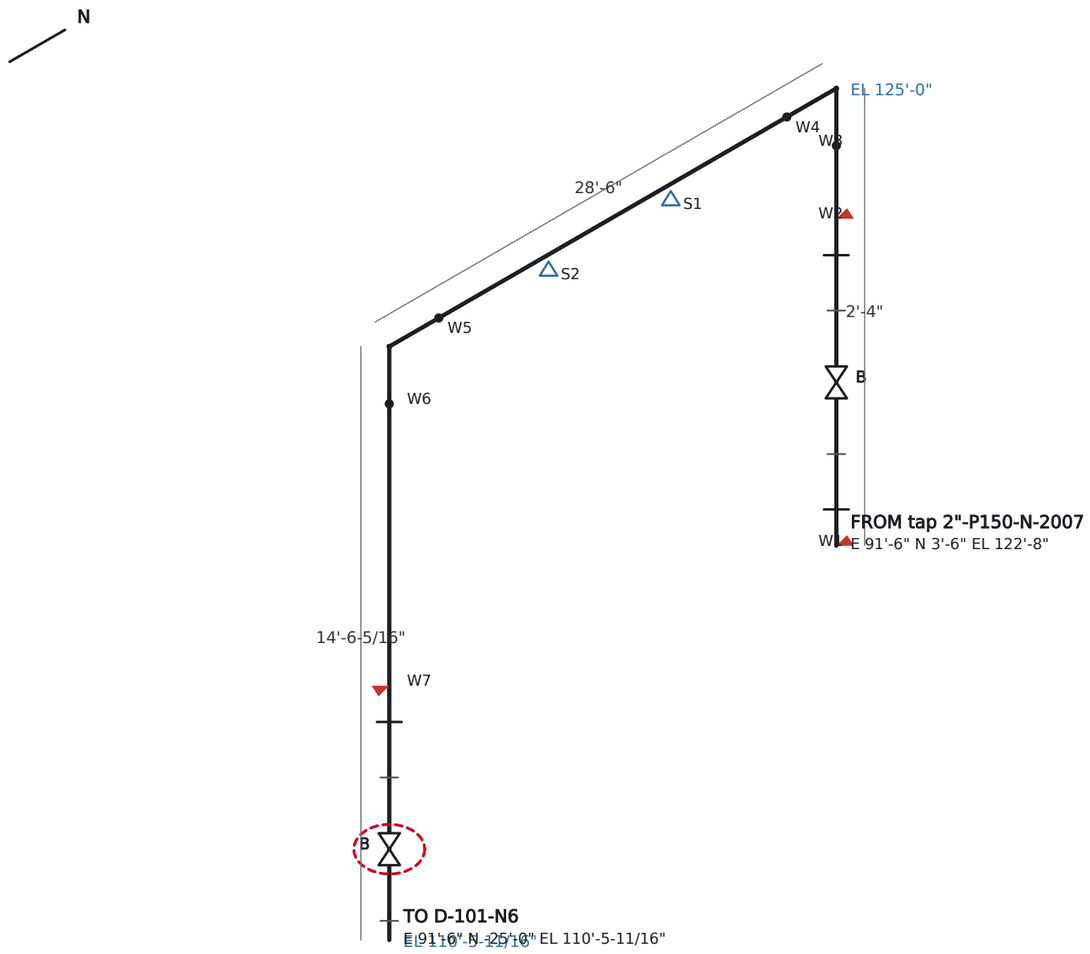

BILL OF MATERIALS

1	FLANGE WELD-NECK 1" P150 RAISED FACE	3
2	GASKET 1" P150 COMPRESSED SHEET	4
3	VALVE, BALL, FLOATING 1" P150	2
4	STUD SET 4 × 0.5" × 4" WITH 2 NUTS, FOR 1" P150	4
5	PIPE 1" P150 BEVELLED ENDS	41'-5-7/8"
6	ELBOW 90° R = 5/3 OD 1" P150	2

WELDS 7 (3 FIELD) · SUPPORTS 2 · SPOOLS 4

W1F W2F W3 W4 W5 W6 W7F

1"-P150-N-3014


CLASS G150 — Air and gases
SERVICE N · 1" · P150 · DESIGN 150 psi
tap 2"-P150-N-2007 → D-101-N6
PIPE 41'-5-7/8" · WEIGHT 121 lb

DWG ISO-1"-P150-N-3014 REV 0 WO-300-03

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 3/4"-P300-I-6018 — Internal inspection of horizontal drum D-101

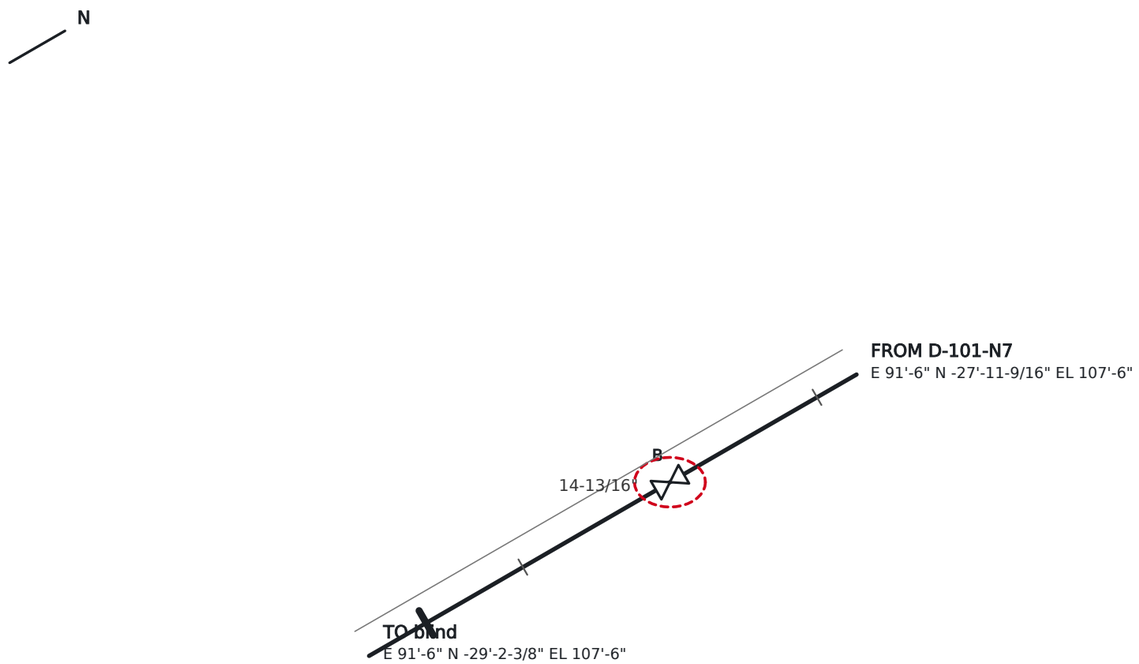

BILL OF MATERIALS

1	GASKET 3/4" P300 COMPRESSED SHEET	2
2	VALVE, BALL, FLOATING 3/4" P300	1
3	STUD SET 4 × 0.5" × 4-1/4" WITH 2 NUTS, FOR 3/4" P300	2
4	FLANGE BLIND 3/4" P300 RAISED FACE	1

WELDS 0 (0 FIELD) · SUPPORTS 0 · SPOOLS 0

3/4"-P300-I-6018


CLASS H300 — Hydrocarbon process
SERVICE I · 0.75" · P300 · DESIGN 300 psi
D-101-N7 → blind
PIPE 0.000" · WEIGHT 32 lb

DWG ISO-3/4"-P300-I-6018 REV 0 WO-300-03

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 3/4"-P300-I-6019 — Internal inspection of horizontal drum D-101

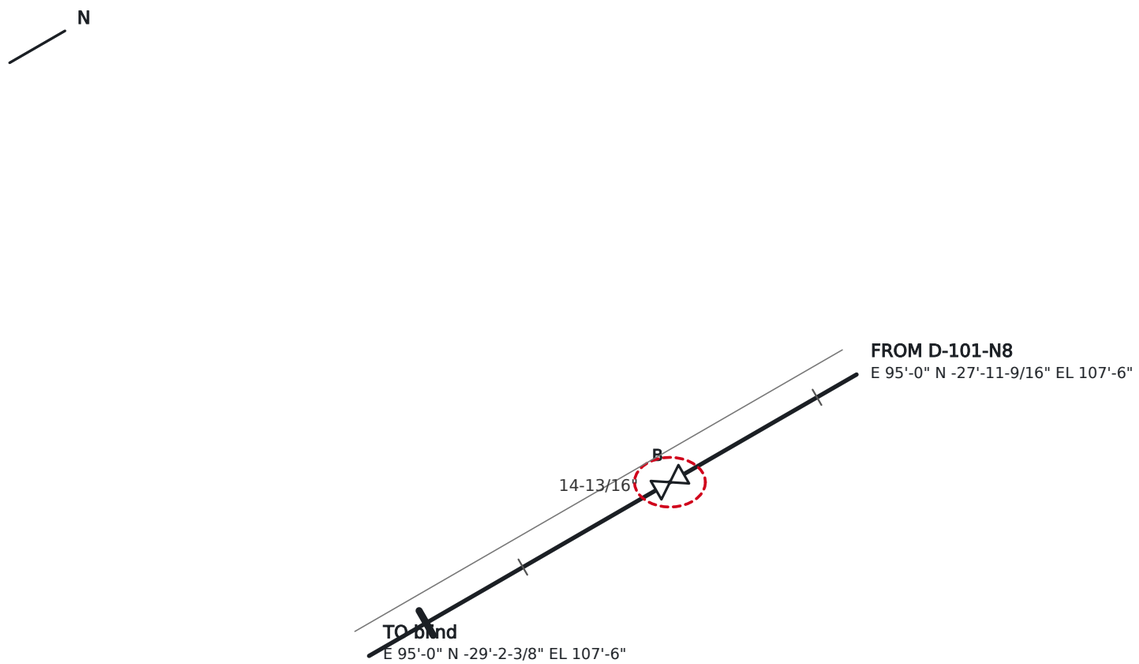

BILL OF MATERIALS

1	GASKET 3/4" P300 COMPRESSED SHEET	2
2	VALVE, BALL, FLOATING 3/4" P300	1
3	STUD SET 4 × 0.5" × 4-1/4" WITH 2 NUTS, FOR 3/4" P300	2
4	FLANGE BLIND 3/4" P300 RAISED FACE	1

WELDS 0 (0 FIELD) · SUPPORTS 0 · SPOOLS 0

3/4"-P300-I-6019


CLASS H300 — Hydrocarbon process
SERVICE I · 0.75" · P300 · DESIGN 300 psi
D-101-N8 → blind
PIPE 0.000" · WEIGHT 32 lb

DWG ISO-3/4"-P300-I-6019 REV 0 WO-300-03

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

ISOMETRIC — 3/4"-P300-SP-6020 — Internal inspection of horizontal drum D-101

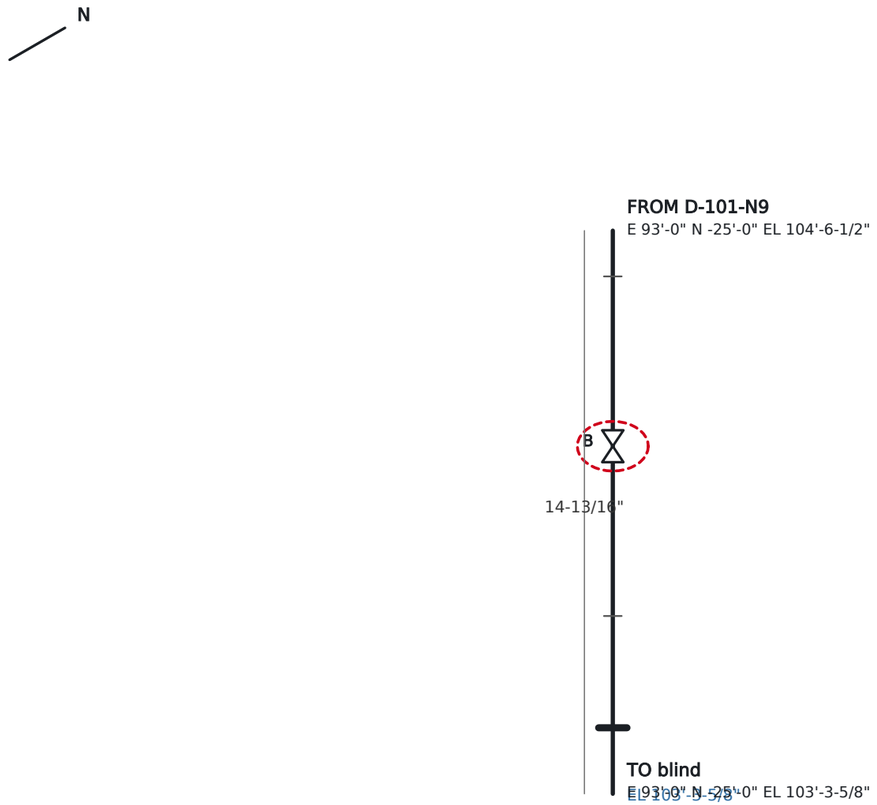

BILL OF MATERIALS

1	GASKET 3/4" P300 COMPRESSED SHEET	2
2	VALVE, BALL, FLOATING 3/4" P300	1
3	STUD SET 4 × 0.5" × 4-1/4" WITH 2 NUTS, FOR 3/4" P300	2
4	FLANGE BLIND 3/4" P300 RAISED FACE	1

WELDS 0 (0 FIELD) · SUPPORTS 0 · SPOOLS 0

3/4"-P300-SP-6020

CLASS H300 — Hydrocarbon process
SERVICE SP · 0.75" · P300 · DESIGN 300 psi
D-101-N9 → blind
PIPE 0.000" · WEIGHT 32 lb

DWG ISO-3/4"-P300-SP-6020 REV 0 WO-300-03

SmartWeld AI · not to scale · E lower right, N upper right, EL up (SW-ISO-1)

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE

Notices

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE; THE FACILITY OWNER'S QUALIFIED PROCEDURES AND APPLICABLE CODES GOVERN.

This document embeds a subset of the DejaVu Sans font (SW-LIC-3), renamed under its licence. DejaVu Sans (assets/fonts/DejaVuSans.ttf), from the DejaVu fonts 2.37 as packaged in the build environment.

Copyright (c) 2003 by Bitstream, Inc. All Rights Reserved. Bitstream Vera is a trademark of Bitstream, Inc.
DejaVu changes are in public domain.

Permission is hereby granted, free of charge, to any person obtaining a copy
of the fonts accompanying this license ("Fonts") and associated
documentation files (the "Font Software"), to reproduce and distribute the
Font Software, including without limitation the rights to use, copy, merge,
publish, distribute, and/or sell copies of the Font Software, and to permit
persons to whom the Font Software is furnished to do so, subject to the
following conditions:

The above copyright and trademark notices and this permission notice shall
be included in all copies of one or more of the Font Software typefaces.

The Font Software may be modified, altered, or added to, and in particular
the designs of glyphs or characters in the Fonts may be modified and
additional glyphs or characters may be added to the Fonts, only if the fonts
are renamed to names not containing either the words "Bitstream" or the word
"Vera".

This License becomes null and void to the extent applicable to Fonts or Font
Software that has been modified and is distributed under the "Bitstream
Vera" names.

The Font Software may be sold as part of a larger software package but no
copy of one or more of the Font Software typefaces may be sold by itself.

THE FONT SOFTWARE IS PROVIDED "AS IS", WITHOUT WARRANTY OF ANY KIND, EXPRESS
OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY WARRANTIES OF MERCHANTABILITY,
FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT OF COPYRIGHT, PATENT,
TRADEMARK, OR OTHER RIGHT. IN NO EVENT SHALL BITSTREAM OR THE GNOME
FOUNDATION BE LIABLE FOR ANY CLAIM, DAMAGES OR OTHER LIABILITY, INCLUDING
ANY GENERAL, SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES,
WHETHER IN AN ACTION OF CONTRACT, TORT OR OTHERWISE, ARISING FROM, OUT OF
THE USE OR INABILITY TO USE THE FONT SOFTWARE OR FROM OTHER DEALINGS IN THE
FONT SOFTWARE.

Except as contained in this notice, the names of Gnome, the Gnome
Foundation, and Bitstream Inc., shall not be used in advertising or
otherwise to promote the sale, use or other dealings in this Font Software
without prior written authorization from the Gnome Foundation or Bitstream
Inc., respectively. For further information, contact: fonts at gnome dot
org.