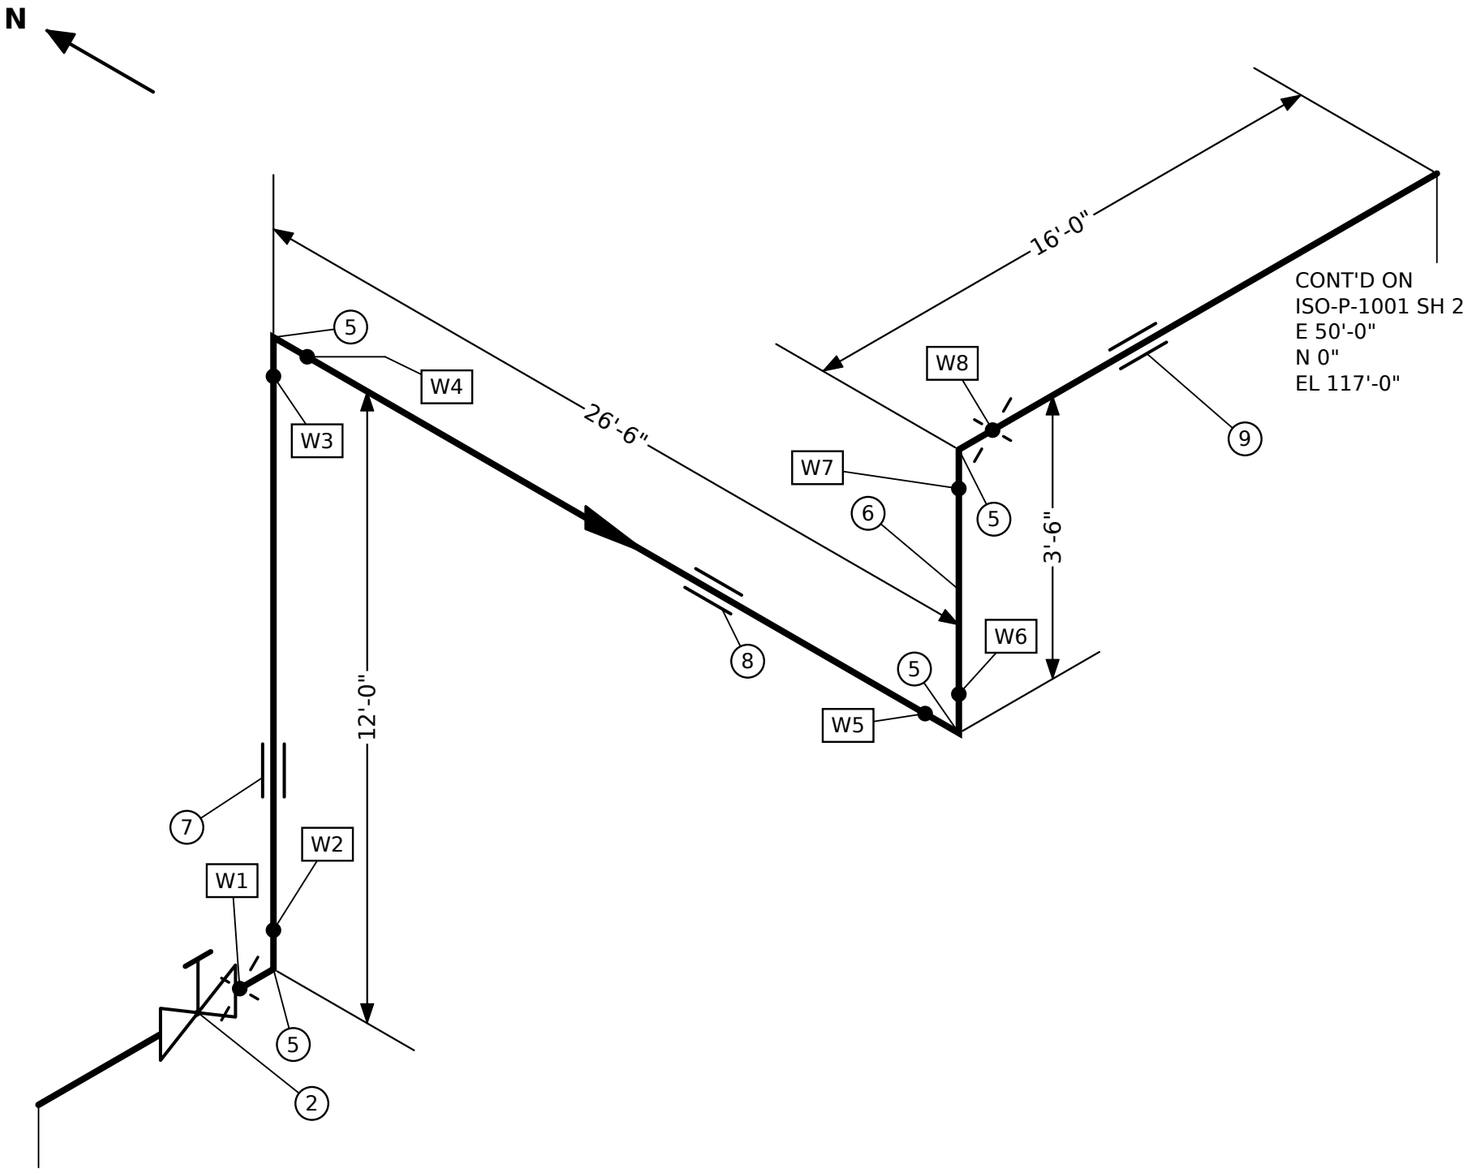


BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	6"	GASKET 6" P150 COMPRESSED SHEET
2	1	6"	VALVE, GATE, WEDGE, OS&Y 6" P150
3	2	6"	STUD SET 8 × 0.625" × 4" WITH 2 NUTS, FOR 6" P150
4	1	6"	FLANGE WELD-NECK 6" P150 RAISED FACE
5	4	6"	ELBOW 90° R = 5/3 OD 6" P150
6	52'-2"	6"	PIPE 6" P150 BEVELLED ENDS
7	1	6"	TRUNNION FOR 6" LINE (TRUNNION-6x15.0)
8	1	6"	HANGER FOR 6" LINE (HANGER-6x23.0)
9	1	6"	GUIDE FOR 6" LINE (GUIDE-6)

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-
1	2026-11-02	REVISED TO MATCH THE MODEL (FL-1)	-

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. HYDROTEST BEFORE PAINTING
4. REMOVE BURRS FROM ALL CUT ENDS

TEST PRESS. -	INSULATION NONE	PAINT -	
PWHT -	NDE -	FLUID P	


COMPANY

SMARTWELD

TITLE

HYDROCARBON PROCESS

LINE NO. 6"-P150-P-1001	PIPING CLASS H150	DESIGN PRESS. 150 PSIG	DESIGN TEMP. -
DRAWING NO. ISO-P-1001		SHEET 1 OF 5	REV 1
DATE 2026-11-01	DRAWN -	CHECKED -	SCALE NTS

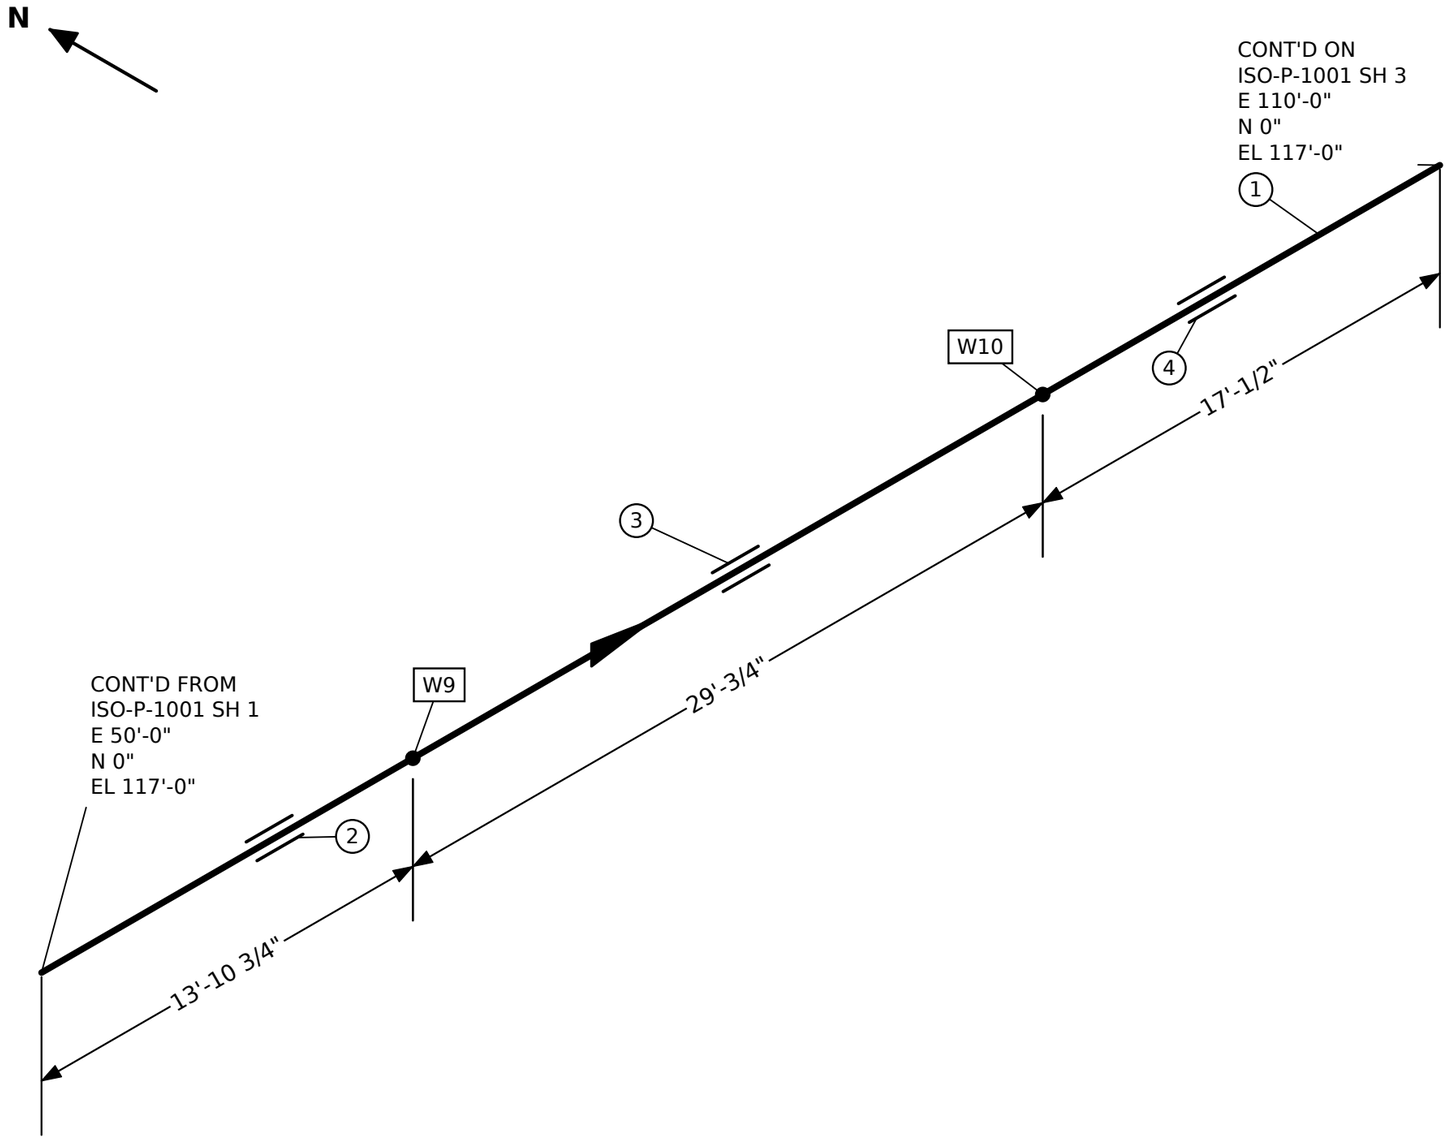

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	60'-0"	6"	PIPE 6" P150 BEVELLED ENDS
2	1	6"	SHOE FOR 6" LINE (SHOE-6)
3	1	6"	GUIDE FOR 6" LINE (GUIDE-6)
4	1	6"	ANCHOR FOR 6" LINE (ANCHOR-6)

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-
1	2026-11-02	REVISED TO MATCH THE MODEL (FL-1)	-

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. CHECK ORIENTATION BEFORE WELDING
4. REMOVE BURRS FROM ALL CUT ENDS

TEST PRESS.	INSULATION	PAINT
-	NONE	-
PWHT	NDE	FLUID
-	-	P

COMPANY

SMARTWELD


TITLE

HYDROCARBON PROCESS

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
6"-P150-P-1001	H150	150 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1001	2 OF 5	1

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

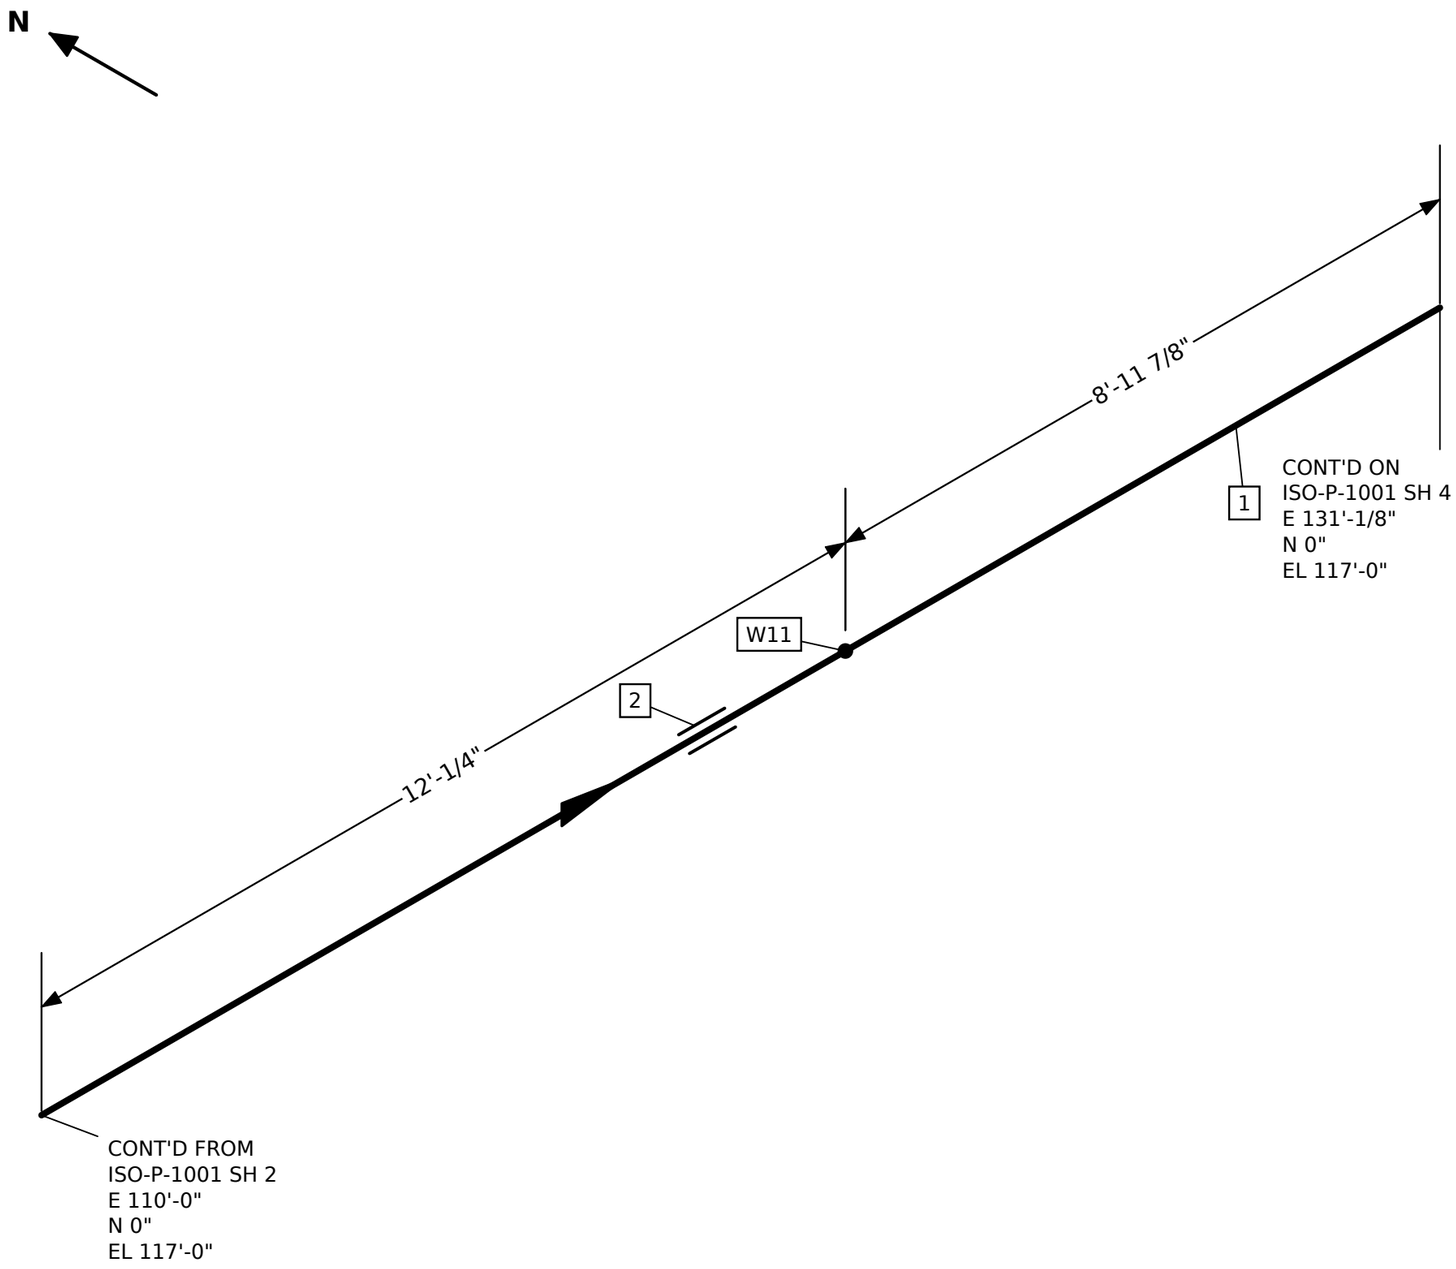

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	21'-1/8"	6"	PIPE 6" P150 BEVELLED ENDS
2	1	6"	GUIDE FOR 6" LINE (GUIDE-6)

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-
1	2026-11-02	REVISED TO MATCH THE MODEL (FL-1)	-

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD

TEST PRESS.	INSULATION	PAINT
-	NONE	-
PWHT	NDE	FLUID
-	-	P

COMPANY

SMARTWELD


TITLE

HYDROCARBON PROCESS

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
6"-P150-P-1001	H150	150 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1001	3 OF 5	1

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

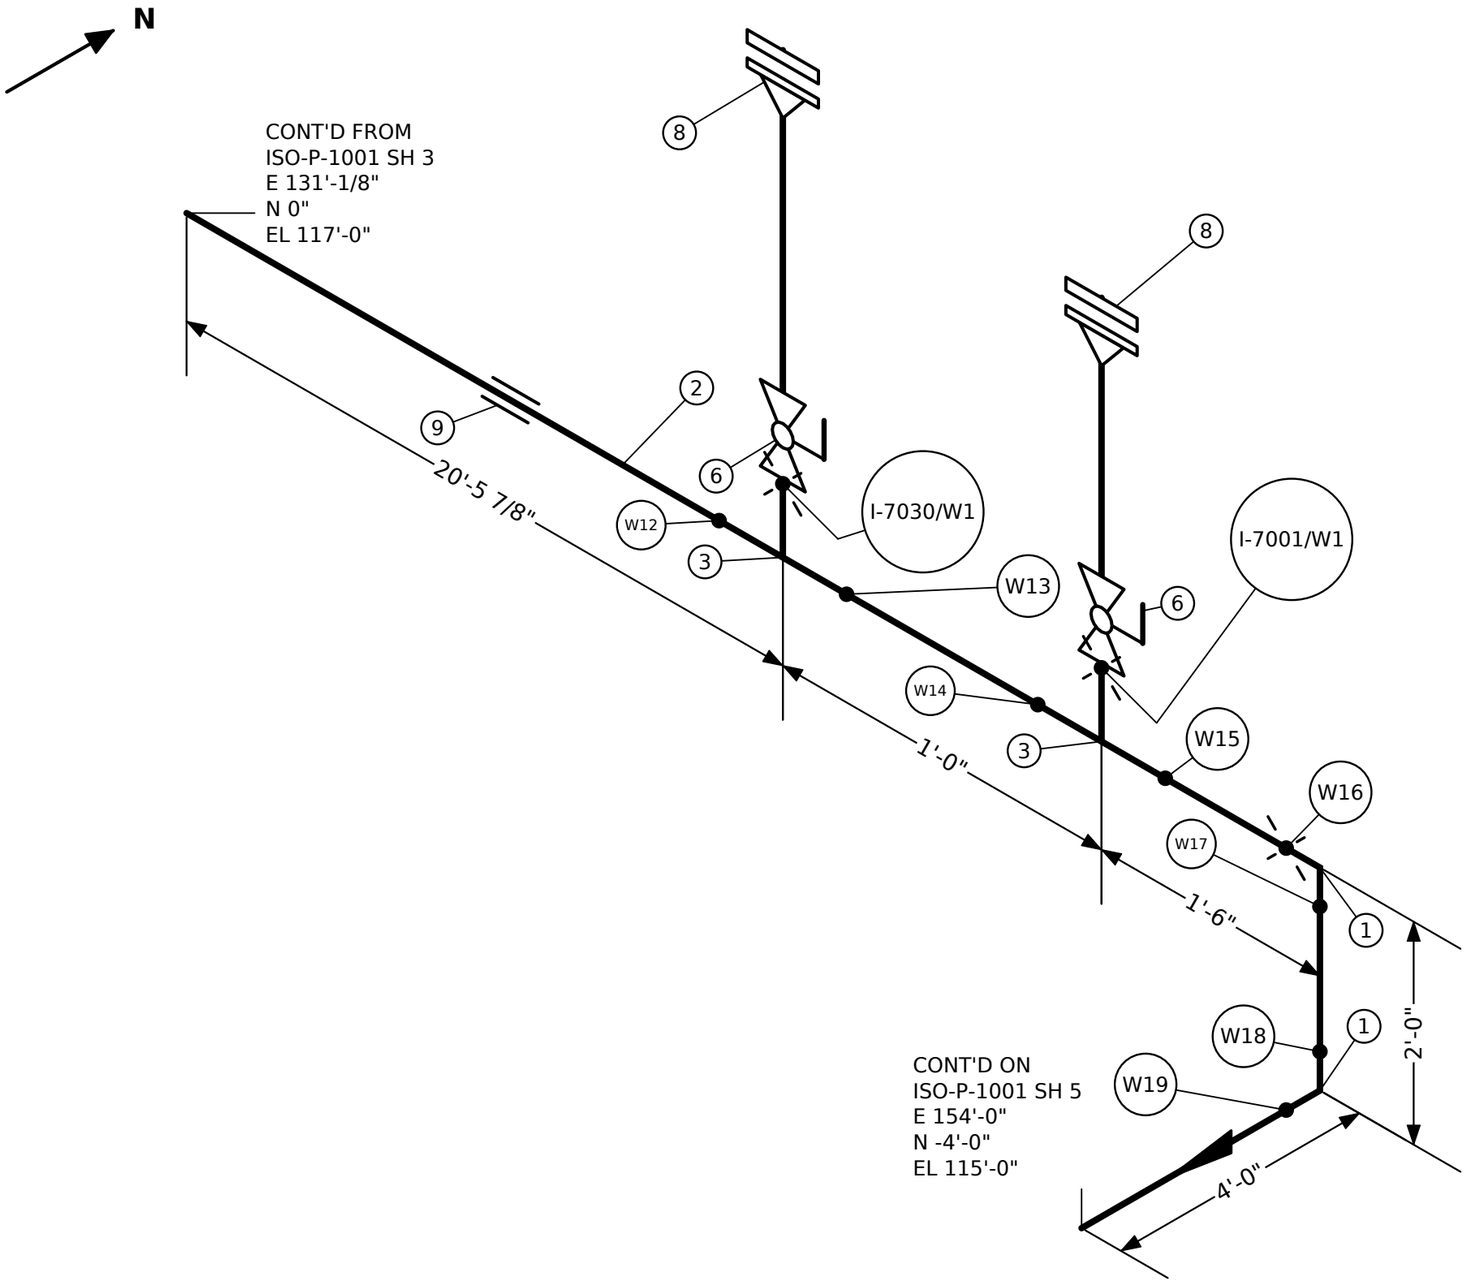

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	6"	ELBOW 90° R = 5/3 OD 6" P150
2	23'-11 7/8"	6"	PIPE 6" P150 BEVELLED ENDS
3	2	6"x3/4"	TEE REDUCING 6" × 3/4" P150
4	2	3/4"	FLANGE WELD-NECK 3/4" P300 RAISED FACE
5	4	3/4"	GASKET 3/4" P300 COMPRESSED SHEET
6	2	3/4"	VALVE, BALL, FLOATING 3/4" P300
7	4	3/4"	STUD SET 4 × 0.5" × 4-1/4" WITH 2 NUTS, FOR 3/4" P300
8	2	3/4"	FLANGE BLIND 3/4" P300 RAISED FACE
9	1	6"	GUIDE FOR 6" LINE (GUIDE-6)

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. PAINT PER PROJECT SPECIFICATION
4. FLANGE BOLT HOLES STRADDLE CENTRELINES

TEST PRESS.	INSULATION	PAINT
-	NONE	-

PWHT	NDE	FLUID
-	-	P

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-
1	2026-11-02	REVISED TO MATCH THE MODEL (FL-1)	-

COMPANY

SMARTWELD


TITLE

HYDROCARBON PROCESS

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
6"-P150-P-1001	H150	150 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1001	4 OF 5	1

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

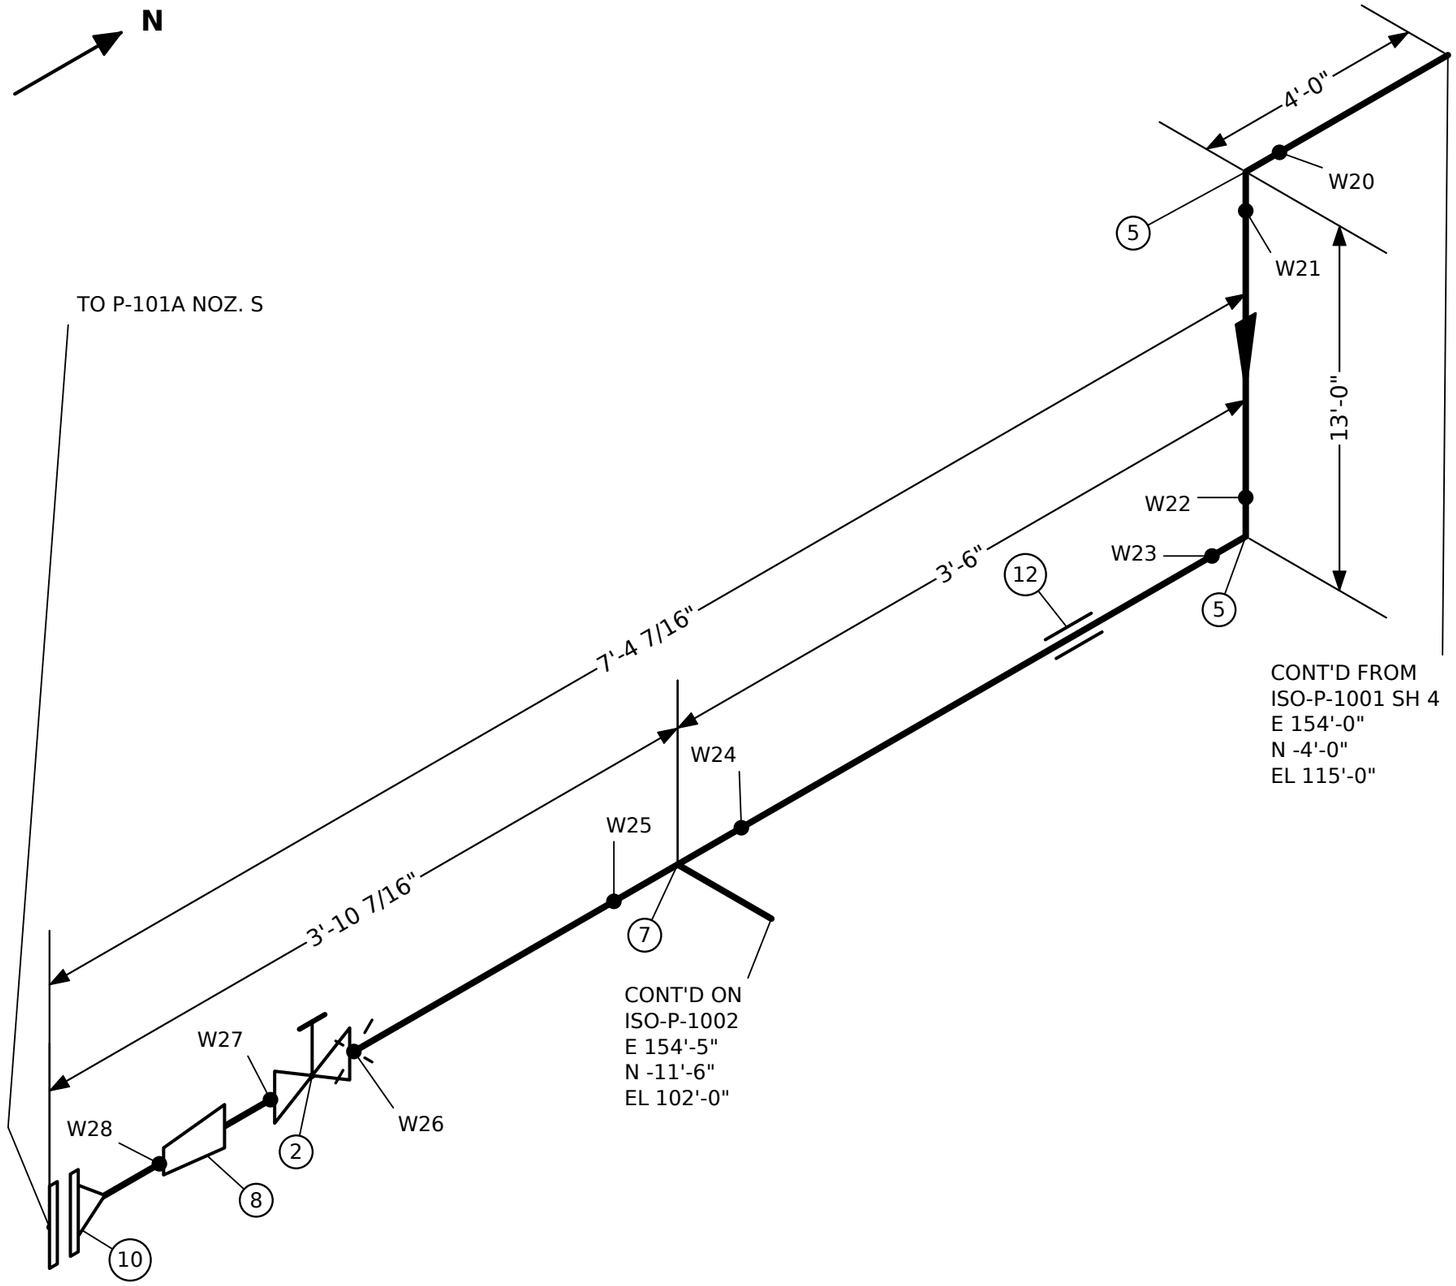

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	6"	GASKET 6" P150 COMPRESSED SHEET
2	1	6"	VALVE, GATE, WEDGE, OS&Y 6" P150
3	2	6"	STUD SET 8 × 0.625" × 4" WITH 2 NUTS, FOR 6" P150
4	2	6"	FLANGE WELD-NECK 6" P150 RAISED FACE
5	2	6"	ELBOW 90° R = 5/3 OD 6" P150
6	17'-4 1/8"	6"	PIPE 6" P150 BEVELLED ENDS
7	1	6"	TEE EQUAL 6" P150
8	1	6"x4"	REDUCER CONCENTRIC 6" × 4" P150
9	1	4"	STUD SET 4 × 1" × 6-1/4" WITH 2 NUTS, FOR 4" P150
10	1	4"	FLANGE WELD-NECK 4" P150 RAISED FACE
11	1	4"	GASKET 4" P150 COMPRESSED SHEET
12	1	6"	TRUNNION FOR 6" LINE (TRUNNION-6x21.0)

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-
1	2026-11-02	REVISED TO MATCH THE MODEL (FL-1)	-

COMPANY

SMARTWELD

TITLE

HYDROCARBON PROCESS

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. HYDROTEST BEFORE PAINTING
4. REMOVE BURRS FROM ALL CUT ENDS

TEST PRESS.	INSULATION	PAINT
-	NONE	-
PWHT	NDE	FLUID
-	-	P

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
6"-P150-P-1001	H150	150 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1001	5 OF 5	1

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS