DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE; THE FACILITY OWNER'S QUALIFIED PROCEDURES AND APPLICABLE CODES GOVERN.

WO-200-01 — Internal inspection of vertical vessel C-101

Area	A200 Vessels and column	**Task**	VI Internal inspection
Priority	2 (integrity)	**Issued by**	Facility owner (demonstration)
Primary asset	C-101 — C-101 vertical vessel 48" ID × 240" T/T — E 68'-6" N 25'-0" EL 100'-8-1/4"		
Equipment	C-101	**Lines**	4"-P300-P-1010, 6"-P300-P-1011, 6"-P300-P-1017, 3"-P300-P-1015, 1"-P150-V-6011, 1"-P150-D-6012, 1"-P150-N-3013, 3/4"-P300-I-6013, 3/4"-P300-I-6014, 3/4"-P300-SP-6015
Isometrics	ISO-P-1010, ISO-P-1011, ISO-P-1017, ISO-P-1015, ISO-V-6011, ISO-D-6012, ISO-N-3013, ISO-I-6013, ISO-I-6014, ISO-SP-6015 (owner's drawings, attached)		
Permits	General work permit, Confined-space entry permit		

Reason

Scheduled internal inspection of the column.

Scope of work

1. Isolate C-101 per the isolation list; drain, vent, purge and gas-test for entry.
2. Open for entry; clean as needed for inspection.
3. Internal visual examination; ultrasonic thickness at the 16 TMLs.
4. Close with new gaskets on every opened joint; remove blinds; restore the line-up.

Affected items: C-101

Rules: SW-ITP-1, SW-ITP-2, SW-ITP-3, SW-TEST-2, SW-WO-1, SW-WO-2, SW-WO-3, SW-WO-5, SW-WO-6, SW-WO-7

Owner's isometric drawings (SW-IMP-6)

Drawing	Line drawn	Work line	Sheets	Match to the plant model
ISO-P-1010	4"-P300-P-1010	4"-P300-P-1010	4	2 error(s), 2 warning(s) — see below
ISO-P-1011	6"-P300-P-1011	6"-P300-P-1011	2	0 error(s), 3 warning(s) — see below
ISO-P-1017	6"-P300-P-1017	6"-P300-P-1017	4	0 error(s), 5 warning(s) — see below
ISO-P-1015	3"-P300-P-1015	3"-P300-P-1015	6	1 error(s), 9 warning(s) — see below
ISO-V-6011	1"-P150-V-6011	1"-P150-V-6011	1	agrees with the model
ISO-D-6012	1"-P150-D-6012	1"-P150-D-6012	1	agrees with the model
ISO-N-3013	1"-P150-N-3013	1"-P150-N-3013	1	agrees with the model
ISO-I-6013	3/4"-P300-I-6013	3/4"-P300-I-6013	1	agrees with the model
ISO-I-6014	3/4"-P300-I-6014	3/4"-P300-I-6014	1	agrees with the model
ISO-SP-6015	3/4"-P300-SP-6015	3/4"-P300-SP-6015	1	agrees with the model

ISO-P-1010 (PDF): ../isometrics-imported/ISO-P-1010.pdf · ISO-P-1011 (PDF): ../isometrics-imported/ISO-P-1011.pdf · ISO-P-1017 (PDF): ../isometrics-imported/ISO-P-1017.pdf · ISO-P-1015 (PDF): ../isometrics-imported/ISO-P-1015.pdf · ISO-V-6011 (PDF): ../isometrics-imported/ISO-V-6011.pdf · ISO-D-6012 (PDF): ../isometrics-imported/ISO-D-6012.pdf · ISO-N-3013 (PDF): ../isometrics-imported/ISO-N-3013.pdf · ISO-I-6013 (PDF): ../isometrics-imported/ISO-I-6013.pdf · ISO-I-6014 (PDF): ../isometrics-imported/ISO-I-6014.pdf · ISO-SP-6015 (PDF): ../isometrics-imported/ISO-SP-6015.pdf — the sheets that hold the work follow the ITP.

Drawing	Sheet	Level	Finding
ISO-P-1010	1	error	sheet 1: CONT'D ON ISO-P-1010 SH 2 prints E 133'-6" N -16'-6 5/16" EL 112'-6" for E 133'-6" N -15'-5 11/16" EL 112'-6": the minus sign applies to the feet only; read as written the point is 12.62 in away (still on the centreline, at the wrong place along it)
ISO-P-1010	2	error	sheet 2: CONT'D FROM ISO-P-1010 SH 1 prints E 133'-6" N -16'-6 5/16" EL 112'-6" for E 133'-6" N -15'-5 11/16" EL 112'-6": the minus sign applies to the feet only; read as written the point is 12.62 in away (still on the centreline, at the wrong place along it)
ISO-P-1010	3	warning	branch weld 3/4"-P300-I-7010/W1 (E 70'-0" N 3'-0" EL 116'-9 5/16", sheet 3) has no label
ISO-P-1010	4	warning	TO label 'C-101 NOZ. N1' is not on the drawing
ISO-P-1011	2	warning	W14 (6"-P300-P-1011/W14, sheet 2) is labelled again on sheet 1; it is 162.0 in from the nearest break
ISO-P-1011	2	warning	weld 6"-P300-P-1011/W20 (E 89'-0" N 25'-0" EL 110'-2 1/2", sheet 2) has no label
ISO-P-1011	1	warning	branch weld 3/4"-P300-I-7011/W1 (E 68'-11" N 6" EL 120'-0", sheet 1) has no label
ISO-P-1017	4	warning	W17 (6"-P300-P-1017/W17, sheet 4) is labelled again on sheet 3; it is 11.0 in from the nearest break
ISO-P-1017	4	warning	W18 (6"-P300-P-1017/W18, sheet 4) is labelled again on sheet 3; it is 31.0 in from the nearest break
ISO-P-1017	3	warning	branch weld 3/4"-P300-I-7036/W1 (E 114'-0" N 2'-0" EL 117'-5", sheet 3) has no label
ISO-P-1017	3	warning	branch weld 3/4"-P300-I-7017/W1 (E 115'-0" N 2'-0" EL 117'-5", sheet 3) has no label
ISO-P-1017	4	warning	TO label 'P-104A NOZ. S' is not on the drawing
ISO-P-1015	1	error	sheet 1: CONT'D ON ISO-P-1016 prints E 174'-2 1/2" N -17'-6" EL 107'-6" for E 174'-2 1/2" N -16'-6" EL 107'-6": the minus sign applies to the feet only; read as written the point is 12.00 in away and 12.00 in off where 3"-P300-P-1015 meets 3"-P300-P-1016 (E 174'-2 1/2" N -16'-6" EL 107'-6")
ISO-P-1015	5	warning	weld 3"-P300-P-1015/W16 (E 68'-6" N -5'-0" EL 124'-7", sheet 5) has no label

Drawing	Sheet	Level	Finding
ISO-P-1015	5	warning	weld 3"-P300-P-1015/W17 (E 68'-11" N -5'-0" EL 125'-0", sheet 5) has no label
ISO-P-1015	5	warning	weld 3"-P300-P-1015/W19 (E 69'-6" N -4'-7" EL 125'-0", sheet 5) has no label
ISO-P-1015	5	warning	weld 3"-P300-P-1015/W20 (E 69'-6" N -4'-2 1/2" EL 125'-0", sheet 5) has no label
ISO-P-1015	6	warning	W22 (3"-P300-P-1015/W22, sheet 6) is labelled again on sheet 5; it is 149.8 in from the nearest break
ISO-P-1015	6	warning	W23 (3"-P300-P-1015/W23, sheet 6) is labelled again on sheet 5; it is 159.8 in from the nearest break
ISO-P-1015	6	warning	weld 3"-P300-P-1015/W26 (E 68'-6" N 14'-11 9/16" EL 125'-0", sheet 6) has no label
ISO-P-1015	5	warning	branch weld 3/4"-P300-I-7015/W1 (E 68'-8 1/2" N -5'-0" EL 124'-0", sheet 5) has no label
ISO-P-1015	5	warning	branch weld 3/4"-P300-SP-7026/W1 (E 69'-3 1/2" N -4'-0" EL 125'-0", sheet 5) has no label

Assets in the plant model (SW-WO-7)

Tag	Kind	Description	Line	Location
C-101	equipment	C-101 vertical vessel 48" ID × 240" T/T		E 68'-6" N 25'-0" EL 100'-8-1/4"
4"-P300-P-1010/B2	item	VALVE, GATE, WEDGE, OS&Y 4" P300	4"-P300-P-1010	E 68'-6" N 21'-8-3/16" EL 116'-0"
C-101-N1	nozzle	Nozzle C-101-N1 (feed, 4" P300) on C-101		E 68'-6" N 22'-3-15/16" EL 116'-0"
6"-P300-P-1011/A2	item	VALVE, GATE, WEDGE, OS&Y 6" P300	6"-P300-P-1011	E 68'-6" N 25'-0" EL 127'-11-11/16"
C-101-N2	nozzle	Nozzle C-101-N2 (overhead, 6" P300) on C-101		E 68'-6" N 25'-0" EL 127'-4-9/16"
6"-P300-P-1017/A2	item	VALVE, GATE, WEDGE, OS&Y 6" P300	6"-P300-P-1017	E 68'-6" N 21'-8-9/16" EL 106'-6"
C-101-N3	nozzle	Nozzle C-101-N3 (bottoms, 6" P300) on C-101		E 68'-6" N 22'-3-3/4" EL 106'-6"
3"-P300-P-1015/B2	item	VALVE, GATE, WEDGE, OS&Y 3" P300	3"-P300-P-1015	E 68'-6" N 21'-9-3/4" EL 125'-0"
C-101-N4	nozzle	Nozzle C-101-N4 (reflux, 3" P300) on C-101		E 68'-6" N 22'-4-11/16" EL 125'-0"
1"-P150-V-6011/2	item	VALVE, BALL, FLOATING 1" P150	1"-P150-V-6011	E 70'-0" N 25'-0" EL 127'-4-13/16"
C-101-N5	nozzle	Nozzle C-101-N5 (vent, 1" P150) on C-101		E 70'-0" N 25'-0" EL 126'-9-15/16"
1"-P150-D-6012/2	item	VALVE, BALL, FLOATING 1" P150	1"-P150-D-6012	E 65'-5-1/2" N 25'-0" EL 106'-0"
C-101-N6	nozzle	Nozzle C-101-N6 (drain, 1" P150) on C-101		E 66'-3/8" N 25'-0" EL 106'-0"
1"-P150-N-3013/B2	item	VALVE, BALL, FLOATING 1" P150	1"-P150-N-3013	E 68'-6" N 28'-1/2" EL 115'-0"
C-101-N7	nozzle	Nozzle C-101-N7 (nitrogen, 1" P150) on C-101		E 68'-6" N 27'-5-11/16" EL 115'-0"
3/4"-P300-I-6013/2	item	VALVE, BALL, FLOATING 3/4" P300	3/4"-P300-I-6013	E 65'-5-3/4" N 25'-0" EL 108'-6"
C-101-N8	nozzle	Nozzle C-101-N8 (instrument, 0.75" P300) on C-101		E 66'-1/2" N 25'-0" EL 108'-6"
3/4"-P300-I-6014/2	item	VALVE, BALL, FLOATING 3/4" P300	3/4"-P300-I-6014	E 68'-6" N 28'-1/4" EL 117'-6"
C-101-N9	nozzle	Nozzle C-101-N9 (instrument, 0.75" P300) on C-101		E 68'-6" N 27'-5-9/16" EL 117'-6"
3/4"-P300-SP-6015/2	item	VALVE, BALL, FLOATING 3/4" P300	3/4"-P300-SP-6015	E 65'-5-3/4" N 25'-0" EL 107'-6"
C-101-N10	nozzle	Nozzle C-101-N10 (sample, 0.75" P300) on C-101		E 66'-1/2" N 25'-0" EL 107'-6"

Isolation list (SW-WO-3)

#	Kind	Tag	Line	Action	Location	Fitted ✓	Removed ✓
1	valve	4"-P300-P-1010/B2	4"-P300-P-1010	Close and lock VALVE, GATE, WEDGE, OS&Y 4" P300 (4"-P300-P-1010/B2) on C-101-N1	E 68'-6" N 21'-8-3/16" EL 116'-0"		
2	blind	C-101-N1	4"-P300-P-1010	Fit a blind between 4"-P300-P-1010/B2 and the nozzle flange C-101-N1	E 68'-6" N 22'-3-15/16" EL 116'-0"		
3	valve	6"-P300-P-1011/A2	6"-P300-P-1011	Close and lock VALVE, GATE, WEDGE, OS&Y 6" P300 (6"-P300-P-1011/A2) on C-101-N2	E 68'-6" N 25'-0" EL 127'-11-11/16"		
4	blind	C-101-N2	6"-P300-P-1011	Fit a blind between 6"-P300-P-1011/A2 and the nozzle flange C-101-N2	E 68'-6" N 25'-0" EL 127'-4-9/16"		
5	valve	6"-P300-P-1017/A2	6"-P300-P-1017	Close and lock VALVE, GATE, WEDGE, OS&Y 6" P300 (6"-P300-P-1017/A2) on C-101-N3	E 68'-6" N 21'-8-9/16" EL 106'-6"		
6	blind	C-101-N3	6"-P300-P-1017	Fit a blind between 6"-P300-P-1017/A2 and the nozzle flange C-101-N3	E 68'-6" N 22'-3-3/4" EL 106'-6"		
7	valve	3"-P300-P-1015/B2	3"-P300-P-1015	Close and lock VALVE, GATE, WEDGE, OS&Y 3" P300 (3"-P300-P-1015/B2) on C-101-N4	E 68'-6" N 21'-9-3/4" EL 125'-0"		
8	blind	C-101-N4	3"-P300-P-1015	Fit a blind between 3"-P300-P-1015/B2 and the nozzle flange C-101-N4	E 68'-6" N 22'-4-11/16" EL 125'-0"		
9	valve	1"-P150-V-6011/2	1"-P150-V-6011	Close and lock VALVE, BALL, FLOATING 1" P150 (1"-P150-V-6011/2) on C-101-N5	E 70'-0" N 25'-0" EL 127'-4-13/16"		

#	Kind	Tag	Line	Action	Location	Fitted ✓	Removed ✓
10	blind	C-101-N5	1"-P150-V-6011	Fit a blind between 1"-P150-V-6011/2 and the nozzle flange C-101-N5	E 70'-0" N 25'-0" EL 126'-9-15/16"		
11	valve	1"-P150-D-6012/2	1"-P150-D-6012	Close and lock VALVE, BALL, FLOATING 1" P150 (1"-P150-D-6012/2) on C-101-N6	E 65'-5-1/2" N 25'-0" EL 106'-0"		
12	blind	C-101-N6	1"-P150-D-6012	Fit a blind between 1"-P150-D-6012/2 and the nozzle flange C-101-N6	E 66'-3/8" N 25'-0" EL 106'-0"		
13	valve	1"-P150-N-3013/B2	1"-P150-N-3013	Close and lock VALVE, BALL, FLOATING 1" P150 (1"-P150-N-3013/B2) on C-101-N7	E 68'-6" N 28'-1/2" EL 115'-0"		
14	blind	C-101-N7	1"-P150-N-3013	Fit a blind between 1"-P150-N-3013/B2 and the nozzle flange C-101-N7	E 68'-6" N 27'-5-11/16" EL 115'-0"		
15	valve	3/4"-P300-I-6013/2	3/4"-P300-I-6013	Close and lock VALVE, BALL, FLOATING 3/4" P300 (3/4"-P300-I-6013/2) on C-101-N8	E 65'-5-3/4" N 25'-0" EL 108'-6"		
16	blind	C-101-N8	3/4"-P300-I-6013	Fit a blind between 3/4"-P300-I-6013/2 and the nozzle flange C-101-N8	E 66'-1/2" N 25'-0" EL 108'-6"		
17	valve	3/4"-P300-I-6014/2	3/4"-P300-I-6014	Close and lock VALVE, BALL, FLOATING 3/4" P300 (3/4"-P300-I-6014/2) on C-101-N9	E 68'-6" N 28'-1/4" EL 117'-6"		
18	blind	C-101-N9	3/4"-P300-I-6014	Fit a blind between 3/4"-P300-I-6014/2 and the nozzle flange C-101-N9	E 68'-6" N 27'-5-9/16" EL 117'-6"		
19	valve	3/4"-P300-SP-6015/2	3/4"-P300-SP-6015	Close and lock VALVE, BALL, FLOATING 3/4" P300 (3/4"-P300-SP-6015/2) on C-101-N10	E 65'-5-3/4" N 25'-0" EL 107'-6"		
20	blind	C-101-N10	3/4"-P300-SP-6015	Fit a blind between 3/4"-P300-SP-6015/2 and the nozzle flange C-101-N10	E 66'-1/2" N 25'-0" EL 107'-6"		

Inspections

Id	Inspection	Criteria	Basis
WO-200-01-I1	Internal visual examination of the shell, heads and nozzles	Findings recorded against the owner's integrity criteria	SW-NDE-4
WO-200-01-I2	Ultrasonic thickness at the 16 TMLs listed	Each reading above the owner's minimum wall	SW-WO-6

Thickness monitoring locations (SW-WO-6)

TML	Item	Location	Position	Nominal wall	R1	R2	R3	R4
WO-200-01-TML01	C-101	Nozzle neck C-101-N1	E 68'-6" N 22'-3-15/16" EL 116'-0"		top: ____	side: ____	bottom: ____	side: ____
WO-200-01-TML02	C-101	Nozzle neck C-101-N2	E 68'-6" N 25'-0" EL 127'-4-9/16"		top: ____	side: ____	bottom: ____	side: ____
WO-200-01-TML03	C-101	Nozzle neck C-101-N3	E 68'-6" N 22'-3-3/4" EL 106'-6"		top: ____	side: ____	bottom: ____	side: ____
WO-200-01-TML04	C-101	Nozzle neck C-101-N4	E 68'-6" N 22'-4-11/16" EL 125'-0"		top: ____	side: ____	bottom: ____	side: ____
WO-200-01-TML05	C-101	Nozzle neck C-101-N5	E 70'-0" N 25'-0" EL 126'-9-15/16"		top: ____	side: ____	bottom: ____	side: ____
WO-200-01-TML06	C-101	Nozzle neck C-101-N6	E 66'-3/8" N 25'-0" EL 106'-0"		top: ____	side: ____	bottom: ____	side: ____
WO-200-01-TML07	C-101	Nozzle neck C-101-N7	E 68'-6" N 27'-5-11/16" EL 115'-0"		top: ____	side: ____	bottom: ____	side: ____
WO-200-01-TML08	C-101	Nozzle neck C-101-N8	E 66'-1/2" N 25'-0" EL 108'-6"		top: ____	side: ____	bottom: ____	side: ____
WO-200-01-TML09	C-101	Nozzle neck C-101-N9	E 68'-6" N 27'-5-9/16" EL 117'-6"		top: ____	side: ____	bottom: ____	side: ____
WO-200-01-TML10	C-101	Nozzle neck C-101-N10	E 66'-1/2" N 25'-0" EL 107'-6"		top: ____	side: ____	bottom: ____	side: ____
WO-200-01-TML11	C-101	Bottom head centre	E 68'-6" N 25'-0" EL 103'-8"		centre: ____			
WO-200-01-TML12	C-101	Top head centre	E 68'-6" N 25'-0" EL 125'-8-1/2"		centre: ____			
WO-200-01-TML13	C-101	Shell at 0.000" above the lower tangent	E 68'-6" N 25'-0" EL 104'-8-1/4"		0°: ____	90°: ____	180°: ____	270°: ____
WO-200-01-TML14	C-101	Shell at 6'-0" above the lower tangent	E 68'-6" N 25'-0" EL 110'-8-1/4"		0°: ____	90°: ____	180°: ____	270°: ____
WO-200-01-TML15	C-101	Shell at 12'-0" above the lower tangent	E 68'-6" N 25'-0" EL 116'-8-1/4"		0°: ____	90°: ____	180°: ____	270°: ____
WO-200-01-TML16	C-101	Shell at 18'-0" above the lower tangent	E 68'-6" N 25'-0" EL 122'-8-1/4"		0°: ____	90°: ____	180°: ____	270°: ____

Test — Service leak test

Description	Every opened joint checked at operating pressure on start-up
Basis	SW-TEST-2

Inspection and test plan (SW-ITP-1..3)


H hold · W witness · R review · S surveillance. Status: accepted / rejected / not applicable.

#	Activity	Reference	Acceptance	Record	Contr.	Owner	3rd party	Status	Signed (contr. / owner / 3rd)	Date	Remark
1	Work permit issued; isolation list (valves locked, blinds fitted) verified at zero pressure and drained	SW-WO-3, isolation list	Every isolation in place and tagged; zero pressure at the vent	Signed isolation certificate	H	H	—				
2	Equipment vented, purged and gas-tested for entry; confined-space entry permit issued	Owner entry procedure	Atmosphere safe for entry per owner limits	Gas test record, entry permit	H	H	—				
3	Opened for entry; cleaned for inspection	Owner procedure	Surfaces clean enough to inspect	Daily report	S	S	—				
4	Internal visual examination	SW-NDE-4	Findings recorded	Inspection report with photographs	W	H	W				
5	Ultrasonic thickness at 16 TMLs	SW-WO-6	Above the owner's minimum wall	Thickness record per TML	S	R	R				
6	Owner's decision on findings (repair, monitor or accept)	Owner integrity procedure	Decision recorded	Signed disposition	R	H	R				
7	Closed with new gaskets on every opened joint; studs to preload	SW-WO-5	Preload as stated	Bolt-up record	W	W	—				
8	Service leak test of opened joints on start-up	SW-TEST-2	No leak	Leak test record	W	W	—				
9	Blinds removed, isolations returned to normal line-up per the isolation list	SW-WO-3	Every blind removed and accounted for	Isolation certificate closed	H	H	—				
10	Records complete; work order handed back to operations	SW-ITP-3	All ITP activities accepted or not applicable	Signed ITP and completion record	H	H	R				

Where the work is on the owner's drawings (SW-IMP-8)

Each affected item, replaced weld and isolation point, with the drawing and sheet that hold it and the weld label printed there. The sheets follow, copied unchanged.

Tag	Role	Drawing	Sheet	Weld label
4"-P300-P-1010/B2	isolation: valve	ISO-P-1010	4	
6"-P300-P-1011/A2	isolation: valve	ISO-P-1011	1	
6"-P300-P-1017/A2	isolation: valve	ISO-P-1017	1	
3"-P300-P-1015/B2	isolation: valve	ISO-P-1015	6	
1"-P150-V-6011/2	isolation: valve	ISO-V-6011	1	
1"-P150-D-6012/2	isolation: valve	ISO-D-6012	1	
1"-P150-N-3013/B2	isolation: valve	ISO-N-3013	1	
3/4"-P300-I-6013/2	isolation: valve	ISO-I-6013	1	
3/4"-P300-I-6014/2	isolation: valve	ISO-I-6014	1	
3/4"-P300-SP-6015/2	isolation: valve	ISO-SP-6015	1	

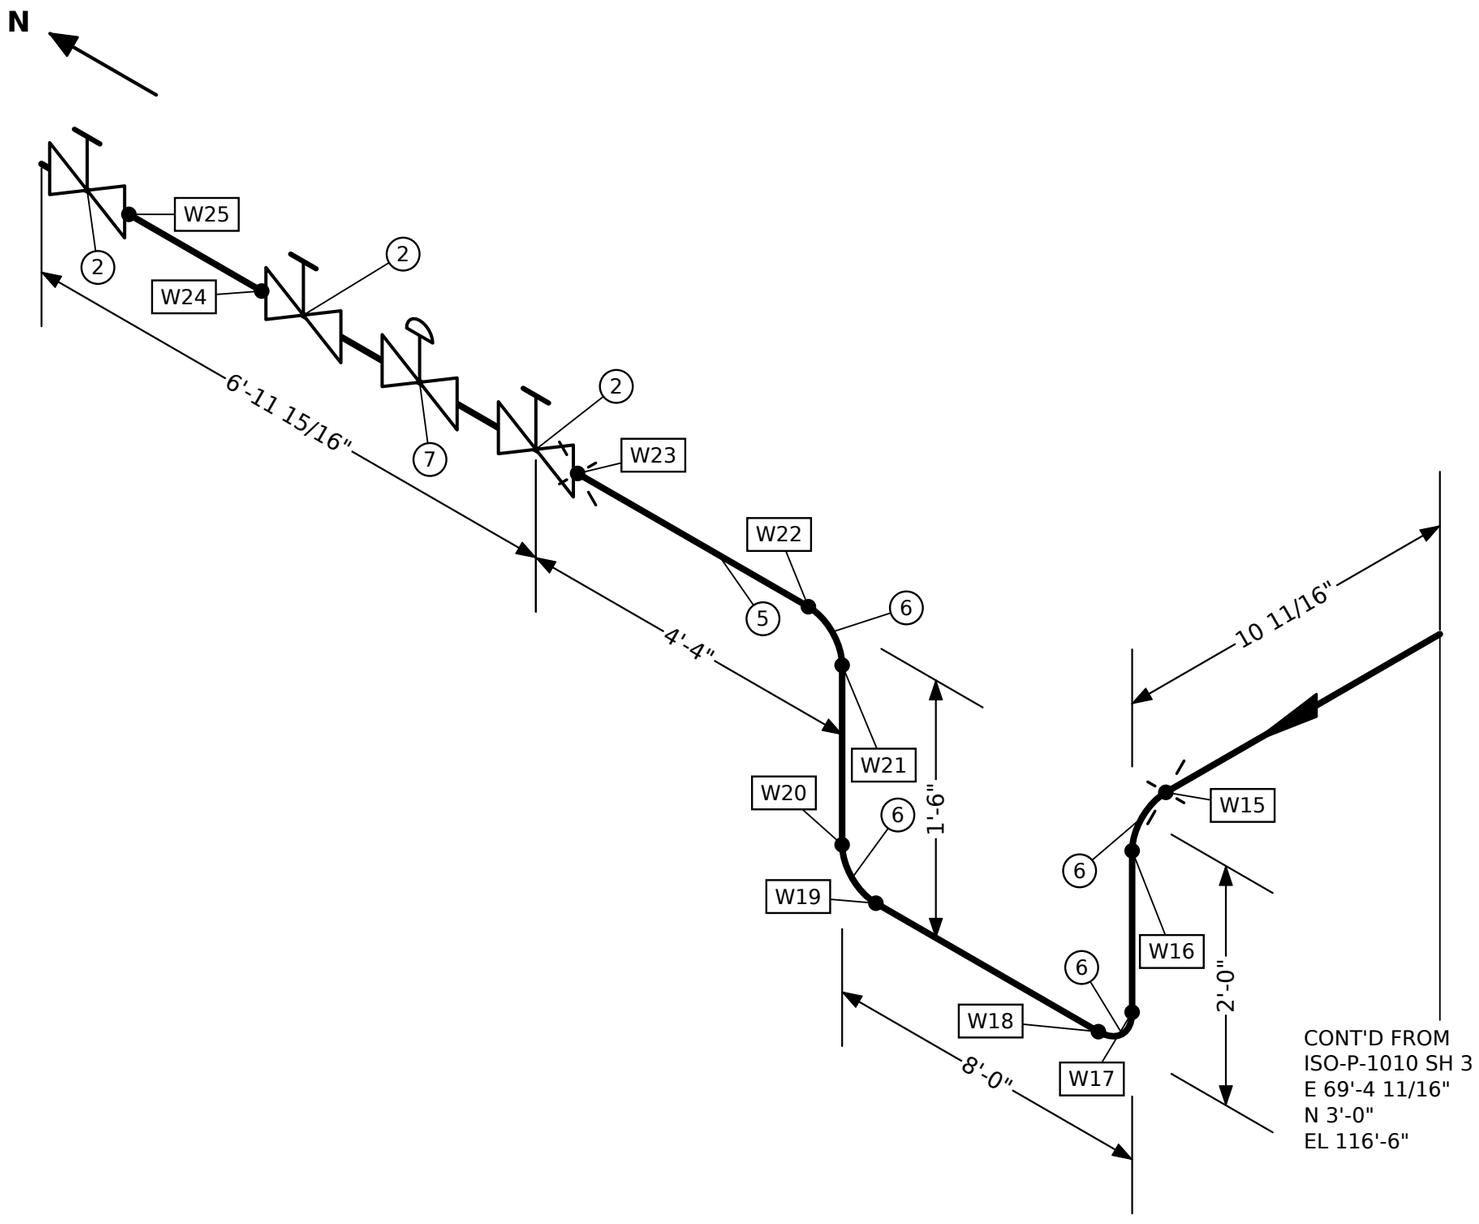

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	6	4"	GASKET 4" P300 COMPRESSED SHEET
2	3	4"	VALVE, GATE, WEDGE, OS&Y 4" P300
3	6	4"	STUD SET 4 × 1" × 6-1/4" WITH 2 NUTS, FOR 4" P300
4	3	4"	FLANGE WELD-NECK 4" P300 RAISED FACE
5	12'-8 3/16"	4"	PIPE 4" P300 BEVELLED ENDS
6	4	4"	ELBOW 90° R = 5/3 OD 4" P300
7	1	4"	VALVE, CONTROL, GLOBE WITH DIAPHRAGM ACTUATOR 4" P300

NOTES:
1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-

COMPANY

SMARTWELD

TITLE


HYDROCARBON PROCESS

TEST PRESS.	INSULATION	PAINT
-	NONE	-
PWHT	NDE	FLUID
-	-	P

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
4"-P300-P-1010	H300	300 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1010	4 OF 4	0

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

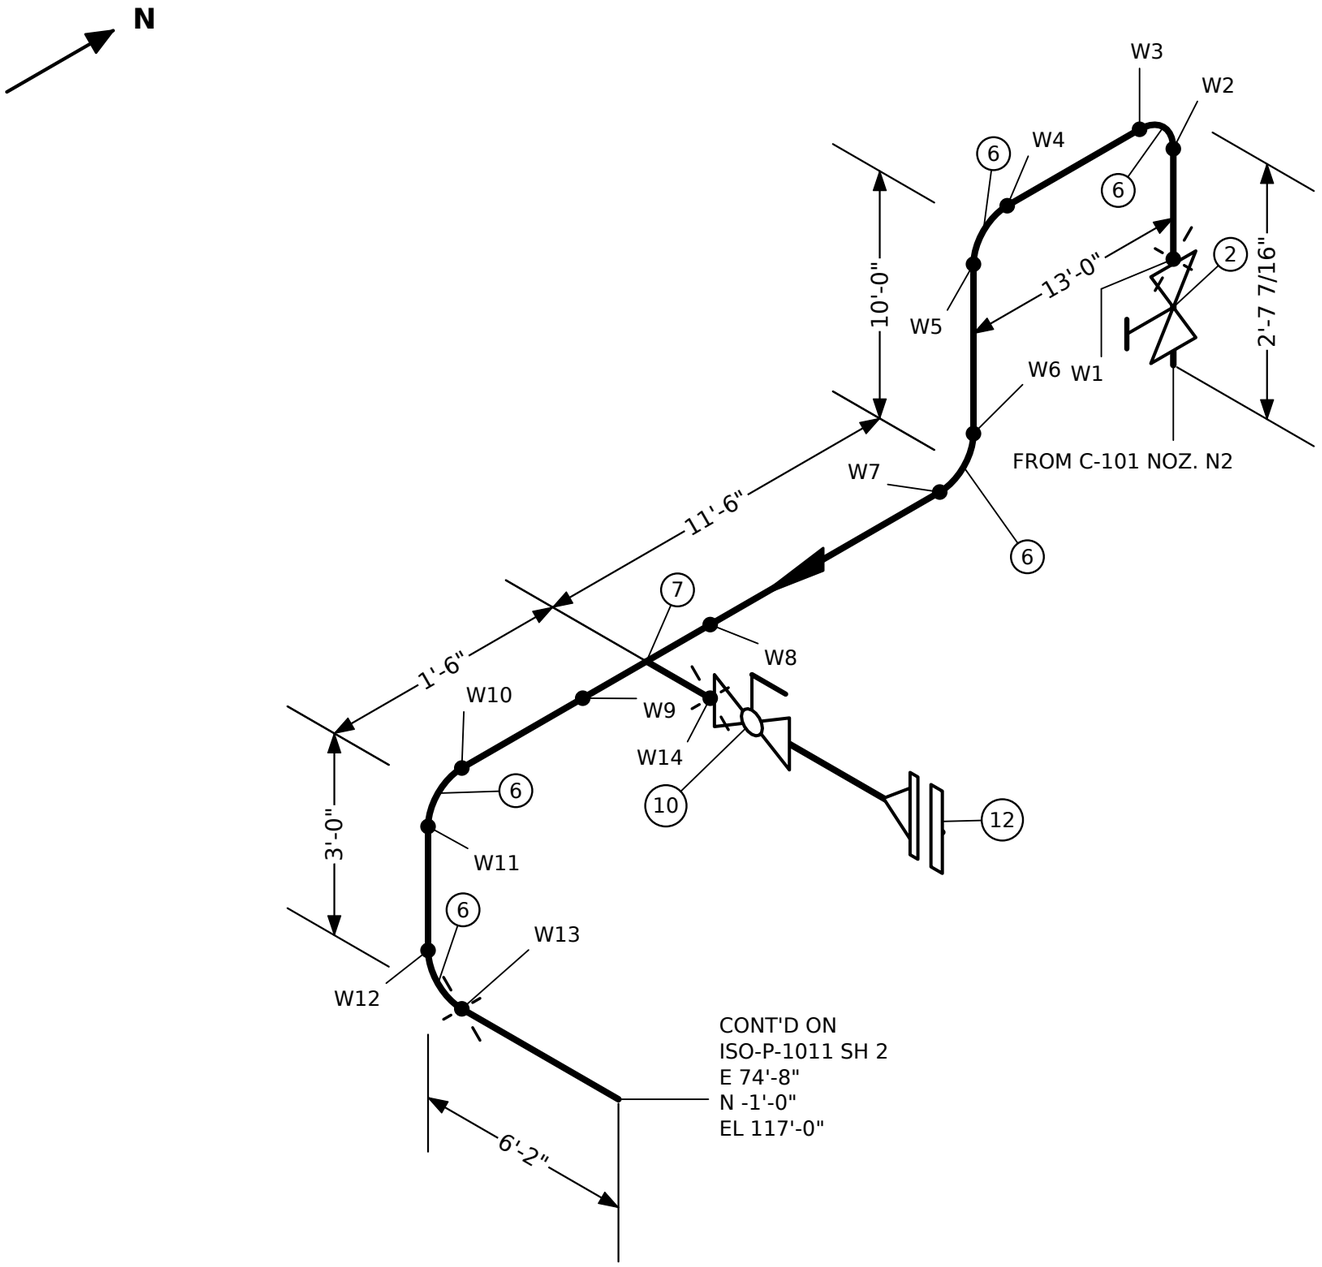

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	6"	GASKET 6" P300 COMPRESSED SHEET
2	1	6"	VALVE, GATE, WEDGE, OS&Y 6" P300
3	2	6"	STUD SET 8 × 0.625" × 4" WITH 2 NUTS, FOR 6" P300
4	1	6"	FLANGE WELD-NECK 6" P300 RAISED FACE
5	37'-1 1/4"	6"	PIPE 6" P300 BEVELLED ENDS
6	5	6"	ELBOW 90° R = 5/3 OD 6" P300
7	1	6"x3/4"	TEE REDUCING 6" × 3/4" P300
8	1	3/4"	FLANGE WELD-NECK 3/4" P300 RAISED FACE
9	2	3/4"	GASKET 3/4" P300 COMPRESSED SHEET
10	1	3/4"	VALVE, BALL, FLOATING 3/4" P300
11	2	3/4"	STUD SET 4 × 0.5" × 4-1/4" WITH 2 NUTS, FOR 3/4" P300
12	1	3/4"	FLANGE BLIND 3/4" P300 RAISED FACE

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-

COMPANY

SMARTWELD

TITLE

HYDROCARBON PROCESS

NOTES:


1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD

TEST PRESS.	INSULATION	PAINT
-	NONE	-
PWHT	**NDE**	**FLUID**
-	-	P

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
6"-P300-P-1011	H300	300 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1011	1 OF 2	0

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

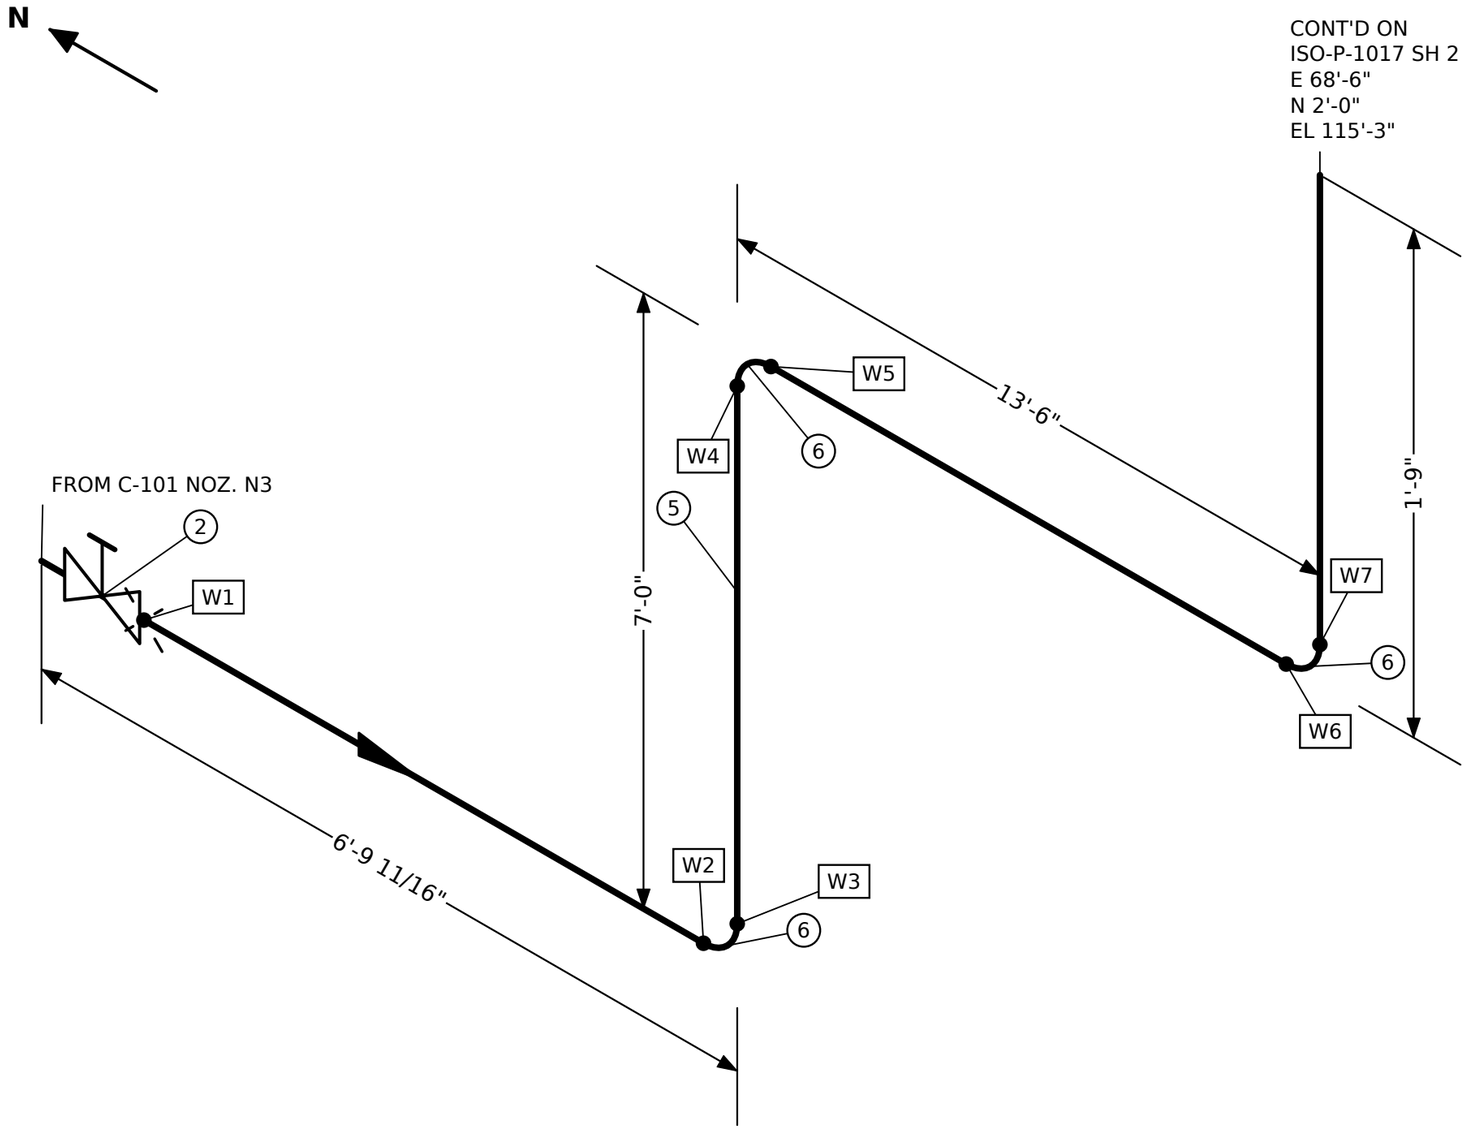

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	6"	GASKET 6" P300 COMPRESSED SHEET
2	1	6"	VALVE, GATE, WEDGE, OS&Y 6" P300
3	2	6"	STUD SET 8 × 0.625" × 4" WITH 2 NUTS, FOR 6" P300
4	1	6"	FLANGE WELD-NECK 6" P300 RAISED FACE
5	22'-6 1/2"	6"	PIPE 6" P300 BEVELLED ENDS
6	3	6"	ELBOW 90° R = 5/3 OD 6" P300

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. REMOVE BURRS FROM ALL CUT ENDS
4. HYDROTEST BEFORE PAINTING

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-

COMPANY

SMARTWELD

TITLE


HYDROCARBON PROCESS

TEST PRESS.	INSULATION	PAINT
-	NONE	-
PWHT	NDE	FLUID
-	-	P

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
6"-P300-P-1017	H300	300 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1017	1 OF 4	0

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

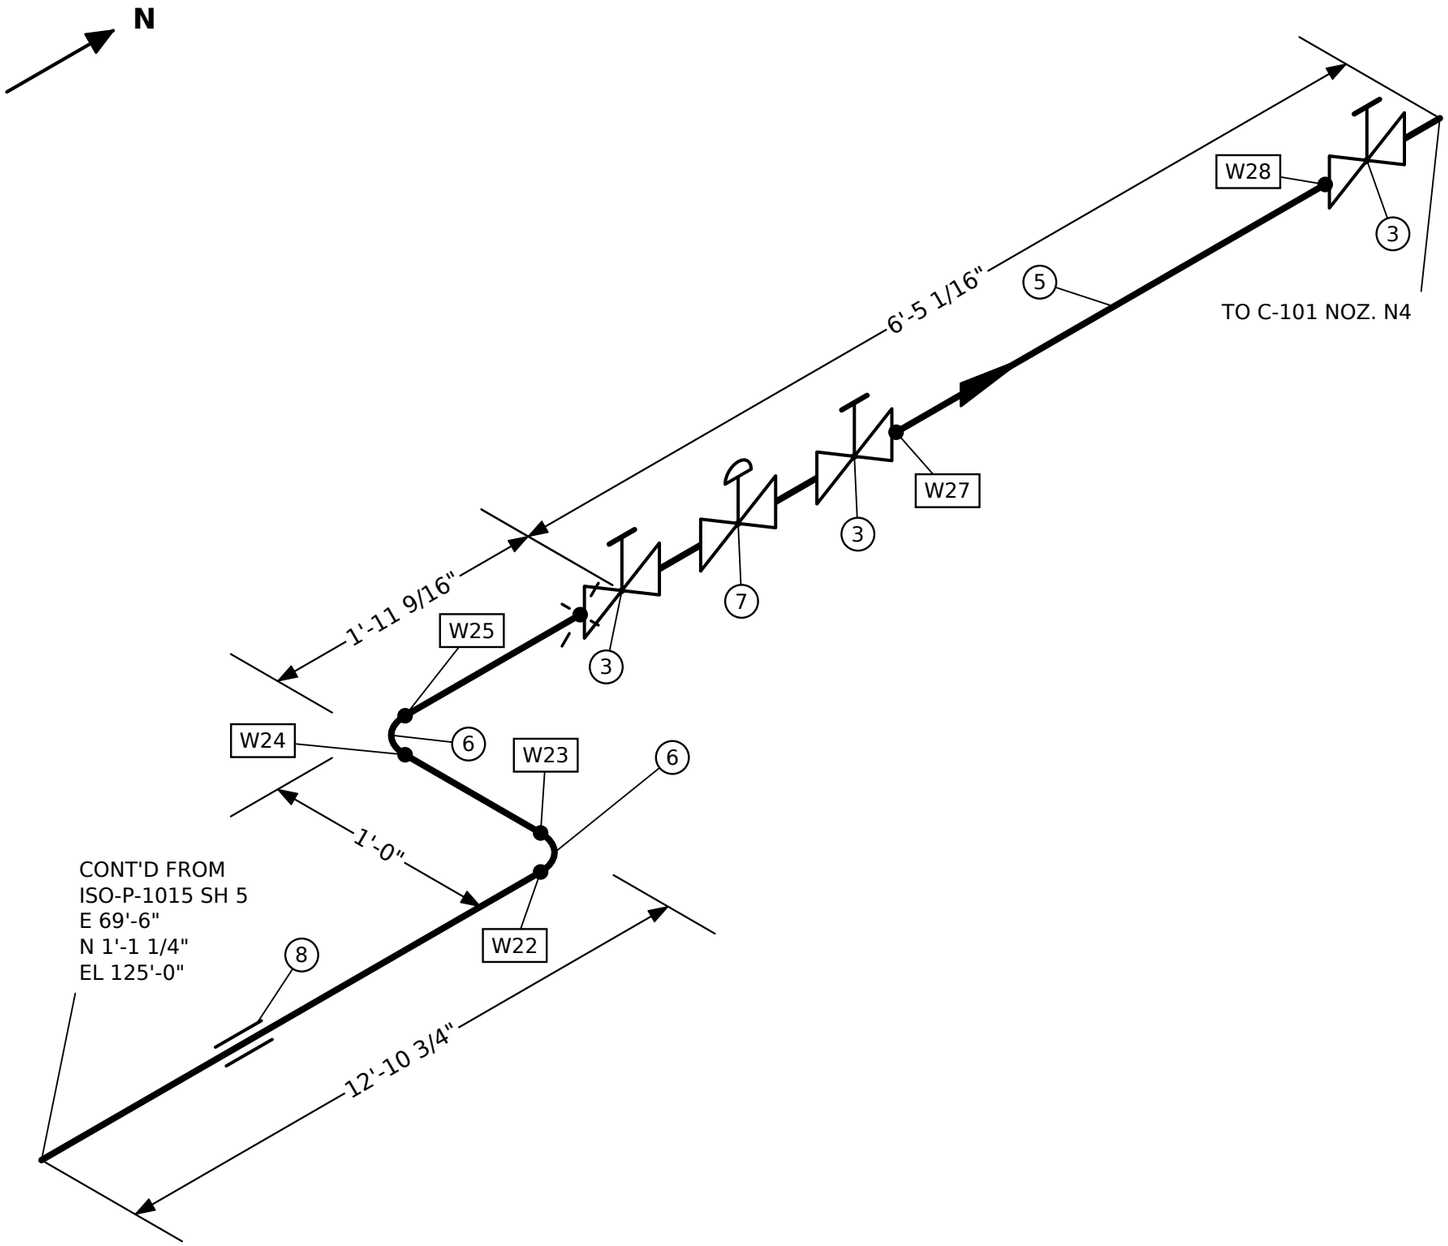

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	6	3"	GASKET 3" P300 COMPRESSED SHEET
2	6	3"	STUD SET 4 × 0.875" × 5-3/4" WITH 2 NUTS, FOR 3" P300
3	3	3"	VALVE, GATE, WEDGE, OS&Y 3" P300
4	3	3"	FLANGE WELD-NECK 3" P300 RAISED FACE
5	14'-8 5/16"	3"	PIPE 3" P300 BEVELLED ENDS
6	2	3"	ELBOW 90° R = 5/3 OD 3" P300
7	1	3"	VALVE, CONTROL, GLOBE WITH DIAPHRAGM ACTUATOR 3" P300
8	1	3"	HANGER FOR 3" LINE (HANGER-3x93.0)

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-

COMPANY

SMARTWELD

TITLE

HYDROCARBON PROCESS

NOTES:


1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. FLANGE BOLT HOLES STRADDLE CENTRELINES
4. PAINT PER PROJECT SPECIFICATION

TEST PRESS.	INSULATION	PAINT
-	NONE	-
PWHT	NDE	FLUID
-	-	P

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
3"-P300-P-1015	H300	300 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1015	6 OF 6	0

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

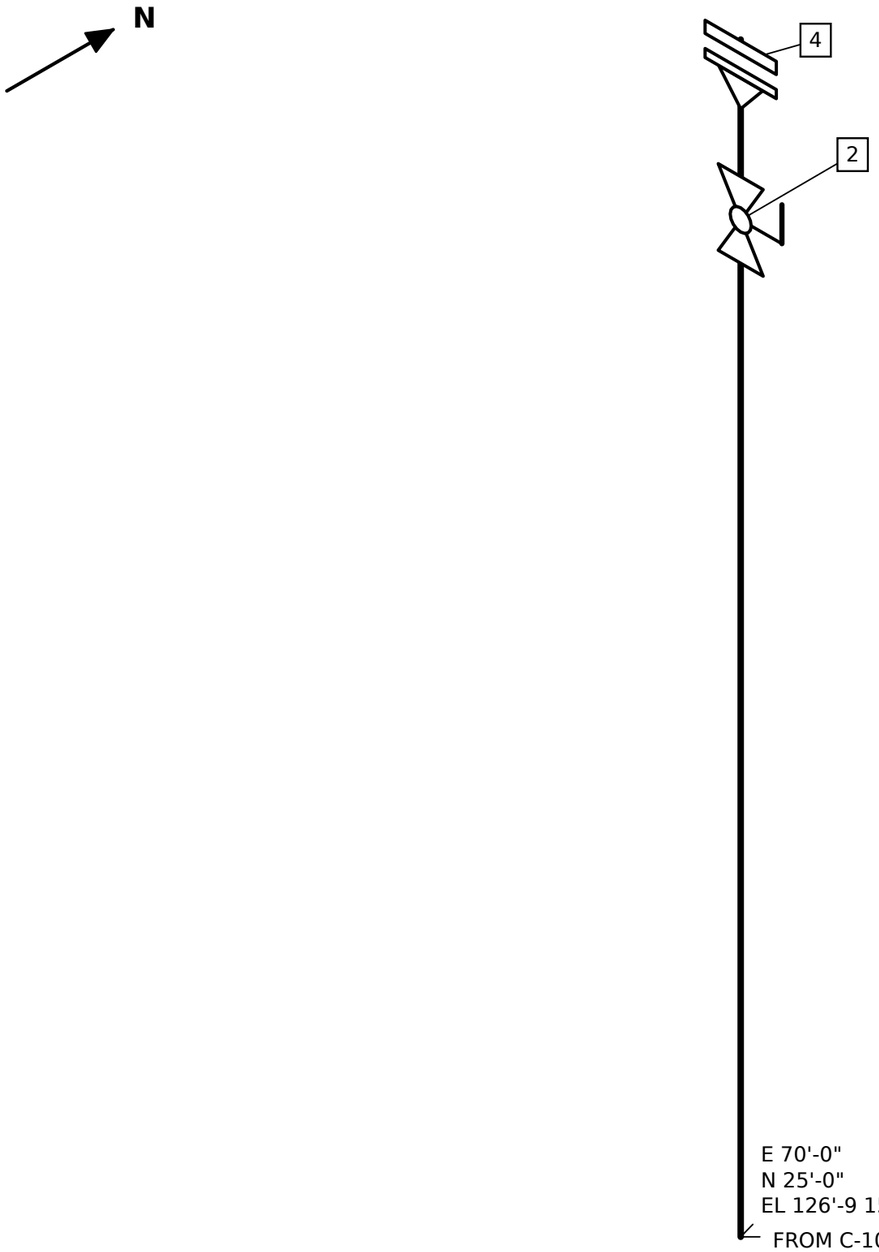

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	1"	GASKET 1" P150 COMPRESSED SHEET
2	1	1"	VALVE, BALL, FLOATING 1" P150
3	2	1"	STUD SET 4 × 0.5" × 4" WITH 2 NUTS, FOR 1" P150
4	1	1"	FLANGE BLIND 1" P150 RAISED FACE

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. PAINT PER PROJECT SPECIFICATION

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-

COMPANY


SMARTWELD

TITLE

HYDROCARBON PROCESS

TEST PRESS. **-**	INSULATION **NONE**	PAINT **-**	
PWHT **-**	NDE **-**	FLUID **V**	

LINE NO. **1"-P150-V-6011**	PIPING CLASS **H150**	DESIGN PRESS. **150 PSIG**	DESIGN TEMP. **-**
DRAWING NO. **ISO-V-6011**		SHEET **1 OF 1**	REV **0**
DATE **2026-11-01**	DRAWN **-**	CHECKED **-**	SCALE **NTS**

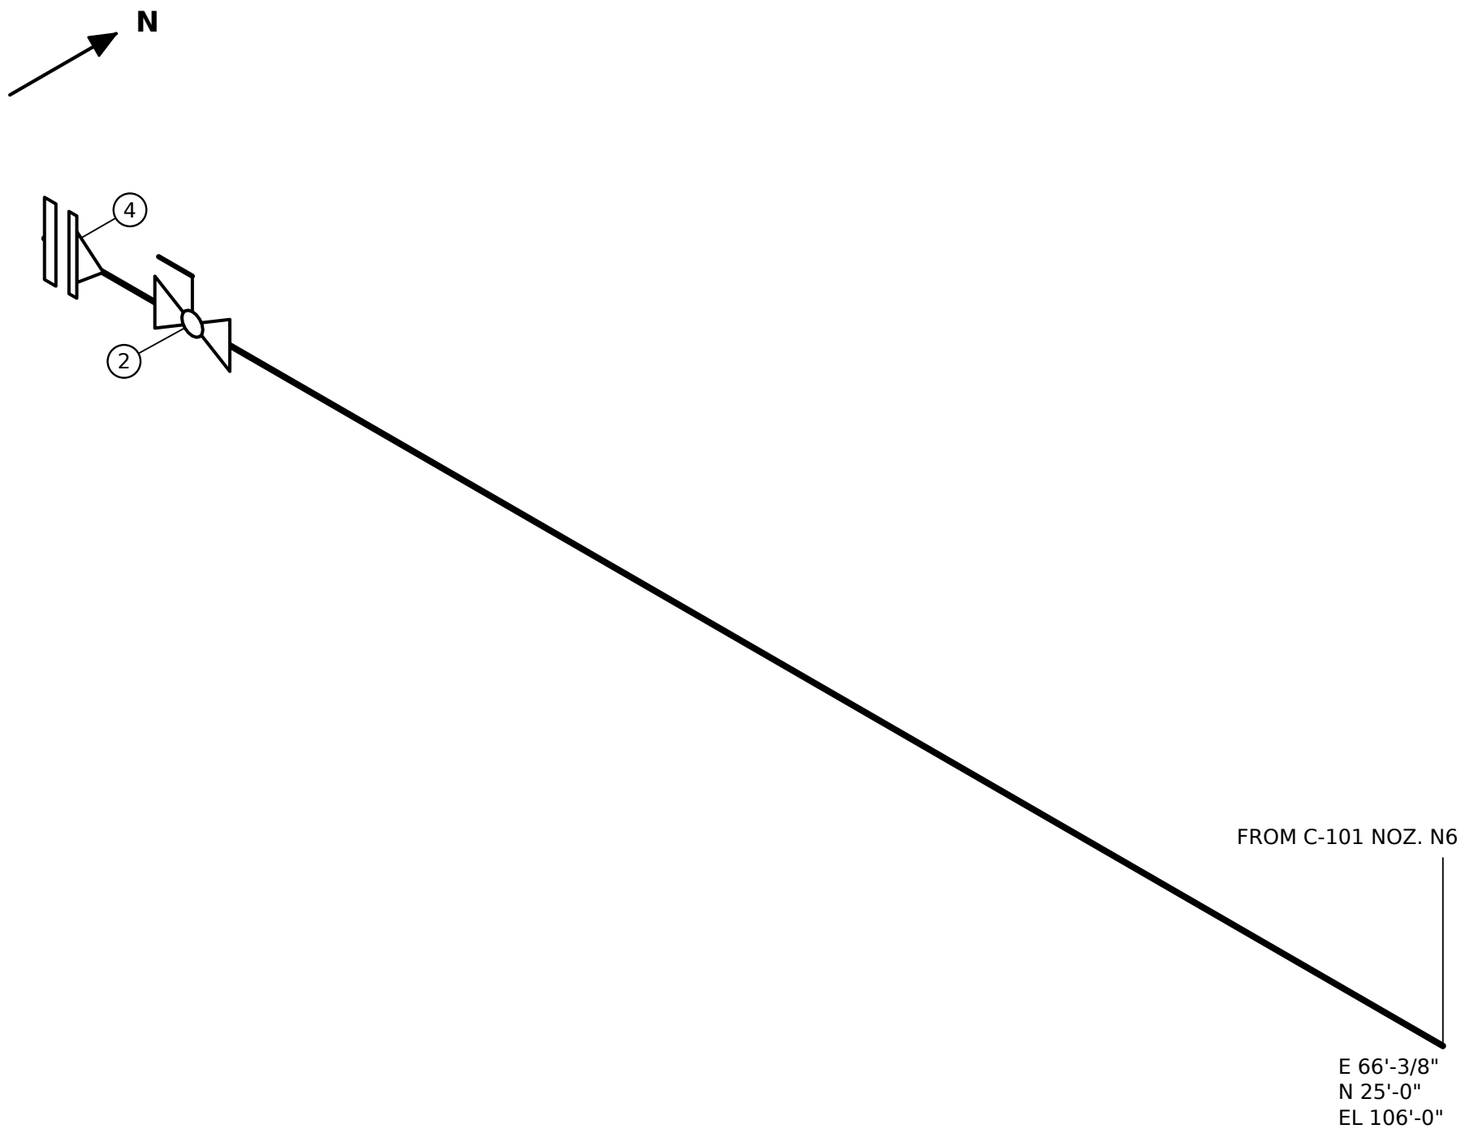

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	1"	GASKET 1" P150 COMPRESSED SHEET
2	1	1"	VALVE, BALL, FLOATING 1" P150
3	2	1"	STUD SET 4 × 0.5" × 4" WITH 2 NUTS, FOR 1" P150
4	1	1"	FLANGE BLIND 1" P150 RAISED FACE

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. FLANGE BOLT HOLES STRADDLE CENTRELINES
4. PAINT PER PROJECT SPECIFICATION

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-

COMPANY


SMARTWELD

TITLE

HYDROCARBON PROCESS

TEST PRESS. **-**	INSULATION **NONE**	PAINT **-**	
PWHT **-**	NDE **-**	FLUID **D**	

LINE NO. **1"-P150-D-6012**	PIPING CLASS **H150**	DESIGN PRESS. **150 PSIG**	DESIGN TEMP. **-**
DRAWING NO. **ISO-D-6012**		SHEET **1 OF 1**	REV **0**
DATE **2026-11-01**	DRAWN **-**	CHECKED **-**	SCALE **NTS**

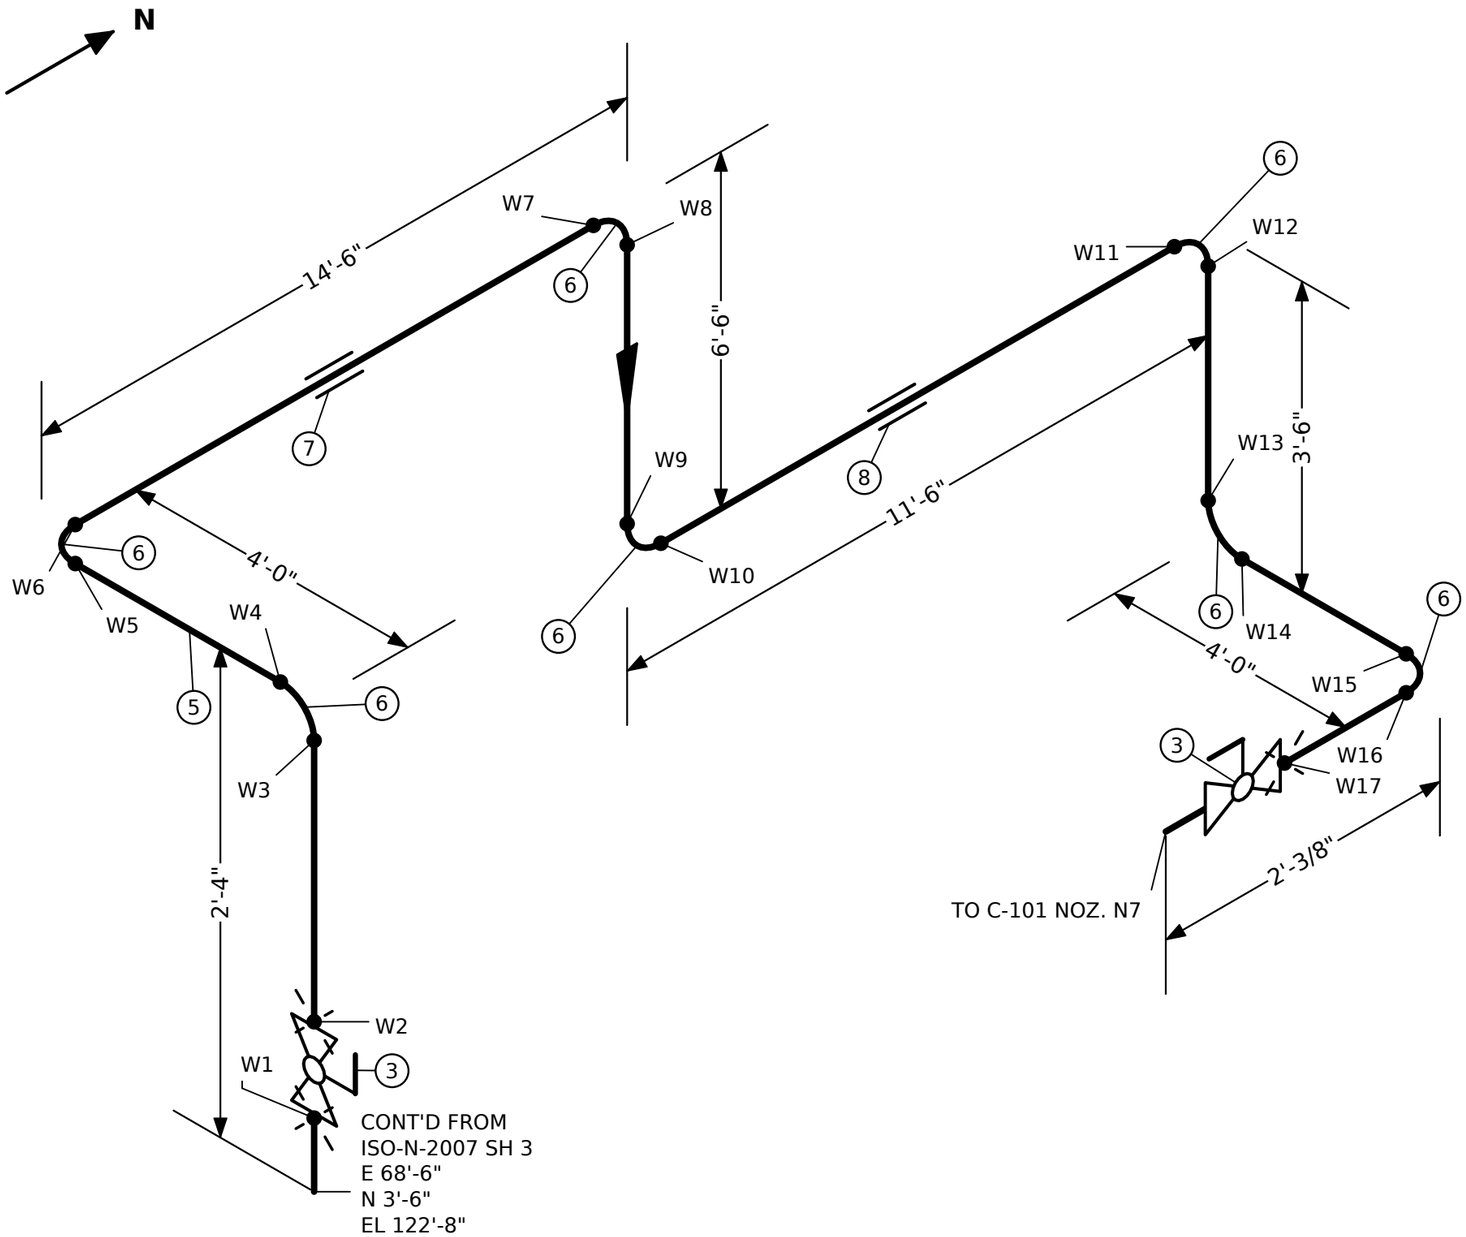

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	3	1"	FLANGE WELD-NECK 1" P150 RAISED FACE
2	4	1"	GASKET 1" P150 COMPRESSED SHEET
3	2	1"	VALVE, BALL, FLOATING 1" P150
4	4	1"	STUD SET 4 × 0.5" × 4" WITH 2 NUTS, FOR 1" P150
5	43'-1 3/16"	1"	PIPE 1" P150 BEVELLED ENDS
6	7	1"	ELBOW 90° R = 5/3 OD 1" P150
7	1	1"	HANGER FOR 1" LINE (HANGER-1x88.0)
8	1	1"	HANGER FOR 1" LINE (HANGER-1x10.9)

NOTES:
1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-

COMPANY

SMARTWELD

TITLE


AIR AND GASES

TEST PRESS.	INSULATION	PAINT
-	NONE	-
PWHT	NDE	FLUID
-	-	N

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
1"-P150-N-3013	G150	150 PSIG	-

DRAWING NO.	SHEET	REV
ISO-N-3013	1 OF 1	0

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

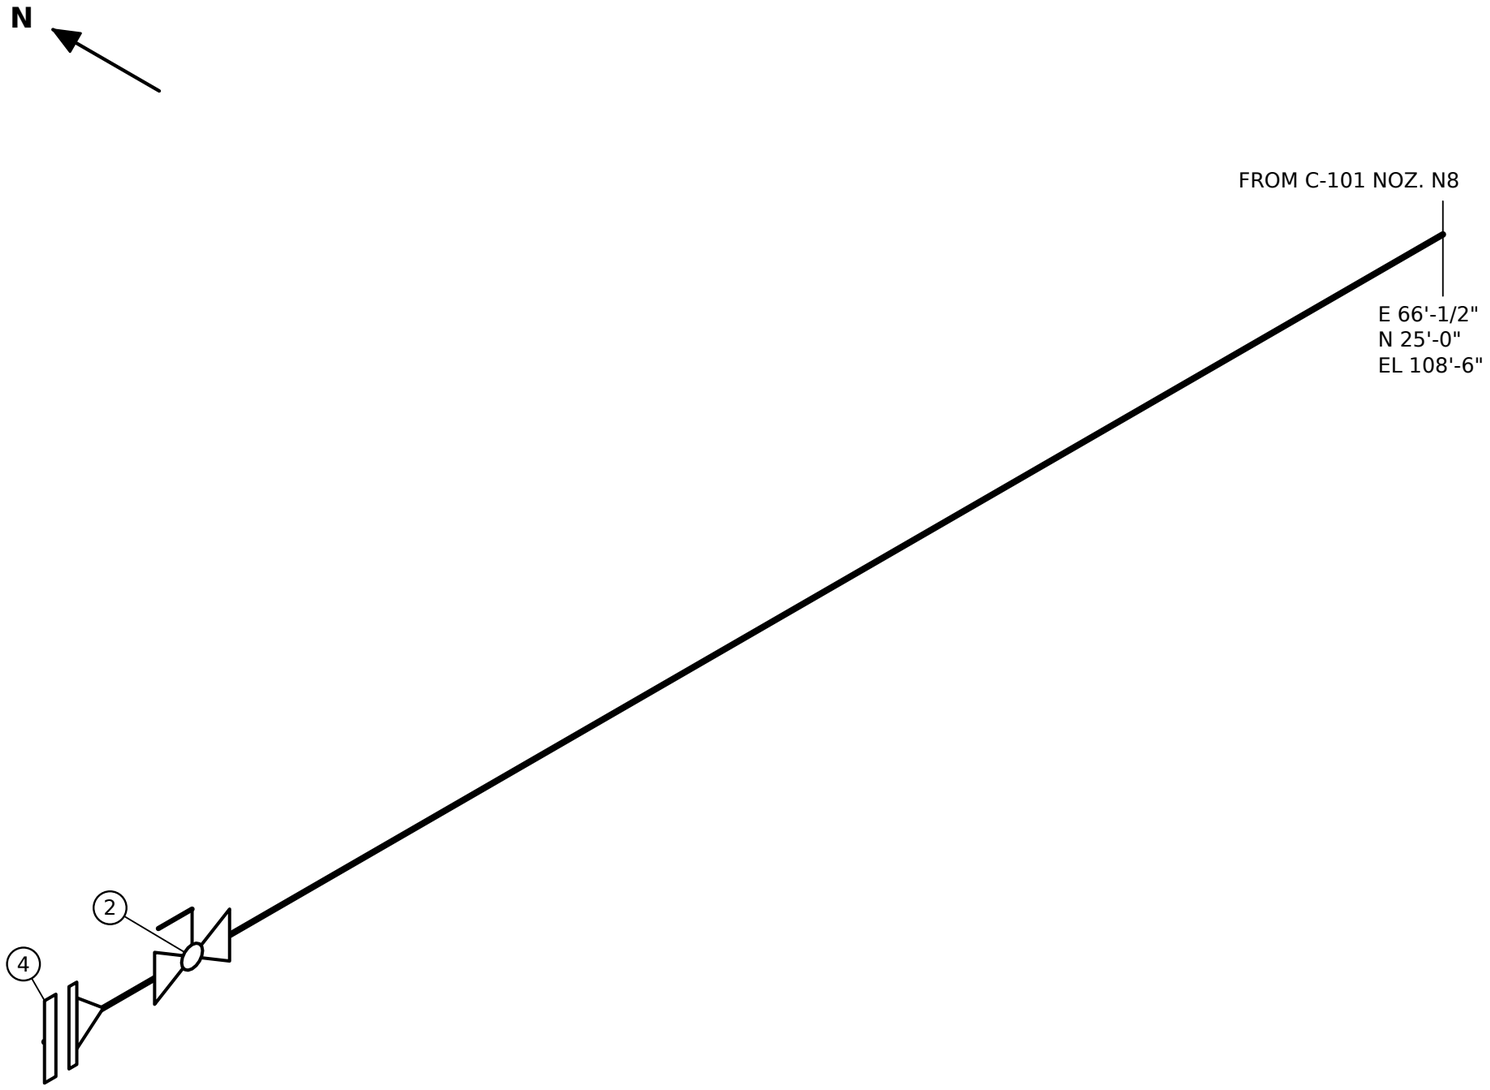

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	3/4"	GASKET 3/4" P300 COMPRESSED SHEET
2	1	3/4"	VALVE, BALL, FLOATING 3/4" P300
3	2	3/4"	STUD SET 4 × 0.5" × 4-1/4" WITH 2 NUTS, FOR 3/4" P300
4	1	3/4"	FLANGE BLIND 3/4" P300 RAISED FACE

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. CHECK ORIENTATION BEFORE WELDING

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-

COMPANY

SMARTWELD

TITLE


HYDROCARBON PROCESS

TEST PRESS.	INSULATION	PAINT
-	NONE	-
PWHT	NDE	FLUID
-	-	I

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
3/4"-P300-I-6013	H300	300 PSIG	-

DRAWING NO.	SHEET	REV
ISO-I-6013	1 OF 1	0

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

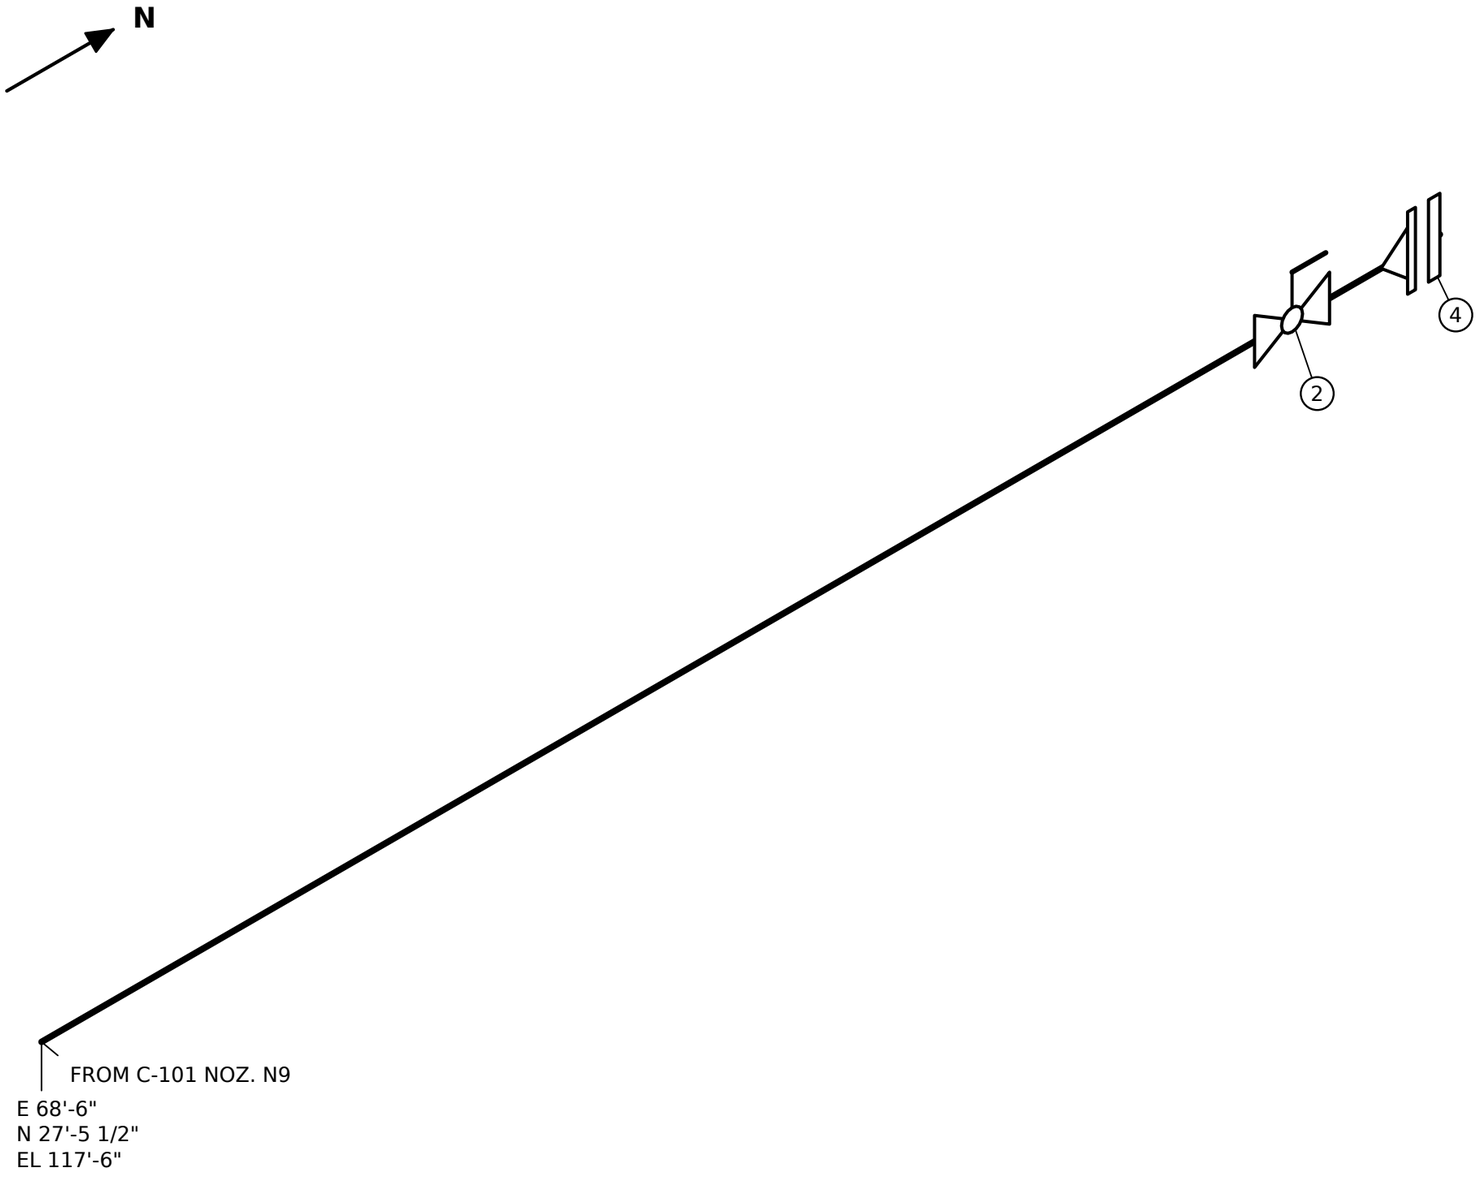

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	3/4"	GASKET 3/4" P300 COMPRESSED SHEET
2	1	3/4"	VALVE, BALL, FLOATING 3/4" P300
3	2	3/4"	STUD SET 4 × 0.5" × 4-1/4" WITH 2 NUTS, FOR 3/4" P300
4	1	3/4"	FLANGE BLIND 3/4" P300 RAISED FACE

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-

COMPANY

SMARTWELD

TITLE

HYDROCARBON PROCESS

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. REMOVE BURRS FROM ALL CUT ENDS
4. HYDROTEST BEFORE PAINTING


TEST PRESS.	INSULATION	PAINT
-	NONE	-

PWHT	NDE	FLUID
-	-	I

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
3/4"-P300-I-6014	H300	300 PSIG	-

DRAWING NO.	SHEET	REV
ISO-I-6014	1 OF 1	0

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

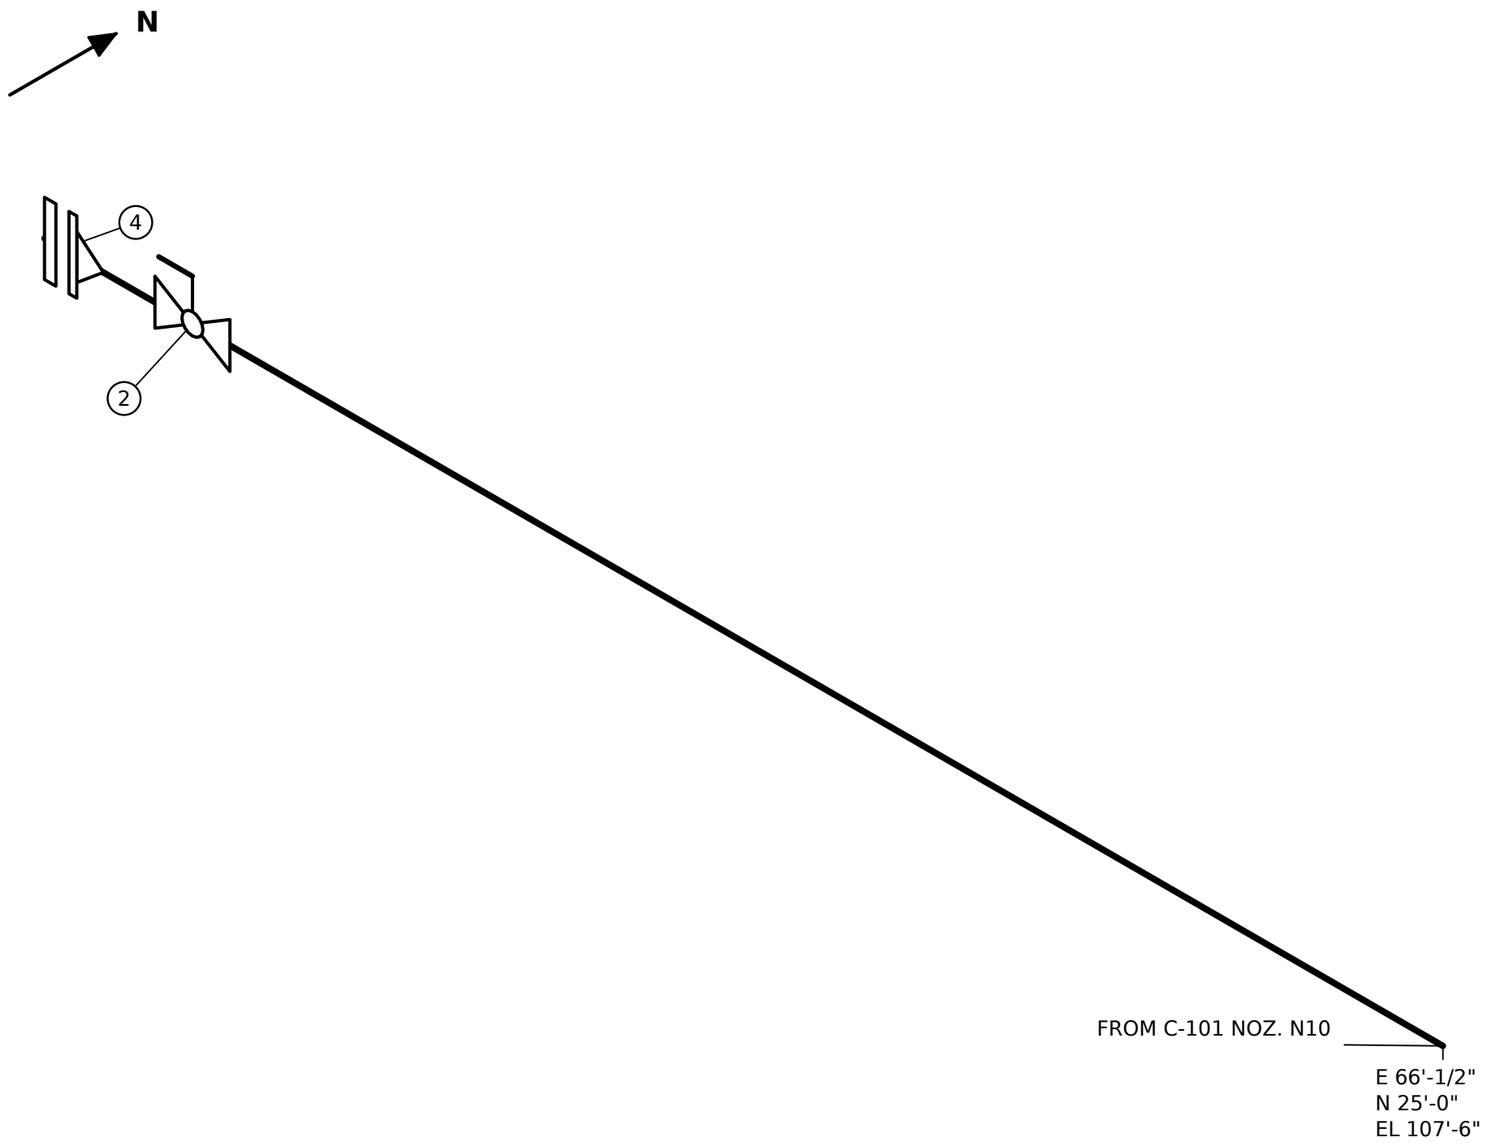

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	3/4"	GASKET 3/4" P300 COMPRESSED SHEET
2	1	3/4"	VALVE, BALL, FLOATING 3/4" P300
3	2	3/4"	STUD SET 4 × 0.5" × 4-1/4" WITH 2 NUTS, FOR 3/4" P300
4	1	3/4"	FLANGE BLIND 3/4" P300 RAISED FACE

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. HYDROTEST BEFORE PAINTING

TEST PRESS.	INSULATION	PAINT
-	NONE	-
PWHT	NDE	FLUID
-	-	SP

COMPANY

SMARTWELD

TITLE

HYDROCARBON PROCESS

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
3/4"-P300-SP-6015	H300	300 PSIG	-

DRAWING NO.	SHEET	REV
ISO-SP-6015	1 OF 1	0

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

Notices

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE; THE FACILITY OWNER'S QUALIFIED PROCEDURES AND APPLICABLE CODES GOVERN.

This document embeds a subset of the DejaVu Sans font (SW-LIC-3), renamed under its licence. DejaVu Sans (assets/fonts/DejaVuSans.ttf), from the DejaVu fonts 2.37 as packaged in the build environment.

Copyright (c) 2003 by Bitstream, Inc. All Rights Reserved. Bitstream Vera is a trademark of Bitstream, Inc.
DejaVu changes are in public domain.

Permission is hereby granted, free of charge, to any person obtaining a copy
of the fonts accompanying this license ("Fonts") and associated
documentation files (the "Font Software"), to reproduce and distribute the
Font Software, including without limitation the rights to use, copy, merge,
publish, distribute, and/or sell copies of the Font Software, and to permit
persons to whom the Font Software is furnished to do so, subject to the
following conditions:

The above copyright and trademark notices and this permission notice shall
be included in all copies of one or more of the Font Software typefaces.

The Font Software may be modified, altered, or added to, and in particular
the designs of glyphs or characters in the Fonts may be modified and
additional glyphs or characters may be added to the Fonts, only if the fonts
are renamed to names not containing either the words "Bitstream" or the word
"Vera".

This License becomes null and void to the extent applicable to Fonts or Font
Software that has been modified and is distributed under the "Bitstream
Vera" names.

The Font Software may be sold as part of a larger software package but no
copy of one or more of the Font Software typefaces may be sold by itself.

THE FONT SOFTWARE IS PROVIDED "AS IS", WITHOUT WARRANTY OF ANY KIND, EXPRESS
OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY WARRANTIES OF MERCHANTABILITY,
FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT OF COPYRIGHT, PATENT,
TRADEMARK, OR OTHER RIGHT. IN NO EVENT SHALL BITSTREAM OR THE GNOME
FOUNDATION BE LIABLE FOR ANY CLAIM, DAMAGES OR OTHER LIABILITY, INCLUDING
ANY GENERAL, SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES,
WHETHER IN AN ACTION OF CONTRACT, TORT OR OTHERWISE, ARISING FROM, OUT OF
THE USE OR INABILITY TO USE THE FONT SOFTWARE OR FROM OTHER DEALINGS IN THE
FONT SOFTWARE.

Except as contained in this notice, the names of Gnome, the Gnome
Foundation, and Bitstream Inc., shall not be used in advertising or
otherwise to promote the sale, use or other dealings in this Font Software
without prior written authorization from the Gnome Foundation or Bitstream
Inc., respectively. For further information, contact: fonts at gnome dot
org.