DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE; THE FACILITY OWNER'S QUALIFIED PROCEDURES AND APPLICABLE CODES GOVERN.

WO-200-05 — Replace spool SP02 of 6"-P300-P-1017

Area	A200 Vessels and column	**Task**	SR Spool replacement
Priority	2 (integrity)	**Issued by**	Facility owner (demonstration)
Primary asset	C-101 — C-101 vertical vessel 48" ID × 240" T/T — E 68'-6" N 25'-0" EL 100'-8-1/4"		
Equipment	C-101	**Lines**	6"-P300-P-1017
Isometrics	ISO-P-1017 (owner's drawings, attached)		
Permits	General work permit, Hot work permit		

Reason

Wall loss below the owner's minimum found by the last survey on the column bottoms line.

Scope of work

1. Isolate per the isolation list; drain, vent and purge 6"-P300-P-1017 between the isolations; confirm gas-free for hot work.
2. Remove spool 6"-P300-P-1017-SP02 (8 items, 23'-5-1/2" of pipe) — cut at the field welds and break the flanged joints at its ends as listed.
3. Fabricate the replacement spool to ISO-6"-P300-P-1017 with the same items (parts list), welding to WS-01; 7 shop welds.
4. Install the spool; make 2 field welds; new gaskets and studs at flanged ends, tightened per SW-WO-5.
5. NDE per the NDE table; hydrostatic test at 420 psi for 30 minutes with the relief valves blinded (SW-TEST-1).
6. Remove blinds, restore the line-up, hand back.

Affected items: 6"-P300-P-1017/p7, 6"-P300-P-1017/el8, 6"-P300-P-1017/p9, 6"-P300-P-1017/el10, 6"-P300-P-1017/p11, 6"-P300-P-1017/el12, 6"-P300-P-1017/p13, 6"-P300-P-1017/el14

Rules: SW-ITP-1, SW-ITP-2, SW-ITP-3, SW-NDE-1, SW-NDE-2, SW-NDE-4, SW-TEST-1, SW-WO-1, SW-WO-2, SW-WO-3, SW-WO-4, SW-WO-5, SW-WO-7, SW-WPS-1, SW-WPS-2, SW-WPS-3

Owner's isometric drawings (SW-IMP-6)

Drawing	Line drawn	Work line	Sheets	Match to the plant model
ISO-P-1017	6"-P300-P-1017	6"-P300-P-1017	4	agrees with the model

ISO-P-1017 (PDF): ../isometrics-imported/ISO-P-1017.pdf — the sheets that hold the work follow the ITP.

Assets in the plant model (SW-WO-7)

Tag	Kind	Description	Line	Location
C-101	equipment	C-101 vertical vessel 48" ID × 240" T/T		E 68'-6" N 25'-0" EL 100'-8-1/4"
6"-P300-P-1017/p7	item	PIPE 6" P300 BEVELLED ENDS	6"-P300-P-1017	E 68'-6" N 19'-6-3/4" EL 106'-6"
6"-P300-P-1017/el8	item	ELBOW 90° R = 5/3 OD 6" P300	6"-P300-P-1017	E 68'-6" N 17'-11" EL 106'-11"
6"-P300-P-1017/p9	item	PIPE 6" P300 BEVELLED ENDS	6"-P300-P-1017	E 68'-6" N 17'-6" EL 110'-6"
6"-P300-P-1017/el10	item	ELBOW 90° R = 5/3 OD 6" P300	6"-P300-P-1017	E 68'-6" N 17'-1" EL 114'-1"
6"-P300-P-1017/p11	item	PIPE 6" P300 BEVELLED ENDS	6"-P300-P-1017	E 68'-6" N 9'-9" EL 114'-6"
6"-P300-P-1017/el12	item	ELBOW 90° R = 5/3 OD 6" P300	6"-P300-P-1017	E 68'-6" N 2'-5" EL 114'-11"
6"-P300-P-1017/p13	item	PIPE 6" P300 BEVELLED ENDS	6"-P300-P-1017	E 68'-6" N 2'-0" EL 115'-9"
6"-P300-P-1017/el14	item	ELBOW 90° R = 5/3 OD 6" P300	6"-P300-P-1017	E 68'-11" N 2'-0" EL 116'-7"
6"-P300-P-1017/A2	item	VALVE, GATE, WEDGE, OS&Y 6" P300	6"-P300-P-1017	E 68'-6" N 21'-8-9/16" EL 106'-6"
6"-P300-P-1017/A5	item	FLANGE WELD-NECK 6" P300 RAISED FACE	6"-P300-P-1017	E 68'-6" N 20'-11-7/16" EL 106'-6"
6"-P300-P-1017/B7	item	VALVE, GATE, WEDGE, OS&Y 6" P300	6"-P300-P-1017	E 116'-6" N 13'-5-1/8" EL 102'-0"
6"-P300-P-1017/B10	item	FLANGE WELD-NECK 6" P300 RAISED FACE	6"-P300-P-1017	E 116'-6" N 12'-8-1/16" EL 102'-0"
6"-P300-P-1017/W1	weld	Butt weld 6" P300 (field)	6"-P300-P-1017	E 68'-6" N 20'-9-1/2" EL 106'-6"
6"-P300-P-1017/W2	weld	Butt weld 6" P300 (shop)	6"-P300-P-1017	E 68'-6" N 18'-4" EL 106'-6"
6"-P300-P-1017/W3	weld	Butt weld 6" P300 (shop)	6"-P300-P-1017	E 68'-6" N 17'-6" EL 107'-4"
6"-P300-P-1017/W4	weld	Butt weld 6" P300 (shop)	6"-P300-P-1017	E 68'-6" N 17'-6" EL 113'-8"
6"-P300-P-1017/W5	weld	Butt weld 6" P300 (shop)	6"-P300-P-1017	E 68'-6" N 16'-8" EL 114'-6"
6"-P300-P-1017/W6	weld	Butt weld 6" P300 (shop)	6"-P300-P-1017	E 68'-6" N 2'-10" EL 114'-6"
6"-P300-P-1017/W7	weld	Butt weld 6" P300 (shop)	6"-P300-P-1017	E 68'-6" N 2'-0" EL 115'-4"
6"-P300-P-1017/W8	weld	Butt weld 6" P300 (shop)	6"-P300-P-1017	E 68'-6" N 2'-0" EL 116'-2"
6"-P300-P-1017/W9	weld	Butt weld 6" P300 (field)	6"-P300-P-1017	E 69'-4" N 2'-0" EL 117'-0"

Isolation list (SW-WO-3)

#	Kind	Tag	Line	Action	Location	Fitted ✓	Removed ✓
1	valve	6"-P300-P-1017/A2	6"-P300-P-1017	Close and lock VALVE, GATE, WEDGE, OS&Y 6" P300 (6"-P300-P-1017/A2)	E 68'-6" N 21'-8-9/16" EL 106'-6"		
2	blind	6"-P300-P-1017/A5	6"-P300-P-1017	Fit a line blind between 6"-P300-P-1017/A2 and FLANGE WELD-NECK 6" P300 RAISED FACE (6"-P300-P-1017/A5), work side	E 68'-6" N 21'-1-3/8" EL 106'-6"		
3	valve	6"-P300-P-1017/B7	6"-P300-P-1017	Close and lock VALVE, GATE, WEDGE, OS&Y 6" P300 (6"-P300-P-1017/B7)	E 116'-6" N 13'-5-1/8" EL 102'-0"		
4	blind	6"-P300-P-1017/B10	6"-P300-P-1017	Fit a line blind between 6"-P300-P-1017/B7 and FLANGE WELD-NECK 6" P300 RAISED FACE (6"-P300-P-1017/B10), work side	E 116'-6" N 12'-10" EL 102'-0"		

Parts

Description	Qty	Replaces
PIPE 6" P300 BEVELLED ENDS	4	
ELBOW 90° R = 5/3 OD 6" P300	4	

New welds (SW-WO-4)

Weld	Replaces	On drawing	Line	Size	Wall	Shop/field	Spec	NDE	Location	Welder	Date
WO-200-05-W01	6"-P300-P-1017/W1	ISO-P-1017 sh 1 W1	6"-P300-P-1017	6" P300	0.21875 in	field	WS-01	VT + RT	E 68'-6" N 20'-9-1/2" EL 106'-6"		
WO-200-05-W02	6"-P300-P-1017/W2	ISO-P-1017 sh 1 W2	6"-P300-P-1017	6" P300	0.21875 in	shop	WS-01	VT + RT	E 68'-6" N 18'-4" EL 106'-6"		
WO-200-05-W03	6"-P300-P-1017/W3	ISO-P-1017 sh 1 W3	6"-P300-P-1017	6" P300	0.21875 in	shop	WS-01	VT + RT	E 68'-6" N 17'-6" EL 107'-4"		
WO-200-05-W04	6"-P300-P-1017/W4	ISO-P-1017 sh 1 W4	6"-P300-P-1017	6" P300	0.21875 in	shop	WS-01	VT + RT	E 68'-6" N 17'-6" EL 113'-8"		
WO-200-05-W05	6"-P300-P-1017/W5	ISO-P-1017 sh 1 W5	6"-P300-P-1017	6" P300	0.21875 in	shop	WS-01	VT + RT	E 68'-6" N 16'-8" EL 114'-6"		
WO-200-05-W06	6"-P300-P-1017/W6	ISO-P-1017 sh 1 W6	6"-P300-P-1017	6" P300	0.21875 in	shop	WS-01	VT + RT	E 68'-6" N 2'-10" EL 114'-6"		
WO-200-05-W07	6"-P300-P-1017/W7	ISO-P-1017 sh 2 W7	6"-P300-P-1017	6" P300	0.21875 in	shop	WS-01	VT + RT	E 68'-6" N 2'-0" EL 115'-4"		
WO-200-05-W08	6"-P300-P-1017/W8	ISO-P-1017 sh 2 W8	6"-P300-P-1017	6" P300	0.21875 in	shop	WS-01	VT + RT	E 68'-6" N 2'-0" EL 116'-2"		
WO-200-05-W09	6"-P300-P-1017/W9	ISO-P-1017 sh 2 W9	6"-P300-P-1017	6" P300	0.21875 in	field	WS-01	VT + RT	E 69'-4" N 2'-0" EL 117'-0"		

Welding specification WS-01 — Butt welds, pipe grade, wall to 1/2 in

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE; THE FACILITY OWNER'S QUALIFIED PROCEDURES AND APPLICABLE CODES GOVERN.

Scope	Pipe, fittings and weld-neck flanges of Grade 35 pipe / Grade 36 forging, wall up to 1/2 in
Joint	Single-V, 60° included, root opening 1/8 in, root face 1/16 in (SW-WD-4)
Process	Root: gas-shielded tungsten arc. Fill and cap: shielded metal arc.
Filler	Root SW-F1 wire; fill and cap SW-F2 covered electrode (matching strength, low hydrogen)
Preheat	≥ 30 °F above dew point and ≥ 60 °F, 3 in each side
Interpass	≤ 450 °F
Post-weld heat treatment	Not specified (owner to state)
Rules	SW-WPS-1, SW-WPS-2, SW-WPS-3, SW-WD-4

NDE

Method	Extent	Welds	Basis
VT	100 % of new welds, before and after welding	WO-200-05-W01, WO-200-05-W02, WO-200-05-W03, WO-200-05-W04, WO-200-05-W05, WO-200-05-W06, WO-200-05-W07, WO-200-05-W08, WO-200-05-W09	SW-NDE-1
RT (UT where RT is impractical)	100 % of new welds (class H300, high consequence)	WO-200-05-W01, WO-200-05-W02, WO-200-05-W03, WO-200-05-W04, WO-200-05-W05, WO-200-05-W06, WO-200-05-W07, WO-200-05-W08, WO-200-05-W09	SW-NDE-2

Test — Hydrostatic test

Description	Test boundary between the isolations; relief valves blinded or removed
Pressure	420 psi
Hold	30 minutes, no leak, no pressure drop
Basis	SW-TEST-1

Inspection and test plan (SW-ITP-1..3)


H hold · W witness · R review · S surveillance. Status: accepted / rejected / not applicable.

#	Activity	Reference	Acceptance	Record	Contr.	Owner	3rd party	Status	Signed (contr. / owner / 3rd)	Date	Remark
1	Work permit issued; isolation list (valves locked, blinds fitted) verified at zero pressure and drained	SW-WO-3, isolation list	Every isolation in place and tagged; zero pressure at the vent	Signed isolation certificate	H	H	—				
2	Line drained, vented and purged; gas-free for hot work	Owner hot-work procedure	Gas test within owner limits	Gas test record, hot work permit	H	H	—				
3	Replacement materials verified against the parts list (size, class, grade, heat marking)	Parts list, SW-LC-3	All items match the line class	Material receiving record	R	R	R				
4	Welding specification WS-01 and welder identification available at the work	WS-01, SW-WPS-3	Specification on site; every welder identified	Welder list	R	R	R				
5	Fit-up of every new weld: root opening and alignment within the root face	SW-WPS-3, SW-WD-4	Root opening 1/8 in; bores aligned within 1/16 in	Fit-up record per weld	H	H	S				
6	Preheat and interpass temperatures maintained during welding	WS-01, SW-WPS-2	Preheat ≥ 30 °F above dew point and ≥ 60 °F, 3 in each side; interpass ≤ 450 °F	Weld record per weld (welder, temperatures)	S	S	S				
7	Visual examination of every new weld	SW-NDE-1, SW-NDE-4	No crack, lack of fusion or incomplete penetration	VT report	W	W	W				
8	Volumetric examination per the NDE table; repairs re-examined	SW-NDE-2, SW-NDE-4	Acceptance per SW-NDE-4 and the owner's criteria	RT/UT reports	R	H	R				
9	Flanged ends: faces inspected, new gaskets, studs to preload	SW-NDE-5, SW-WO-5	No radial scratch; preload as stated	Bolt-up record	W	W	—				
10	Hydrostatic test at 420 psi, 30 minutes	SW-TEST-1	No leak, no pressure drop	Test record with gauge calibration	H	H	H				
11	Blinds removed, isolations returned to normal line-up per the isolation list	SW-WO-3	Every blind removed and accounted for	Isolation certificate closed	H	H	—				
12	Records complete; work order handed back to operations	SW-ITP-3	All ITP activities accepted or not applicable	Signed ITP and completion record	H	H	R				

Where the work is on the owner's drawings (SW-IMP-8)

Each affected item, replaced weld and isolation point, with the drawing and sheet that hold it and the weld label printed there. The sheets follow, copied unchanged.

Tag	Role	Drawing	Sheet	Weld label
6"-P300-P-1017/p7	affected	ISO-P-1017	1	
6"-P300-P-1017/el8	affected	ISO-P-1017	1	
6"-P300-P-1017/p9	affected	ISO-P-1017	1	
6"-P300-P-1017/el10	affected	ISO-P-1017	1	
6"-P300-P-1017/p11	affected	ISO-P-1017	1	
6"-P300-P-1017/el12	affected	ISO-P-1017	1	
6"-P300-P-1017/p13	affected	ISO-P-1017	2	
6"-P300-P-1017/el14	affected	ISO-P-1017	2	
6"-P300-P-1017/W1	replaced by WO-200-05-W01	ISO-P-1017	1	W1
6"-P300-P-1017/W2	replaced by WO-200-05-W02	ISO-P-1017	1	W2
6"-P300-P-1017/W3	replaced by WO-200-05-W03	ISO-P-1017	1	W3
6"-P300-P-1017/W4	replaced by WO-200-05-W04	ISO-P-1017	1	W4
6"-P300-P-1017/W5	replaced by WO-200-05-W05	ISO-P-1017	1	W5
6"-P300-P-1017/W6	replaced by WO-200-05-W06	ISO-P-1017	1	W6
6"-P300-P-1017/W7	replaced by WO-200-05-W07	ISO-P-1017	2	W7 (printed on sheet 1)
6"-P300-P-1017/W8	replaced by WO-200-05-W08	ISO-P-1017	2	W8
6"-P300-P-1017/W9	replaced by WO-200-05-W09	ISO-P-1017	2	W9
6"-P300-P-1017/A2	isolation: valve	ISO-P-1017	1	
6"-P300-P-1017/A5	isolation: blind	ISO-P-1017	1	
6"-P300-P-1017/B7	isolation: valve	ISO-P-1017	4	
6"-P300-P-1017/B10	isolation: blind	ISO-P-1017	4	

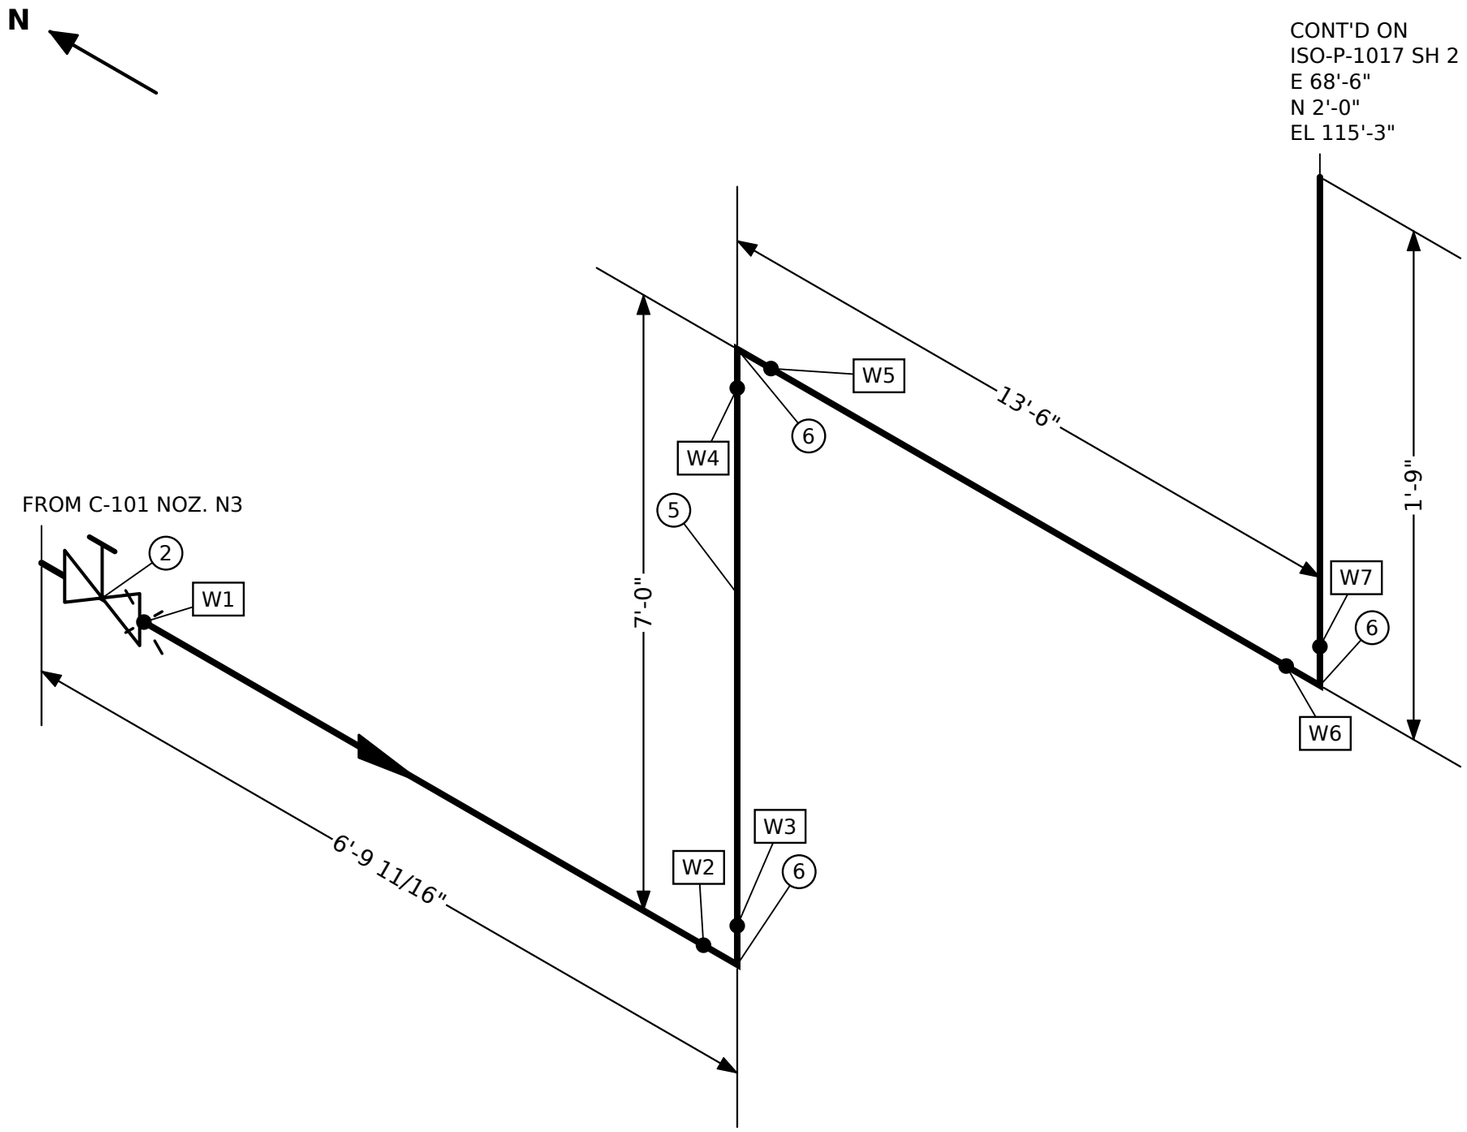

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	6"	GASKET 6" P300 COMPRESSED SHEET
2	1	6"	VALVE, GATE, WEDGE, OS&Y 6" P300
3	2	6"	STUD SET 8 × 0.625" × 4" WITH 2 NUTS, FOR 6" P300
4	1	6"	FLANGE WELD-NECK 6" P300 RAISED FACE
5	22'-6 1/2"	6"	PIPE 6" P300 BEVELLED ENDS
6	3	6"	ELBOW 90° R = 5/3 OD 6" P300

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-
1	2026-11-02	REVISED TO MATCH THE MODEL (FL-1)	-

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. REMOVE BURRS FROM ALL CUT ENDS
4. HYDROTEST BEFORE PAINTING

TEST PRESS.	INSULATION	PAINT
-	NONE	-

PWHT	NDE	FLUID
-	-	P

COMPANY

SMARTWELD


TITLE

HYDROCARBON PROCESS

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
6"-P300-P-1017	H300	300 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1017	1 OF 4	1

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

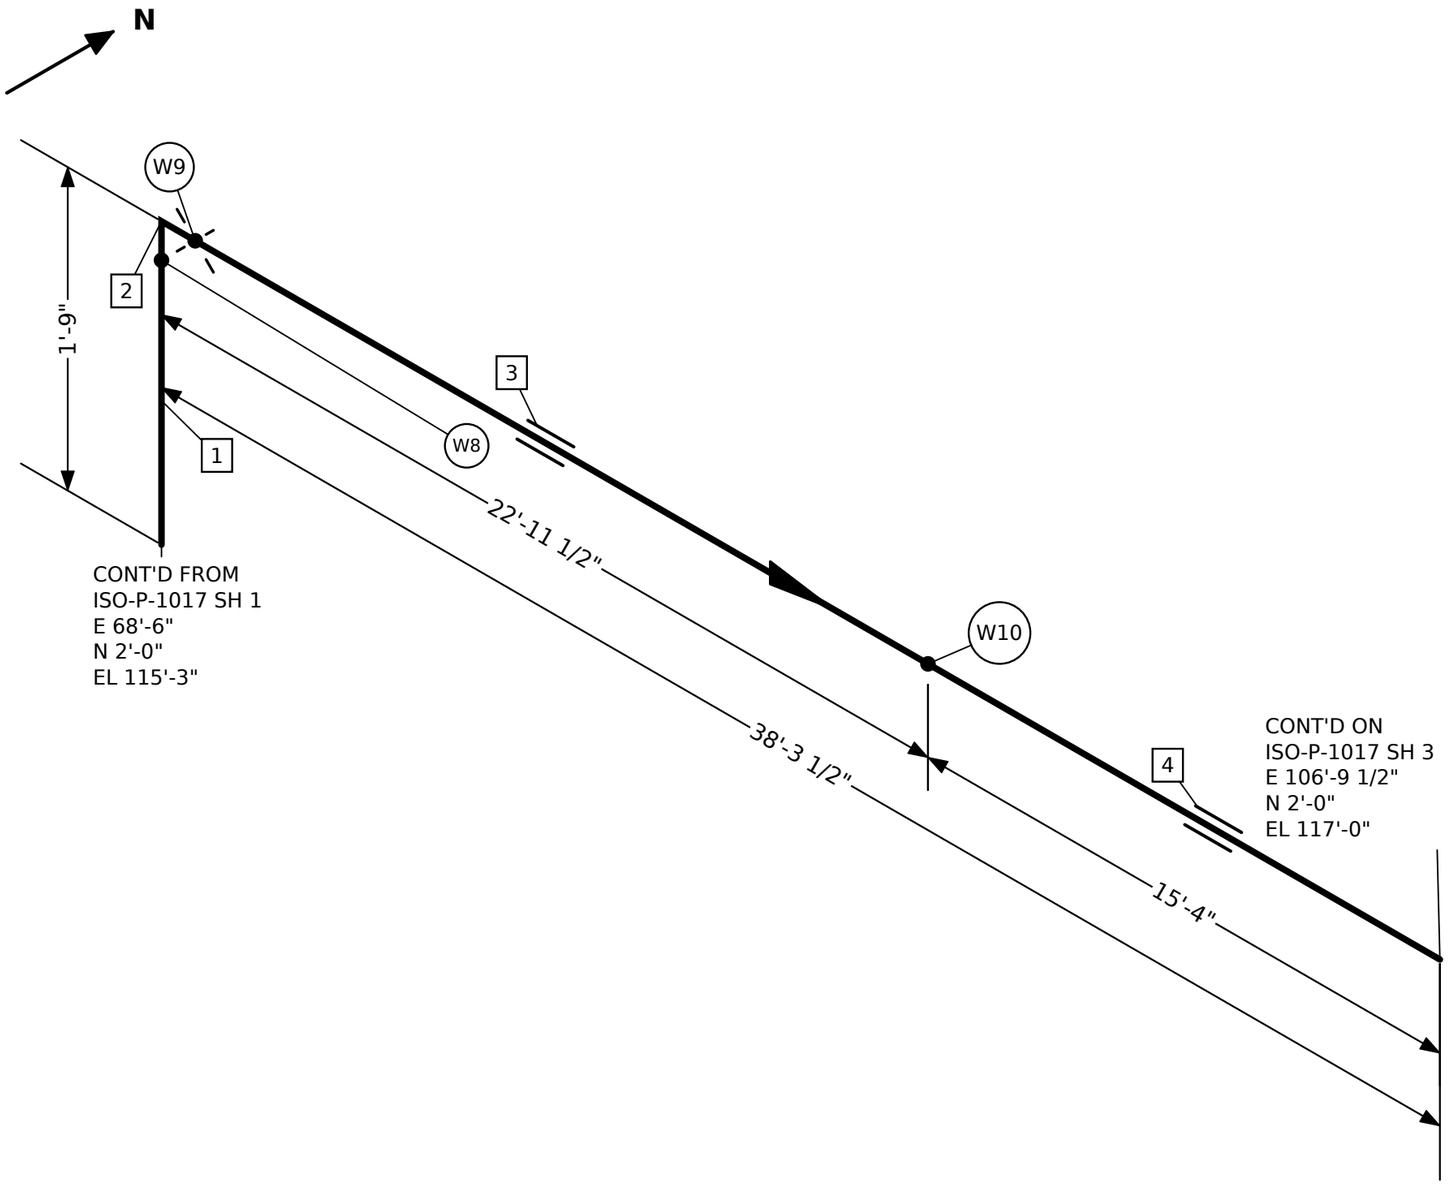

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	38'-4 1/2"	6"	PIPE 6" P300 BEVELLED ENDS
2	1	6"	ELBOW 90° R = 5/3 OD 6" P300
3	1	6"	GUIDE FOR 6" LINE (GUIDE-6)
4	1	6"	ANCHOR FOR 6" LINE (ANCHOR-6)

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-
1	2026-11-02	REVISED TO MATCH THE MODEL (FL-1)	-

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. HYDROTEST BEFORE PAINTING
4. FLANGE BOLT HOLES STRADDLE CENTRELINES

TEST PRESS.	INSULATION	PAINT
-	NONE	-

PWHT	NDE	FLUID
-	-	P

COMPANY

SMARTWELD


TITLE

HYDROCARBON PROCESS

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
6"-P300-P-1017	H300	300 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1017	2 OF 4	1

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

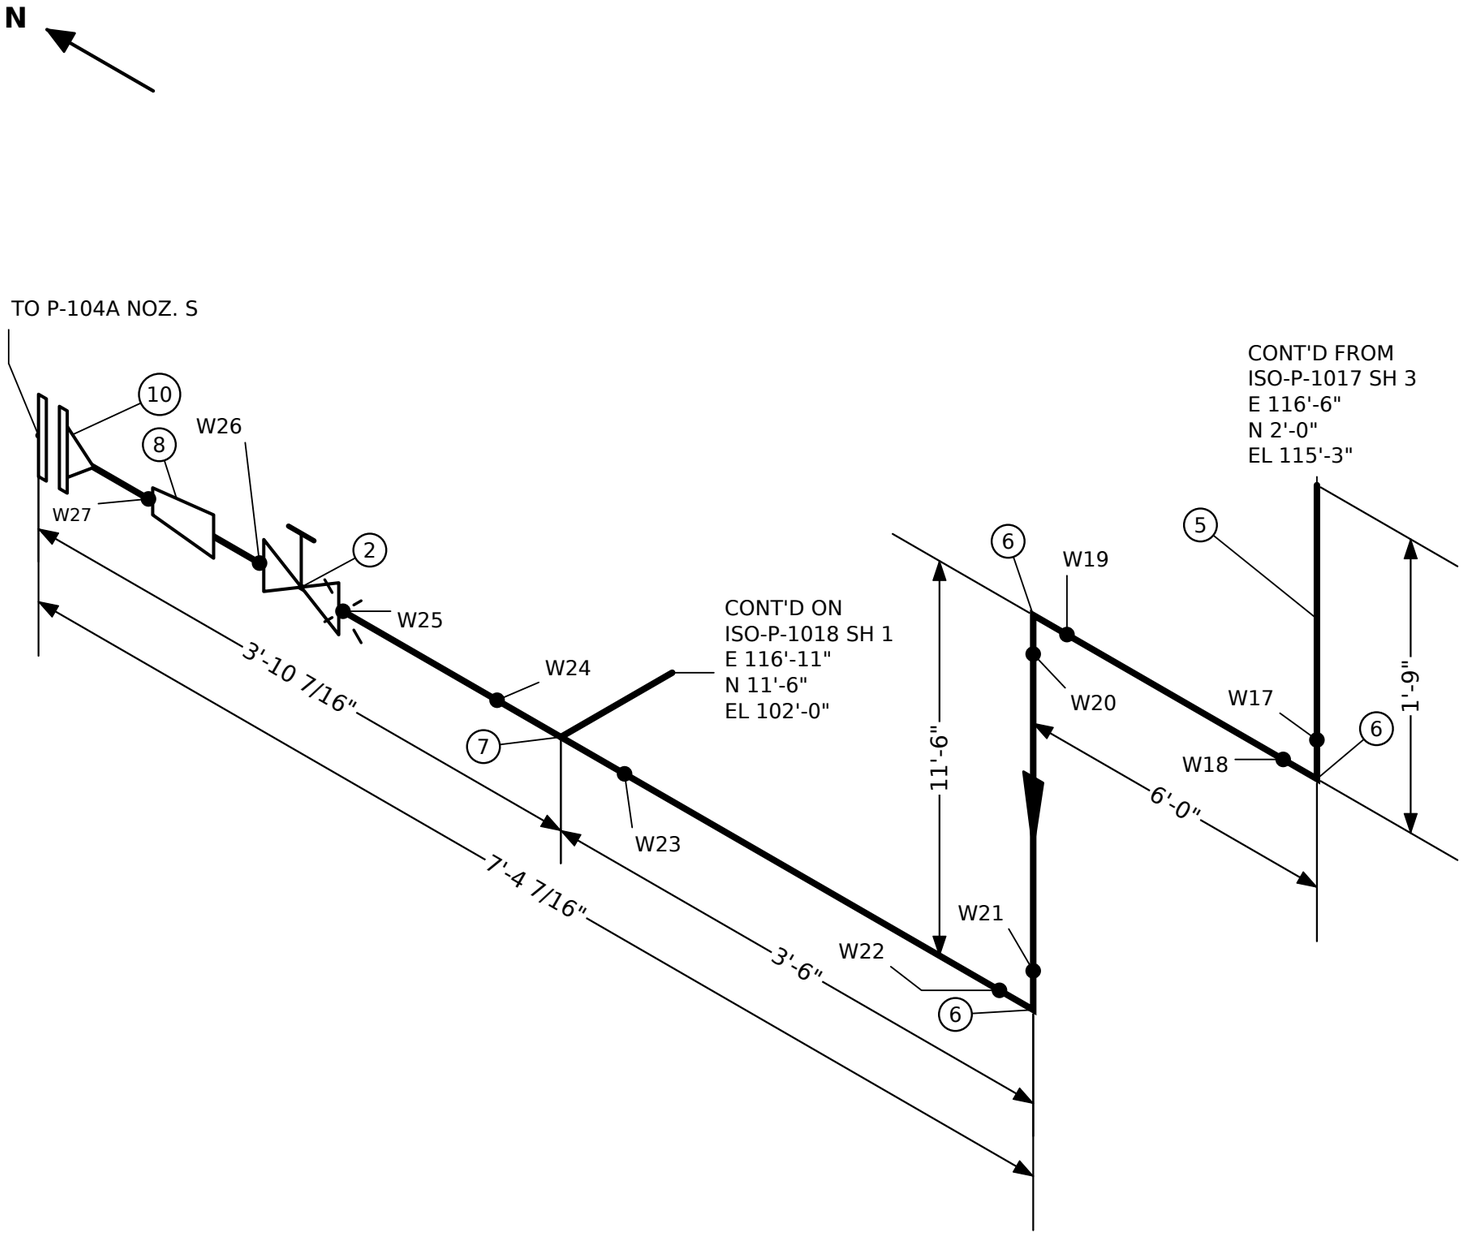

BILL OF MATERIALS

PT	QTY	NPS	DESCRIPTION
1	2	6"	GASKET 6" P300 COMPRESSED SHEET
2	1	6"	VALVE, GATE, WEDGE, OS&Y 6" P300
3	2	6"	STUD SET 8 × 0.625" × 4" WITH 2 NUTS, FOR 6" P300
4	2	6"	FLANGE WELD-NECK 6" P300 RAISED FACE
5	17'-11 1/8"	6"	PIPE 6" P300 BEVELLED ENDS
6	3	6"	ELBOW 90° R = 5/3 OD 6" P300
7	1	6"	TEE EQUAL 6" P300
8	1	6"x4"	REDUCER CONCENTRIC 6" × 4" P300
9	1	4"	STUD SET 4 × 1" × 6-1/4" WITH 2 NUTS, FOR 4" P300
10	1	4"	FLANGE WELD-NECK 4" P300 RAISED FACE
11	1	4"	GASKET 4" P300 COMPRESSED SHEET

REV	DATE	DESCRIPTION	BY
0	2026-11-01	ISSUED FOR CONSTRUCTION	-
1	2026-11-02	REVISED TO MATCH THE MODEL (FL-1)	-

COMPANY

SMARTWELD

TITLE

HYDROCARBON PROCESS

NOTES:

1. ALL DIMENSIONS IN FEET AND INCHES UNLESS NOTED
2. BEVEL ENDS FOR BUTT WELD
3. REMOVE BURRS FROM ALL CUT ENDS

TEST PRESS.	INSULATION	PAINT
-	NONE	-

PWHT	NDE	FLUID
-	-	P

LINE NO.	PIPING CLASS	DESIGN PRESS.	DESIGN TEMP.
6"-P300-P-1017	H300	300 PSIG	-

DRAWING NO.	SHEET	REV
ISO-P-1017	4 OF 4	1

DATE	DRAWN	CHECKED	SCALE
2026-11-01	-	-	NTS

Notices

DEMONSTRATION ONLY — NOT A QUALIFIED PROCEDURE; THE FACILITY OWNER'S QUALIFIED PROCEDURES AND APPLICABLE CODES GOVERN.

This document embeds a subset of the DejaVu Sans font (SW-LIC-3), renamed under its licence. DejaVu Sans (assets/fonts/DejaVuSans.ttf), from the DejaVu fonts 2.37 as packaged in the build environment.

Copyright (c) 2003 by Bitstream, Inc. All Rights Reserved. Bitstream Vera is a trademark of Bitstream, Inc.
DejaVu changes are in public domain.

Permission is hereby granted, free of charge, to any person obtaining a copy
of the fonts accompanying this license ("Fonts") and associated
documentation files (the "Font Software"), to reproduce and distribute the
Font Software, including without limitation the rights to use, copy, merge,
publish, distribute, and/or sell copies of the Font Software, and to permit
persons to whom the Font Software is furnished to do so, subject to the
following conditions:

The above copyright and trademark notices and this permission notice shall
be included in all copies of one or more of the Font Software typefaces.

The Font Software may be modified, altered, or added to, and in particular
the designs of glyphs or characters in the Fonts may be modified and
additional glyphs or characters may be added to the Fonts, only if the fonts
are renamed to names not containing either the words "Bitstream" or the word
"Vera".

This License becomes null and void to the extent applicable to Fonts or Font
Software that has been modified and is distributed under the "Bitstream
Vera" names.

The Font Software may be sold as part of a larger software package but no
copy of one or more of the Font Software typefaces may be sold by itself.

THE FONT SOFTWARE IS PROVIDED "AS IS", WITHOUT WARRANTY OF ANY KIND, EXPRESS
OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY WARRANTIES OF MERCHANTABILITY,
FITNESS FOR A PARTICULAR PURPOSE AND NONINFRINGEMENT OF COPYRIGHT, PATENT,
TRADEMARK, OR OTHER RIGHT. IN NO EVENT SHALL BITSTREAM OR THE GNOME
FOUNDATION BE LIABLE FOR ANY CLAIM, DAMAGES OR OTHER LIABILITY, INCLUDING
ANY GENERAL, SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES,
WHETHER IN AN ACTION OF CONTRACT, TORT OR OTHERWISE, ARISING FROM, OUT OF
THE USE OR INABILITY TO USE THE FONT SOFTWARE OR FROM OTHER DEALINGS IN THE
FONT SOFTWARE.

Except as contained in this notice, the names of Gnome, the Gnome
Foundation, and Bitstream Inc., shall not be used in advertising or
otherwise to promote the sale, use or other dealings in this Font Software
without prior written authorization from the Gnome Foundation or Bitstream
Inc., respectively. For further information, contact: fonts at gnome dot
org.